No: 4/88 Ref:1c

Aircraft Type

and Registration: Amateur Construction Currie Wot G-ARZW

No & Type of Engines: 1 Walter Mikron 3 piston engine

Year of Manufacture: 1962

Date and Time (UTC): 12 February 1988 at 1645 hrs

Location: Headcorn Aerodrome, Kent

Type of Flight: Private (pleasure)

Persons on Board: Crew - 1 Passengers - None

Injuries: Crew - 1 (Serious) Passengers - N/A

Nature of Damage: Aircraft destroyed

Commander's Licence: Private Pilot's Licence with IMC and assistant Instructor's Ratings

Commander's Age: 24 years

Commander's Total

Flying Experience: 430 hours (none of which were on type)

Information Source: Aircraft Accident Report Form submitted by the pilot and subsequent

examination of salvaged wreckage by AAIB engineer

The aircraft had been flown a number of times with satisfactory behaviour after a major re-build following accident damage.

On the day of this accident the pilot involved took the aircraft over immediately after the previous pilot landed. During the take-off run, the starboard lower wing struck one of the frangible runway markers. The pilot reports that immediately after take-off the nose yawed hard right, although full left rudder was applied the aircraft then also rolled hard right. Believing that a wing drop associated with a stall may have occurred the pilot pushed the stick forward and maintained left rudder. Despite applying full forward stick, it was the pilots impression that the climb was continuing and a further sharp roll to the right was experienced. The pilot therefore maintained the stick forward and moved it fully to the left. The aircraft nonetheless continued to climb and turn to the right. Although aware of a tree in the path of the aircraft, the state of control was such that the pilot realised a collision with this tree was inevitable.

After the collision, the aircraft entered a spiral dive during which the pilot was able to throttle back and close the fuel cock before the aircraft struck the ground.

Subsequent examination of the wreckage revealed no evidence of any pre-impact failure in the aircraft nor was there any indication of damage having occurred during the contact with the runway marker.

lear of Manufacture:

Oate and Time (UTC):

Elsure Airport, Heris

Lype of Fight:

Private trictsons

Ones of Board:

Crew Note President Note

Sature of Damage:

Commander's Licence:

Commander's Licence:

Output Styres

Aircraft Norder Report Francusbruites

Aircraft Norder Report Francusbruites

Aircraft Norder Report Francusbruites

Aircraft Norder Report Francusbruites