



**WARN® Handheld Wireless/Corded Remote Control for VR EVO Winches**

Aspect	Details								
Images									
Alert Number	2302-0100								
Product Type	Electrical Appliances and Equipment – Remote Control for Winch								
Product Identifiers	<p>Affected model numbers:</p> <table border="0"> <tr> <td>PN 103250 – VR EVO 8</td> <td>PN 103253 – VR EVO 10-S</td> </tr> <tr> <td>PN 103251 – VR EVO 8-S</td> <td>PN 103254 – VR EVO 12</td> </tr> <tr> <td>PN 103252 – VR EVO 10</td> <td>PN 103255 – VR EVO 12-S</td> </tr> <tr> <td colspan="2">PN 104218 – S/P Remote &amp; Control Module</td> </tr> </table>	PN 103250 – VR EVO 8	PN 103253 – VR EVO 10-S	PN 103251 – VR EVO 8-S	PN 103254 – VR EVO 12	PN 103252 – VR EVO 10	PN 103255 – VR EVO 12-S	PN 104218 – S/P Remote & Control Module	
PN 103250 – VR EVO 8	PN 103253 – VR EVO 10-S								
PN 103251 – VR EVO 8-S	PN 103254 – VR EVO 12								
PN 103252 – VR EVO 10	PN 103255 – VR EVO 12-S								
PN 104218 – S/P Remote & Control Module									
Product Description	The recall affects serial numbers range from 03062019xxxx-29112022xxxx (03 June 2019 – 29 November 2022). Serial numbers are located on the back side of the winch drum support. Only the remote is subject to the recall notice – the winch is not affected. The affected remote switch face configurations have all black components on the remote switch face.								
Country of Origin	China								
Counterfeit	No								
Risk Type	Injuries								
Risk Description	A small number of remotes exposed to water and/or corrosion on specific locations on the circuit board may cause the winch to start operating when not intended, or to not turn off when the switch button is released, posing an injury hazard.								
Corrective Measures	<p>Consumers have been contacted by WARN® directly and have been instructed to immediately:</p> <ol style="list-style-type: none"> <li>1. Inspect the remote for any internal corrosion or signs of water ingress.</li> <li>2. Open the remote by removing the 3 screws and remove the batteries. Removing the batteries disables the wireless function of the remote.</li> <li>3. If corrosion is identified, contact WARN® to arrange a replacement remote. Further information can be accessed on the WARN® website at: <a href="https://international.warn.com/vr-evo-remote-info">https://international.warn.com/vr-evo-remote-info</a></li> </ol>								
Online Marketplace	N/A								
Notifier	Local Authority Trading Standards								