

## **Product Safety Report**

Jungheinrich / Liquefied Petroleum Gas (LPG) powered industrial lift trucks / Various Models			
Aspect	Details		
Images	ADECEMBRICA SUNGHEINRICH		
PSD Number	2306-0003		
Product Type	Machinery – Industrial Lift Truck		
Product Identifiers	installed as part of the trucks fuel sy	vaporiser manufactured by EControls Extem are affected. This includes and model ranges manufactured between   Manufacture Date 01.14 – 03.23	
Product Description	Liquified Petroleum Gas (LPG) powered industrial lift trucks.		
Country of Origin	Germany		
Counterfeit	No		
Risk Level	High		
Risk Type	Fire		
Risk Description	Owners, users and other persons supplying, inspecting and maintaining these LPG powered vehicles are being alerted to the risk of fire when presented with a non-starting engine.  Although these trucks had operated for many years without issue a build-up of deposits in fuel systems of some LPG powered vehicles, in particular those fitted with IMPCO C-series vaporiser units, has led to several fires. Deposits in vaporiser units, flow regulators and shut off valves are also causing trucks to fail to start, particularly from cold. The cause of these deposits appears to be related to variation in the composition of LPG fuel which has been distributed in some regions of Great Britain.		

The OPSS Product Safety Alerts, Reports and Recalls Site can be accessed at the following link: <a href="https://www.gov.uk/guidance/product-recalls-and-alerts">https://www.gov.uk/guidance/product-recalls-and-alerts</a>



## **Product Safety Report**

Product Safety Repo	
	The model TFG 316s, 320s, 425s, 430s, and 435s LPG industrial lift trucks manufactured by Jungheinrich AG have been identified as one of a number of manufacturers' models known to be fitted with the IMPCO C-Series vaporiser in their fuel systems, which are particularly affected. Any other industrial lift truck or other LPG powered vehicle fitted with the IMPCO C-Series vaporisers manufactured by EControls Europe BV, either as originally supplied or as a replacement part, may also present a risk of fire.  The particular design of the IMPCO C-Series vaporiser means that a build-up of deposits caused by some LPG fuel can lead to sticking valves resulting in the fuel mixture supplied to the engine being too rich to be ignited. Repeated starting attempts can then result in the release of unburned LPG, which in extreme cases can be ignited setting fire to the vehicle and surrounding materials.
Corrective Measures	Jungheinrich is contacting known owners and suppliers of affected lift trucks to warn them of the risks and provide guidance on how to reduce and mitigate risks.  Jungheinrich have also initiated a programme of voluntary corrective action to retro-fit a fuel system modification kit to priority users worse affected by vaporiser contamination issues. Users should note that although the kit will reduce the likelihood and mitigate the consequences of a fire occurring, the risk is not completely eliminated. Users should continue to exercise caution and follow the advice given by the manufacturer.  Any owners and users of affected Jungheinrich lift trucks who have not been contacted are advised to contact Jungheinrich or the supplying dealer for further advice.  The Health and Safety Executive (HSE) has issued a safety notice informing users and persons supplying, inspecting and maintaining LPG powered vehicles of the risk of fire in certain conditions and measures to take. This can be accessed from: <a href="https://www.hse.gov.uk/safetybulletins/forklift-fires.htm">https://www.hse.gov.uk/safetybulletins/forklift-fires.htm</a> Jungheinrich is also notifying users of these alerts via their website at: <a href="https://www.jungheinrich.co.uk/about-us/press-events/press-releases/lpg-safety-bulletin-1352012">https://www.jungheinrich.co.uk/about-us/press-events/press-releases/lpg-safety-bulletin-1352012</a> Users of any other industrial lift truck or other LPG powered vehicle fitted with the IMPCO C-Series vaporiser are also advised to contact the manufacturer or supplying dealer for further advice.  Owners and users of other makes and models of LPG-powered lift trucks and vehicles incorporating other vaporiser designs may also experience fuel system problems due to LPG composition and should take note of the general advice given.
Online Marketplace	Not applicable
Notifier	Health and Safety Executive
P	

The OPSS Product Safety Alerts, Reports and Recalls Site can be accessed at the following link: <a href="https://www.gov.uk/guidance/product-recalls-and-alerts">https://www.gov.uk/guidance/product-recalls-and-alerts</a>