




Siemens Gamesa Renewable Energy - Siemens 3 MW SWP 3.0 Wind Turbine Generator fitted with Avanti SWP L service lift

Aspect	Details																		
<p>Images</p>																			
<p>PSD Number</p>	<p>2202-0389</p>																		
<p>Product Type</p>	<p>Machinery – Wind Turbine Generator</p>																		
<p>Product Identifiers</p>	<p>Siemens SWT-3.0-113 DD wind turbine generator fitted with Avanti Wind Systems A/S service lift model SWP L, including swinging door (landing gates) and trapped-key fence interlock system.</p> <p>SWT-3.0-113 DD wind turbine generator - including but not limited to - serial numbers:</p> <table border="1" data-bbox="395 1615 1318 1720"> <tbody> <tr> <td>3001073</td> <td>3001074</td> <td>3001075</td> <td>3001076</td> <td>3001077</td> <td>3001078</td> </tr> <tr> <td>3001079</td> <td>3001082</td> <td>3001083</td> <td>3001084</td> <td>3001085</td> <td>3001086</td> </tr> <tr> <td>3001087</td> <td>3001087</td> <td>3001089</td> <td>3001090</td> <td>3001091</td> <td></td> </tr> </tbody> </table>	3001073	3001074	3001075	3001076	3001077	3001078	3001079	3001082	3001083	3001084	3001085	3001086	3001087	3001087	3001089	3001090	3001091	
3001073	3001074	3001075	3001076	3001077	3001078														
3001079	3001082	3001083	3001084	3001085	3001086														
3001087	3001087	3001089	3001090	3001091															
<p>Product Description</p>	<p>Siemens Model SWT-3.0-113 DD Onshore wind turbine generator with rated power 3000 kW and rotor diameter 113.0 m, fitted with Avanti Wind Systems A/S Model SWP L service lift intended to transport people and/or tools and equipment.</p>																		
<p>Country of Origin</p>	<p>Denmark</p>																		
<p>Counterfeit</p>	<p>Not counterfeit</p>																		
<p>Risk Level</p>	<p>Serious</p>																		

The OPSS Product Safety Alerts, Reports and Recalls Site can be accessed at the following link: <https://www.gov.uk/guidance/product-recalls-and-alerts>

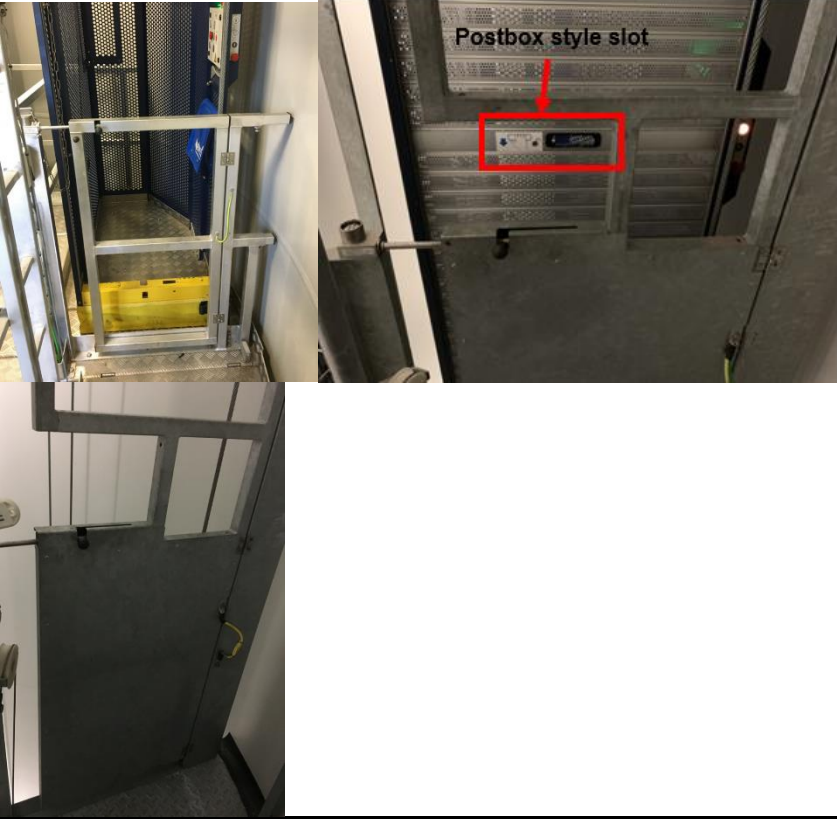

Risk Type	Injuries from moving parts
Risk Description	<p>The Siemens SWT-3.0-113 DD wind turbine generator fitted with the Avanti Wind Systems A/S SWP L service lift and landing gates, presents a serious risk of injury due to entrapment and shearing/crushing with the moving lift car.</p> <p>The service lift installed in the wind turbine can be operated from inside the lift car, and from outside using the control box mounted on the outside of the lift car. The design of the landing gates is inadequate, as when the service lift is operated using either the internal or external controls, the gates do not prevent persons outside the lift car from coming into contact with the moving lift. It is possible for parts of a person to become caught in the postbox style slots and drawn in or trapped between the moving lift and the landing gate or platform edges, resulting in risk of serious injury.</p> <p>The design of the landing gates and their integration with the service lift did not result in a safe installation. It did not include appropriate protective measures to eliminate identified hazards or to reduce risks related to being caught in the slots of the moving lift or between the landing gate or platform edges and the moving lift.</p> <p>The wind turbine generator fitted with the SWP L service lift and landing gates does not meet the requirements of the Supply of Machinery (Safety) Regulations 2008.</p>
Corrective Measures	<p>The manufacturer in Denmark and the supplier in Great Britain have been informed of the non-compliance with the Supply of Machinery (Safety) Regulations 2008.</p> <p>The supplier has agreed to engage with all previously supplied customers, recommending that they initiate a risk review of the service lift and wind turbine generator interface as a matter of priority.</p> <p>Operators of the wind turbines should ensure that contact with moving parts of the service lift is not possible, and that the landing gates do not create crushing/shearing hazards to persons on the landings during lift operation.</p> <p>The Health and Safety Executive (HSE) issued Safety Notice ED01-2024 (05/24) on service lifts in offshore and onshore wind turbines and the potential risk to operators using, or working near, them. ED01-2024 provides information on actions that operators should take to ensure dangerous moving parts cannot be reached over or through landing gates. It also contains information for economic operators: reminding them of their legal duties when supplying new lifts to the UK, and that they should help those operating lifts already supplied, to eliminate the hazards identified. ED01-2024 can be found at https://www.hse.gov.uk/safetybulletins/service-lifts-in-offshore-onshore-turbines.htm.</p>
Online Marketplace	N/A
Notifier	Health and Safety Executive