



Abbreviated Vibration Monitoring Report

Monitoring Period: 05 January 2026 to 01 February 2026

Project: Grenfell Tower

Document Ref: EEMC-VMR-201/104 – Grenfell Tower Rev 01

Period: 05 January 2026 to 01 February 2026

(EEMC) Limited Contact Information:
European Environmental Monitoring & Consultancy (EEMC) Ltd.
Suite 11, 5a Lombard Road, Wimbledon, London SW19 3TZ
t: [0203 6271312](tel:02036271312)
e: info@eemc.london
w: www.eemc.london


Details of Vibration Monitor at Receptor Point VMP1 – VMP3

ID Reference	Location
VMP1	Opposite Southeast corner of tower between two (2) concrete blocks
VMP2	Base of North hoarding co located with NMP2
VMP3	Mobile unit- Located base of NW hoarding with DMP5 and NMP3

Contents

1. Exceedance Summary.....	3
Figure 1- Map of Vibration, Dust & Vibration Monitoring Locations.....	5
Image 1 – VMP1 Monitoring Location.....	6
Image 2 – VMP1 – VMP3 Monitoring Location.....	7
Image 3 – VMP1 – VMP3 Monitoring Location.....	8
2. Introduction.....	9
3. Instrumentation.....	9
4. Methodology.....	9
5. Measurement Results.....	10
6. Vibration Monitoring Graphs.....	11

Review and Authorisation

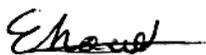	Name	Role	Signature	
Author:	Stacey Miller	Project Manager		03/02/2026
Technical Reviewer:	Emma Howard <small>AMIOA, AISEP</small>	Operations Manager/ Senior Consultant		06/02/2026

(EEMC) Limited have prepared this document for the sole use of the client, using all reasonable skill and care, for the intended purpose(s) and within the resources made available and agreed with the client. No responsibility is accepted for matters outside the terms and scope of the agreement under which this document has been prepared. Similarly, no responsibility in any form is accepted for third party use of this report or parts thereof, the contents of which are confidential to the client. No other warranty, expressed or implied, is made as to the professional advice included in this report.

1. Exceedance Summary

At VMP1:

There were **five (5) exceedances** of the red action level 3.0mm/s and **four (4) exceedance** of the amber trigger level 1.0mm/s during working hours in this reporting period.

Due to this monitoring location having experienced a few accidental disturbances site have installed a physical barrier in front of VMP1 to help prevent these.

At VMP2:

- There was **one (1) exceedance** of the Red Action level 5.0mm/s and **two (2) exceedances** of the Amber Trigger level 3.0mm/s during working hours in this reporting period.

At VMP3:

- There were **two (2) exceedances** of the Red Action Level 5.0mm/s, and **no exceedances** of the Amber Trigger level in this reporting period during working hours.

Any exceedances that do occur will be shown in **Tables 0.1 and 0.2**, if there are no exceedances these tables will remain empty.

For more information regarding the trigger limits please refer to Section 4 – Methodology.

Table 0.1. – Amber Alert Exceedance Count

Monitoring Location	Time and Date of Exceedance	Measured Level of Exceedance (mm/s)	Amber Trigger Alert Level (mm/s)	Cause of Exceedance
VMP1	05/01/2026 10:00	1.08	1.0mm/s	No works undertaken near monitoring location, given the isolated nature of these exceedances these may have been caused by an accidental disturbance of the MEMS sensor
	07/01/2026 08:10	1.01		A physical barrier has now been installed to help prevent these
	13/01/2026 08:50	1.02		Banner work in close proximity to the monitoring location
	14/01/2026 09:55	1.87		No works undertaken near monitoring location, given the isolated nature of these exceedances these may have been caused by an accidental disturbance of the MEMS sensor

				A physical barrier has now been installed to help prevent these
VMP2	22/01/2026 15:30	3.08	3.0mm/s	14T skip being exchanged.
	22/01/2026 16:00	3.01		
VMP3	-	-		-

**Exceedances outside of working hours can be explained as small mammals e.g. mice/rats/cats or foxes landing on the monitor after climbing a fence or by extreme heavy rainfall.*

Table 0.2. Red Alert Exceedance Count

Monitoring Location	Date and Time of Exceedance	Measured Level of Exceedance (mm/s)	Red Action Alert Level (mm/s)	Cause of Exceedance	Mitigation
VMP1	07/01/2026 09:40	7.11	3.0mm/s	Banner work in close proximity to monitoring location	Monitoring location was assessed to evaluate if it is still suitable and will not get interference/erroneous data capture
	07/01/2026 11:10	6.01			
	07/01/2026 11:15	5.24			
	27/01/2026 11:25	7.92			
	27/01/2026 11:30	9.49			
VMP2	27/01/2026 10:55	82.12	5.0mm/s	EEMC technician in attendance for site maintenance.	
VMP3	27/01/2026 11:40	77.14			
	27/01/2026 11:45	14.54			

Figure 1- Map of Vibration, Dust & Vibration Monitoring Locations

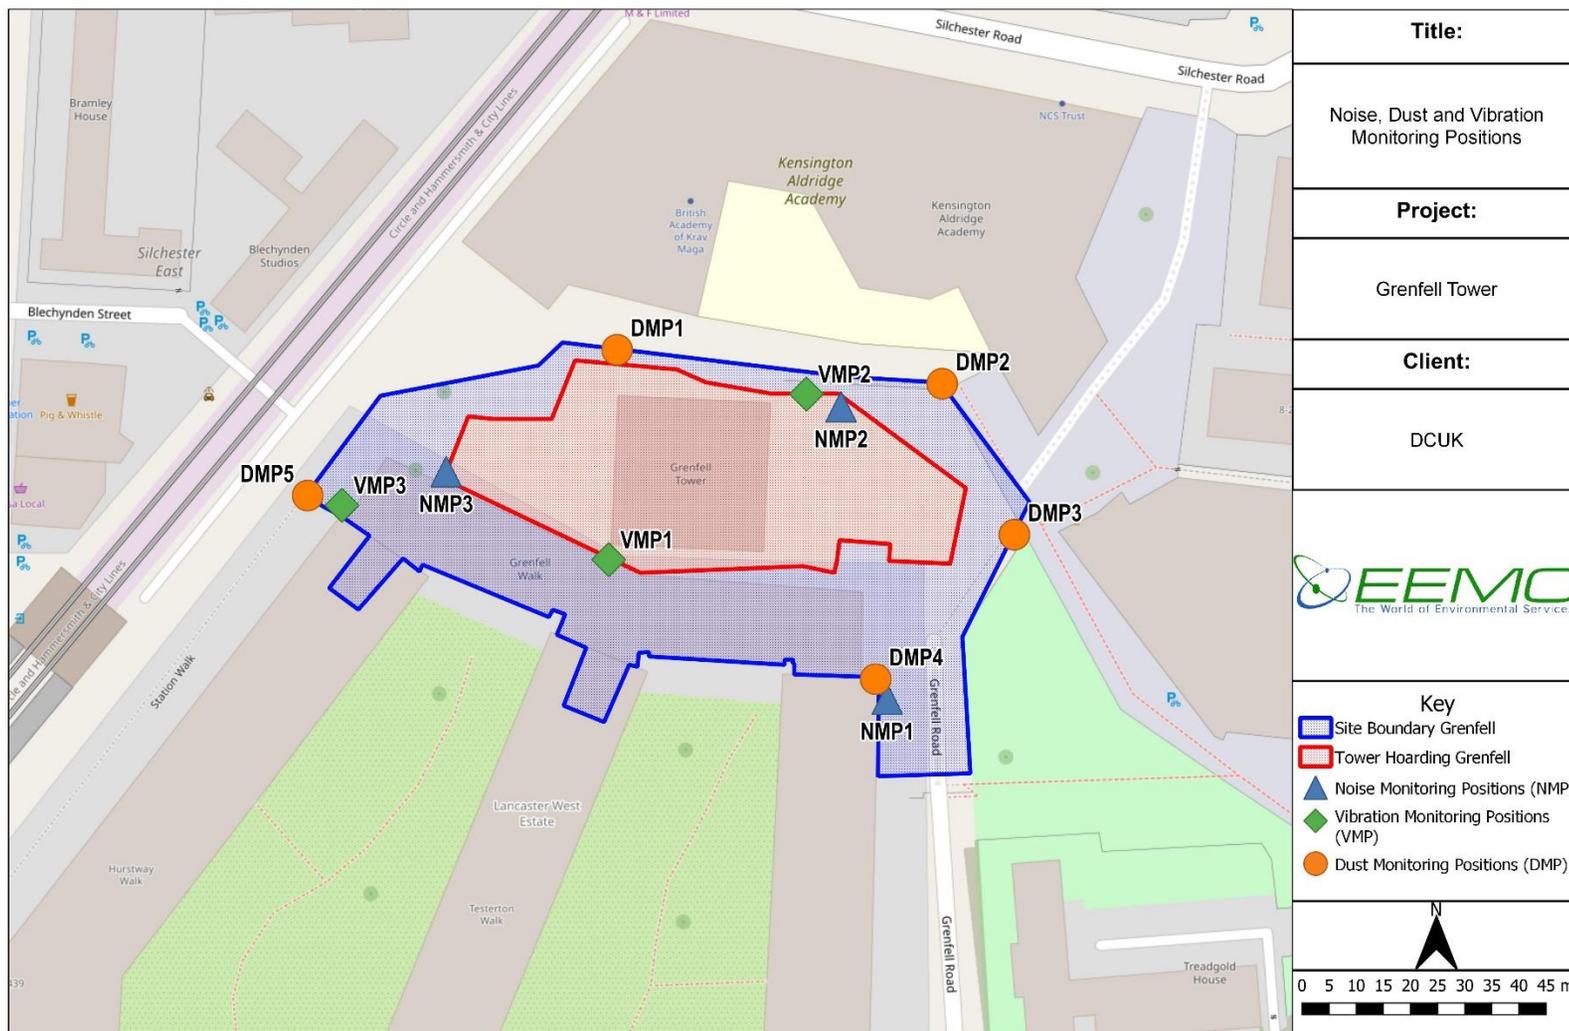


Image 1 – VMP1 Monitoring Location



Image 2 – VMP1 – VMP3 Monitoring Location



Image 3 – VMP1 – VMP3 Monitoring Location



2. Introduction

European Environmental Monitoring and Consultancy (EEMC) Limited have been appointed by Deconstruct to undertake vibration monitoring work during the Deconstruction works at the Grenfell Tower project.

The site boundary and hoarding line of this project is shown in Figure 1. The project is located at Grenfell Tower, Grenfell Road, W11 1TQ. The entire site is located within Royal Borough of Kensington & Chelsea (RBKC) and is bordered by residential blocks to the south, and a school and football pitches to the north and a leisure centre to the east. The London Underground viaduct is 70m to the west and Latimer Road Tube station is 200m from the project

This report presents the measured and recorded unattended vibration monitoring data for the period 05 January 2026 to 01 February 2026.

Deconstruct will ensure ongoing liaison with MHCLG and RBKC when required to obtain any required consents and permits for the project.

3. Instrumentation

Three (3) Omnidots Swarm vibration (DIN45669-2 compliant) monitoring systems, affixed to ground vibration base plates, are installed positioned on a solid floor structure, close to the site boundary. A copy of the calibration certificates for the monitor located at VMP1 is attached as Appendix 1.

The Swarm monitor has built in logging and telemetry and data is managed, configured, and viewed on the Honeycomb cloud portal. Email alerts are generated when trigger levels are exceeded.

4. Methodology

The Swarm monitors record Peak Particle Velocity (PPV) in orthogonal (x, y and z) directions in mm/s continuously over 1-minute periods. A map showing the locations of the monitors is in Figure 1. A photograph showing the monitoring location is shown in Image 1.

The Trigger and Action levels for the project are set out in the **Noise and Vibration Management Plan** (ref: [Noise and vibration management plan - Grenfell Tower](#)) and are reproduced for reference in Table 3.1. The NVMP sets out different limits depending on if the closest sensitive receptor is residential or commercial.

The closest sensitive receptors for the three (3) monitoring positions are outlined below and directly link to the limits used:

- The closest sensitive receptor to VMP1 is the **residential** Receptor: E - Testerton Walk.
- The closest sensitive receptor to VMP2 is the **commercial** Receptor: A - Kensington Aldridge Academy.
- The closest sensitive receptor to VMP3 is the **commercial** adjacent Hammersmith and City and Circle Tube Lines.

Table 3.1 – Trigger & Action Levels


	Green Trigger Level	Amber Trigger Level	Red Action Level
VMP1 <i>Residential</i>		1 mm/s	3 mm/s
VMP2 and VMP3 <i>Commercial</i>	1 mm/s	3 mm/s	5 mm/s


**Green Trigger Alerts are a pre-warning for site only. These are not actionable and therefore the green alerts are not reported on in this report. Amber are a warning for site and red alerts are exceedances which require investigation and mitigation measures.*

5. Measurement Results

The results of the Vibration measurements in this period are presented graphically in Section 6 of this report.

6. Vibration Monitoring Graphs

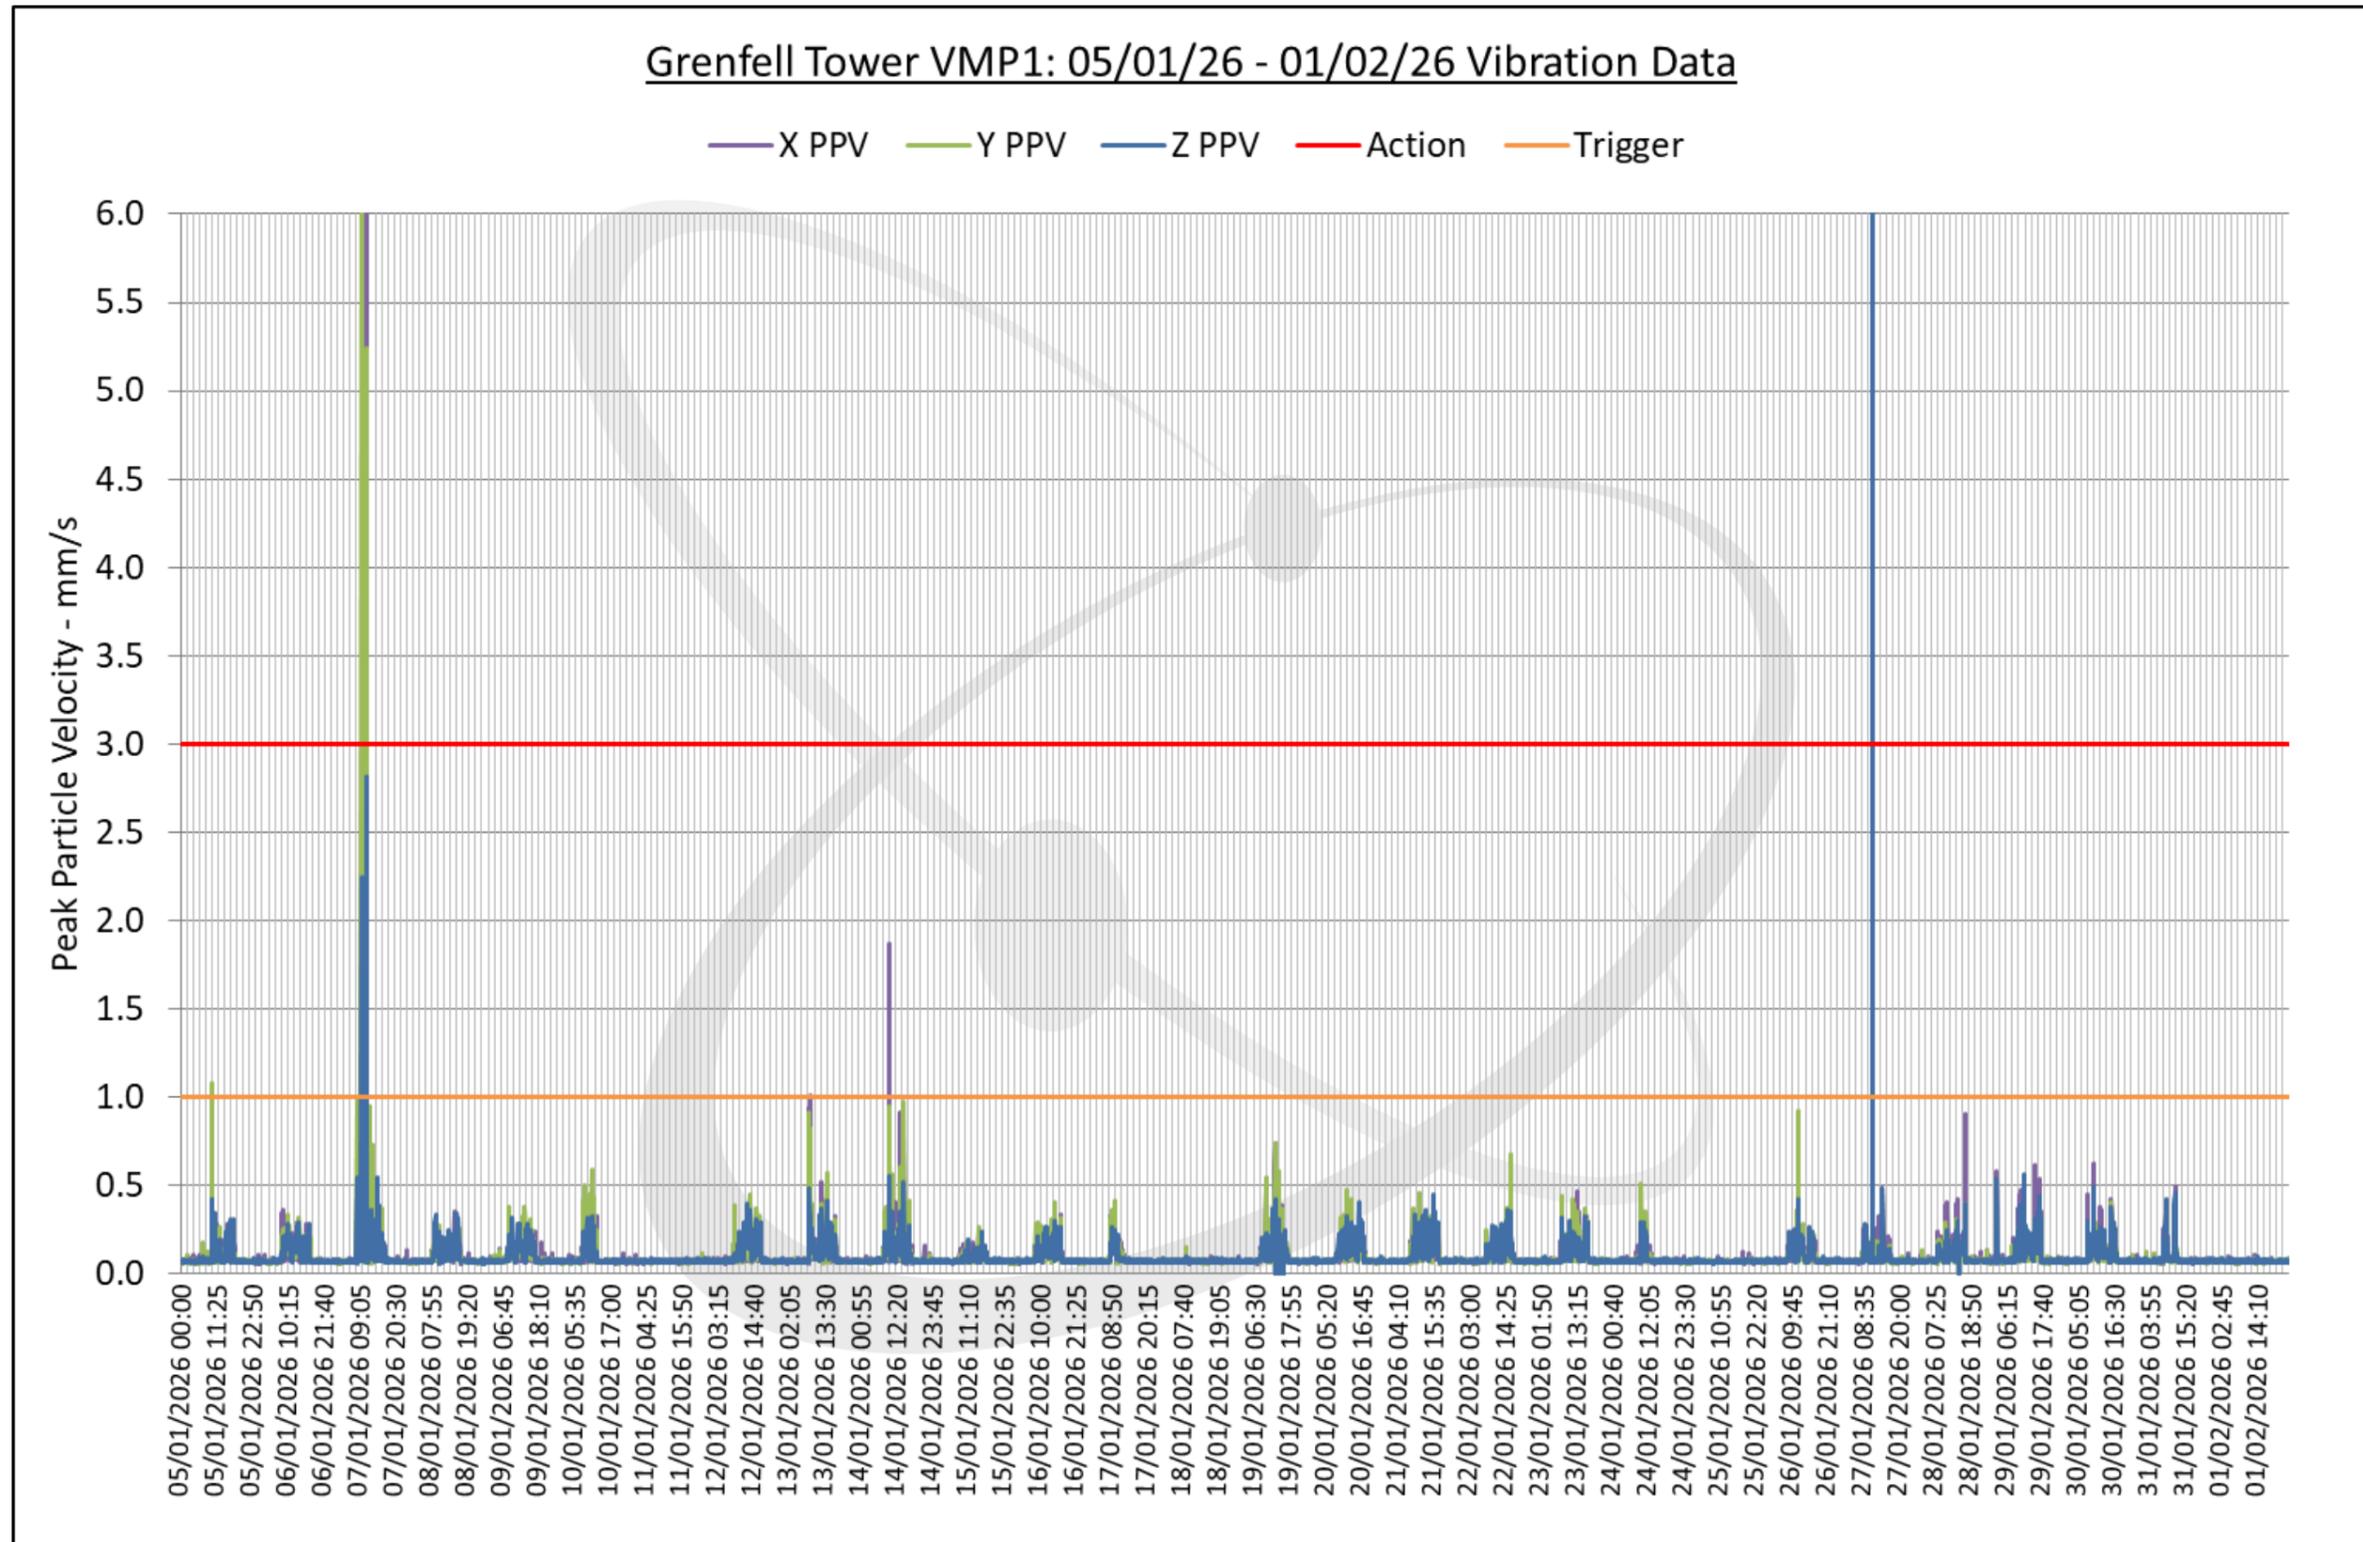

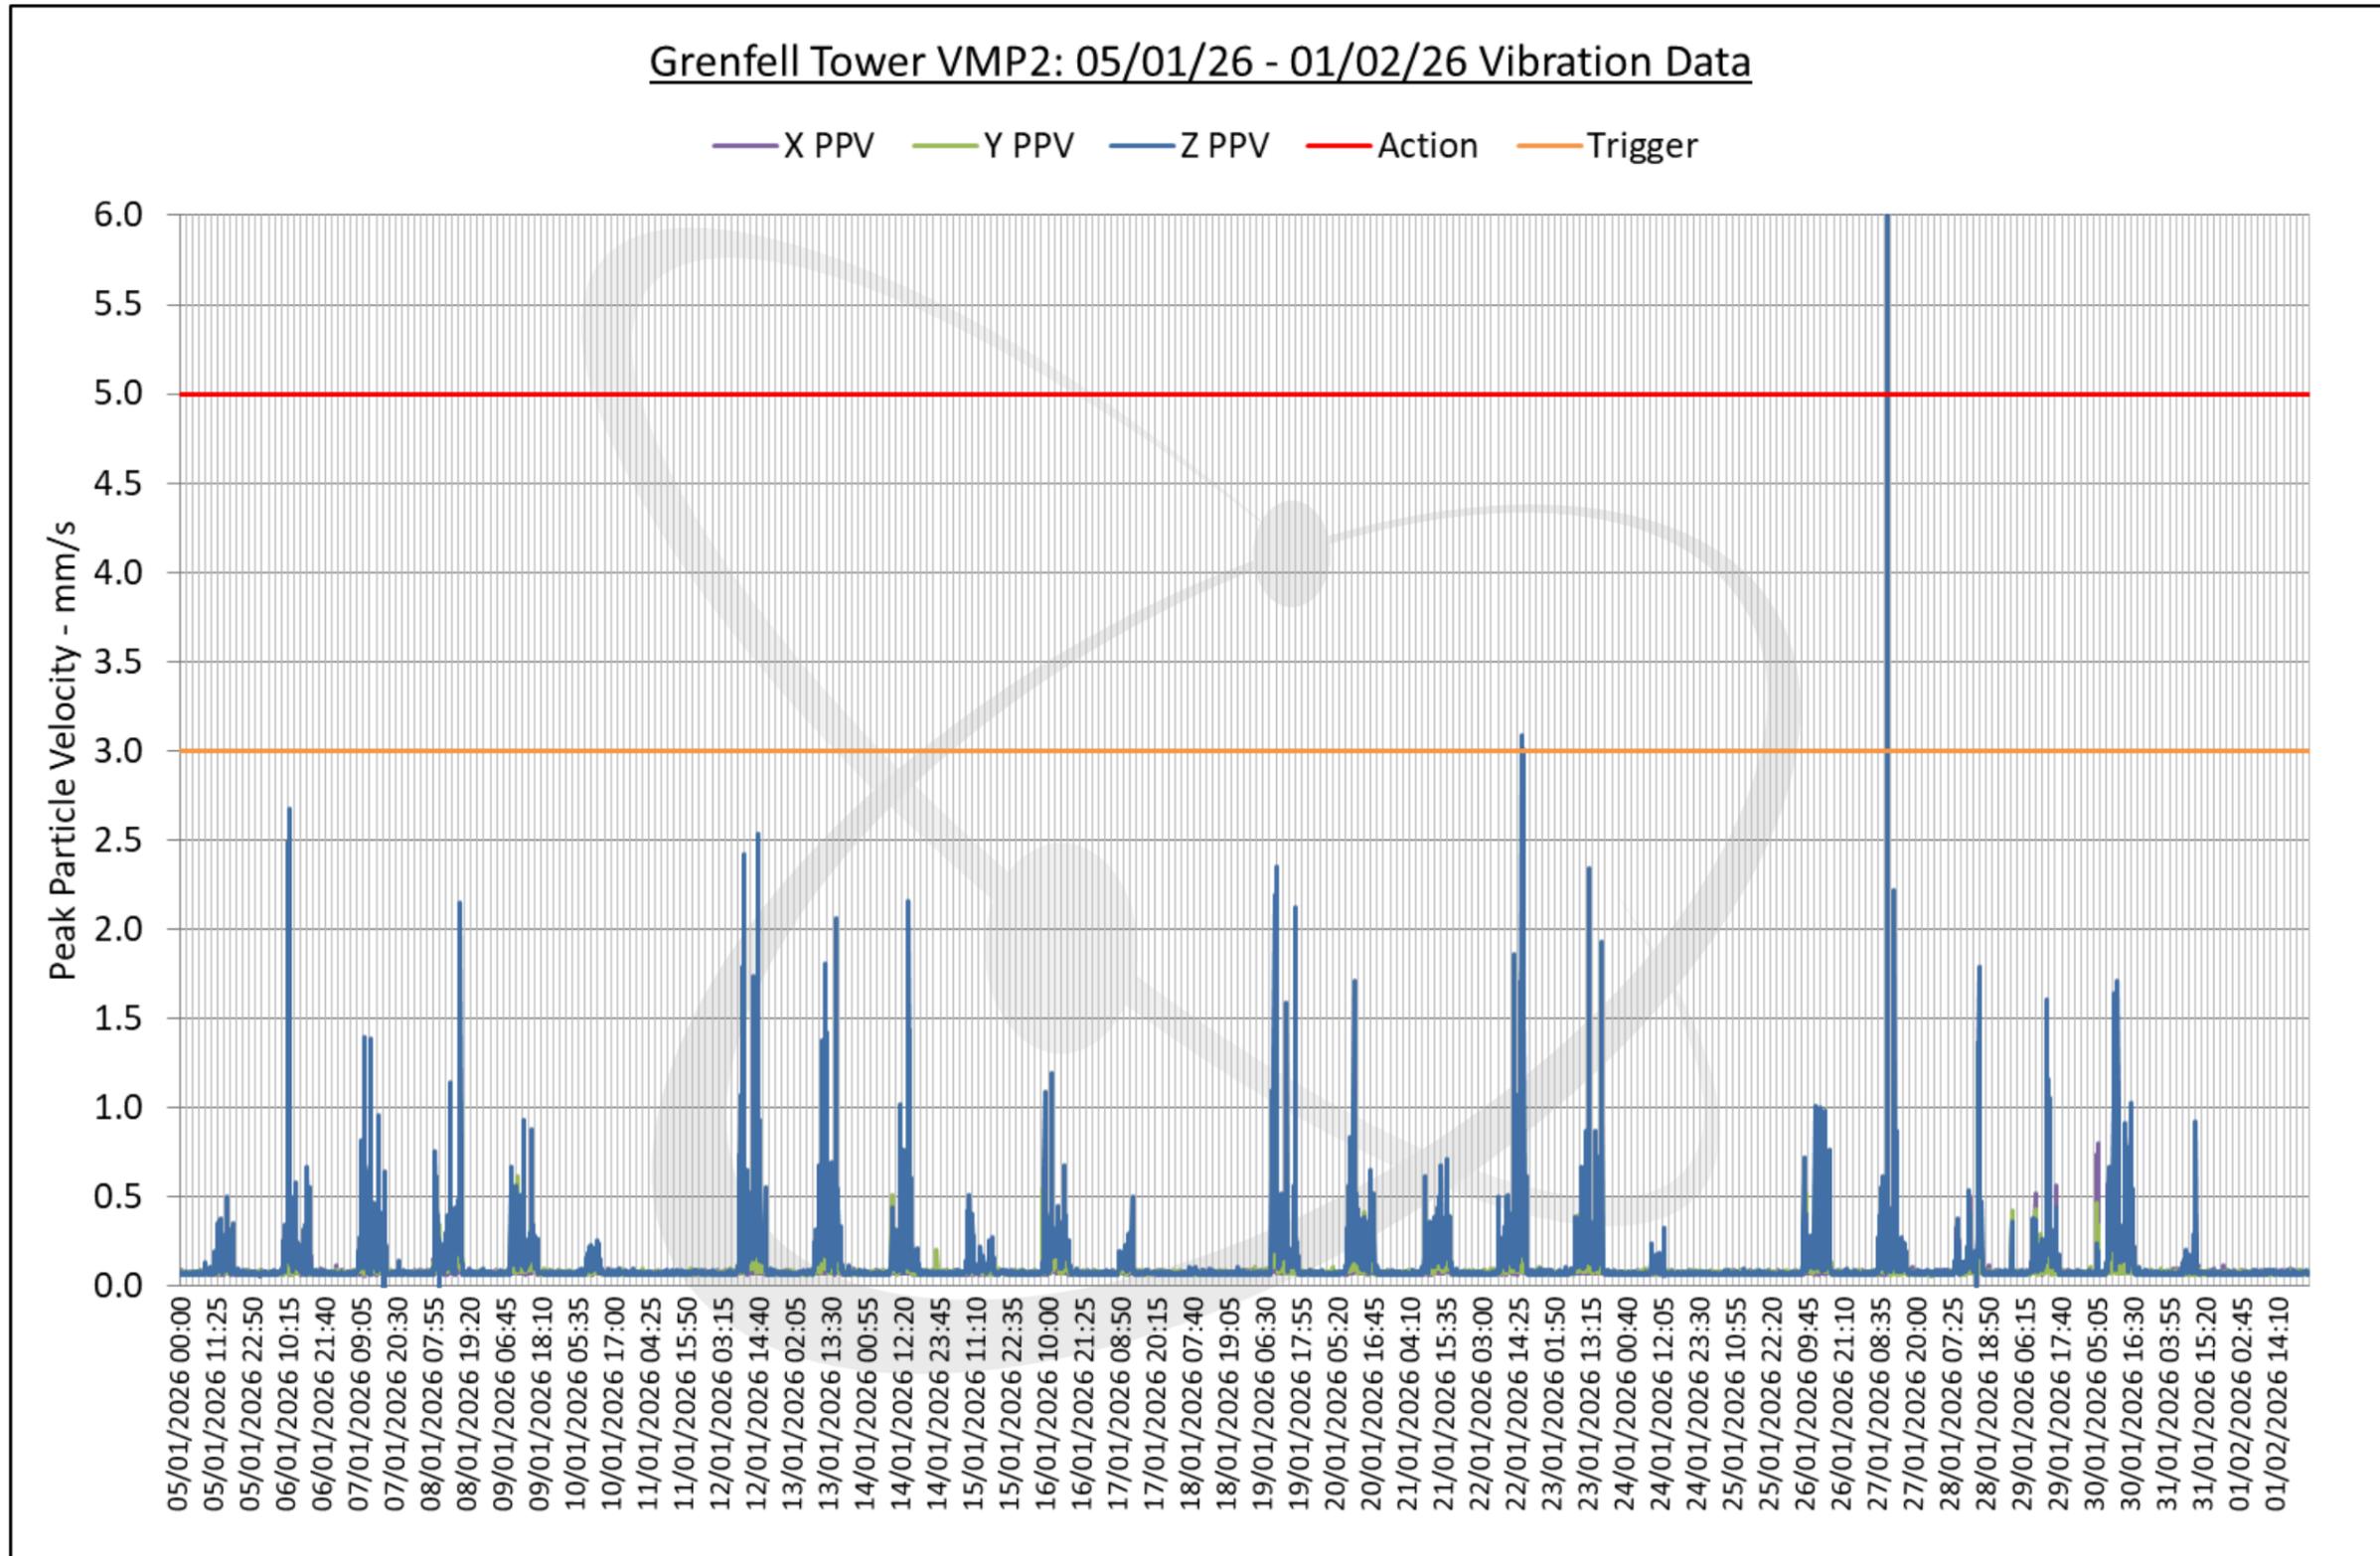

Grenfell Tower VMP3: 05/01/26 - 01/02/26 Vibration Data

