**April 2019** 

# HS2

### Air Quality and Dust Monitoring Monthly Report – April 2019

**London Borough of Hillingdon** 



COSTAIN SKANSKA



High Speed Two (HS2) Limited has been tasked by the Department for Transport (DfT) with managing the delivery of a new national high speed rail network. It is a non-departmental public body wholly owned by the DfT.

High Speed Two (HS2) Limited, Two Snowhill Snow Hill Queensway Birmingham B4 6GA

Telephone: 08081 434 434

General email enquiries: HS2enquiries@hs2.org.uk

Website: www.gov.uk/hs2

A report prepared by Costain Skanska on behalf of HS2 Ltd.

High Speed Two (HS2) Limited has actively considered the needs of blind and partially sighted people in accessing this document. The text will be made available in full on the HS2 website. The text may be freely downloaded and translated by individuals or organisations for conversion into other accessible formats. If you have other needs in this regard please contact High Speed Two (HS2) Limited.

© High Speed Two (HS2) Limited, 2019, except where otherwise stated.

Copyright in the typographical arrangement rests with High Speed Two (HS2) Limited.

This information is licensed under the Open Government Licence v2.0. To view this licence, visit www.nationalarchives.gov.uk/doc/open-government-licence/ version/2 **OGL** or write to the Information Policy Team, The National Archives, Kew, London TW9 4DU, or e-mail: psi@nationalarchives.gsi.gov.uk. Where we have identified any third-party copyright information you will need to obtain permission from the copyright holders concerned.



Printed in Great Britain on paper containing at least 75% recycled fibre.

#### **Monthly Summary**


- 1.1.1 This Summary Report is published in fulfilment of commitments detailed in the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, Annex 1: Code of Construction Practice, for the nominated undertaker to present the results of air quality and dust monitoring undertaken in the London Borough of Hillingdon (LBH) during March 2019 and April 2019 respectively.
- 1.1.2 Figure 1 to Figure 4 in Appendix A indicate the current worksites, together with air quality and dust monitoring locations.
- 1.1.3 This summary should be read in conjunction with the overview monitoring report available from <a href="www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2">www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2</a>, which highlights: the applicable standards and guidance, as well as the air quality and dust monitoring methodologies to be implemented by nominated undertakers throughout construction.
- 1.1.4 The current phase of works commenced within the LBH during May 2018 and are expected to be completed by July 2019. The current worksites, as presented in Appendix A, Figure 1, include:
  - 18' and 48' gas pipeline diversions, advanced planting and habitat creation, worksite ref. S002-WS05;
  - Merck Sharpe Dohme, demolition works and new access road construction, worksite ref. S002-WS03;
  - Utility diversions at Breakspear Road South; work sites ref. S002-WS07 and S002-WS08;
  - Utility diversions at Copthall North, worksite ref. S002-WS06 and South, worksite ref. S002-WS04; and
  - Haul Road construction and site compound and vegetation clearance at West Ruislip Golf Course site, worksite ref. S002-WS09.
- 1.1.5 Two (2) dust monitors were installed around worksite ref. S002-WS03, where site establishment works are underway. This site returned a high dust risk rating.
- 1.1.6 Dust monitoring locations and results are presented in Appendix B, Table 1 together with line charts of monthly data from each dust monitor.
- 1.1.7 There were no (0) exceedances of the dust trigger level recorded during the month of April 2019. All results were in line with the expected ranges.
- 1.1.8 Diffusion tube monitoring of Nitrogen Dioxide ( $NO_2$ ) was undertaken at eleven (11) locations in March 2019, around highways within the LBH as part of the management of air quality where significant effects may occur as a result of the scheme.


Page 1


- 1.1.9 Diffusion tube monitoring results are provided from the laboratory analysis, and therefore still require various analysis and adjustments to be undertaken. Final corrected results will be presented and described in the annual report. However, based on the results to date, no unexpected values were recorded during the monitoring period.
- 1.1.10 NO<sub>2</sub> monitoring locations and results are presented in Appendix C, Table 2, together with the 2019 running mean.
- 1.1.11 There were no complaints received, relating to dust or air quality, during this monitoring period.


### **Appendix A – Worksites and Monitoring Locations**

Figure 1 to Figure 4: Worksites and monitoring locations within the LBH

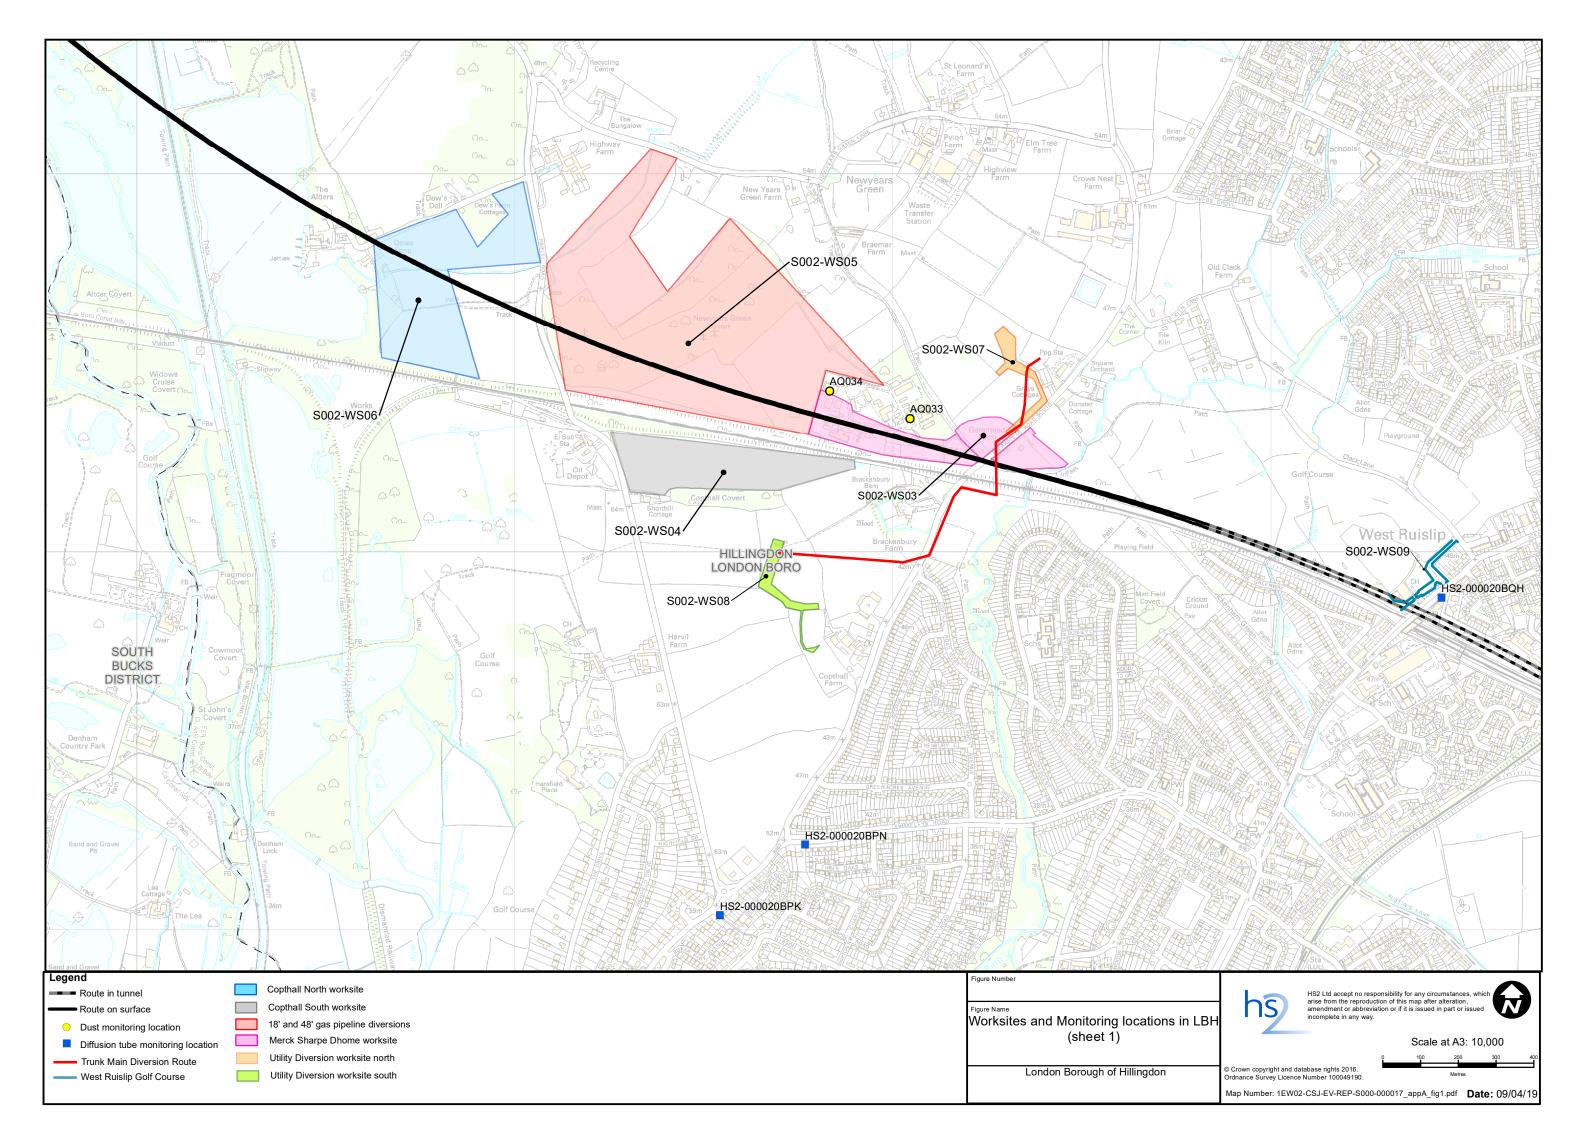

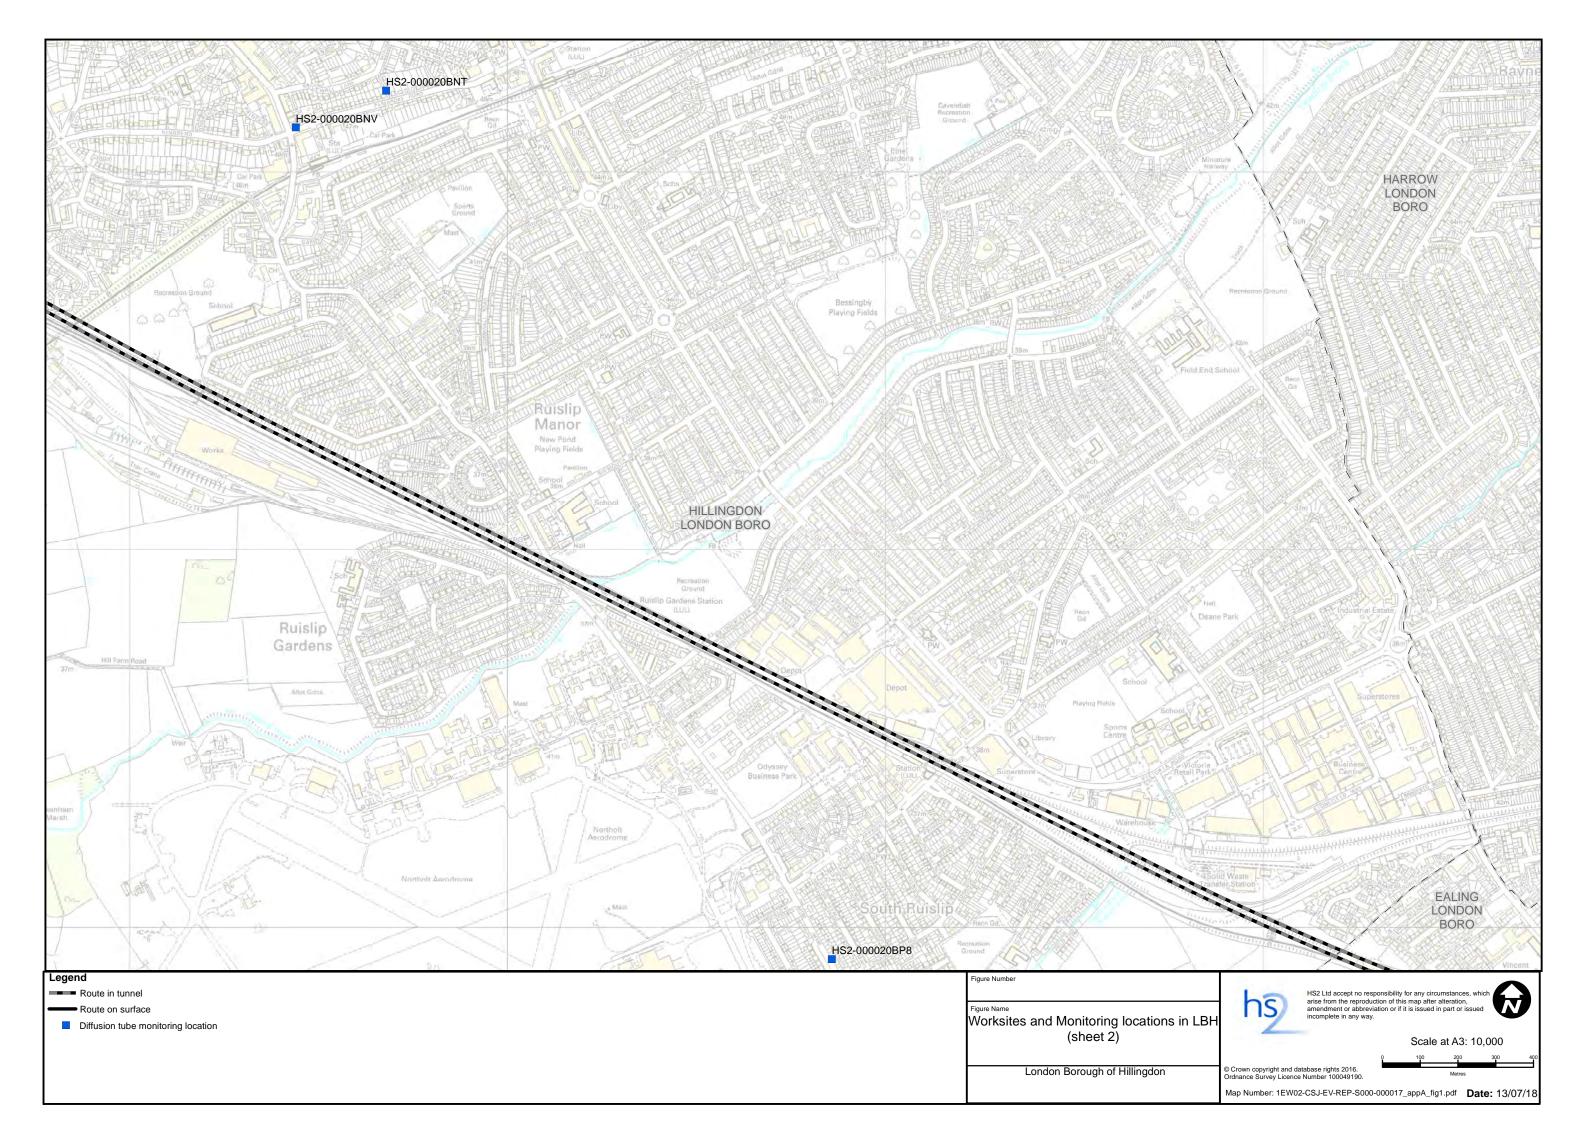

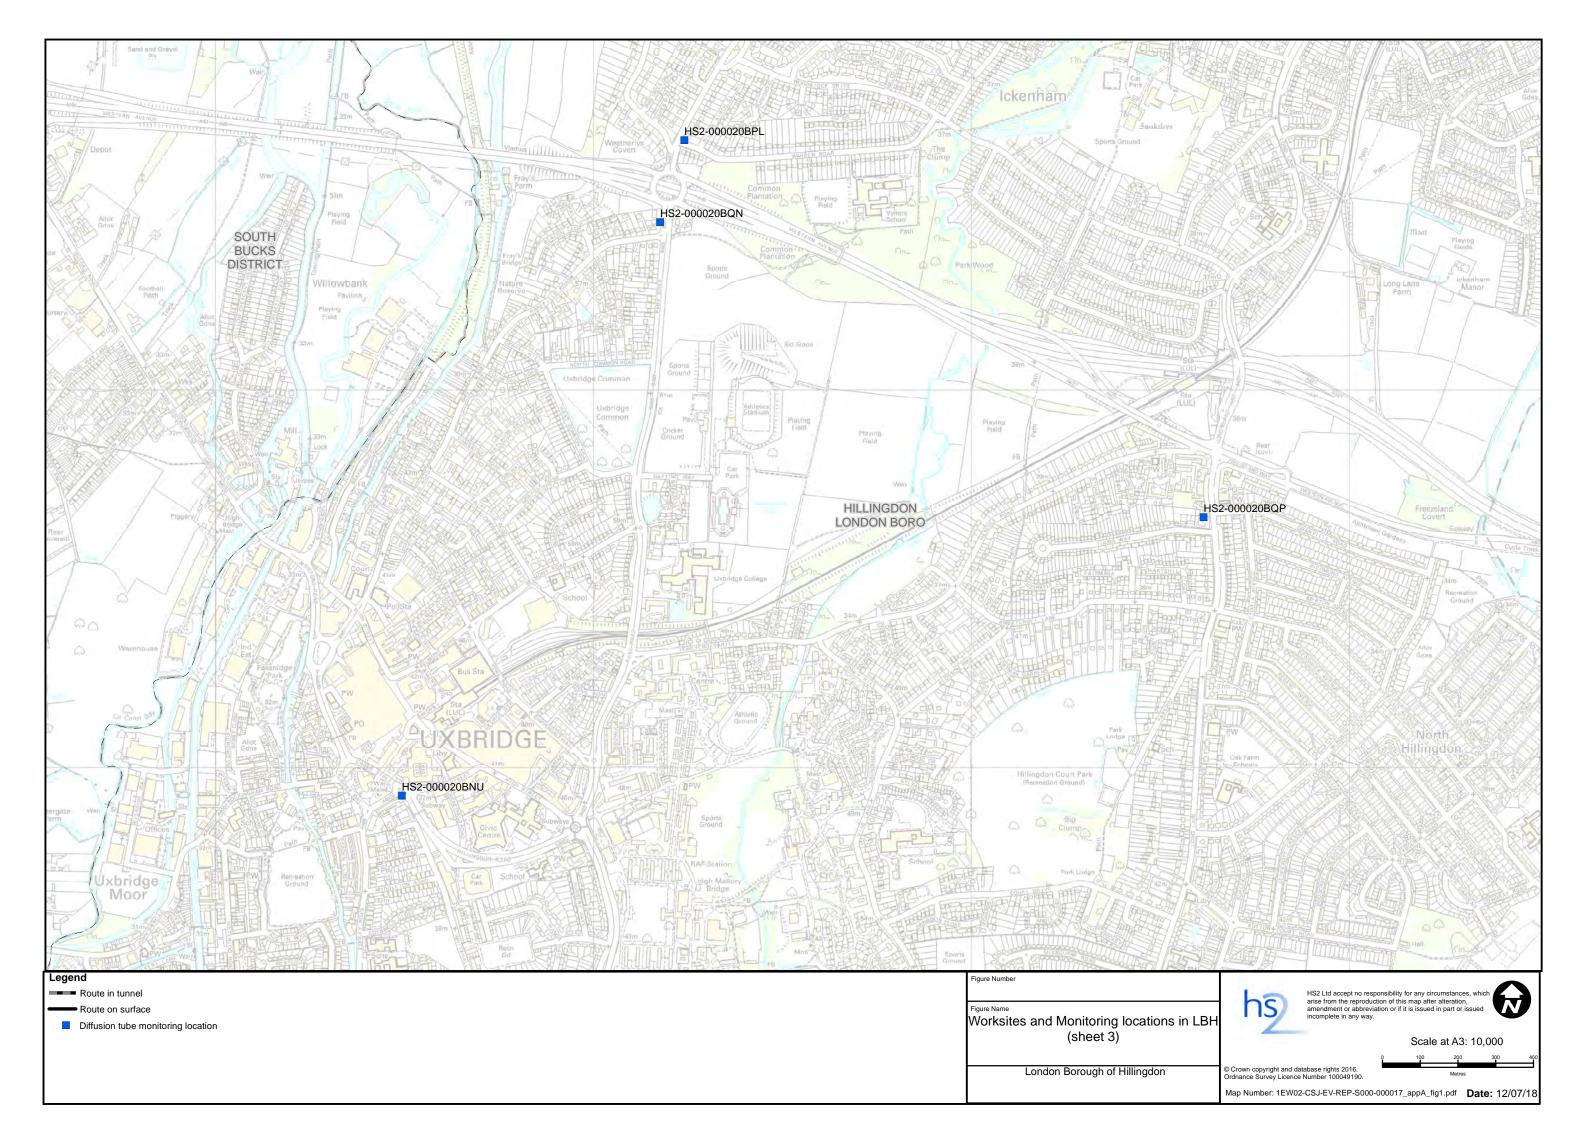

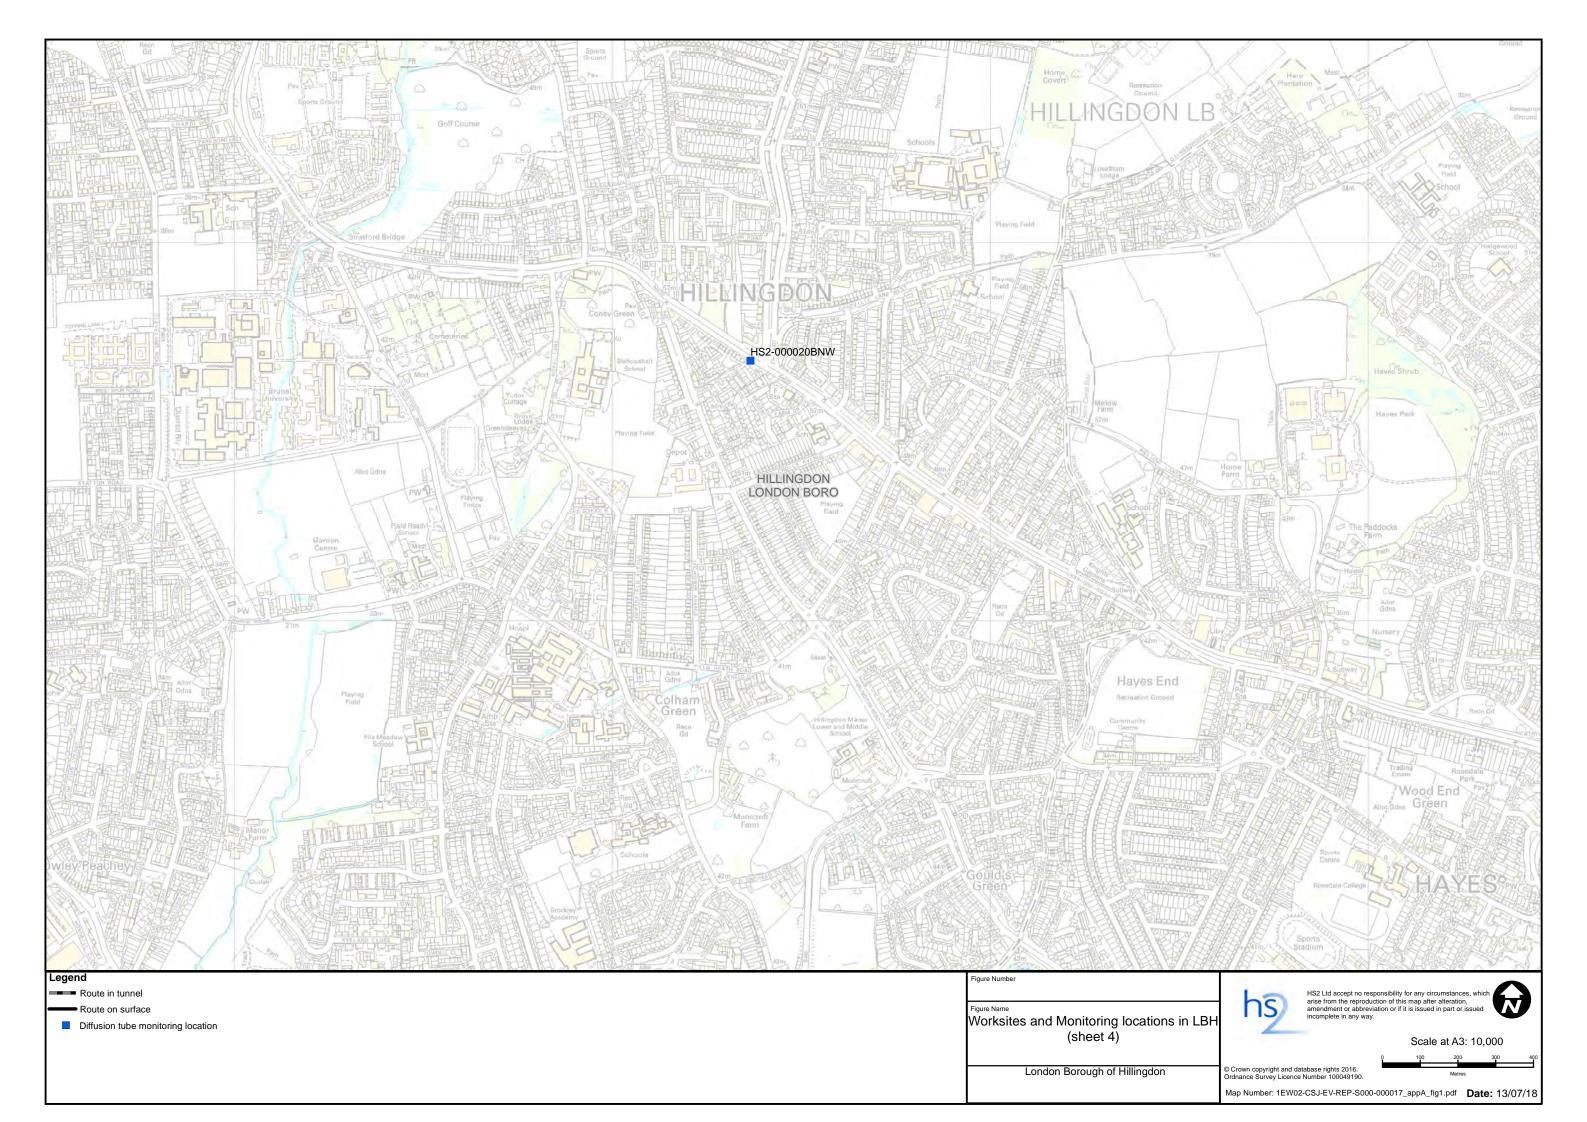


## **Appendix B – Dust Monitoring Results**

Table 1: Dust monitoring locations and April 2019 Results

Monitoring site ID	Coordinates (X,Y)	Location description	Dust risk rating for site	Monitoring site active during period	Change to site since previous period report	Mean 1-hour PM <sub>10</sub> concentration (μg/m³)	Minimum 1- hour PM <sub>10</sub> concentration (μg/m³)	Maximum 1- hour PM <sub>10</sub> concentration (μg/m³)	Number of 1- hour periods exceeding trigger level of 190 µg/m <sup>3</sup>	1-hour data capture (%)
AQ033	507045, 187352	Merck Sharp Dohme, Building 24	Н	Yes	N	9.6	1.1	36.4	0	96.7
AQ034	506832, 187425	Merck Sharpe Dohme Building 43	Н	Yes	N	8.9	1.4	38.3	0	99.9

Figure 5: Construction dust 1-hour mean indicative PM<sub>10</sub> concentration for dust monitors

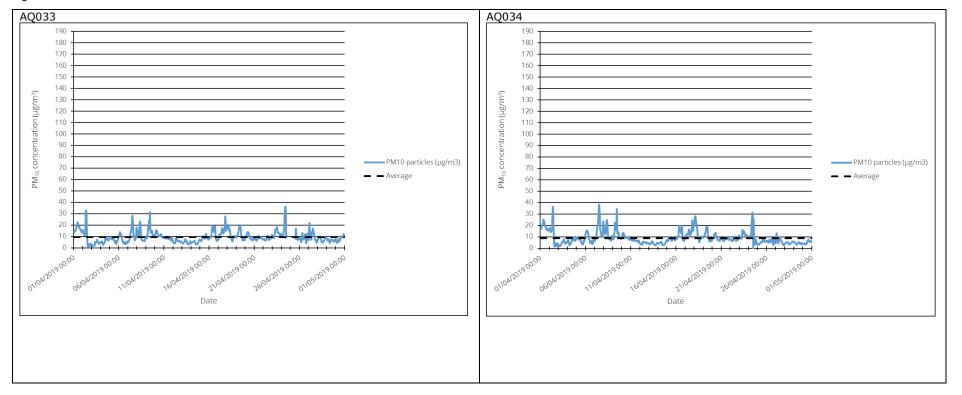

## **Appendix C – Air Quality Monitoring Results**

Table 2: NO<sub>2</sub> monitoring locations around highways, NO<sub>2</sub> concentrations and monthly monitoring results with running mean for 2019 (μg/m³)

Monitoring Site ID	Location description	Coordinates (X, Y)	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Mean <sup>1</sup>
HS2- 000020BNT	Lamp post on Pembroke Road	509678, 187214	34	41	28										34
HS2- 000020BNU	Cowley Road sign post at junction with Hillingdon Road	505492, 183926	47	49	41										46
HS2- 000020BNV	High Street sign post at junction with Pembroke Road	509439, 187117	46	47	38										44
HS2- 000020BNW	Signpost on A4020 Uxbridge Road at junction with Long Lane	507365, 182687	54	47	41										47
HS2- 000020BPK	Lamp post in crescent off Swakeleys Road	506542, 186037	45	48	39										44
HS2- 000020BPL	Warren Road sign post on corner of Swakeleys Road and Warren Road	506240, 185660	43	61	Tube missing										52

<sup>&</sup>lt;sup>1</sup> Note: to aid interpretation and conform with best practice, the monthly measurements in this table are reported rounded to the nearest whole number. The annual mean presented here is calculated based on laboratory data to 4 significant figures, rounded to a whole number, and therefore may differ slightly to a mean derived from averaging the rounded monthly measurements in the table.

Monitoring Site ID	Location description	Coordinates (X, Y)	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Mean <sup>1</sup>
HS2- 000020BPN	Lamp post on B467	506767, 186224	39	No data	36										37
HS2- 000020BQH	Lamp post on High Road Ickenham	508451, 186879	51	49	42										47
HS2- 000020BQN	Lamp post on Park Road	506176, 185444	45	54	54										51
HS2- 000020BQP	Signpost on Long Lane	507614, 184663	43	47	43										44
HS2- 000020BP8	Triplicate site at South Ruislip roadside automatic monitoring station	510858, 184916	46	44	34										41