

October 2022

Construction Noise and Vibration Monthly Report – August 2022

North Warwickshire Borough Council

Non-Technical Summary						
Abbreviations and Descriptions	3					
1 Introduction	4					
1.2 Measurement Locations	8					
2 Summary of Results	10					
2.1 Summary of Measured Noise and Vibration Level	s 10					
2.2 Exceedances of the LOAEL and SOAEL	13					
2.3 Exceedances of Trigger Level	16					
2.4 Complaints	17					
Appendix A Site Locations						
Appendix B Monitoring Locations						
Appendix C Data						

List of tables

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	8
Table 3: Summary of Measured dB L _{Aeq} Data over the Monitoring Period	11
Table 4: Summary of Measured PPV Data over the Monitoring Period	13
Table 5: Summary of Exceedances of LOAEL and SOAEL	14
Table 6: Summary of Exceedances of Trigger Levels	16
Table 7: Summary of Complaints	17

-

Н

Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within North Warwickshire Borough Council (NWBC) area during the month of August 2022.

Within this period monitoring was undertaken at the following worksites:

- Noise monitoring was undertaken at the Kingsbury Main Compound worksite (ref.: KMC), where work activities included material movement, fencing installation, concrete works, services installation, road sweeping and fuel pipe installation.
- Noise monitoring was undertaken at the Birmingham & Fazeley Canal Viaduct worksite (ref.: BFCV), where work activities included topsoil stripping and stockpiling.
- Noise and vibration monitoring were undertaken at the Marston Box/Marston Lane worksite (ref.: MB), where work activities included installation of plates, pre-fabrication and installation of box structure base, sheet piling, drainage works, concrete works, excavation works and road sweeping.
- Noise monitoring was undertaken at the Faraday Avenue Embankment and Underbridge worksite (ref.: FAEU), where work activities included stockpiling, material deliveries and road sweeping.
- Noise monitoring was not undertaken at the Water Orton South Compound worksite (ref.: WOSC), where work activities included concrete works, excavations, earthworks and material deliveries.
- Noise monitoring was undertaken at the Attleboro Lane Overbridge worksite (ref.: ALO), where work activities included compound and drainage construction, stockpiling management, vegetation clearance, permanent embankment works and excavation works .
- Noise monitoring was undertaken at the Gilson Drive worksite (ref.: GLD), where work activities included haul road construction, embankment construction, hardstanding works, topsoil stripping, vegetation clearance, stockpiling and excavation works.
- Noise monitoring was undertaken at the Birmingham Road worksite (ref.: BRD), where work activities included compound construction works and haul road construction.
- Noise monitoring was undertaken at the Coleshill Heath Road worksite (ref.: CHR), where work activities included structure stabilisation works.

- Noise monitoring was undertaken at the Packington Embankment worksite (ref.: PE), where work activities included embankment works .
- Noise monitoring was undertaken at the Bickenhill Cutting worksite (ref.: BIC), where work activities included site clean-up and piling works.
- Noise monitoring was undertaken at Diddington Lane Cutting (ref.: DLC), where work activities included topsoil stripping.

Further works, where noise and vibration monitoring did not take place, were also undertaken at Gilson Road as part of sewer diversion works.

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<u>https://www.gov.uk/government/publications/hs2-information-papers-environment</u>) were not exceeded due to HS2 works in the Local Authority Area during August 2022.

There was no exceedances of trigger levels, as defined in Section 61 consents during the reporting period.

One (1) complaint was received within the North Warwickshire area during the monitoring period. A description of complaints, the results of investigations and any actions taken are detailed in Table 7 of this report.

Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
L _{Aeq,T}	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A- weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or L _{Aeq,T}	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in m/s ^{1.75} .

1 Introduction

- 1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:
 - monitoring the impact of construction works;
 - to investigate complaints, incidents and exceedance of trigger levels; or
 - monitoring the effectiveness of noise and vibration control measures.
- 1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the North Warwickshire Borough Council (NWBC) area for the period 1st to 31st August 2022.
- 1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:
 - Kingsbury Main Compound worksite, ref.: KMC (see Plan 1 in Appendix A), where work activities included:
 - Material movement.
 - Fencing installation.
 - Concrete works.
 - Services installation.
 - Road sweeping.
 - Fuel pipe installation.
 - Birmingham & Fazeley Canal Viaduct worksite, ref.: BFCV (see Plan 1 in Appendix A), where works included:

- Topsoil stripping.
- Stockpiling.
- Marston Box/Marston Lane worksite, ref.: MB (see Plan 1 in Appendix A), where work activities included:
 - Installation of plates.
 - Pre-fabrication and installation of box structure base.
 - Sheet piling.
 - Excavation works.
 - Concrete works.
 - Road sweeping.
- Faraday Avenue Embankment and Underbridge worksite, ref.: FAEU (see Plan 2 in Appendix A), work activities included:
 - Stockpiling.
 - Material deliveries.
 - Road sweeping.
- Water Orton South Compound worksite, ref.: WOSC (see Plan 3 in Appendix A), work activities included:
 - Concrete works.
 - Excavations.
 - Earthworks.
 - Material deliveries.
- Attleboro Lane Overbridge worksite, ref.: ALO (see Plan 3 in Appendix A), work activities included:
 - Compound and drainage construction.
 - Stockpiling materials and management.

- Vegetation clearance.
- Permanent embankment works, including excavations and backfilling.
- Excavation works.
- Gilson Drive worksite, ref.: GLD (see Plan 3 in Appendix A), works activities included:
 - Haul road construction.
 - Embankment construction.
 - Hardstanding works.
 - Topsoil stripping.
 - Vegetation clearance, including stump removal.
 - Stockpiling.
 - Excavation works.
- Birmingham Road worksite, ref.: BRD (see Plan 4 in Appendix A), work activities included:
 - Compound construction works.
 - Haul road construction.
- Coleshill Heath Road worksite, ref.: CHR (see Plan 5 in Appendix A), works activities included:
 - Structure stabilisation works, including material filling and installation of rigid inclusions.
- Packington Embankment worksite, ref.: PE (see Plan 6 in Appendix A), works activities included:
 - Embankment works, including sealing, weatherproofing and laying works.
- Bickenhill Cutting worksite, ref.: BIC (see Plan 6 in Appendix A), works activities included:
 - Site clean-up.

- Piling works.
- Diddington Lane Cutting worksite: ref.: DLC (see Plan 7 in Appendix A), works activities included:
 - Topsoil stripping, including bund construction and compacting of topsoil bund.
- 1.1.4 Further works, where noise and vibration monitoring did not take place, were also undertaken at Gilson Road as part of sewer diversion works.
- 1.1.5 The applicable standards, guidance, and monitoring methodology is outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <u>https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2</u>. Noise and vibration monitoring reports for previous months can also be found at this location.

1.2 Measurement Locations

- 1.2.1 Thirteen (13) noise monitoring installations and seven (7) vibration monitoring installations were active in August in the NWBC area. Table 2 summarises the position of noise and vibration monitoring installations within the NWBC area in August 2022.
- 1.2.2 Vibration monitor, ref.: WOSC-V1, was installed at Water Orton South Compound worksite (ref.: WOSC) on the 4th of August 2022.
- 1.2.3 Noise monitor, ref.: DLC-N4, was installed at Diddington Lane Cutting (DLC) worksite (ref.: DLC) on the 19th of August 2022.
- 1.2.4 Maps showing the position of noise and vibration monitoring installations are presented in Appendix B.

Worksite Reference	Measurement Reference	Address			
Kingsbury Main	KMC-N1	Kingsbury Road, Curdworth CP, Marston, Warwick, West Midlands			
Compound (KMC)	KMC-N2	Kingsbury Road, Curdworth CP, Marston, Warwick, West Midlands			
Birmingham Fazeley	BFCV-N1	Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire			
Canal Viaduct (BFCV)	BFCV-V1	Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire			
Marston Box (MB)	MB-N1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midlands			
	MB-V1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midlands			
Faraday Avenue	FAEU-N1	Orchard Cottage, Newlands Lane, Curdworth, Warwickshire			
Embankment and Underbridge (FAEU)	FAEU-V1	Orchard Cottage, Newlands Lane, Curdworth, Warwickshire			
Water Orton South	WOSC-N1	53 Watton Lane, Water Orton CP, Warwickshire			
Compound (WOSC)	WOSC-V1	53 Watton Lane, Water Orton CP, Warwickshire			
Attleboro Lane	ALO-N1	47 Attleboro Lane, Water Orton, Birmingham			
Overbridge (ALO)	ALO-V1	47 Attleboro Lane, Water Orton, Birmingham			
Gilson Drive (GLD)	GLD-N1	Gilson Dr, Coleshill, Birmingham			
	GLD-V1	Gilson Dr, Coleshill, Birmingham			
Birmingham Road	BRD-N2	New Cottages, Birmingham Road, Coleshill, Birmingham			
(BRD)	BRD-V1	New Cottages, Birmingham Road, Coleshill, Birmingham			
Coleshill Heath Road (CHR)	CHR-N1	Coleshill Heath Road, Coleshill Heath, Solihull			
Pakington Embankment (PE)	PE-N1	Common Farm, Chester Road, Coleshill, Birmingham			

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
Bickenhill Cutting (BIC)	BIC-N1	Park Farm Barns, Chester Rd, Marston Green, Coventry
Diddington Lane Cutting (DLC)	DLC-N4	Hampton Hill Hounds, Nursery Cottage, Coventry Road, Bickenhill

2 Summary of Results

2.1 Summary of Measured Noise and Vibration Levels

2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The L_{Aeq,T} is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period L_{Aeq,T} that was found to occur within the month.

Table 3: Summary of Measured dB LAeq Data over the Monitoring Period

Worksite Reference	Site Address		Free-Field or Site Address Façade Measurement			Weekday Average L _{Aeq,T} (Highest Day L _{Aeq,T})			Saturday Average L _{Aeq,T} (Highest Day L _{Aeq,T})				Sunday / Public Holiday Average L _{Aeq,T} (Highest Day L _{Aeq,T})		
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
КМС	KMC-N1	Kingsbury Road, Curdworth CP, Marston	Free-field	57.6	58.7 (71.0)	54.2 (58.6)	52.9 (58.0)	52.6 (59.8)	54.5 (56.0)	54.5 (56.2)	52.2 (55.6)	52.2 (56.8)	51.0 (54.9)	51.3 (55.3)	51.9 (57.7)
	KMC-N2	Kingsbury Road, Curdworth CP, Marston	Free-field	(60.6) 55.2 (58.4)	(71.0) 56.6 (68.9)	(58.6) 53.9 (56.6)	(58.0) 53.1 (56.8)	(59.8) 52.5 (58.6)	(56.0) 54.6 (56.1)	(56.2) 53.6 (56.4)	(55.6) 52.8 (56.2)	(56.8) 53.1 (56.9)	(54.9) 52.4 (55.5)	(55.3) 53.2 (61.3)	(57.7) 52.7 (56.0)
BFCV	BFCV-N1*	Lock Cottage, Marston Lane, Curdworth CP	Free-field	-	-	-	-	-	-	-	-	-	-	-	-
MB	MB-N1	Kingsbury Road, Curdworth, Sutton Coldfield	Free-field	56.3 (59.3)	56.3 (69.4)	57.6 (64.9)	57.1 (66.2)	52.9 (60.1)	55.1 (57.0)	54.6 (56.4)	53.2 (55.3)	54.9 (59.7)	50.8 (55.9)	54.3 (62.1)	51.7 (59.8)
FAEU	FAEU-N1	Orchard Cottage, Newlands Lane, Curdworth	Free-field	56.4 (60.5)	58.0 (63.6)	55.2 (60.5)	53.9 (59.8)	53.2 (61.4)	55.4 (57.0)	53.5 (60.2)	52.9 (59.7)	52.6 (61.9)	50.3 (58.3)	50.7 (58.2)	51.5 (60.1)
WOSC	WOSC-N1	53 Watton Lane, Water Orton CP	Free-field	64.4 (67.6)	65.3 (72.8)	64.1 (67.4)	62.4 (66.5)	59.9 (67.5)	61.4 (62.2)	63.3 (63.9)	63.0 (63.8)	62.2 (64.2)	57.0 (60.3)	61.7 (63.6)	58.7 (64.5)
ALO	ALO-N1	47 Attleboro Lane, Water Orton	Free-field	46.5 (59.8)	50.6 (68.4)	45.9 (58.6)	45.5 (58.4)	44.3 (60.1)	52.8 (52.8)	53.1 (53.1)	48.2 (48.2)	50.1 (51.4)	47.9 (50.8)	49.7 (53.4)	46.8 (52.5)

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement		Weekda (High	y Avera est Day		T			y Avera est Day	i ge L_{Aeq,T} L _{Aeq,T})		Pul Holi Averag (Highe	day / blic iday ge L _{Aeq,T} est Day _{eq,T})
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
GLD	GLD-N1	10 Gilson Dr, Coleshill, Birmingham	Free-field	57.0 (60.9)	57.9 (64.7)	56.8 (69.4)	55.3 (59.6)	53.9 (60.7)	57.1 (64.9)	55.7 (58.6)	54.4 (56.6)	57.4 (75.4)	52.6 (57.7)	54.7 (68.5)	54.7 (60.6)
BRD	BRD-N2	1, New Cottages, Birmingham Road, Coleshill	Free field	61.4 (64.5)	61.5 (80.0)	61.0 (63.4)	60.1 (62.5)	57.9 (63.7)	58.4 (59.1)	60.0 (60.2)	58.8 (59.4)	59.2 (60.7)	56.0 (58.8)	58.8 (61.0)	57.3 (63.2)
CHR	CHR-N1	Coleshill Heath Road, Coleshill Heath, Solihull	Free-field	62.9 (65.7)	64.4 (66.3)	62.1 (64.2)	59.7 (63.0)	57.7 (65.1)	59.4 (60.1)	60.0 (60.5)	60.4 (60.8)	60.9 (69.6)	56.5 (59.3)	60.1 (64.8)	57.7 (63.7)
PE	PE-N1	Common Farm, Chester Road, Coleshill	Free-field	55.6 (59.3)	57.4 (62.6)	54.9 (63.1)	54.7 (61.4)	53.2 (58.6)	53.6 (57.3)	56.0 (61.1)	53.2 (56.4)	53.7 (59.6)	52.9 (56.8)	52.0 (57.9)	52.1 (59.3)
BIC	BIC-N1	Park Farm Barns, Chester Rd, Marston Green	Free-field	55.4 (63.4)	53.7 (56.3)	52.0 (55.3)	51.6 (56.5)	51.2 (69.1)	53.2 (56.8)	54.2 (58.3)	50.5 (54.4)	50.5 (55.1)	50.1 (58.1)	51.1 (60.5)	50.9 (60.0)
DLC	DLC-N4	Hampton Hill Hounds, Nursery Cottage, Coventry Road	Free-field	53.7 (57.8)	55.4 (59.6)	54.2 (62.6)	50.8 (56.0)	50.0 (57.7)	51.0 (53.2)	56.8 (61.3)	49.2 (50.8)	51.4 (55.3)	48.8 (56.0)	49.8 (52.6)	49.8 (56.9)

*Note: Noise levels measured at monitor location BFCV-N1 across the month have been excluded due to interference with the residents and therefore they are not representative of the noise levels at the receptor. The monitor will be relocated once a new representative location will be agreed.

2.1.2 Table 4 presents a summary of the measured vibration levels at the monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
WOSC - Water Orton South Compound	WOSC-V1	53 Watton Lane, Water Orton CP, Warwickshire	1.42 (Y-axis)
BFCV - Birmingham Fazeley Canal	BFCV-V1*	Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire, B76 0DG	-
MB - Marston Box	MB-V1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midland, B76 0DF	2.79 (X-axis)
ALO - Attleboro Lane Overbridge	ALO-V1	47 Attleboro Lane, Water Orton, Birmingham, B46 1SB	5.64 (X-axis)
BRD - Birmingham Road	BRD-V1	1, New Cottages, Birmingham Road, Coleshill, Birmingham B46 1DP	0.60 (X-axis)
FAEU - Orchard Cottage	FAEU-V1	Orchard Cottage, Newlands Lane, Curdworth, Warwickshire, B76 0BE	2.85 (Z-axis)
GLD – Gilson Drive	GLD-V1	10 Gilson Dr, Coleshill, Birmingham B46 1DN	5.08 (X-axis)

Table 4: Summary of Measured PPV Data over the Monitoring Period

*Note: Vibration levels measured at monitor location BFCV-V1 across the month have been excluded due to interference with the residents and therefore they are not representative of the HS2 vibration levels at the receptor. The monitor will be relocated once a new representative location will be agreed.

2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly L_{Aeq} values and, where relevant, the L_{Aeq,T} values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location: https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data.

2.2 Exceedances of the LOAEL and SOAEL

2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".

- 2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."
- 2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.
- 2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
КМС	KMC-N1*	Wheatley House, Kingsbury Road, Sutton Coldfield	All days	All periods	No exceedances	No exceedances
	KMC-N2	Wheatley House, Kingsbury Road, Sutton Coldfield	Weekdays	0800-1800	1	No exceedances
MB	MB-N1*	Kingsbury Road, Curdworth	Weekdays	0800-1800	1	No exceedances
FAEU	FAEU-N1	Orchard Cottage, Newlands Lane, Curdworth	All days	All periods	No exceedances	No exceedances

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
WOSC	WOSC-N1	53 Watton Lane, Water Orton CP, Warwickshire	Weekdays	0800-1800	1	No exceedances
ALO	ALO-N1*	47 Attleboro Lane, Water Orton, Birmingham	Weekdays	0800-1800	2	No exceedances
BRD	BRD-N2	New Cottages, Birmingham Road, Coleshill, Birmingham B46 1DP	Weekdays	0800-1800	1	No exceedances
PE	PE-N1	Common Farm, Chester Road, Coleshill	All days	All periods	No exceedances	No exceedances
BIC	BIC-N1	Park Farm Barns, Chester Rd, Marston Green	All days	All periods	No exceedances	No exceedances
DLC	DLC-N4	Hampton Hill Hounds, Nursery Cottage, Coventry Road	All days	All periods	No exceedances	No exceedances
CHR	CHR-N1	Coleshill Heath Road, Coleshill Heath, Solihull	All days	All periods	No exceedances	No exceedances
GLD	GLD-N1	Gilson Dr, Coleshill, Birmingham	Weekdays	0800-1800	1	No exceedances

* A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

Monitor BFCV-N1 has not been presented here as the relocation of the noise monitor is in progress.

2.2.6 Seven (7) exceedances of the LOAEL were recorded at KMC, MB, WOSC, ALO, BRD, and GLD worksites during core working hours. No exceedances of the SOAEL were recorded due to HS2 construction works during August 2022

2.3 Exceedances of Trigger Level

2.3.1 Table 6 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	ldentified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-

Table 6: Summary of Exceedances of Trigger Levels

2.4 Complaints


2.4.1 Table 7 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.

Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
HS2-22-43921-C	ALO	Complaint due to high levels of vibration felt inside the property.	Investigations shown that monitored vibration levels were below Section 61 and code of practice trigger levels.	The contractor will be monitoring the vibration levels and the community engagement team has been offered to stakeholder.

Table 7: Summary of Complaints


Appendix A Site Locations


HS2 Worksite Identification Plan - Overview

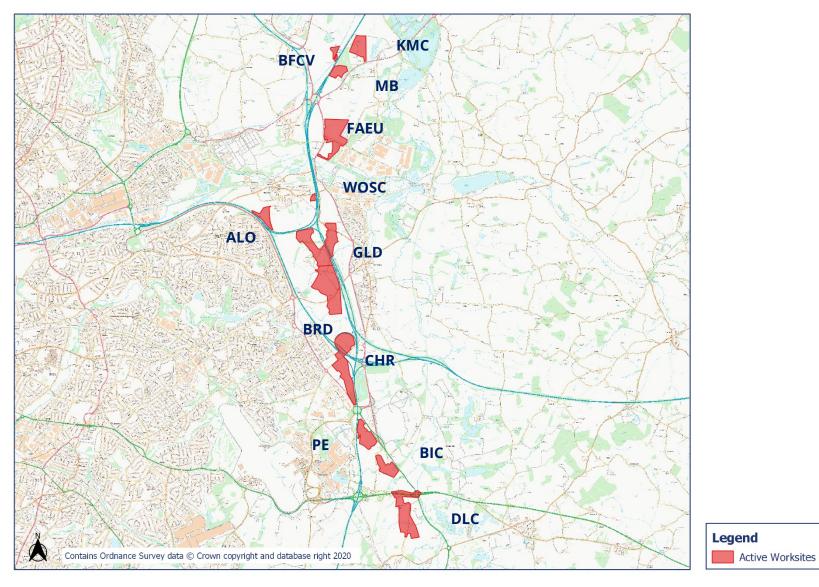






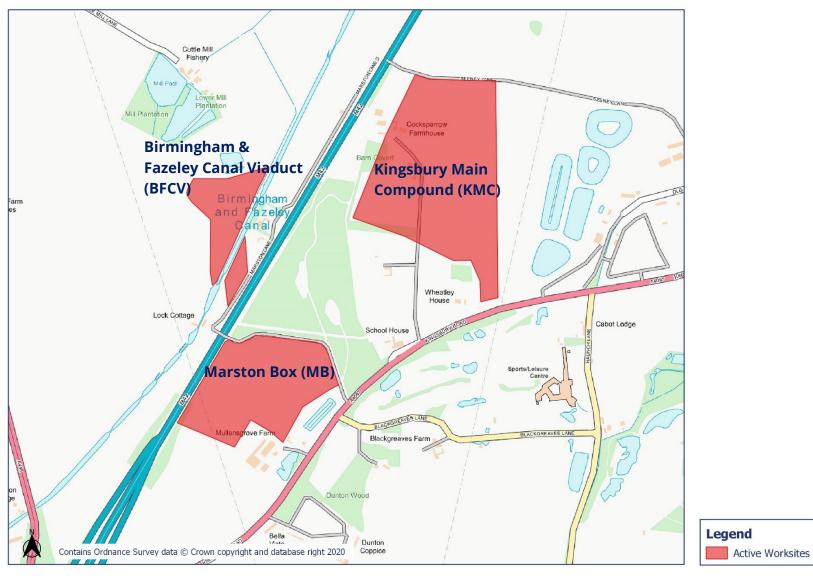

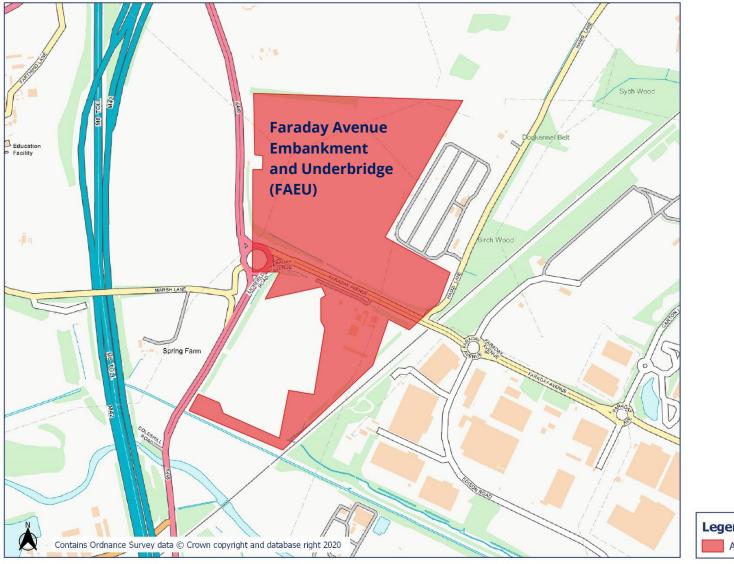




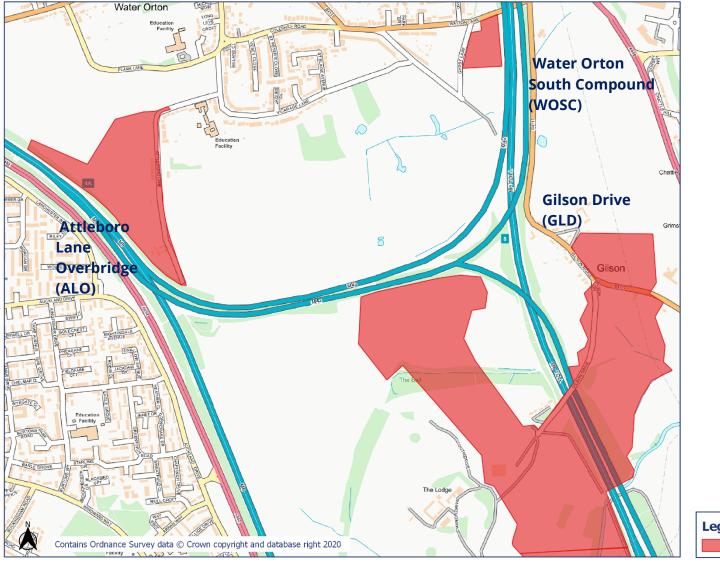







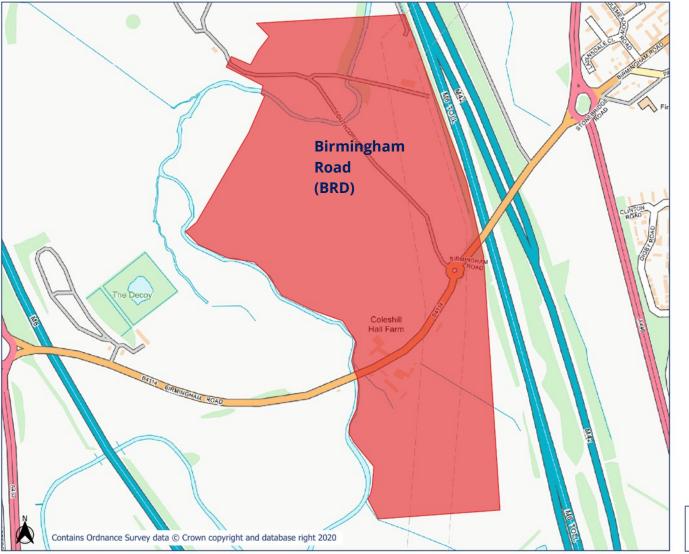


Legend Active Worksites

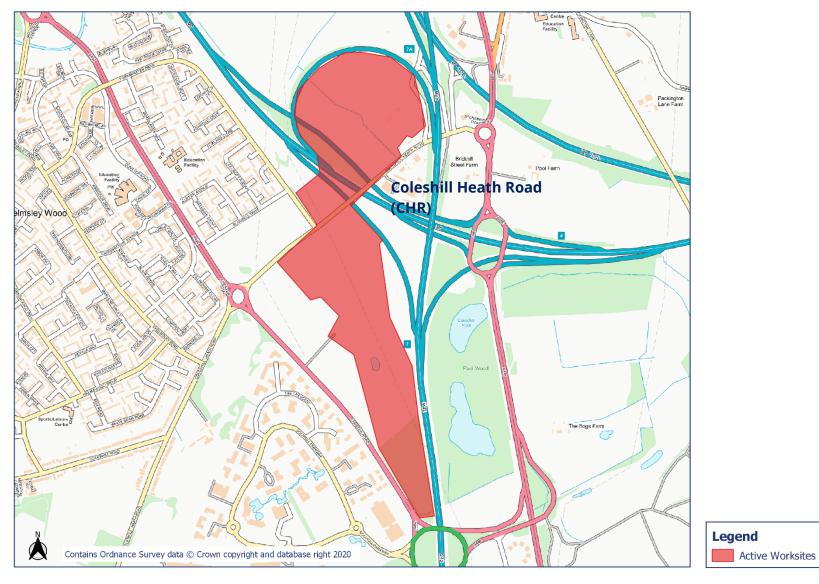




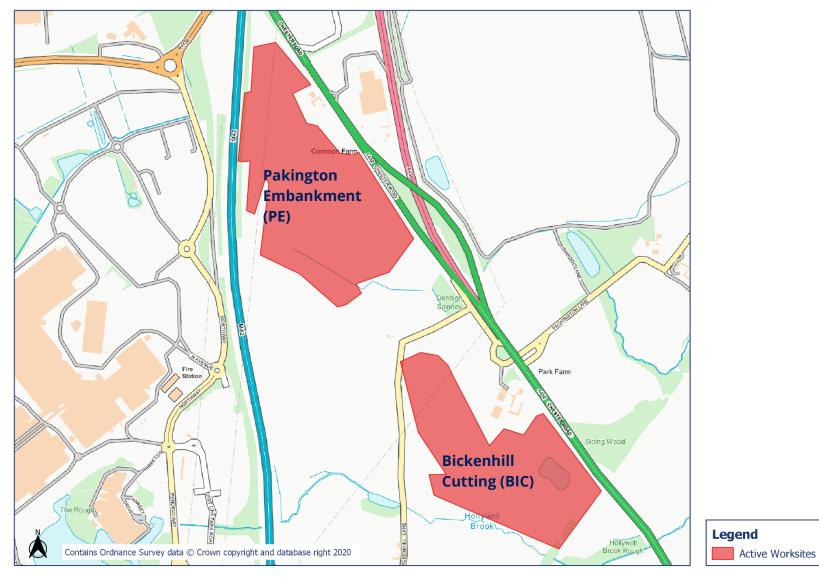


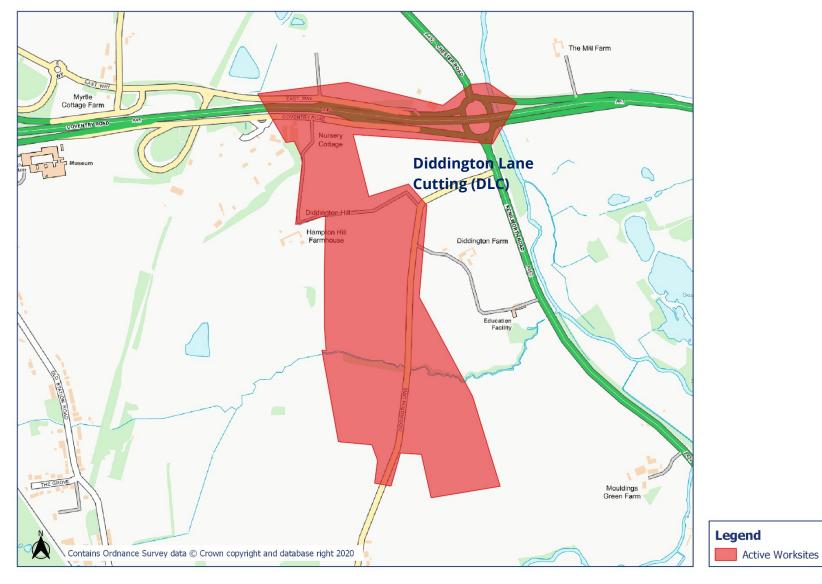





Appendix B Monitoring Locations

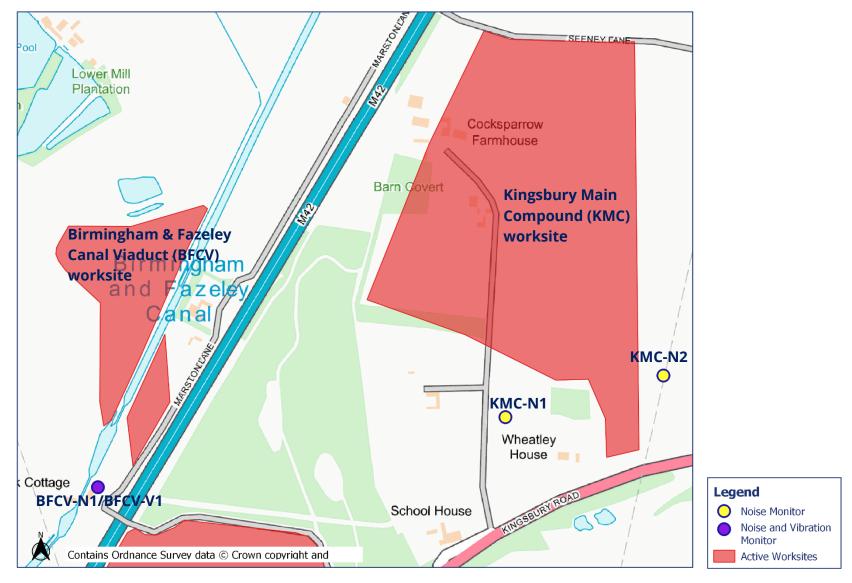


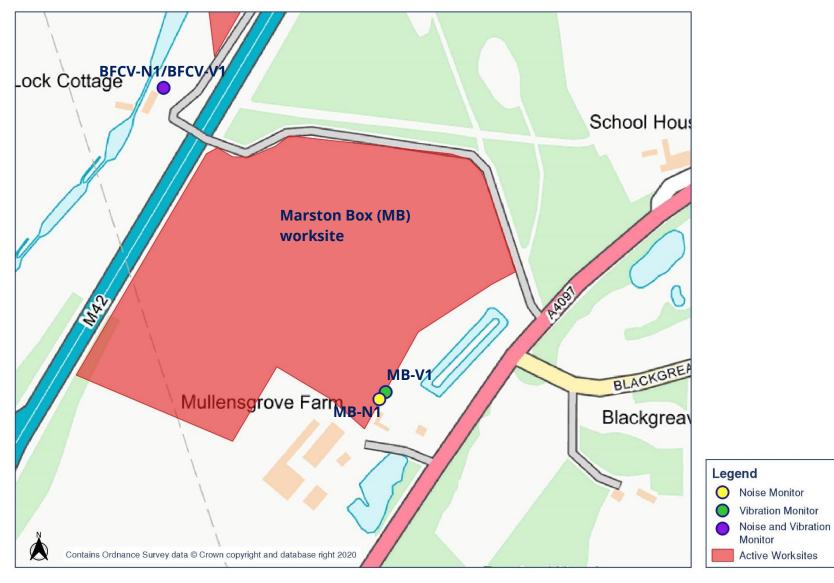

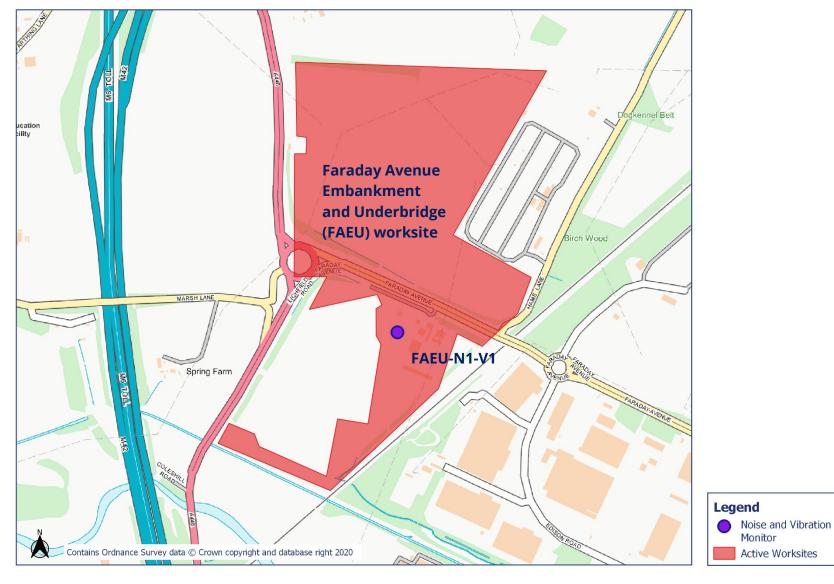


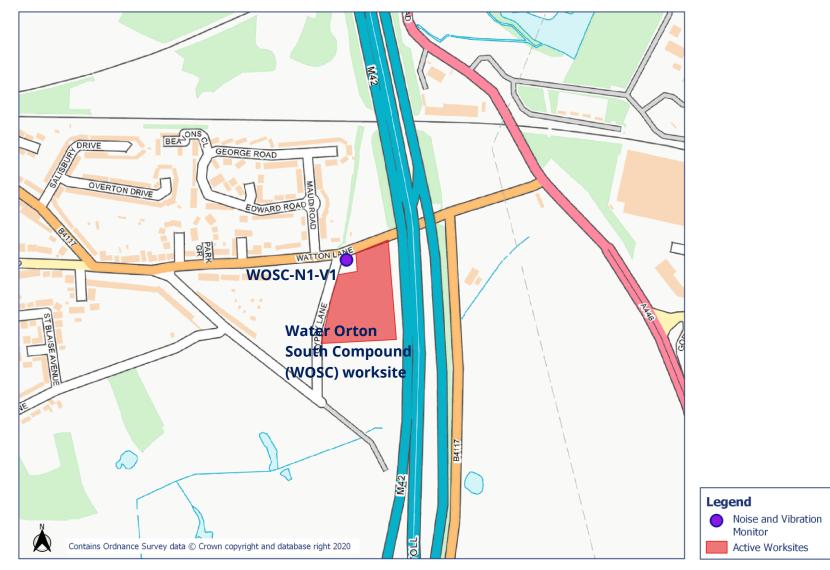



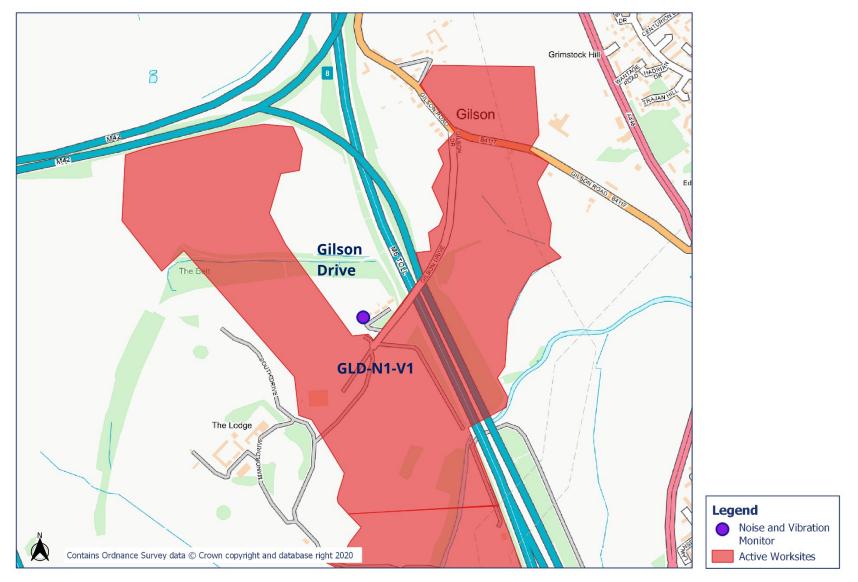




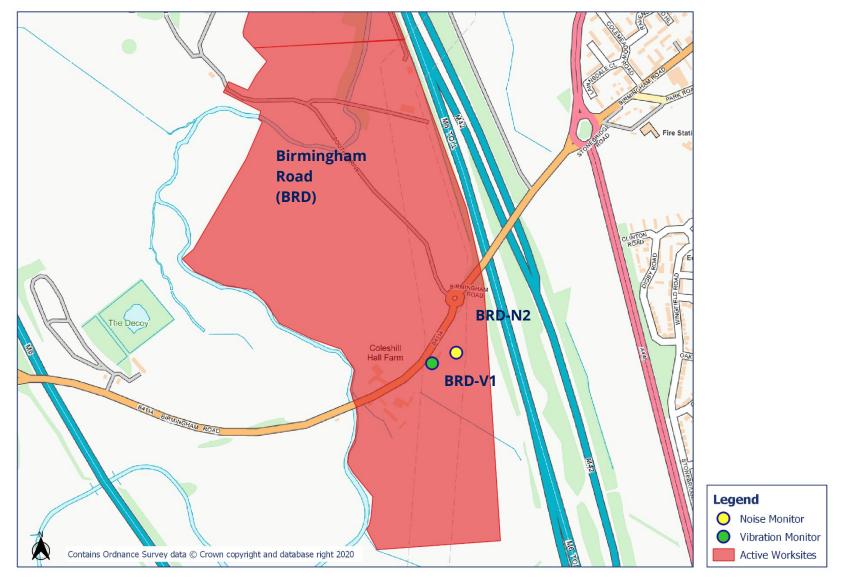




HS2 Noise and Vibration Monitoring Plan - 8

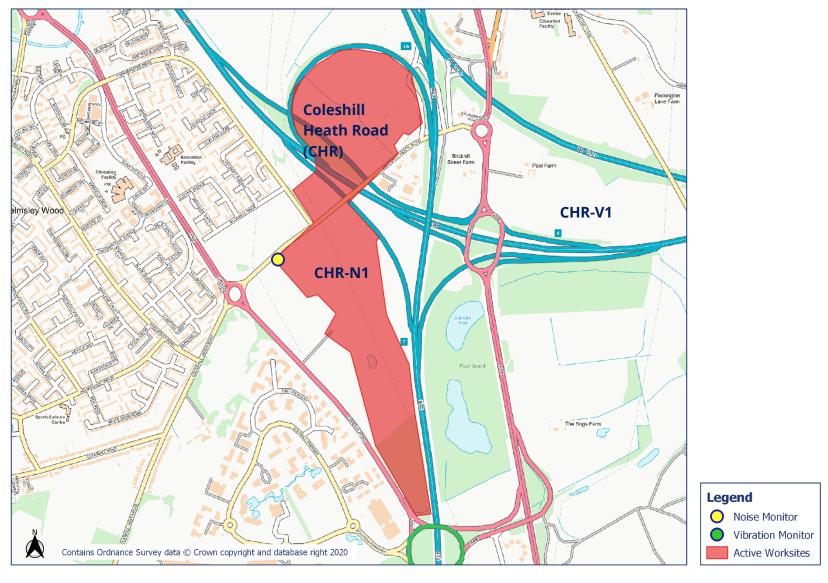




HS2 Noise and Vibration Monitoring Plan - 9

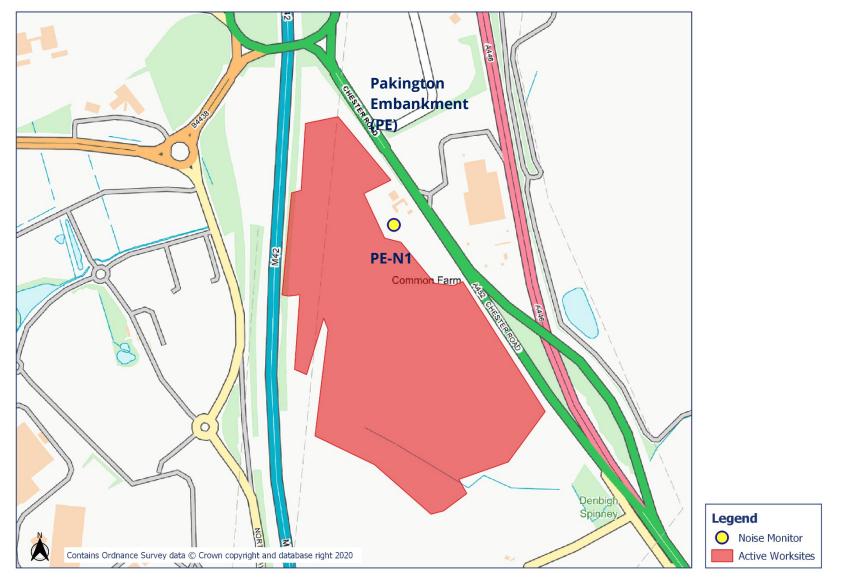



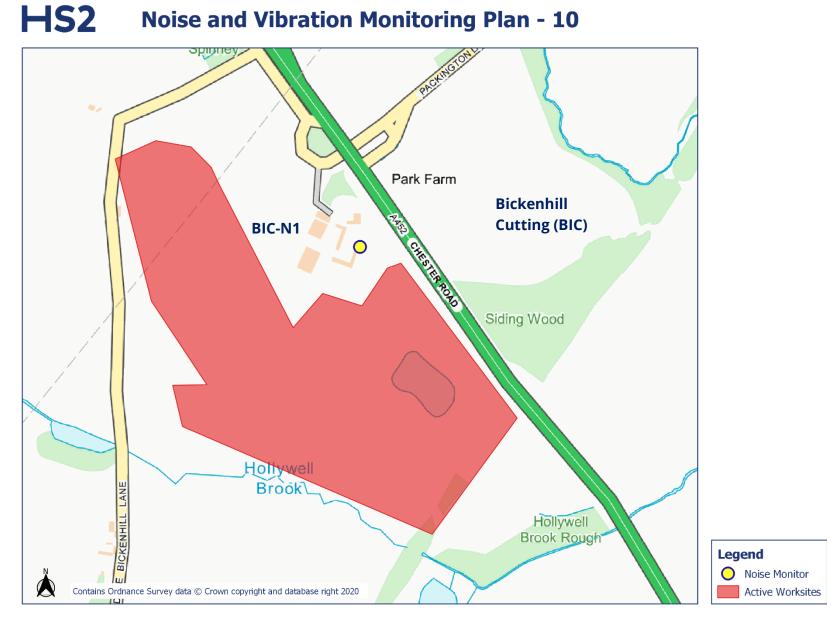



HS2 Noise and Vibration Monitoring Plan - 11







Appendix C Data


Noise


The following graphs show the hourly measured ambient noise level $L_{Aeq,1h}$ and, where relevant, the averaged noise level $L_{Aeq,T}$ values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the $L_{Aeq,T}$ values in Table 3 of the main report.:

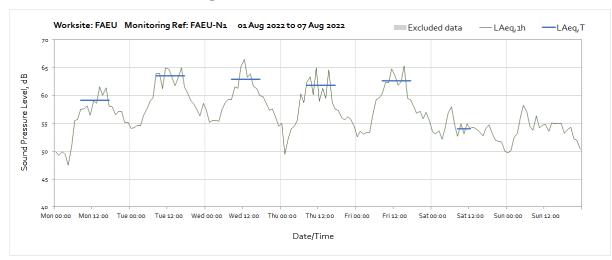



Worksite: FAEU - Monitoring Ref: FAEU-N1

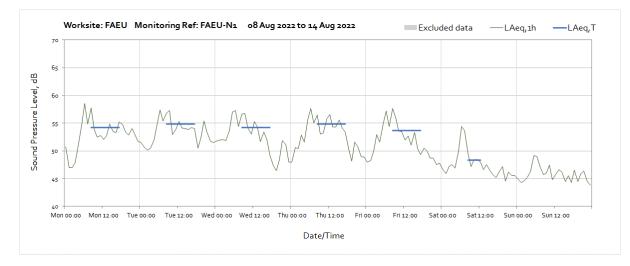

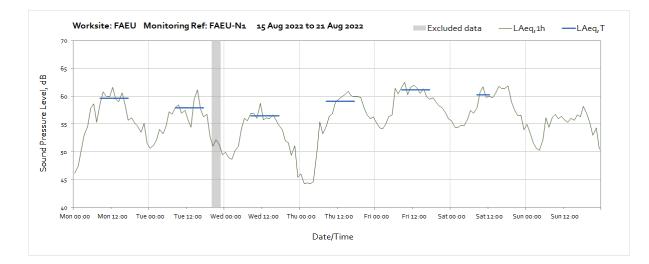

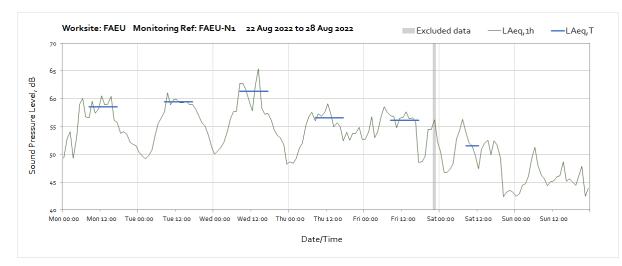

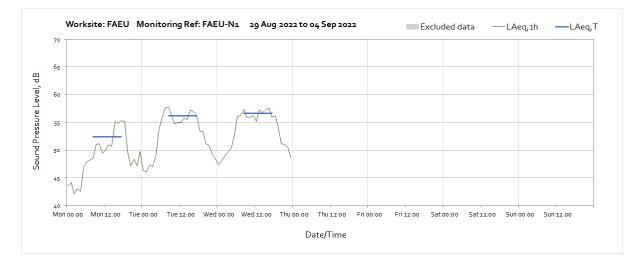

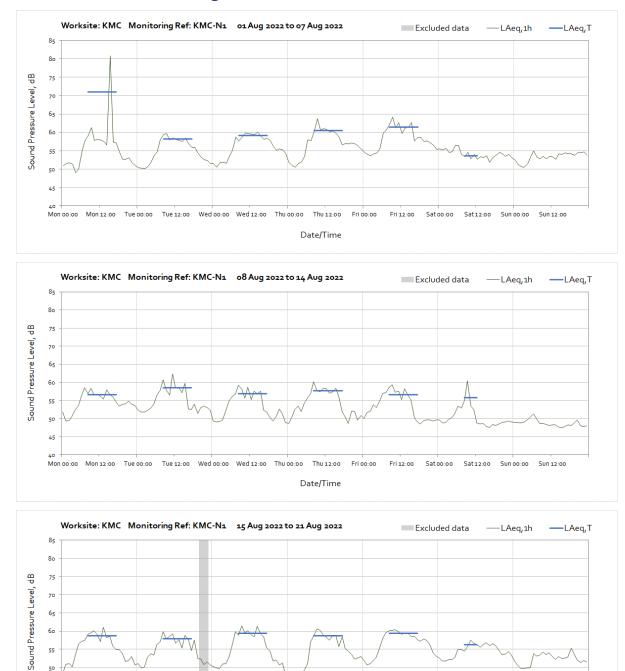

Worksite: KMC - Monitoring Ref: KMC-N1


OFFICIAL


55 50 45


Mon 00:00 Mon 12:00 Tue 00:00 Tue 12:00 Wed 00:00 Wed 12:00 Thu 00:00 Thu 12:00 Fri 00:00 Fri 12:00 Sato 0:00 Sat 12:00 Sun 12:00 Date/Time




Worksite: KMC - Monitoring Ref: KMC-N2

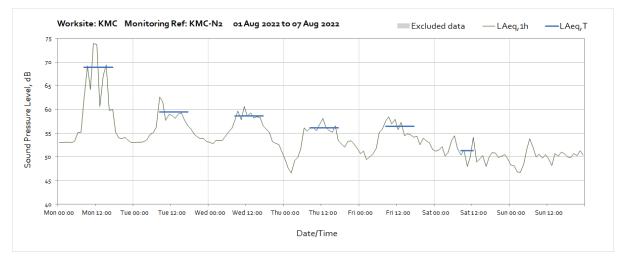


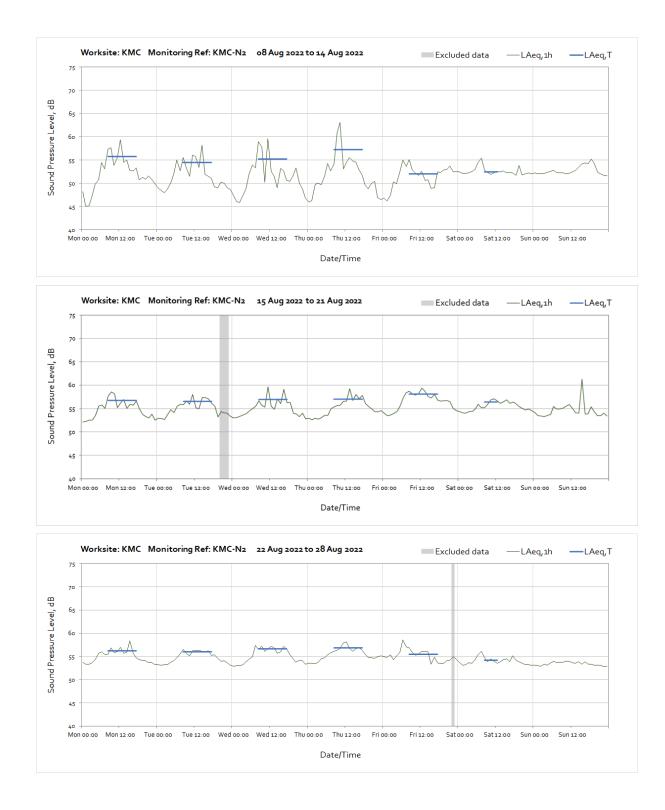


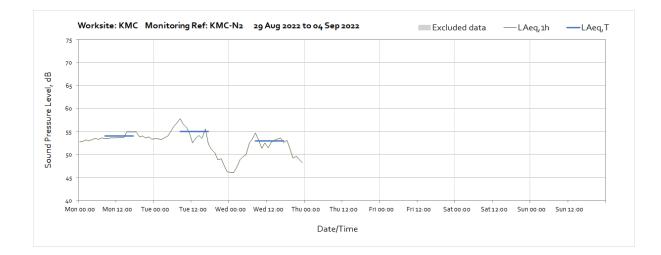



Worksite: MB - Monitoring Ref: MB-N1

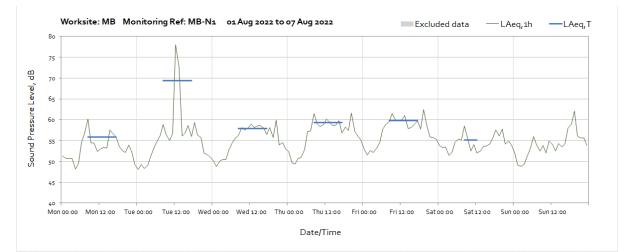


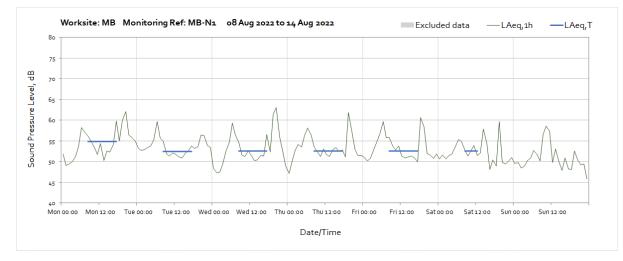

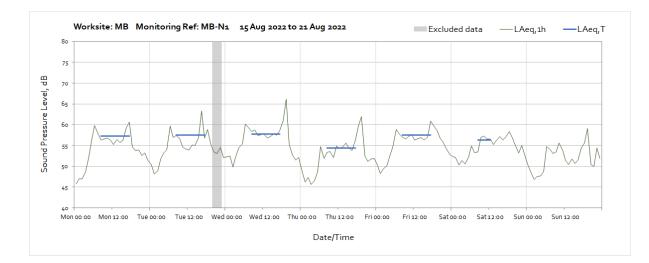

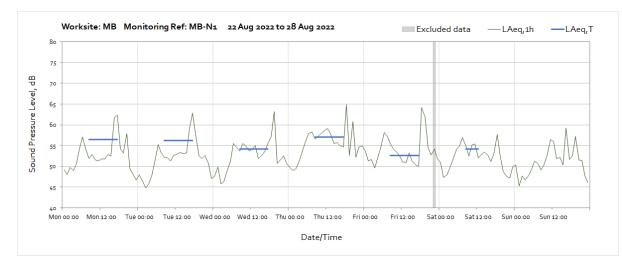

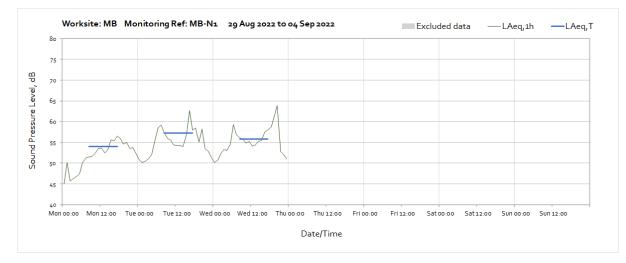


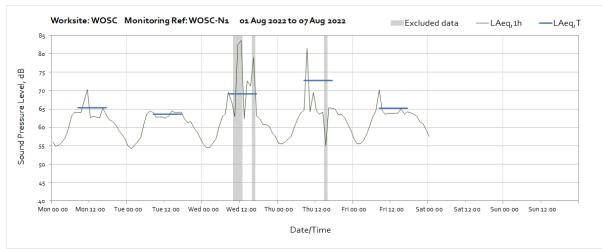



Worksite: WOSC - Monitoring Ref: WOSC-N1

Note: Missing data form 00:00 on 6th August until 15:00 on 9th August were due to loss of power to the monitor.






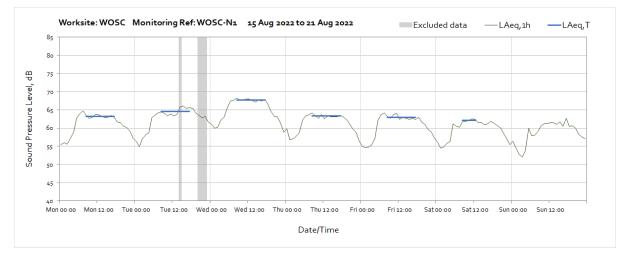


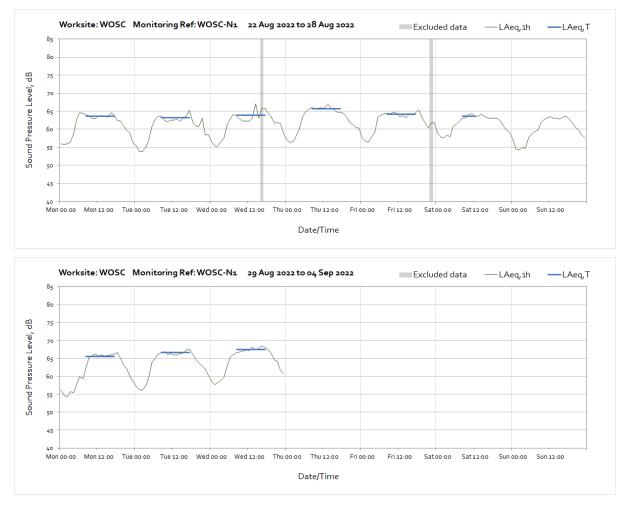

Worksite: ALO – Monitoring Ref: ALO-N1

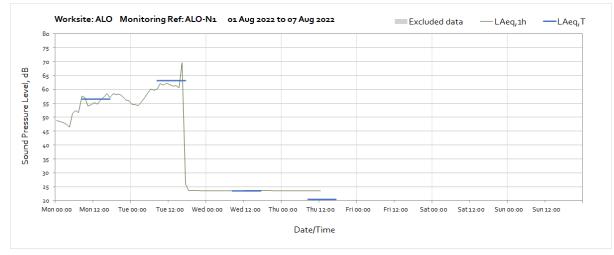


Note: Missing data from 12:00 on Thursday 4th August until 16:00 on Wednesday 24th August were due to a error with the monitor.

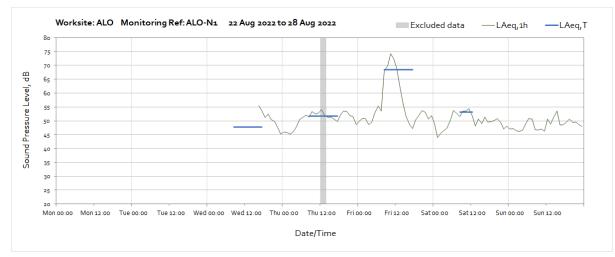


Note: Missing data from 12:00 on Thursday 4th August until 16:00 on Wednesday 24th August were due to a error with the monitor.





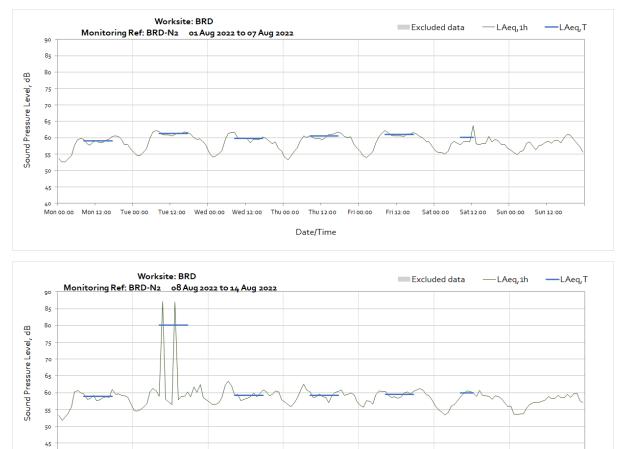



40 Mon oo.oo Mon 12:00 Tue 00:00 Tue 12:00 Wed 00:00 Wed 12:00 Thu 00:00 Thu 12:00 Fri 00:00 Fri 12:00 Sat 00:00 Sun 00:00 Sun 12:00 Date/Time

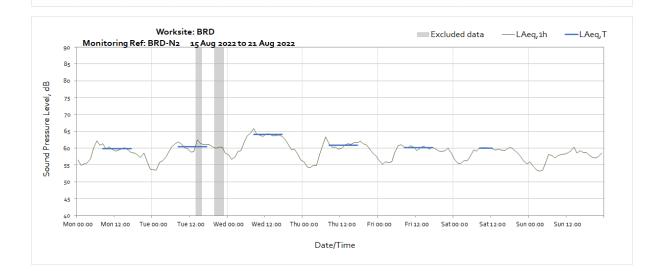






Worksite: PE - Monitoring Ref: PE-N1

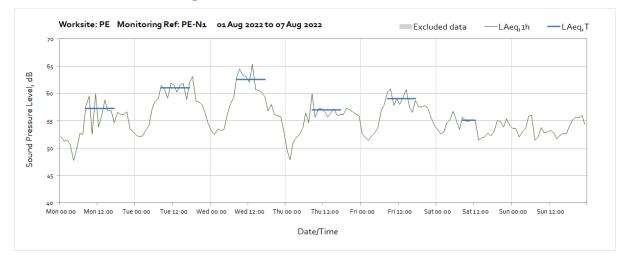

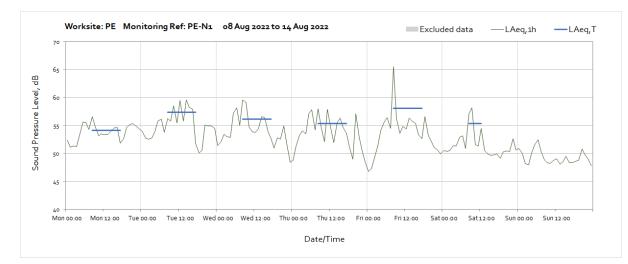


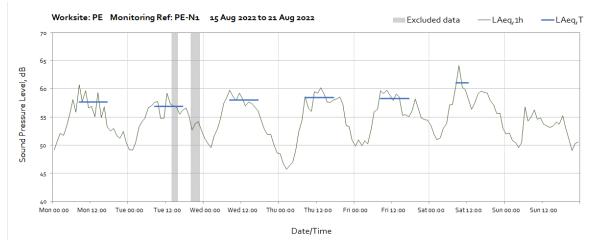


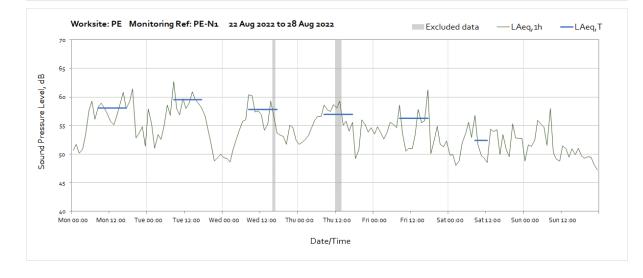

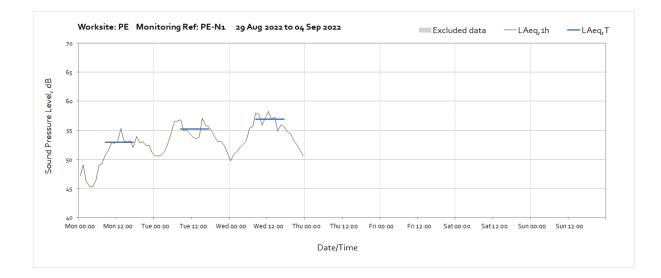


Worksite: BIC - Monitoring Ref: BIC-N1

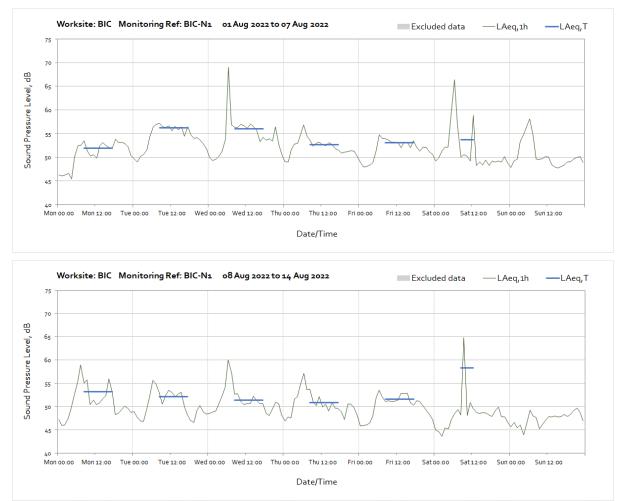


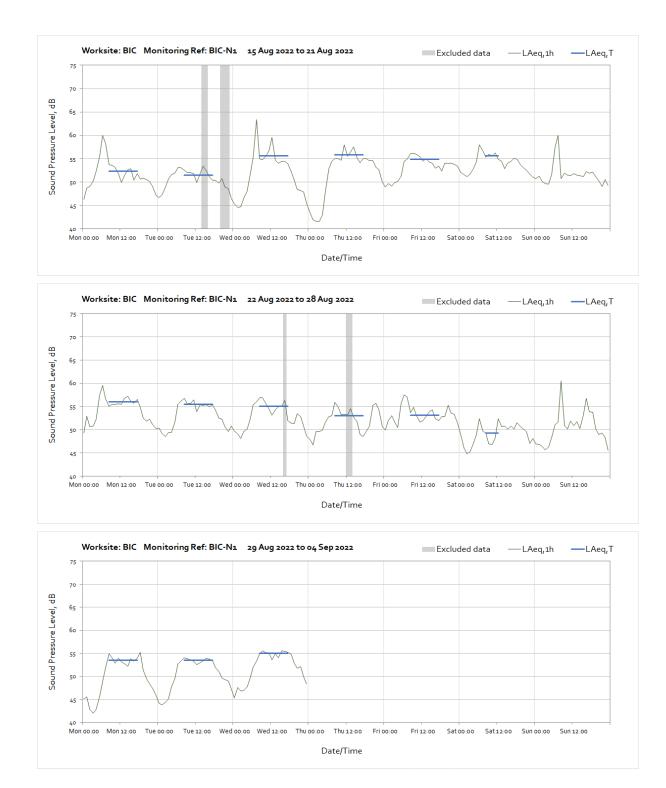



Worksite: DLC - Monitoring Ref: DLC-N4

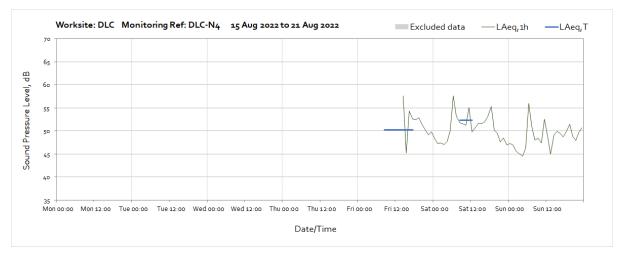


Note: Noise monitor installed at 14:00 on Friday 19th August 2022.

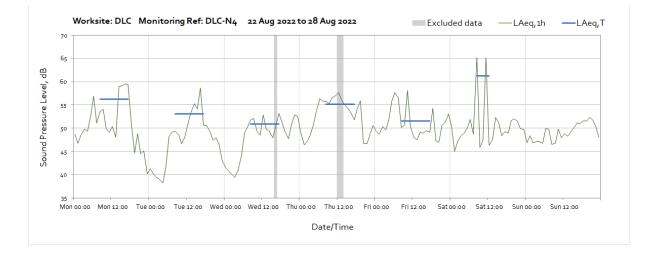

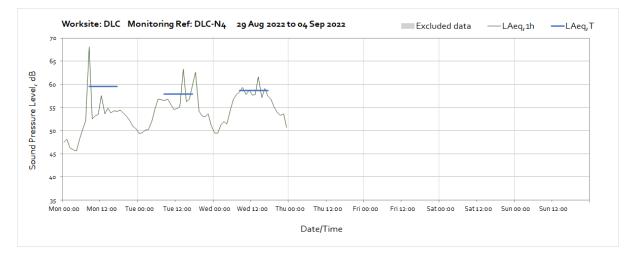

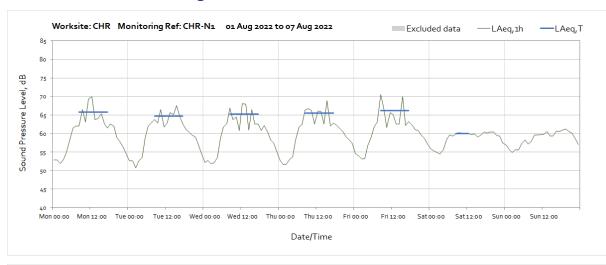


Worksite: CHR - Monitoring Ref: CHR-N1

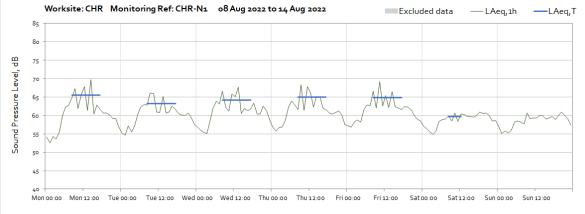



Date/Time




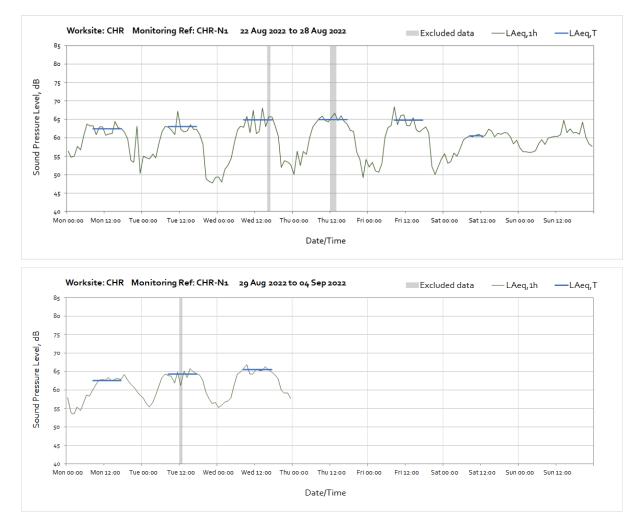


Worksite: GLD - Monitoring Ref: GLD-N1

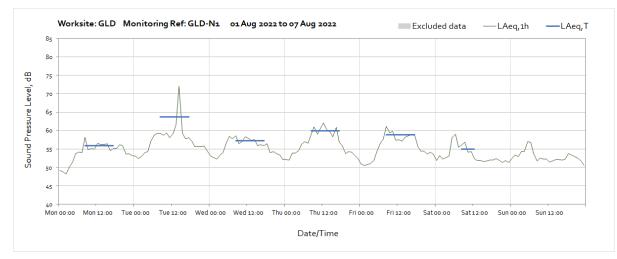

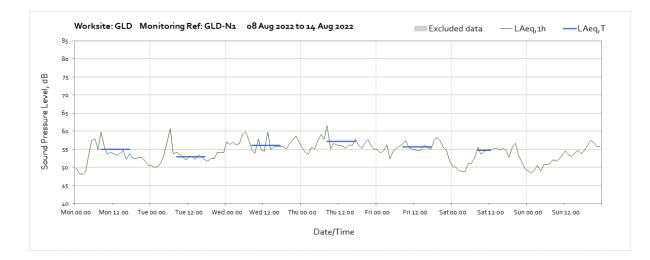

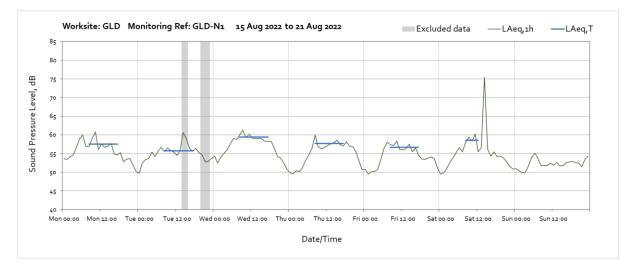


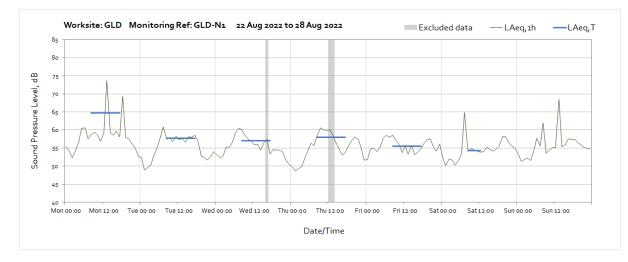




Vibration


The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.

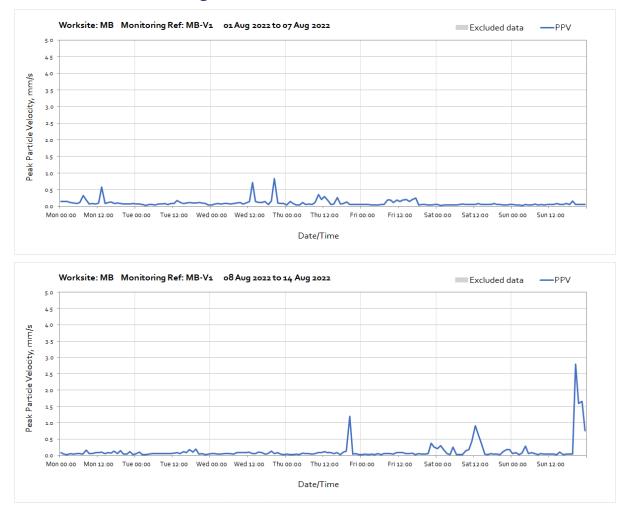


Worksite: MB – Monitoring Ref: MB-V1

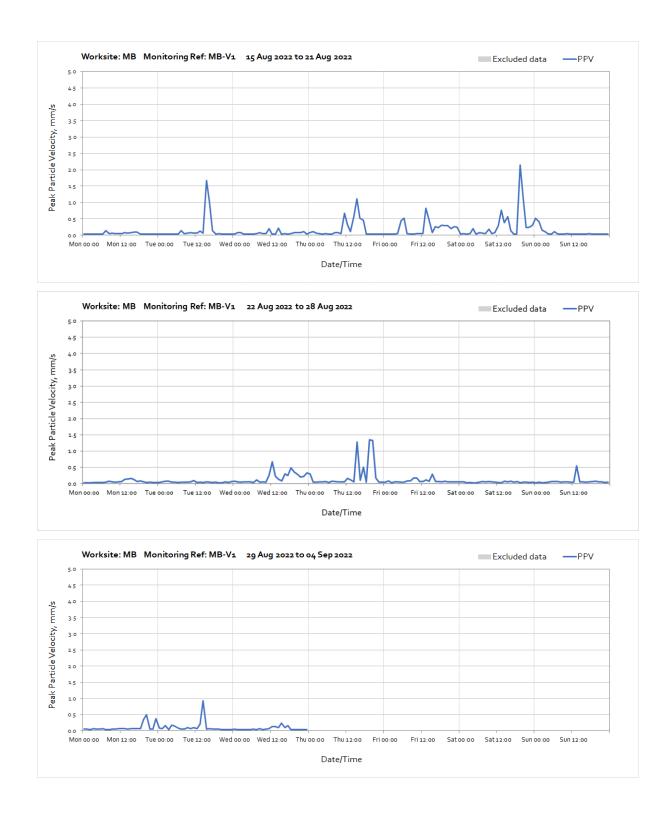


Worksite: ALO – Monitoring Ref: ALO-V1

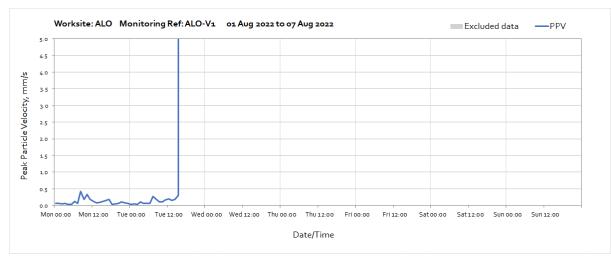


Note: Missing data from Tuesday 17.00 on 2nd August until Wednesday 16:00 on 24th August was due to damage to the equipment.

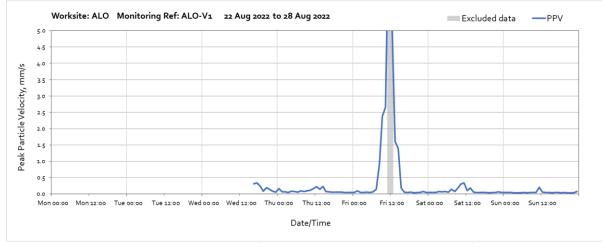


Note: Missing data from Tuesday 17.00 on 2nd August until Wednesday 16:00 on 24th August was due to damage to the equipment.

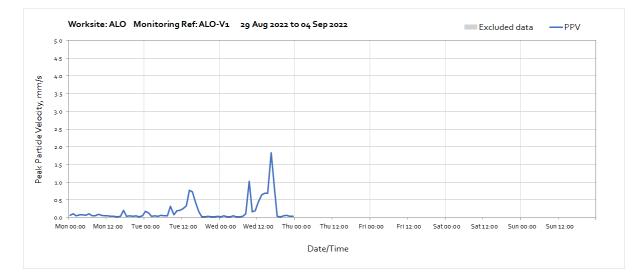



Worksite: BRD - Monitoring Ref: BRD-V1

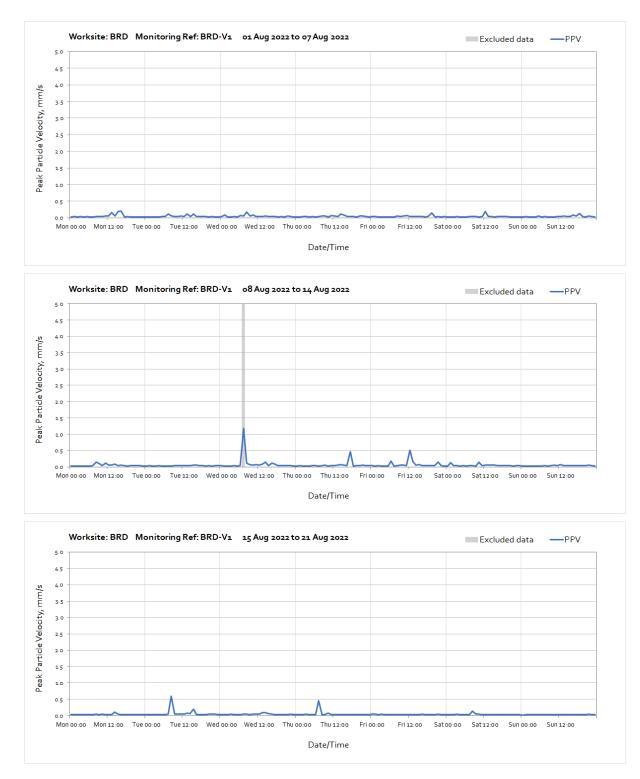


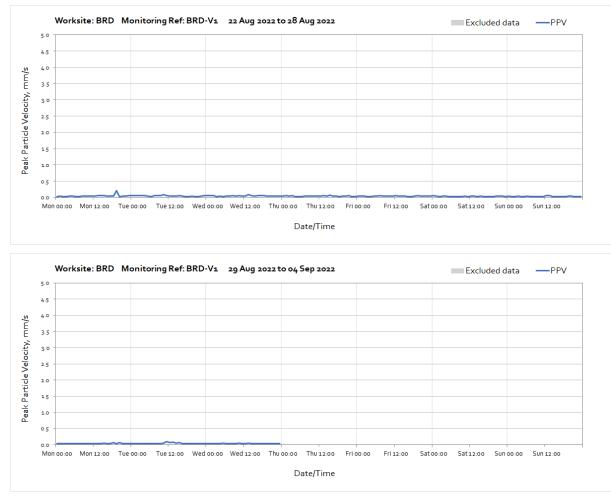


Worksite: FAEU – Monitoring Ref: FAEU-V1

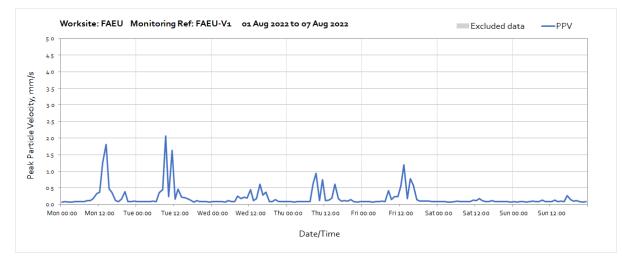

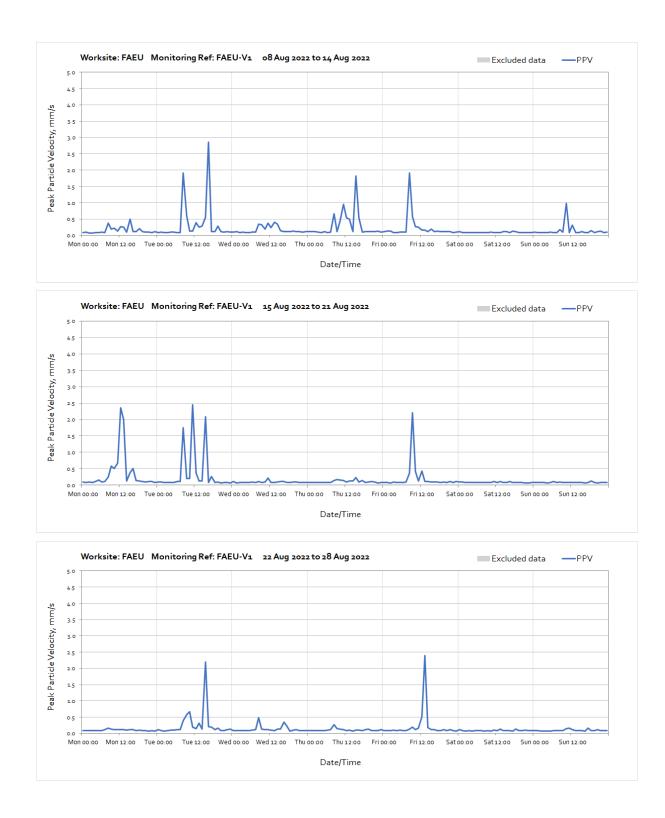


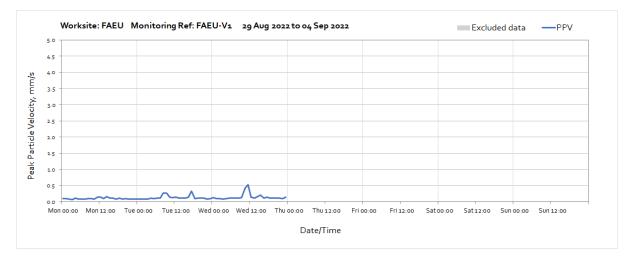


Worksite: GLD - Monitoring Ref: GLD-V1

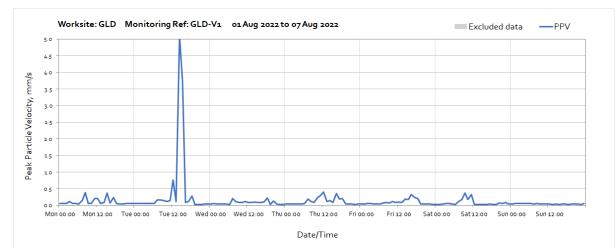


Note: High vibration levels from 14:00 to 15:00 on Tuesday 2nd August was due to road maintenance activity undertaken approximately 20m away.

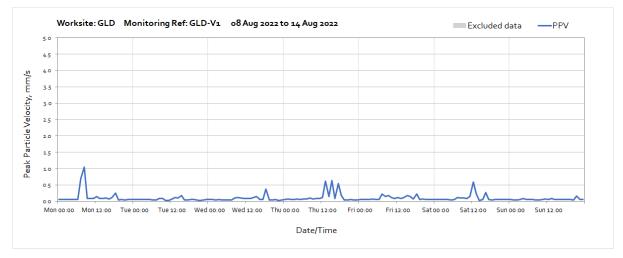

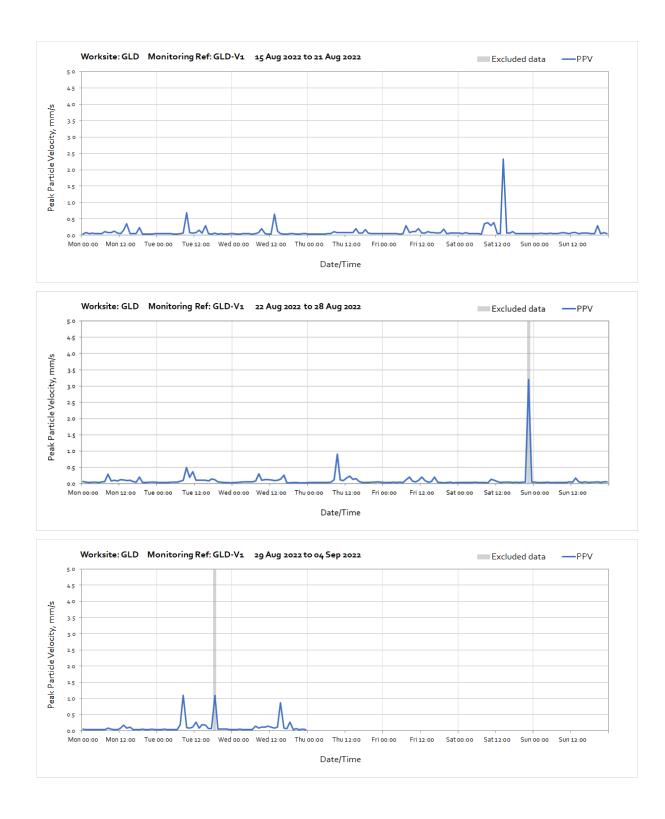

Worksite: WOSC – Monitoring Ref: WOSC-V1

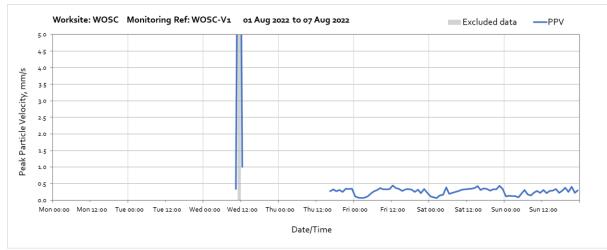

Note: Monitor installed at 16:00 on Thursday 4th August. High vibration levels at 11:00 on Wednesday 3rd August was due to monitor testing.

