



Ministry
of Defence

Defence Equipment and Support
Secretariat
#2043 Maple 0a
Ministry of Defence
Abbey Wood
Bristol BS34 8JH



Email: DES SEC-PolSec LE-JSC-WPNS@mod.uk

[REDACTED]

email: [REDACTED]

Our Reference:
FOI2022/10427
Date:
20 September 2022

Dear [REDACTED]

I am writing about your email of 6 September 2022, requesting the following information:

I am making this Freedom of Information Request to determine if you have any records related to my 1997 Land Rover Defender 90 Wolf, TRUCK UTILITY LIGHT (TULHS) 4X4 GS FFR HARD TOP LHD LANDROVER 2.5LTR TD (WITH EEGR), Chassis No. SALLDAA68VA126582, Registration No. KB83AA

I am treating your correspondence as a request for information under the Freedom of Information Act 2000 (FOIA).

A search for the information has now been completed within the Ministry of Defence (MOD), and I can confirm that information in scope of your request is held. This is attached, as follows:

- Annex A – Owner History
- Annex B – Fault History (redacted)
- Annex C – Inspection History
- Annex D – Modification History (redacted)
- Annex E – Servicing History

It has proved necessary to withhold some information in accordance with qualified exemptions of the FOI Act. Some of the commercially sensitive information in the Fault and Modification Histories (Annexes B and D) relates to contractor repair times, which have been withheld under qualified exemption Section 43(2) (Commercial Interests). Section 43 concerns information which if disclosed would or would likely prejudice the commercial interests of any person (including defence contractors and the public authority holding it).

As the exemption is qualified, it was necessary to undertake a Public Interest Test to determine whether the balance for withholding the information outweighs that for disclosure. General arguments in favour of release were that full disclosure would demonstrate the MOD's commitment to openness and transparency; and make the UK Government more accountable to the electorate. The FOI Act also contains a presumption for release.

Defence Equipment & Support

However, reporting the time taken by MOD contractors to rectify fault reports could be used, along with already published contractor information, to reveal market sensitive information, such as hourly labour rates, that would likely allow the company's competitors to exploit when bidding for similar work.

Given the arguments described above, on balance, it was determined that the information should be withheld under Section 43(2) (Commercial Interests). The level of prejudice against release of this exempted information has been set at the higher level of "would" rather than "would be likely to".

If you have any queries regarding the content of this letter, please contact this office in the first instance. If you wish to complain about the handling of your request, or the content of this response, you can request an independent internal review by contacting the Information Rights Compliance team, Ground Floor, MOD Main Building, Whitehall, SW1A 2HB (e-mail CIO-FOI-IR@mod.gov.uk). Please note that any request for an internal review should be made within 40 working days of the date of this response.

If you remain dissatisfied following an internal review, you may raise your complaint directly to the Information Commissioner under the provisions of Section 50 of the Freedom of Information Act. Please note that the Information Commissioner will not normally investigate your case until the MOD internal review process has been completed. The Information Commissioner can be contacted at: Information Commissioner's Office, Wycliffe House, Water Lane, Wilmslow, Cheshire, SK9 5AF. Further details of the role and powers of the Information Commissioner can be found on the Commissioner's website at <https://ico.org.uk/>.

Yours sincerely,

DE&S Policy Secretariat

VEHICLE DETAILS

ERIM	NATO Stock Number	Asset Code	Contract Number	Description	Colour
(a)	(b)	(c)	(d)	(e)	(f)
KB83AA	2320998939965	NB42258100	LV2A/088DUM	TRUCK UTY LIGHT (TUL HS) 4X4 GS FFR HARD TOP LHD LANDROVER 2.5LTR TD (WITH EEGR)	Army/NATO Green IRR

Date In Service	Chassis Number	Engine No.	Cast	Cast Date
(g)	(h)	(i)	(j)	(k)
28/10/1997	SALLDAA68VA126582	25L03128A		

VEHICLE HISTORY

ERIM	Key No.	RIV Date	UIN	Unit Title	RIV No.	RCP No.	RCP Date	Batch
(a)	(b)	(c)	(d)	(e)	(f)	(g)	(h)	(i)
KB83AA	3	27/10/1997	CA005A	JSCS ASHCHURCH	CAPITA	29753AA	28/10/1997	
KB83AA	4	25/11/1997	A0504A	1 CG	35182A	2893	29/01/1998	
KB83AA	4	25/06/1998	A0510A	1 IG	555	555188	25/06/1998	
KB83AA	4	29/08/2003	A0507A	1 SG	999	999	29/08/2003	H/T
KB83AA	4	05/12/2004	A0507B	1 SG REAR PARTY	999	999	05/01/2005	
KB83AA	4	09/05/2005	A0507A	1 SG	1	1	10/05/2005	H/T
KB83AA	2	05/05/2010	A2264A	5 RIFLES		JHQ1DIV	05/05/2010	

Work Objects

Serial Number: KB83AA
 NSN: 2320998939965

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Fault ID	Work Request ID	Fault Description	Work Status	Fault State	Escalate Work	Repair Level	Batch Fault Group ID Number	Fault Occurrence Date	Mission Impact	Reason For Work	Level 3 Description	Working Organisation	Repair Section	Estimated Repair Time
000000-00B82023		Tighten wiper swing arm	Closed	Non-Taskworthy	No	Level 1		29 Nov 2019	N/A	Failure	TUL HS FFR HARD TOP			000:00
000000-00B61818	000000-0034376C	VEH WILL NOT START	Closed	Non-Taskworthy	No	Level 2		06 Sep 2019	Aborted	Failure	TUL HS FFR HARD TOP			000:00
000000-00B5844F		CARRY OUT LAND ROVER REHAB PROGRAM	Closed	Fully Fit	No	Level 2		31 Jul 2019	N/A	Refurbishment	TUL HS FFR HARD TOP			000:00
000000-00B3869A		RENEW REAR RH SHOCK BUSHES	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Inspection	TUL HS FFR HARD TOP			000:00
000000-00A90C26		FUSE BOX COVER MISSING SECURINGSCREW	Closed	Fully Fit	No	Level 1		07 Feb 2018	N/A	Inspection	TUL HS FFR HARD TOP			000:00
000000-00A27639		Fan Control Snapped	Closed	Non-Taskworthy	No	Level 2		24 May 2017	N/A	Damage	TUL HS FFR HARD TOP			000:00
000000-00B585F8		BRAKES. Insufficient braking force. failed RBT. investigate and rectify	Closed	Non-Taskworthy	No	Level 2		31 Jul 2019	N/A	Inspection	TUL HS FFR HARD TOP			000:00
000000-00B10E02		Front RH aerial base insecure	Closed	Fully Fit	No	Level 2		19 Feb 2019	N/A	Closed No Action	TUL HS FFR HARD TOP			000:00
000000-00B10DEF		RH mast mount insecure	Closed	Fully Fit	No	Level 2		19 Feb 2019	N/A	Closed No Action	TUL HS FFR HARD TOP			000:00
000000-00A90C2D		DRIVERS DOOR SEAL DAMAGED	Closed	Fully Fit	No	Level 2		07 Feb 2018	N/A	Inspection	TUL HS FFR HARD TOP			000:00
000000-00B4022B		RENEW ENGINE	Closed	Non-Taskworthy	No	Level 2		31 May 2019	N/A	Failure	TUL HS FFR HARD TOP			000:00
000000-00B38622		RENEW DAMAGED PASSENGER DOOR SEAL	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Inspection	TUL HS FFR HARD TOP			000:00

000000-00B3864B		FIT MISSING AIR DUCTS, DRIVER AND PASSENGER	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B38664		RENEW LH FRONT BRAKE GUARD	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B44560		EXHAUST MISSING NUTS AND GASKET AT ENGINE DOWNPIPE	Closed	Fully Fit	No	Level 2		13 Jun 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B4456C		COOLANT PIPE AT TOP OF ENGINE SPLIT	Closed	Non- Taskworthy	No	Level 2		13 Jun 2019	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00B3862E		RENEW DRIVERS SEATBELT	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B38683		RENEW REAR R/H	Closed	Fully Fit	No	Level 2		14 May 2019	N/A	Closed No Action	TUL HS FFR HARD TOP	000:00
000000-00B10DCB		Rear door lock inop	Closed	Fully Fit	No	Level 2		19 Feb 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B10DAC		Map light inop	Closed	Fully Fit	No	Level 2		19 Feb 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B0BCFF		BONNET DOES NOT CLOSE CORRECTLY	Closed	Limited Role	No	Level 2		05 Feb 2019	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A90C13		PLAY IN PASSENGER DOOR (FAULT COMPLETE CLOSE ON RECEIPT OF LAST SPARES)	Closed	Fully Fit	No	Level 2		06 Feb 2018	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00B237BF		SNvE377 - SWIVEL HOUSING	Closed	Fully Fit	No	Level 1	000000-0000697B	29 Mar 2019	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00B20C53		SNvE 377 - SWIVEL HOUSING	Closed	Non- Taskworthy	No	Level 1	000000-0000697A	29 Mar 2019	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00B0BCFE		REVERS LIGHT INOP (NOT BULB OR FUSE)	Closed	Limited Role	No	Level 2		05 Feb 2019	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A90C21		RADIO BATTERIES NOT SECURED	Closed	Fully Fit	No	Level 1		07 Feb 2018	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A90CE4		NO 6530,FIRE EXT OR JACK PRESENTED FOR MEI	Closed	Limited Role	No	Level 1		07 Feb 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	000:00
000000-008D030D	000000-00328F28	PICK AXE HOLDER ON BONNET DAMAGED	Closed	Fully Fit	No	Level 1		19 Oct 2015	N/A	Inspection	TUL HS FFR HARD TOP	5 RIFLES MT PL 000:00
000000-00ADFC01		ENGINE COOLANT TEMPERATURE GUAGE INNACCURATE (FAULT RECTIFIED CLOSE ON RECEIPT OF SPARE FOR STOCK)	Closed	Limited Role	No	Level 2		20 Sep 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00

000000-00A90C0E	FRONT NO PLATE DAMAGED	Closed	Fully Fit	No	Level 1	07 Feb 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00AF846B	RENEW TURBO	Closed	Non-Taskworthy	No	Level 2	16 Nov 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00AD3540	FREE PLAY IN LH WIPER ARM SPLINED SHAFT	Closed	Fully Fit	No	Level 2	16 Aug 2018	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00AD353E	CONVOY LIGHT INOP	Closed	Limited Role	No	Level 2	16 Aug 2018	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00AF6C17	RENEW TURBOCHARGER	Closed	Non-Taskworthy	No	Level 2	20 Nov 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00AF72A8	RENEW TURBOCHARGER	Closed	Non-Taskworthy	No	Level 2	20 Nov 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A5E8B7	vehicle requires respray	Closed	Fully Fit	No	Level 3	04 Oct 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00AAD924	STEERING WHEEL CASING JAMMED UNDER STEERING COLUMN	Closed	Fully Fit	No	Level 2	02 May 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00AAD91E	WINDSCREEN WIPERS ONLY WORK ON ONE SPEED	Closed	Limited Role	No	Level 2	02 May 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A68A07	SECURE CABLING AT LH DOOR SILL	Closed	Fully Fit	No	Level 2	25 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00ACCC7F	CARRY OUT RBT ON COMPLETION OF WHEEL HUB FAULT	Closed	Non-Taskworthy	No	Level 2	26 Jul 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00AB4EBE	RECTIFY R/H/R WHEEL HUB SHEARED AND DAMAGED BOLTS (HUB TO DISC)	Closed	Non-Taskworthy	No	Level 2	22 May 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00A689F1	DENT IN RIGHT HAND DOOR SILL	Closed	Fully Fit	No	Level 2	24 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00AD339C	Carry Out 6 Monthly 6534 Insp	Closed	Non-Taskworthy	No	Level 1	16 Aug 2018	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00AAD919	INDICATORS U/S	Closed	Non-Taskworthy	No	Level 2	02 May 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00AA84B3	WINDSCREEN WIPERS U/S	Closed	Non-Taskworthy	No	Level 2	19 Apr 2018	N/A	Failure	TUL HS FFR HARD TOP	000:00
000000-00A90C1F	FUEL CAP NOT YELLOW	Closed	Fully Fit	No	Level 1	07 Feb 2018	N/A	Closed No Action	TUL HS FFR HARD TOP	


000000-00A90F38		BRAKE FLUID RESERVOIR LOW	Closed	Non-Taskworthy	No	Level 1	07 Feb 2018	N/A	Servicing	TUL HS FFR HARD TOP	000:00
000000-00A02C5D	000000-003267CC	REAR SHOCKS AND SPRINGS REQUIRE REPLACING	Closed	Non-Taskworthy	No	Level 2	15 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A35D99		BONNET STAY CLASP MISSING	Awaiting Labour	Fully Fit	No	Level 2	29 Jun 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A689F3		SECURE CENTER CONSOL (6 WAY LIGHTING SWITCH)	Closed	Fully Fit	No	Level 2	25 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A820DD		FFR GENERATOR BELT U/S	Closed	Limited Role	No	Level 2	19 Dec 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A416C5		CARRY OUT MOD 20 AS PER AESP 2320-D-128-811	Closed	Fully Fit	No	Level 2	28 Jul 2017	N/A	Modification	TUL HS FFR HARD TOP	000:00
000000-00A820C0		COOLANT HOSE CLIP MISSING AND HOSE IS RUBBING ON THE WATER PUMP PULLY	Closed	Fully Fit	No	Level 2	19 Dec 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A7BE94		FIT WHEEL NUT INDICATORS	Closed	Non-Taskworthy	No	Level 2	30 Nov 2017	N/A	Modification	TUL HS FFR HARD TOP	000:00
000000-00A689FD		RADIUS ARM BUSHES PERISHED	Closed	Fully Fit	No	Level 2	24 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A68A00		REPLACE REAR DISCS	Closed	Non-Taskworthy	No	Level 2	24 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A7E10B		RENEW A FRAME BALLJOINT	Closed	Fully Fit	No	Level 2	06 Dec 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A7FD80		A FRAME BALLJOINT PERISHED	Closed	Non-Taskworthy	No	Level 2	11 Dec 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A82073		REAR DOOR HINGE LOOSE	Closed	Fully Fit	No	Level 2	19 Dec 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A689F5		FIT REAR VIEW MIRROR	Closed	Fully Fit	No	Level 2	25 Oct 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A68A03		INVESTIGATE LEAK AT FRONT LH HUB	Closed	Fully Fit	No	Level 2	25 Oct 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A5D12D		CONVOY LIGHT U/S	Closed	Limited Role	No	Level 2	29 Sep 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A689EA		TORQUE REAR LEFT HAND WHEEL NUTS	Closed	Non-Taskworthy	No	Level 1	25 Oct 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	

000000-00A689FA		A FRAME BALL JOINT SPLIT	Closed	Non-Taskworthy	No	Level 2		24 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A7C10C		CARRY OUT MOD 20	Closed	Fully Fit	No	Level 2		30 Nov 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A68A0B		COOLANT LEAK AT TOP HOSE	Closed	Non-Taskworthy	No	Level 2		24 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	000:00
000000-00A689FE		TIGHTEN PROPSHAFT BOLTS	Closed	Non-Taskworthy	No	Level 2		25 Oct 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A433E3		variants, TUL (HS) all variants and Battle Field Ambulance (BFA) post embodiment instruction Mod 41 - Battery Isolation Switch.	Closed	Limited Role	No	Level 2	000000-00004559	31 Jul 2017	N/A	Closed No Action	TUL HS FFR HARD TOP	
000000-00A689EC		FIT MISSING DUST CAP TO REAR LH WHEEL	Closed	Fully Fit	No	Level 1		25 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A689EE		REMOVE DEBRIS FROM ENGINE BAY	Closed	Fully Fit	No	Level 1		25 Oct 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-008D0311		REAR RAD OP SEAT INSECURE	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A02C73	000000-003267CC	CRANKCASE BREATHER U/S	Closed	Fully Fit	No	Level 2		16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A35D97		MAP READING LIGHT COVER DAMAGED	Closed	Fully Fit	No	Level 1		30 Jun 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A02C6D	000000-003267CC	LOOSE PROPSHAFT BOLTS (SEE REPAIR ACTION)	Closed	Fully Fit	No	Level 2		16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-009D5554		NO IMI CARRIED OUT FOR MEI 19-10-16	Closed	Limited Role	No	Level 1		18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A02C6C	000000-003267CC	NUMBER PLATE LIGHT U/S	Closed	Non-Taskworthy	No	Level 2		16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A02C4D	000000-003267CC	RADIUS ARM BUSH PERISHED	Closed	Non-Taskworthy	No	Level 2		16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A02C55	000000-003267CC	INDICATOR U/S	Closed	Non-Taskworthy	No	Level 2		16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00A12259	000000-003267CC	spares re-demanded	Closed	Non-Taskworthy	No	Level 2		28 Mar 2017	N/A	Damage	TUL HS FFR HARD TOP	
000000-00A121A8	000000-003267CC	carry our 6 yearly	Closed	Non-Taskworthy	No	Level 2		28 Mar 2017	N/A	Servicing	TUL HS FFR HARD TOP	

000000-00A02C43	000000-003267CC	A FRAME BALL JOINT SPLIT	Closed	Non-Taskworthy	No	Level 2	16 Feb 2017	N/A	Inspection	TUL HS FFR HARD TOP
000000-009D4BB0		FAN CONTROL KNOB SNAPPED	Closed	Fully Fit	No	Level 2	18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-009D4BA0		REPLACE REAR DOOR EARTH STRAP	Closed	Fully Fit	No	Level 2	18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-009F6AEF		Replace water pump and belts	Closed	Fully Fit	No	Level 2	18 Jan 2017	N/A	Failure	TUL HS FFR HARD TOP
000000-00A02C5E		REPLACE SHOCKS AND SPRINGS	Closed	Non-Taskworthy	No	Level 2	16 Feb 2017	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-009E1CE8		carry out mod 41	Closed	Fully Fit	No	Level 2	16 Nov 2016	N/A	Modification	TUL HS FFR HARD TOP
000000-009D4BAF		fit MOD 44, 7 way lighting switch	Closed	Fully Fit	No	Level 2	19 Oct 2016	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-009D4BAD		secure lighting switch	Closed	Fully Fit	No	Level 2	18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-009D4BA5		secure LH door handle	Closed	Fully Fit	No	Level 2	18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-009D4BA4		secure LH wing mirror	Closed	Fully Fit	No	Level 2	18 Oct 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-008D0313		NO TYRE PRESSURE ON SPARE WHEEL	Closed	Fully Fit	No	Level 1	20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D031F		NO IMI	Closed	Limited Role	No	Level 1	20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D75F7		carry out MOD 6 as per AESP 2320-D-128-811	Closed	Fully Fit	No	Level 1	10 Nov 2015	N/A	Modification	TUL HS FFR HARD TOP
000000-00880D8A		CARRY OUT MOD 42 IAW AESP 2320-D-128-811	Closed	Fully Fit	No	Level 2	17 Mar 2015	N/A	Modification	TUL HS FFR HARD TOP
000000-008D032B		EXCESSIVE PLAY IN DOOR HINGERS	Closed	Fully Fit	No	Level 2	20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-00989A10		radias arm bushes will need replacing	Closed	Fully Fit	No	Level 1	19 Apr 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-00981675		REPLACE WITH UK HEAD LAMP	Closed	Non-Taskworthy	No	Level 2	25 Mar 2016	N/A	No Fault Found	TUL HS FFR HARD TOP




000000-008D0327		DRIVER SEAT BELT PROTECTOR DAMAGED	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D0325		RIFLE RACK PROTECTIVE PAD MISSING	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D031C		NO RADIO BATTERIES FITTED	Closed	Limited Role	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D0317		SECURE "R" TO REAR TOW HOOK	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D0314		24V LABEL NEXT TO NATO SOCKET MISSING	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Inspection	TUL HS FFR HARD TOP
000000-008D0312		BONNET BUMP STOPS MISSING	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Inspection	TUL HS FFR HARD TOP
000000-008D031E		NO EARTH BONDING	Closed	Limited Role	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008D032E		DRIVERS DOOR EARTH STRAP DAMAGED	Closed	Fully Fit	No	Level 2		20 Oct 2015	N/A	Inspection	TUL HS FFR HARD TOP
000000-009863C0		threads stripped in the cylinder head	Closed	Fully Fit	No	Level 2		11 Apr 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-008D0319		"DO NOT OPERATE RADO WHILE REFUELLING" LABEL MISSING	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-0082CB63	000000-002FB0E9	TFSU (G) INSIGHT	Closed	Fully Fit	No	Level 1		11 Aug 2014	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-0095F0E6		Check No2 ball joint torque tightness as per safety notice LE SNvE 00063	Closed	Non-Taskworthy	No	Level 2	000000-000031CF	14 Jan 2016	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-009487A1		CARRY OUT TORUE CHECK OF THE NUMBER 2 BALL JOINT IAW SEFIT SAFETY NOTICE DATED 16/12/15	Closed	Fully Fit	No	Level 2		04 Jan 2016	N/A	Inspection	TUL HS FFR HARD TOP
000000-008D031A		MOD 35 NOT FITTED (GLASS HAMMER)	Closed	Fully Fit	No	Level 1		20 Oct 2015	N/A	Closed No Action	TUL HS FFR HARD TOP
000000-008247D3		CARRY OUT MOD 6 SPARE WHEEL INFLATION.	Closed	Fully Fit	No	Level 2		16 Jul 2014	N/A	Modification	TUL HS FFR HARD TOP
000000-008442EB		Towing Pintle Assembly	Closed	Limited Role	No	Level 2	000000-00001F58	09 Oct 2014	Degraded	Inspection	TUL HS FFR HARD TOP
000000-0082DD68		CARRY OUT MOD 33	Closed	Fully Fit	No	Level 2		14 Aug 2014	N/A	Modification	TUL HS FFR HARD TOP

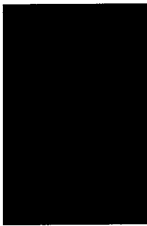

000000-008247DF		DRVS SEAT BELT CLIP U/S	Closed	Fully Fit	No	Level 2		16 Jul 2014	N/A	Damage	TUL HS FFR HARD TOP			
000000-008247D8		INDICATOR LAMP INOP ON DASH	Closed	Fully Fit	No	Level 2		16 Jul 2014	N/A	Failure	TUL HS FFR HARD TOP			
000000-007760F1		REPLACE TOP SIDE PANELS	Closed	Fully Fit	No	Level 2		17 Mar 2013	N/A	Damage	TUL HS FFR HARD TOP			
000000-007760C8		REPLACE SIDE PANELS	Closed	Fully Fit	No	Level 2		17 Mar 2013	N/A	Damage	TUL HS FFR HARD TOP			
000000-0074EE3F		REQUIRES RESPRAY	Closed	Fully Fit	No	Level 3		14 Nov 2012	N/A	Refurbishment	TUL HS FFR HARD TOP			000:00
000000-007FD163	000000-002F54CB	PLEASE INSPECT, REPAIR AND SERVICE TO STI17 STANDARD.	Closed	Fully Fit	No	Level 3		02 Apr 2014	N/A	Non Specific	TUL HS FFR HARD TOP	3 CIV WKSP REME	PB CIVDET B LINE	
000000-007C8EA3		CHANGE GOODYEAR TYRES REF NOTICE	Closed	Non- Taskworthy	No	Level 1		06 Nov 2013	N/A	Failure	TUL HS FFR HARD TOP			
000000-007800E5		FIT MISSING PROP NUT BOLT	Closed	Non- Taskworthy	No	Level 2		16 Apr 2013	N/A	Damage	TUL HS FFR HARD TOP			
000000-0074EA7A		PASSENGER DOOR SIDE SKIRT DAMAGE	Closed	Fully Fit	No	Level 2		14 Nov 2012	N/A	Damage	TUL HS FFR HARD TOP			000:00
000000-0075F986		RENEW WIND SCREEN WIPER STALK	Closed	Fully Fit	No	Level 2		23 Jan 2013	N/A	Failure	TUL HS FFR HARD TOP			
000000-0079C715		RENEW SPARE WHEEL	Closed	Non- Taskworthy	No	Level 1		25 Jun 2013	N/A	Failure	TUL HS FFR HARD TOP			
000000-0072212D		ENGINE NUMBER NOT RECORDED ON JAMES	Closed	Fully Fit	No	Level 1		02 Jul 2012	N/A	Inspection	TUL HS FFR HARD TOP			
000000-007800E3		REPLACE INLET CHARGER PIPE	Closed	Non- Taskworthy	No	Level 2		16 Apr 2013	N/A	Damage	TUL HS FFR HARD TOP			
000000-007B1E69	000000-002EAEDB	INV OVER-PRESSURISING OF COOLANT SYSTEM	Closed	Non- Taskworthy	No	Level 2		04 Sep 2013	N/A	Failure	TUL HS FFR HARD TOP	3 CIV WKSP REME	PB CIVDET B LINE	
000000-0075F5C0		RENEW HEATER MATRIX	Closed	Non- Taskworthy	No	Level 2		14 Jan 2013	N/A	Failure	TUL HS FFR HARD TOP			
000000-00798BCA		GOODYEAR G90 tyres manufactured in South Africa cracking File Ref OSVP/64/40/04/09	Closed	Fully Fit	No	Level 1	000000-0000081A	23 Jun 2013	N/A	Failure	TUL HS FFR HARD TOP			
000000-0079BB9B		Inspect tyres for damage	Closed	Fully Fit	No	Level 2	000000-00000835	25 Jun 2013	N/A	Inspection	TUL HS FFR HARD TOP			

000000-0075C0CF	RENEW WATER PUMP	Closed	Non-Taskworthy	No	Level 2	15 Jan 2013	N/A	Failure	TUL HS FFR HARD TOP	
000000-006C2132	Renew Clutch Master cylinder	Closed	Fully Fit	No	Level 2	16 Aug 2011	N/A	No Fault Found	TUL HS FFR HARD TOP	
000000-0072362A	Carry out OOPM IAW AESP 2320-D-128-601 Table 5 Ser 1 & 4 (Date Due 22/03/14)	Closed	Fully Fit	No	Level 2	05 Jul 2012	N/A	No Fault Found	TUL HS FFR HARD TOP	
000000-00723635	Carry out OOPM IAW AESP 2320-D-128-601 Table 5 Ser 2 & 3 (Date Due 22/03/16)	Closed	Fully Fit	No	Level 2	05 Jul 2012	N/A	No Fault Found	TUL HS FFR HARD TOP	
000000-0072363F	Carry out OOPM IAW AESP 2320-D-128-601 Table 5 Ser 6 (Date Due 22/03/17)	Closed	Fully Fit	No	Level 2	05 Jul 2012	N/A	No Fault Found	TUL HS FFR HARD TOP	
000000-0074EA36	6534 INSPECTION IAW 2320-D-128-601 TABLE 7	Closed	Non-Taskworthy	No	Level 1	14 Nov 2012	N/A	Servicing	TUL HS FFR HARD TOP	000:00
000000-0074EA3A	6 MONTHLY SERVICE L1 JOBS	Closed	Non-Taskworthy	No	Level 1	14 Nov 2012	N/A	Servicing	TUL HS FFR HARD TOP	000:00
000000-0074EA4F	6 MONTHLY SERVICING L2 JOBS	Closed	Non-Taskworthy	No	Level 2	14 Nov 2012	N/A	Servicing	TUL HS FFR HARD TOP	000:00
000000-00726959	Complete All L1 maintenance IAW AESP 2320-D-128-601 Table 7 Col C	Closed	Fully Fit	No	Level 1	16 Jul 2012	N/A	Servicing	TUL HS FFR HARD TOP	
000000-0072237B	Carry out IN inspection from SMRC	Closed	Fully Fit	No	Level 2	02 Jul 2012	N/A	Inspection	TUL HS FFR HARD TOP	
000000-005DB3F6	renew earth starp at dvrs door	Closed	Fully Fit	No	Level 1	09 Feb 2011	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00722127	2x BATT TERMINAL CAPS MISSING	Closed	Fully Fit	No	Level 1	02 Jul 2012	N/A	Inspection	TUL HS FFR HARD TOP	
000000-007220F3	H/BRAKE TRAVEL TOO LONG	Closed	Fully Fit	No	Level 2	02 Jul 2012	N/A	Inspection	TUL HS FFR HARD TOP	
000000-007220E7	WIPERS WORN	Closed	Non-Taskworthy	No	Level 1	02 Jul 2012	N/A	Inspection	TUL HS FFR HARD TOP	
000000-00715858	2 YEARLY	Closed	Non-Taskworthy	No	Level 2	21 May 2012	N/A	Servicing	TUL HS FFR HARD TOP	
000000-007220AE	CARRY OUT 2 YRLY VM TASKS	Closed	Non-Taskworthy	No	Level 2	02 Jul 2012	N/A	Servicing	TUL HS FFR HARD TOP	
000000-00715852	MEI	Closed	Non-Taskworthy	No	Level 2	21 May 2012	N/A	Inspection	TUL HS FFR HARD TOP	

000000-006C847F	Replace exhaust system complete	Closed	Fully Fit	No	Level 2		07 Sep 2011	N/A	Damage	TUL HS FFR HARD TOP
000000-006C2683	6 MONTHLY SERVICE	Closed	Fully Fit	No	Level 1		17 Aug 2011	N/A	Servicing	TUL HS FFR HARD TOP
000000-006BF6AC	Renew fuel lift pump	Closed	Non- Taskworthy	No	Level 2		03 Aug 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-00603D7B	RENEW ALTENATOR	Closed	Fully Fit	No	Level 2		13 May 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-00603D62	RENEW STARTER MOTOR AND GASKET	Closed	Non- Taskworthy	No	Level 2		13 May 2011	N/A	Damage	TUL HS FFR HARD TOP
000000-00602C10	RENEW 4 WAY SWITCH	Closed	Non- Taskworthy	No	Level 2		12 May 2011	N/A	Failure	TUL HS FFR HARD TOP
000000-005F5C37	Inspect engine for damage	Closed	Non- Taskworthy	No	Level 2		06 May 2011	N/A	Damage	TUL HS FFR HARD TOP
000000-005DB30B	FIT MISSING CLUTCH PEDAL SPRING	Closed	Fully Fit	No	Level 2		09 Feb 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-006B0787	Insp Steering Drop Arm Tab Washer	Closed	Non- Taskworthy	No	Level 2	000000-00000313	22 Jun 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-006AD830	Insp Steering Drop Arm Tab Washer	Closed	Non- Taskworthy	No	Level 2	000000-00000281	22 Jun 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-005DB3FC	present jack with correct vrn	Closed	Fully Fit	No	Level 1		09 Feb 2011	N/A	Inspection	TUL HS FFR HARD TOP
000000-005DF70C	OOPM OUT OF DATE	Closed	Non- Taskworthy	No	Level 2		21 Feb 2011	N/A	Servicing	TUL HS FFR HARD TOP
000000-002824AF	Insufficient Data	Closed	Non- Taskworthy	No	Level 1		16 Sep 2008			TUL HS FFR HARD TOP
000000-00078AFC	RENEW HAND THROTTLE CABLE	Closed	Fully Fit	No	Level 2		06 Jul 2007			TUL HS FFR HARD TOP
000000-00078AFD	RECTIFY SPARE TYRE FLAT	Closed	Fully Fit	No	Level 1		06 Jul 2007			TUL HS FFR HARD TOP
000000-00062E31	RENEW FRONT BUMPER	Closed	Fully Fit	No	Level 2		18 Apr 2007			TUL HS FFR HARD TOP
000000-00078AF2	FREE OFF FRONT AND REAR RECOVERY EYES	Closed	Fully Fit	No	Level 2		06 Jul 2007			TUL HS FFR HARD TOP



000000-00078AF4	REPAIR PAX DOOR MAP POCKET	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AF6	FIT SEAT BELT MOD	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AF7	FIT SPARE WHEEL LIFT MOD	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AF8	RENEW REAR SHOCK BUSHES	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AF9	SECURE HAND BRAKE LEVER	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AFA	RECT OIL LEAK AT REAR DIFF	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-00078AFB	RENEW REAR BRAKE PADS	Closed	Fully Fit	No	Level 2	06 Jul 2007	TUL HS FFR HARD TOP
000000-0004789B	RENEW PROP SHAFT BOLTS	Closed	Fully Fit	No	Level 2	22 Jan 2007	TUL HS FFR HARD TOP
000000-0002DE11	Initial Usage	Closed	Fully Fit	No	Level 1	14 Sep 2006	TUL HS FFR HARD TOP
000000-0002DE23	Initial Maintenance	Closed	Fully Fit	No	Level 1	14 Sep 2006	TUL HS FFR HARD TOP

Work Objects

Serial Number: KB83AA
 NSN: 2320998939965

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Maintenance Event ID	Work Request ID	Escalate Work	Maintenance Event Name	Next Due Date	Repair Level	Fault State	Work Status	Estimated Repair Time	Working Organisation	Repair Section
000000-00A99FDE		No	Annual Headlight Alignment Check (2)	31 Aug 2020	Level 2			000:00		
000000-00A9A04F		No	FMT930 Landworthiness (AR)		Level 1	Limited Role	CL	000:00		
000000-00B52D53		No	FMT933 (W) Role Equipment (2)*	31 Jul 2020	Level 2	Fully Fit	CL	000:00		
000000-00A99F9B		No	Annual Brake Test (2)	31 Aug 2020	Level 2			000:00		
000000-00A97D2A		No	FMT932 (W) Mandatory Equipment Inspection (2)*	21 Feb 2020	Level 2	Limited Role	CL	000:00		
000000-00A98CE4		No	FMT934 Functional Check (1)*	31 Jan 2020	Level 1	Fully Fit	CL	000:00		
000000-005C6962		No	6 Monthly 6534 Insp		Level 1	Non-Taskworthy	WiP	000:00		
000000-00A9AE0D		No	FMT934 Functional Check (1)*	31 Jan 2020	Level 1	Limited Role	CL	000:00		
000000-0090FFDE		No	MEI (2)		Level 2	Non-Taskworthy	CL	000:00		
000000-00910059		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00B53006		No	FMT934 Functional Check (1)*	31 Jan 2020	Level 1	Fully Fit	CL	000:00		
000000-00A99FF7		No	Annual Smoke Emissions Test(2)	31 Aug 2020	Level 2			000:00		
000000-00A9A54E		No	FMT932 (W) Mandatory Equipment Inspection (2)*	21 Feb 2020	Level 2	Limited Role	CL	000:00		D FTRS
000000-009CFAC0		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00A9854C		No	FMT931 Comms (2)*	22 Aug 2019	Level 2	Limited Role	CL	000:00		
000000-00B5301C		No	FMT930 Landworthiness (AR)		Level 1	Fully Fit	CL	000:00		
000000-0011B06B		No	MEI (2)		Level 2			000:00		
000000-008343E1		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-001EE9D4		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-0022B6A6		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-003B6E88	000000-002F54CB	No	MEI (2)		Level 2	Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-00083ACD		No	MEI (2)		Level 2		CL	000:00		
000000-000DDCF3		No	MEI (2)		Level 2		CL	000:00		
000000-00035168		No	MEI (2)		Level 2		CL	000:00		
000000-005CE739		No	MEI (2)		Level 2	Fully Fit	CL	000:00		
000000-0017BDBF		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00A9A29D		No	FMT933 (W) Role Equipment (2)*	31 Jul 2020	Level 2	Limited Role	CL	000:00		
000000-00A9837E		No	FMT932 (W) 6 Monthly Safety Inspection (2)	31 Jan 2020	Level 2	Limited Role	CL	000:00		
000000-0072E30D		No	MEI (2)		Level 2	Fully Fit	CL	000:00		
000000-001EEA3C		No	MEI (2)		Level 2			000:00		
000000-00A9A72B		No	FMT932 (W) 6 Monthly Safety Inspection (2)	31 Jan 2020	Level 2	Limited Role	CL	000:00		D FTRS
000000-00B52D3B		No	FMT932 (W) 6 Monthly Safety Inspection (2)	31 Jan 2020	Level 2	Non-Taskworthy	CL	000:00		

000000-00B53017	No	Annual Headlight Alignment Check (2)	31 Aug 2020	Level 2	Non-Taskworthy	CL	000:00	
000000-0067CD32	No	6 Monthly 6534 Insp		Level 1			000:00	
000000-0040E7D1	No	6 Monthly 6534 Insp		Level 1			000:00	
000000-00A9AF32	No	FMT930 Landworthiness (AR)		Level 1	Limited Role	CL	000:00	D FTRS
000000-00B53016	No	Annual Smoke Emissions Test(2)	31 Aug 2020	Level 2	Non-Taskworthy	CL	000:00	
000000-00A9A049	No	FMT934 Functional Check (1)*	31 Jan 2020	Level 1	Limited Role	CL	000:00	D FTRS
000000-00A9A01A	No	FMT933 (W) Role Equipment (2)*	31 Jul 2020	Level 2	Limited Role	CL	000:00	D FTRS
000000-007300A3	No	6 Monthly 6534 Insp		Level 1	Fully Fit	CL	000:00	
000000-00B53018	No	Annual Brake Test (2)	31 Aug 2020	Level 2	Non-Taskworthy	CL	000:00	
000000-00A98BE2	No	FMT931 Comms (2)*	22 Aug 2019	Level 2	Limited Role	CL	000:00	

Work Objects

Serial Number: KB83AA
 NSN: 2320998939965

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Modification Event ID	Modification Number	Modification Description	Work Request ID	Escalate Work	Production Classification / In Service Classification	Modification Type	Apply When Usage Equals	Embody by Target Date	Usage Counter Units	Fault State	Work Status	Repair Level	Working Organisation	Repair Section	Estimated Repair Time
000000-00717B16	00020	8 Metre Mast Mount Installation Kit		No	-/-	UTI				Fully Fit	CL	Level 2			000:00
000000-0071B8D6	00031	Cover for Blue Flashing Beacon (Battlefield Ambulance & RMP TUL/TUM (HS) Variants FITTING OF WHEEL NUT INDICATORS TO LAND ROVER HS PLATFORMS		No	-/-	UTI				Fully Fit	CL	Level 2			000:00
000000-0068BB2E	00046	LAND ROVER HS PLATFORMS		No	1/A	Mod				Non-Taskworthy	CL	Level 2			000:00
000000-0068B829	00035	Fitting of Emergency Hammer		No	1/A	UTI				Fully Fit	CL	Level 2			
000000-0068B827	00020	8 Metre Mast Mount Installation Kit		No	-/-	UTI				Fully Fit	CL	Level 2			
000000-00684A96	00044	This instruction details the removal of the existing six way lighting switch and the fitting of a seven way lighting switch to all variants including winter water vehicles.		No	3/A	Mod				Fully Fit	CL	Level 2			
000000-0068B828	00033	Rear Door Blackout Blind (FFR Variants) Only		No	-/-	UTI				Fully Fit	CL	Level 2			
000000-0068B82A	00037	Fitting Glow Plug Timer Interface Harness		No	-/-	UTI				Fully Fit					
000000-0068B825	00014	Fitting of Showerproof Dash Cover		No	-/-	RTI				Fully Fit					
000000-0068B80B	00012	Fitting Radio Frequency Radiated Hazard (RADHAZ) Protection Kit		No	1/A	RTI				Non-Taskworthy	CL	Level 2			
000000-00684A86	00003	Heli-lift Vehicle Modification (Hard Top Only)		No	-/-	RTI				Fully Fit					
000000-00684A92	00018	Fitting of Front Windscreen and Side and Rear Window Protection Screens		No	-/-	UTI				Fully Fit					
000000-00684A90	00004	Fiitting Emergency Lights, Siren and Harness		No	-/-	RTI				Fully Fit					
000000-00684A84	00025	Fitting of Spare Wheel Lifting Aid Harness		No	1/A	UTI				Non-Taskworthy	CL	Level 2			

000000-00684A93	00019	Blackout Cover for Warning Light Panel	No	-/-	UTI	Fully Fit Non- Taskworthy	CL	Level 2
000000-00684A85	00030	Front Belt Protection Sleeves	No	1/A	UTI	Taskworthy	CL	Level 2
000000-00684A94	00024	Fitting of Trailer Breakaway Attachment Plate	No	-/	UTI	Fully Fit	CL	Level 2
000000-00684A95	00041	Fitting of Battery Negative Isolator Switch	No	1/A	Mod	Fully Fit Non- Taskworthy	CL	Level 2
000000-00684A91	00017	Introduction of Battery Retention TUM (HS) REMUS 1- SAFETY AND COMPLIANCE PROGRAMME	No	1/A	UTI	Taskworthy	CL	Level 2
000000-00629C54	00039	Fitting of Spare Wheel Tyre Inflation Valve	No	-/-	RTI	Fully Fit	CL	Level 2
000000-0063DFD3	00006	Extension	No	-/	RTI	Limited Role Non- Taskworthy	CL	Level 2
000000-006F7BBD	00035	Fitting of Emergency Hammer	No	1/A	UTI	Taskworthy	CL	Level 2



Work Objects

Serial Number: KB83AA
 NSN: 2320998939965

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

a

Maintenance Event ID	Work Request ID	Escalate Work	Maintenance Event Name	Next Due Date	Repair Level	Fault State	Work Status	Estimated Repair Time	Working Organisation	Repair Section
000000-00976EB2		No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	21 May 2020	Level 1	Fully Fit	CL	000:00		
000000-0022B6A3		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1			000:00		
000000-0079C58B	000000-003267CC	No	OOPS 6 Yearly/120000 Kms Camshaft Timing Belt (2)	14 Jun 2023	Level 2	Fully Fit	CL	000:00		
000000-0011B08E		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1			000:00		
000000-00910047		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-001F010E		No	OOPS Drain/Replenish Eng Oil And Renew Oil Filter (AR)(2)		Level 2			000:00		
000000-00731CBB		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1	Limited Role	CL	000:00		FSP FTRS
000000-006527D0		No	OOPS 5 Yearly/155000 Kms Drain And Replen Gearbox Oil (2)	03 Mar 2021	Level 2	Non-Taskworthy	CL	000:00		
000000-0020C071		No	OOPS 5 Yearly/155000 Kms Drain And Replen Gearbox Oil (2)	03 Mar 2021	Level 2			000:00		
000000-0014E2BE		No	6 Yearly/120000 Kms (2)		Level 2			000:00		
000000-001EE9BB		No	Yearly/20000 Kms	06 Aug 2020	Level 1			000:00		
000000-0011B081		No	Yearly/20000 Kms	06 Aug 2020	Level 1			000:00		
000000-00B52D6D		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1			000:00		
000000-001EE9AF		No	2 Yearly/40000 Kms	21 May 2020	Level 1			000:00		
000000-0014E2B0		No	5 Yearly/100000 Kms (1)		Level 1			000:00		
000000-0097C593		No	Yearly/20000 Kms	06 Aug 2020	Level 1	Fully Fit	CL	000:00		
000000-003B6E72	000000-002F54CB	No	2 Yearly/40000 Kms	21 May 2020	Level 1	Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-00A47DF7		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-0020C073		No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	21 May 2020	Level 1			000:00		
000000-001F010D		No	OOPS Cooling System (AR)		Level 2			000:00		
000000-0011B177		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1			000:00		
000000-00B52D6C		No	Yearly/20000 Kms	06 Aug 2020	Level 1			000:00		
000000-006527D8		No	OOPS 5 Yearly Drain/Flush And Replen Cooling System	03 Mar 2021	Level 1	Non-Taskworthy	CL	000:00		
000000-0020C072		No	OOPS 5 Yearly Drain/Flush And Replen Cooling System	03 Mar 2021	Level 1			000:00		
000000-008A0FA5		No	Yearly/20000 Kms	06 Aug 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-0020C070		No	OOPS 6 Yearly/120000 Kms Camshaft Timing Belt (2)	14 Jun 2023	Level 2			000:00		
000000-00976EB4		No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	21 May 2020	Level 1	Fully Fit	CL	000:00		
000000-0011B082		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1			000:00		
000000-0040DD57	000000-002F54CB	No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	21 May 2020	Level 1	Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-00083921		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1		CL	000:00		
000000-000CDAB0		No	Yearly/20000 Kms	06 Aug 2020	Level 1		CL	000:00		
000000-00079BD5		No	6 Monthly/10000 Kms	05 Feb 2020	Level 1		CL	000:00		

000000-000DA2C9	No	2 Yearly/40000 Kms	21 May 2020	Level 1	CL	000:00		
000000-00033CD5	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1	CL	000:00		
000000-00033CD6	No	Yearly/20000 Kms	06 Aug 2020	Level 1	CL	000:00		
000000-00035F58	No	5 Yearly/100000 Kms (1)		Level 1	CL	000:00		
000000-00059626	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1	CL	000:00		
000000-0040DD58	000000-002F54CB	No 6 Monthly/10000 Kms	05 Feb 2020	Level 1 Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-0011B162	No	Yearly/20000 Kms	06 Aug 2020	Level 1		000:00		
000000-00976F2D	No	2 Yearly/40000 Kms	21 May 2020	Level 1 Fully Fit	CL	000:00		
000000-0069019F	No	2 Yearly/40000 Kms	21 May 2020	Level 1 Non-Taskworthy	CL	000:00		
000000-001EE9BC	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1		000:00		
000000-005C695F	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1 Fully Fit	CL	000:00		
000000-00805C2B	000000-00327005	No 6 Monthly/10000 Kms	05 Feb 2020	Level 1 Fully Fit	CL	000:00		
000000-006901A2	No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	21 May 2020	Level 1 Non-Taskworthy	CL	000:00		
000000-0020C06F	No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	21 May 2020	Level 1		000:00		
000000-0067C6F8	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1 Non-Taskworthy	CL	000:00		
000000-0097C592	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1 Fully Fit	CL	000:00		
000000-0040DD55	000000-002F54CB	No Yearly/20000 Kms	06 Aug 2020	Level 1 Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-0011B17E	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1		000:00		
000000-0017AB1B	No	6 Monthly/10000 Kms	05 Feb 2020	Level 1		000:00		
000000-00690189	No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	21 May 2020	Level 1 Non-Taskworthy	CL	000:00		
000000-0072E30F	No	Yearly/20000 Kms	06 Aug 2020	Level 1 Limited Role	CL	000:00		FSP FTRS
000000-001F010C	No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (AR)(1)		Level 1		000:00		
000000-005C6963	No	Yearly/20000 Kms	06 Aug 2020	Level 1 Fully Fit	CL	000:00		
000000-0040DD56	000000-002F54CB	No OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	21 May 2020	Level 1 Fully Fit	CL	000:00	3 CIV WKSP REME	PB CIVDET B LINE
000000-000EA3A1	No	6 Yearly/120000 Kms (2)		Level 2	CL	000:00		