

## **Construction Noise and Vibration Monthly Report – January 2023**

**Lichfield District Council**

<b>Non-Technical Summary</b>	<b>1</b>
<b>Abbreviations and Descriptions</b>	<b>3</b>
<b>1 Introduction</b>	<b>4</b>
1.2 Measurement Locations	7
<b>2 Summary of Results</b>	<b>9</b>
2.1 Summary of Measured Noise and Vibration Levels	9
2.2 Exceedances of the LOAEL and SOAEL	12
2.3 Exceedances of Trigger Level	14
2.4 Complaints	15
<b>Appendix A Site Locations</b>	<b>16</b>
<b>Appendix B Monitoring Locations</b>	<b>26</b>
<b>Appendix C Data</b>	<b>35</b>

#### **List of tables**

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	7
Table 3: Summary of Measured dB $L_{Aeq}$ Data over the Monitoring Period	10
Table 4: Summary of Measured PPV Data over the Monitoring Period	12
Table 5: Summary of Exceedances of LOAEL and SOAEL	13
Table 6: Summary of Exceedances of Trigger Levels	15
Table 7: Summary of Complaints	15

# Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise monitoring carried out within the Lichfield District Council (LDC) area during the month of January 2023.

Within this period monitoring was undertaken at the following worksites:

- Noise monitoring was undertaken in the vicinity of the Shaw Lane Embankment (ref.: SLE) worksite where installation of gates, water diversion works, vegetation clearance, trial holes construction, silt net installation, maintenance activities and topsoil removal works were underway.
- Noise and vibration monitoring was undertaken in the vicinity of the Fradley Wood Embankment (ref.: FEW) worksite where construction of pond, ecological inspections, preparation works for stockpile areas, topsoil stripping, excavation works, backfilling, removal of stockpile, trial hole and pavement works, preparation works for footpath closure including installation of signs, concrete works and extension of haul roads works were underway.
- Noise and vibration monitoring was undertaken in the vicinity of the Streethay Cutting Retaining Structure (ref.: SCRS) worksite where piling works including boring of piles and pile mat maintenance, drainage works, haul road construction, installation of site fencing and placing of temporary vertical concrete barriers (TVCBs) work were underway.
- Noise monitoring was undertaken in the vicinity of South Staffs Lane (ref: SSL) worksite, where fencing maintenance works were underway.
- Noise and vibration monitoring was undertaken in the vicinity of the Cappers Lane Compound (ref.: CLC) worksite, where haul road maintenance, laydown construction area, deliveries, Fulfen wood box construction works, breaking concrete, excavation works, drilling works and concrete works were underway.
- Noise monitoring was undertaken in the vicinity of Whittington Common Cutting (ref: WCC) worksite where no works were undertaken.
- Noise and vibration monitoring was undertaken in the vicinity of the Tamworth Road Overbridge Satellite (ref.: TROS) worksite where stockpiling was underway.
- Noise monitoring was undertaken in the vicinity of the Trunk's Road (ref.: N23) worksite where road diversion works were underway.

- Noise monitoring was undertaken at Brockhurst Lane Realignment worksite (ref.: BLR), where topsoil stripping, installation of traffic signs, trial holes construction and construction of an access ramp were underway.
- Noise and vibration monitoring was undertaken in the vicinity of the Sutton Road Overbridge (ref.: SRO) worksite where drainage works, haul road maintenance and compound construction works were underway.

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<https://www.gov.uk/government/publications/hs2-information-papers-environment>), were not exceeded during January 2023.

There were no exceedances of trigger levels as defined in Section 61 consents during the reporting period at any monitoring position.

No complaints were received during the reporting period.



# Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
$L_{Aeq,T}$	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A-weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or $L_{Aeq,T}$	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, wind speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in $m/s^{1.75}$ .

# 1 Introduction

1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:

- monitoring the impact of construction works;
- to investigate complaints, incidents and exceedance of trigger levels; or
- monitoring the effectiveness of noise and vibration control measures.

1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the Lichfield District Council (LDC) area for the period 1<sup>st</sup> to 31<sup>st</sup> January 2023.

1.1.3 There were nine (9) active construction sites in the local authority area. At all nine sites monitoring was undertaken during this period:

- Shaw Lane Embankment ref: SLE (see Works Identification Plan 1 in Appendix A), where work activities included:
  - Installation of gates.
  - Water diversion works.
  - Vegetation clearance.
  - Trial holes construction.
  - Silt net installation.
  - Maintenance activities, including fencing and moving of materials.
  - Topsoil removal.
- Fradley Wood Embankment ref: FEW (see Works Identification Plan 2 in Appendix A), where work activities included:
  - Construction of pond.

- Ecological inspections.
- Preparation works for stockpile areas.
- Topsoil stripping.
- Excavation works.
- Backfilling.
- Removal of stockpile.
- Trial hole and pavement works.
- Preparation works for footpath closure including installation of signs.
- Concrete works.
- Extension of haul roads.
- Streethay Cutting Retaining Structure ref: SCRS (see Works Identification Plan 3 in Appendix A), where work activities included:
  - Pilling works, including boring of piles and pile mat maintenance.
  - Drainage works.
  - Haul road construction.
  - Installation of site fencing.
  - Placing of Temporary Vertical Concrete Barriers (TVCBs).
- South Staffs Lane ref: SSL (see Works Identification Plan 3 in Appendix A), where work activities included:
  - Fencing maintenance works.
- Cappers Lane Compound ref: CLC (see Works Identification Plan 4 in Appendix A), where work activities included:
  - Haul road maintenance.
  - Laydown construction area.
  - Deliveries.
  - Fulfen wood box construction works.
  - Breaking concrete.
  - Excavation works.
  - Drilling.
  - Concrete works.
- Whittington Common Cutting ref: WCC (see Works Identification Plan 4 in Appendix A), where no works were undertaken.

- Tamworth Road Overbridge Satellite ref: TROS (see Works Identification Plan 5 in Appendix A), where work activities included:
  - Stockpiling.
- Trunk's Road ref: N23 (see Works Identification Plan 6 in Appendix A), where work activities included:
  - Road diversion works.
- Brockhurst Lane Realignment worksite: ref.: BLR (see Plan 7 in Appendix A), where works activities included:
  - Topsoil stripping.
  - Installation of traffic signs.
  - Trial holes construction.
  - Construction of an access ramp for ground investigation works access.
- Sutton Road Overbridge ref: SRO (see Works Identification Plan 8 in Appendix A), where work activities included:
  - Drainage works.
  - Haul road maintenance.
  - Compound construction.

1.1.4 The applicable standards, guidance, and monitoring methodology are outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2>. Noise and vibration monitoring reports for previous months can also be found at this location.

## 1.2 Measurement Locations

- 1.2.1 Fifteen (15) noise monitoring and seven (7) vibration monitoring installations were active in January 2023 in the LDC area. Table 2 summarises the positions of the noise and vibration monitoring installations within the LDC area in January 2023.
- 1.2.2 Noise monitor, ref.: SRO-N2 was installed at worksite ref.: SRO on Tuesday 10<sup>th</sup> January 2023.
- 1.2.3 Vibration monitor FEW-V3 at worksite ref: FEW has been renamed from FEW-V1 for record keeping purposes, the monitor has not changed location.
- 1.2.4 Maps showing the positions of the noise monitoring installations are presented in Appendix B.

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
SLE	SLE-N1	Traveller Site, Shaw Lane, Lichfield
FEW	FEW-N1	Wood End Farm, Wood End Lane, Lichfield
	FEW-V3	Wood End Farm, Wood End Lane, Lichfield
SCRS	SCRS-N1	Manor House, Burton Road, Streethay
	SCRS-N2	Kings Orchard Marina, Broad Ln, Huddlesford, Lichfield
	SCRS-V1	Manor House, Burton Road, Streethay
SSL	SSL-N1	Ash Tree Lane, Hill Farm, Fradley and Streethay
CLC	CLC-N1	Ivy Cottage, Park Lane, Fradley and Streethay
	CLC-N3	Fulfen Barn, Cappers Lane, Lichfield
	CLC-N4	Huddlesford Lane, Fradley and Streethay, Lichfield
	CLC-V1	Ivy Cottage, Park Lane, Fradley and Streethay,
WCC	WCC-N1	Whittington Hill Farm, Darnford Lane, Whittington, Lichfield
TROS	TROS-N1	West side of Tamworth Road Overbridge Site, Tamworth Road, Whittington
	TROS-N2	The Bungalow, Tamworth Road, Whittington
	TROS-V2	The Bungalow, Tamworth Road, Lichfield
N23	N23-N1	21 Roman Road, Lichfield
	N23-V1	21 Roman Road, Lichfield

<b>Worksite Reference</b>	<b>Measurement Reference</b>	<b>Address</b>
BLR	BLR-N1	The Vicarage, School Lane, Hints, Tamworth
SRO	SRO-N1	Sutton Road, Drayton Bassett, Mile Oak, Lichfield
	SRO-N2	White House Farm
	SRO-V1	Sutton Road, Drayton Bassett, Mile Oak, Lichfield
	SRO-V2	Bangley Lane, Hints, Lichfield, Staffordshire, England

## 2 Summary of Results

### 2.1 Summary of Measured Noise and Vibration Levels

2.1.1 Table 3 presents a summary of the measured noise levels at the monitoring locations over the reporting period. The  $L_{Aeq,T}$  is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period  $L_{Aeq,T}$  that was found to occur within the month.

Table 3: Summary of Measured dB LAeq Data over the Monitoring Period

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average LAeq,T (Highest Day LAeq,T)					Saturday Average LAeq,T (Highest Day LAeq,T)					Sunday / Public Holiday Average LAeq,T (Highest Day LAeq,T)	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
SLE	SLE-N1	Traveller Site, Shaw Lane	Free-field	59.1 (62.8)	60.4 (62.5)	58.5 (62.1)	58.1 (62.3)	54.3 (61.1)	56.0 (58.9)	58.1 (58.6)	56.9 (58.4)	57.9 (62.5)	45.7 (56.7)	52.4 (58.7)	49.4 (56.8)
FEW	FEW-N1	Wood End Farm, Wood End Lane	Free-field	62.9 (64.1)	62.2 (63.6)	60.3 (61.2)	58.1 (60.3)	56.2 (61.4)	57.6 (57.8)	60.7 (61.1)	60.7 (61.2)	58.7 (61.3)	52.8 (56.7)	58.3 (61.4)	54.5 (60.4)
SCRS	SCRS-N1	West of Manor House, Burton Road, Streethay	Free-field	55.6 (60.8)	58.3 (60.7)	54.6 (59.0)	53.4 (57.4)	52.2 (59.1)	53.6 (57.3)	57.5 (59.5)	55.3 (57.3)	54.9 (58.8)	51.1 (62.4)	54.4 (57.8)	49.7 (57.0)
	SCRS-N2	Kings Orchard Marina, Broad Ln, Huddlesford	Free-field	54.6 (58.9)	54.7 (57.1)	53.4 (56.4)	52.3 (56.4)	51.4 (59.0)	50.4 (53.2)	52.6 (54.7)	52.8 (54.1)	51.4 (54.4)	46.0 (50.2)	50.9 (53.5)	49.4 (57.1)
SSL	SSL-N1	Ash Tree Lane, Hill Farm, Fradley and Streethay	Free-field	59.4 (63.5)	60.2 (62.9)	58.9 (61.1)	57.5 (60.2)	56.4 (62.9)	55.1 (56.5)	57.5 (60.5)	58.2 (61.6)	57.7 (61.6)	52.3 (60.3)	56.8 (59.4)	54.1 (61.7)
CLC	CLC-N1	Ivy Cottage, Park Lane, Fradley and Streethay, Whittington	Free-field	60.1 (65.9)	61.1 (65.4)	58.1 (61.5)	56.7 (60.2)	53.6 (60.3)	56.3 (57.4)	58.8 (61.1)	58.2 (60.3)	56.4 (59.5)	49.5 (55.2)	55.4 (58.4)	50.8 (59.5)
	CLC-N3	Fulfen Barn, Cappers Lane	Free-field	58.5 (64.3)	59.3 (65.0)	58.7 (61.5)	57.3 (61.0)	55.6 (63.4)	55.9 (57.3)	58.3 (63.0)	59.2 (64.4)	62.2 (79.5)	51.5 (56.6)	55.9 (63.9)	52.4 (60.8)
	CLC-N4	Huddlesford Lane, Fradley and Streethay	Free-field	62.0 (65.9)	64.0 (66.2)	62.6 (66.2)	61.7 (66.0)	58.4 (65.9)	59.4 (64.0)	62.1 (63.0)	61.0 (63.3)	62.0 (65.8)	48.6 (59.1)	53.8 (63.4)	53.1 (64.4)



Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Saturday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Sunday / Public Holiday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
WCC	WCC-N1	Whittington Hill Farm, Darnford Lane, Whittington	Free field	52.2 (59.3)	51.9 (58.5)	50.8 (53.8)	49.9 (55.6)	48.4 (61.4)	48.6 (53.9)	50.3 (52.6)	50.2 (53.0)	49.5 (54.5)	48.1 (68.5)	49.3 (54.6)	45.1 (53.4)
TROS	TROS-N1	South Lodge, Tamworth Road, Whittington	Free-field	61.3 (64.4)	60.8 (64.6)	59.3 (61.3)	56.9 (60.0)	52.4 (60.1)	54.7 (54.9)	60.6 (61.3)	61.2 (61.4)	59.3 (61.7)	50.1 (55.8)	56.6 (60.2)	50.8 (59.4)
	TROS-N2	The Bungalow, Tamworth Road, Whittington	Free-field	49.2 (54.8)	49.5 (59.4)	45.2 (50.7)	44.9 (59.2)	42.9 (55.8)	43.0 (43.9)	47.0 (48.4)	44.1 (45.0)	44.8 (47.1)	39.1 (43.4)	46.3 (56.5)	39.7 (49.6)
N23	N23-N1	21 Roman Road	Free-field	58.4 (61.6)	58.2 (61.2)	56.1 (58.9)	53.6 (56.6)	51.8 (59.1)	51.3 (52.6)	55.6 (60.6)	54.6 (59.0)	54.9 (58.8)	46.3 (48.6)	53.5 (58.6)	50.0 (59.5)
BLR	BLR-N1	The Vicarage, School Lane, Hints, Tamworth	Free-field	49.2 (52.3)	49.4 (61.4)	46.0 (49.4)	45.1 (50.7)	43.1 (49.0)	43.1 (44.9)	46.9 (50.4)	46.3 (49.8)	45.2 (49.9)	39.2 (45.6)	45.9 (49.7)	41.4 (48.7)
SRO	SRO-N1	Sutton Road, Drayton Bassett, Mile Oak	Free-field	52.0 (56.2)	52.3 (55.8)	50.1 (53.8)	49.2 (52.9)	46.7 (53.5)	46.5 (47.6)	50.4 (51.7)	49.6 (52.3)	52.2 (54.7)	46.0 (50.2)	51.2 (55.4)	45.6 (52.4)
	SRO-N2	White House Farm	Free-field	49.3 (52.0)	51.0 (52.8)	47.1 (51.1)	45.3 (51.1)	43.3 (47.5)	44.8 (45.7)	48.9 (49.6)	47.6 (50.7)	47.5 (52.4)	42.3 (45.7)	47.3 (50.4)	42.7 (48.3)

2.1.2 Table 4 presents a summary of the measured vibration levels at each monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
FEW	FEW-V1	Wood End Farm, Wood End Lane	1.88 (Y-axis)
SCRS	SCRS-V1	Manor Farm House, Burton Road, Streethay	1.07 (X-axis)
CLC	CLC-V1	Ivy Cottage, Park Lane, Fradley and Streethay, Whittington	1.36 (Z-axis)
TROS	TROS-V2	The Bungalow, Tamworth Road	0.70 (Y-axis)
N23	N23-V1	21 Roman Road	0.65 (Y-axis)
SRO	SRO-V1	Sutton Road, Drayton Bassett, Mile Oak	0.73 (Y-axis)
	SRO-V2	Bangley Lane, Hints	0.68 (X-axis)

2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly  $L_{Aeq}$  values and, where relevant, the  $L_{Aeq,T}$  values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location: <https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data>.

## 2.2 Exceedances of the LOAEL and SOAEL

2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".

2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in

difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."

2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.

2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.

2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
SLE	SLE-N1	Traveller Site, Shaw Lane, Lichfield	All days	All periods	No exceedance	No exceedance
FEW	FEW-N1	Wood End Farm, Wood End Lane, Lichfield	Weekday	0800-1800	5	No exceedance
SCRS	SCRS-N1	West of Manor House, Burton Road, Streethay	All days	All periods	No exceedance	No exceedance
	SCRS-N2	Kings Orchard Marina, Broad Lane, Huddlesford,	All days	All periods	No exceedance	No exceedance
SSL	SSL-N1	Ash Tree Lane, Hill Farm, Fradley and Streethay	All days	All periods	No exceedance	No exceedance
CLC	CLC-N1	Ivy Cottage, Park Lane, Fradley and Streethay, Whittington	Weekday	0800-1800	4	No exceedance
	CLC-N3	Fulfen Barn, Cappers Lane, Lichfield	Weekday	0800-1800	1	No exceedance

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
	CLC-N4	Huddlesford Lane, Fradley and Streethay	All days	All periods	No exceedance	No exceedance
WCC	WCC-N1	Whittington Hill Farm, Darnford Lane, Whittington	All days	All periods	No exceedance	No exceedance
TROS	TROS-N1	South Lodge, Tamworth Road, Whittington, Lichfield	Weekday	0800-1800	3	No exceedance
	TROS-N2	The Bungalow, Tamworth Road, Whittington	All days	All periods	No exceedance	No exceedance
N23	N23-N1	21 Roman Road, Lichfield	All days	All periods	No exceedance	No exceedance
BLR	BLR-N1	The Vicarage, School Lane, Hints, Tamworth	All days	All periods	No exceedance	No exceedance
SRO	SRO-N1	Sutton Road, Drayton Bassett, Mile Oak, Lichfield	All days	All periods	No exceedance	No exceedance
SRO	SRO-N2	White House Farm	All days	All periods	No exceedance	No exceedance

2.2.6 Thirteen (13) exceedances of the LOAEL were recorded during weekday core working hours at the monitoring locations ref.: FEW-N1, CLC-N1, CLC-N3 and TROS-N1.

2.2.7 No exceedances of SOAEL were recorded due to HS2 construction works during January 2023.

## 2.3 Exceedances of Trigger Level

2.3.1 Table 6 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 6: Summary of Exceedances of Trigger Levels

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	Identified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-


## 2.4 Complaints


2.4.1 Table 7 provides a summary of complaint information related to noise received during the reporting period, along with the findings of any investigation.

Table 7: Summary of Complaints


Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
-	-	-	-	-


# Appendix A Site Locations

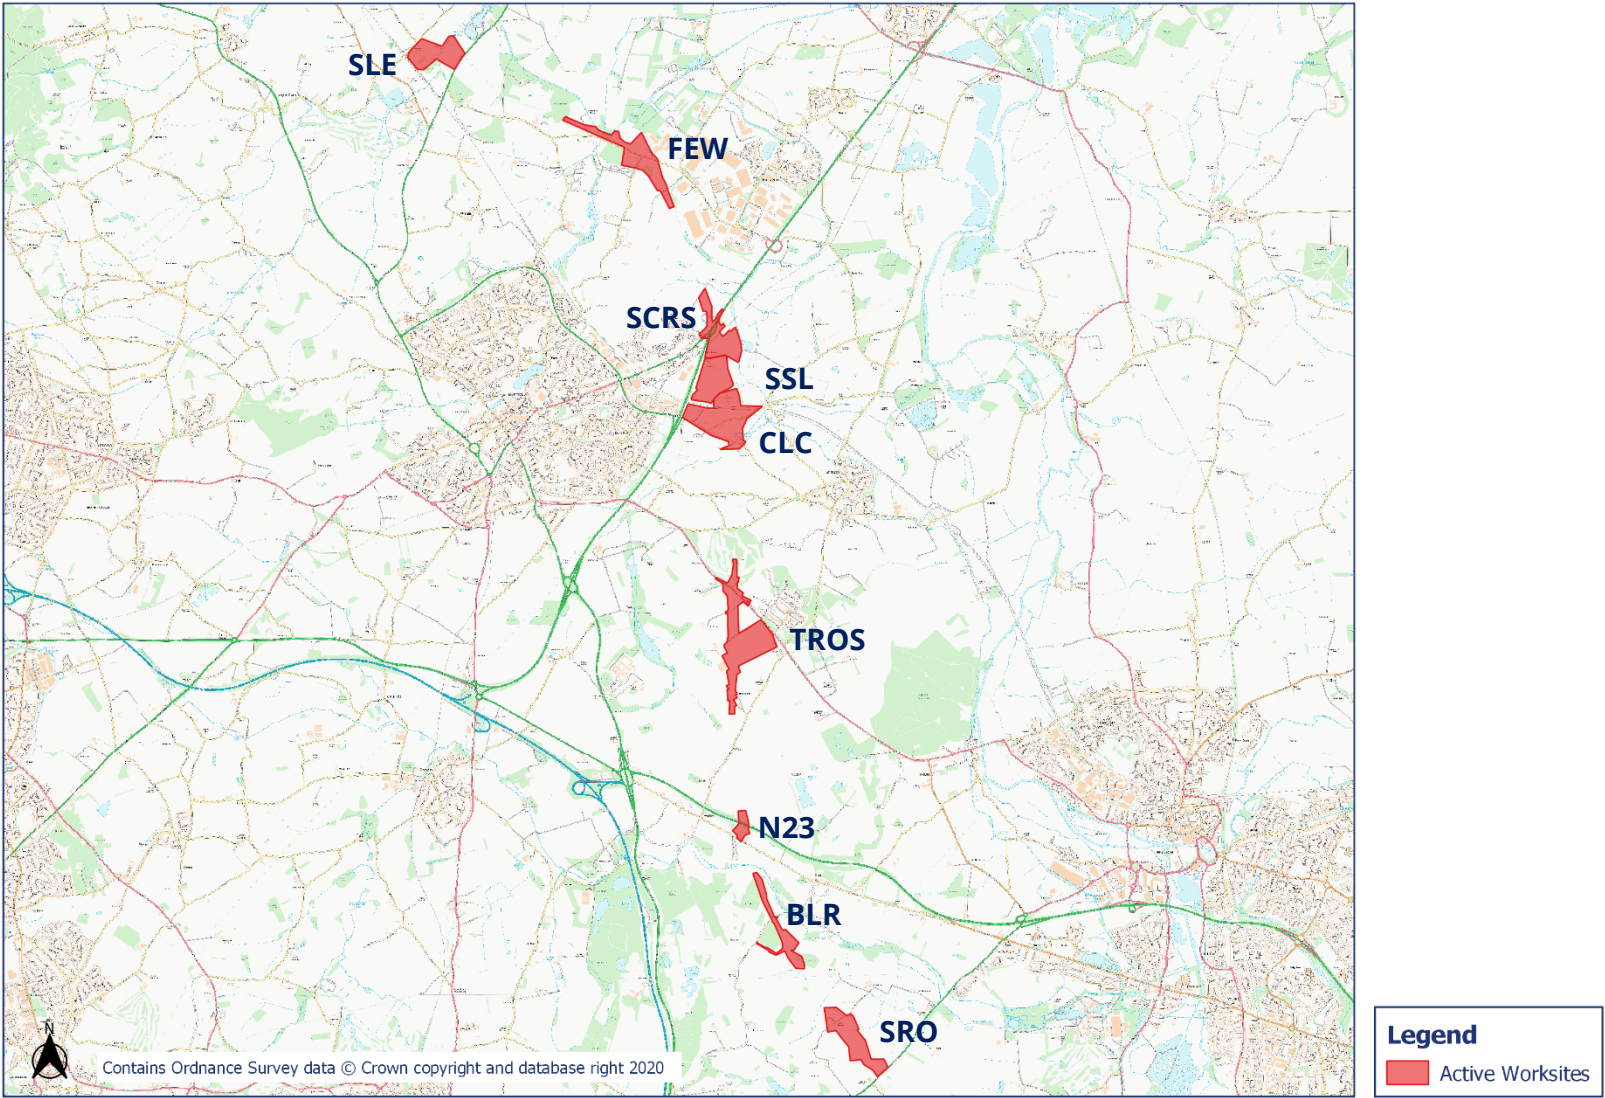


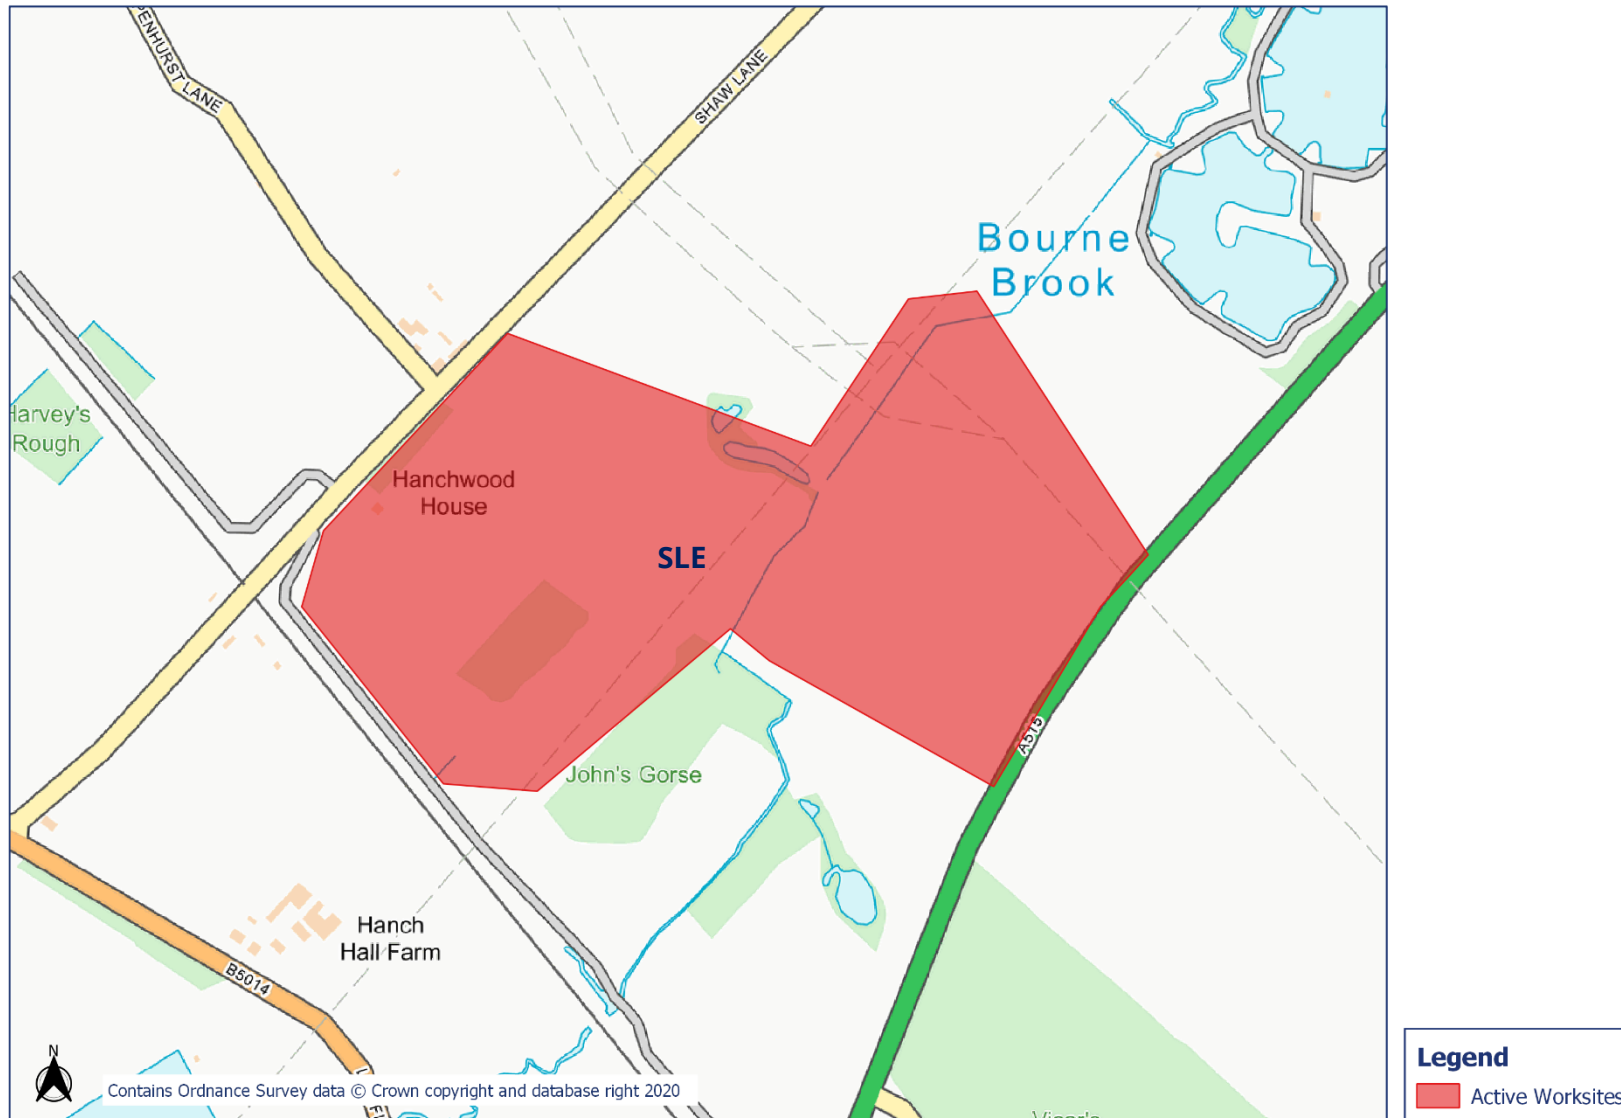




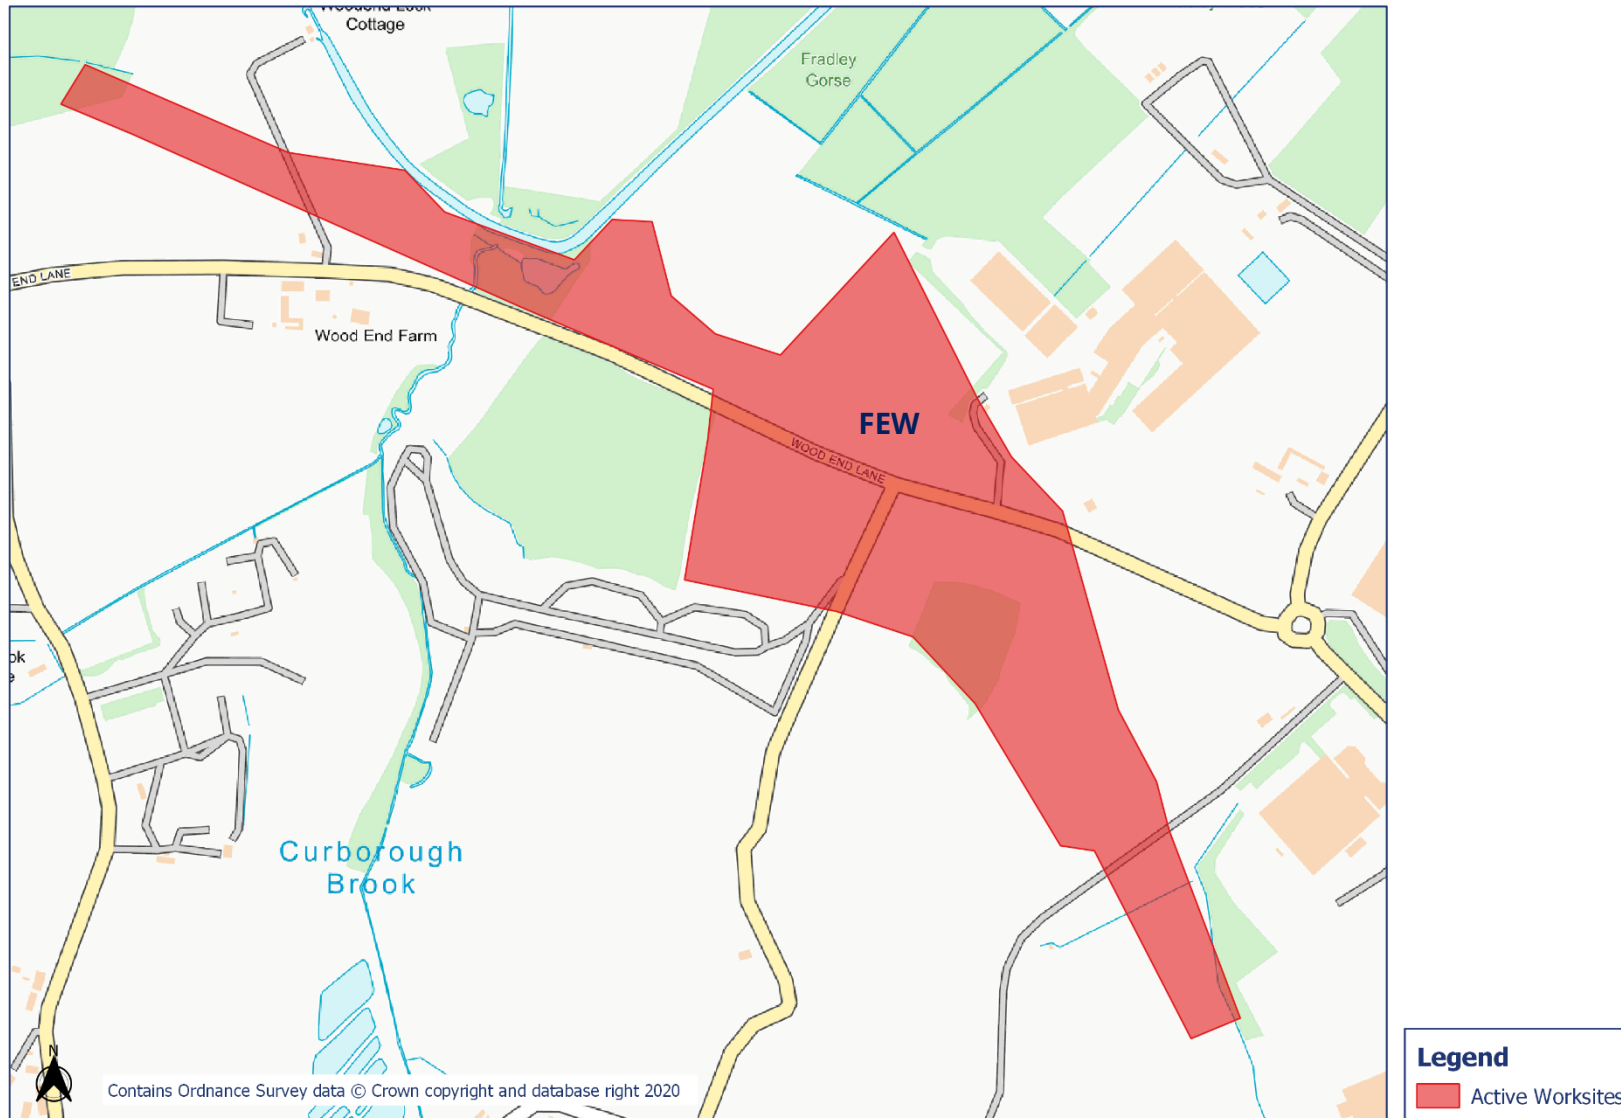

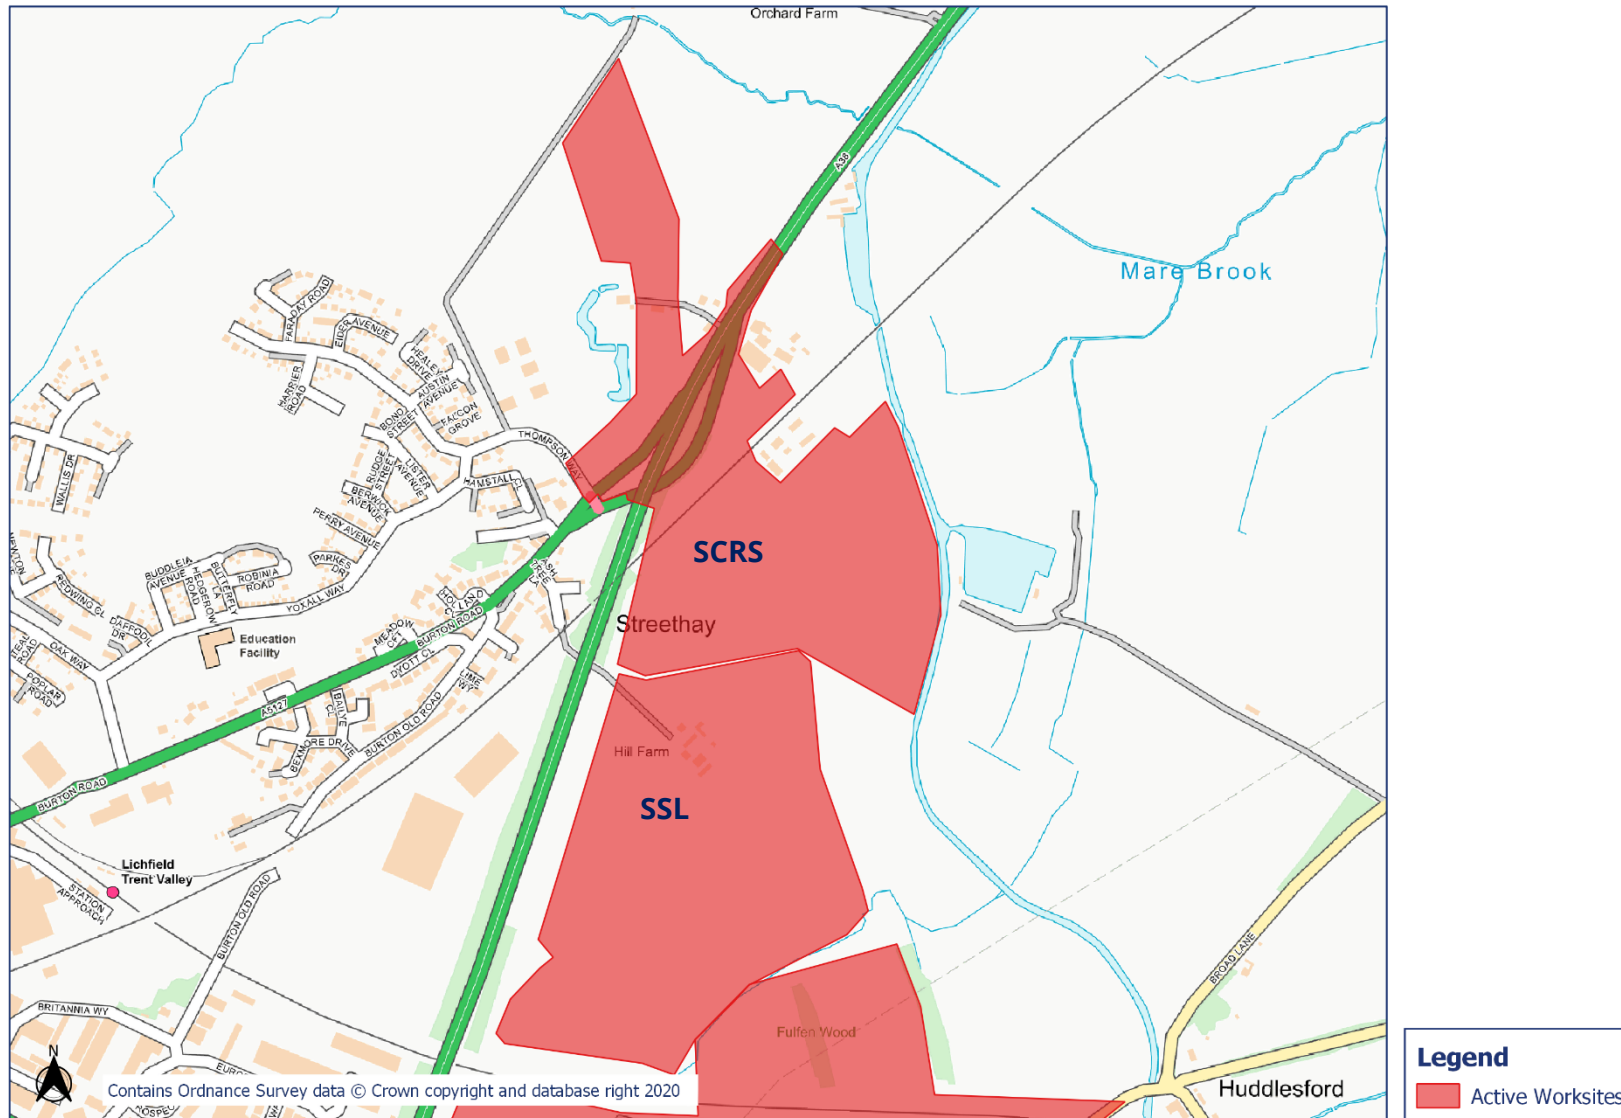


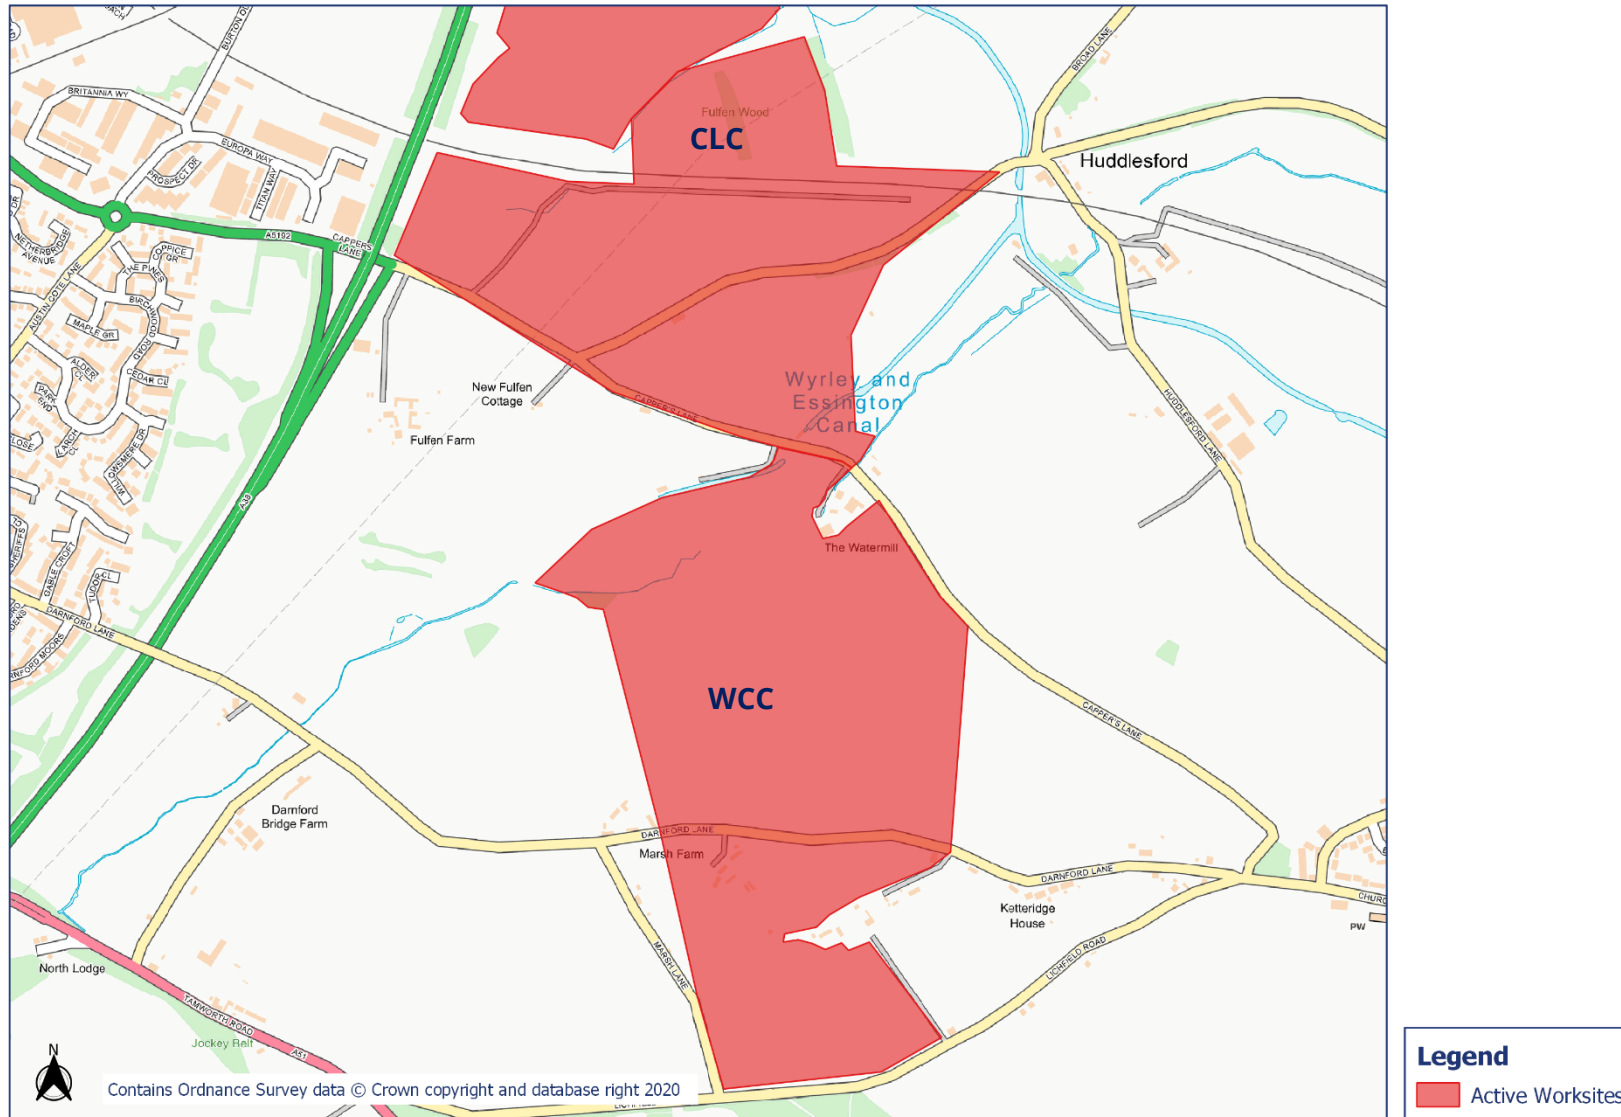


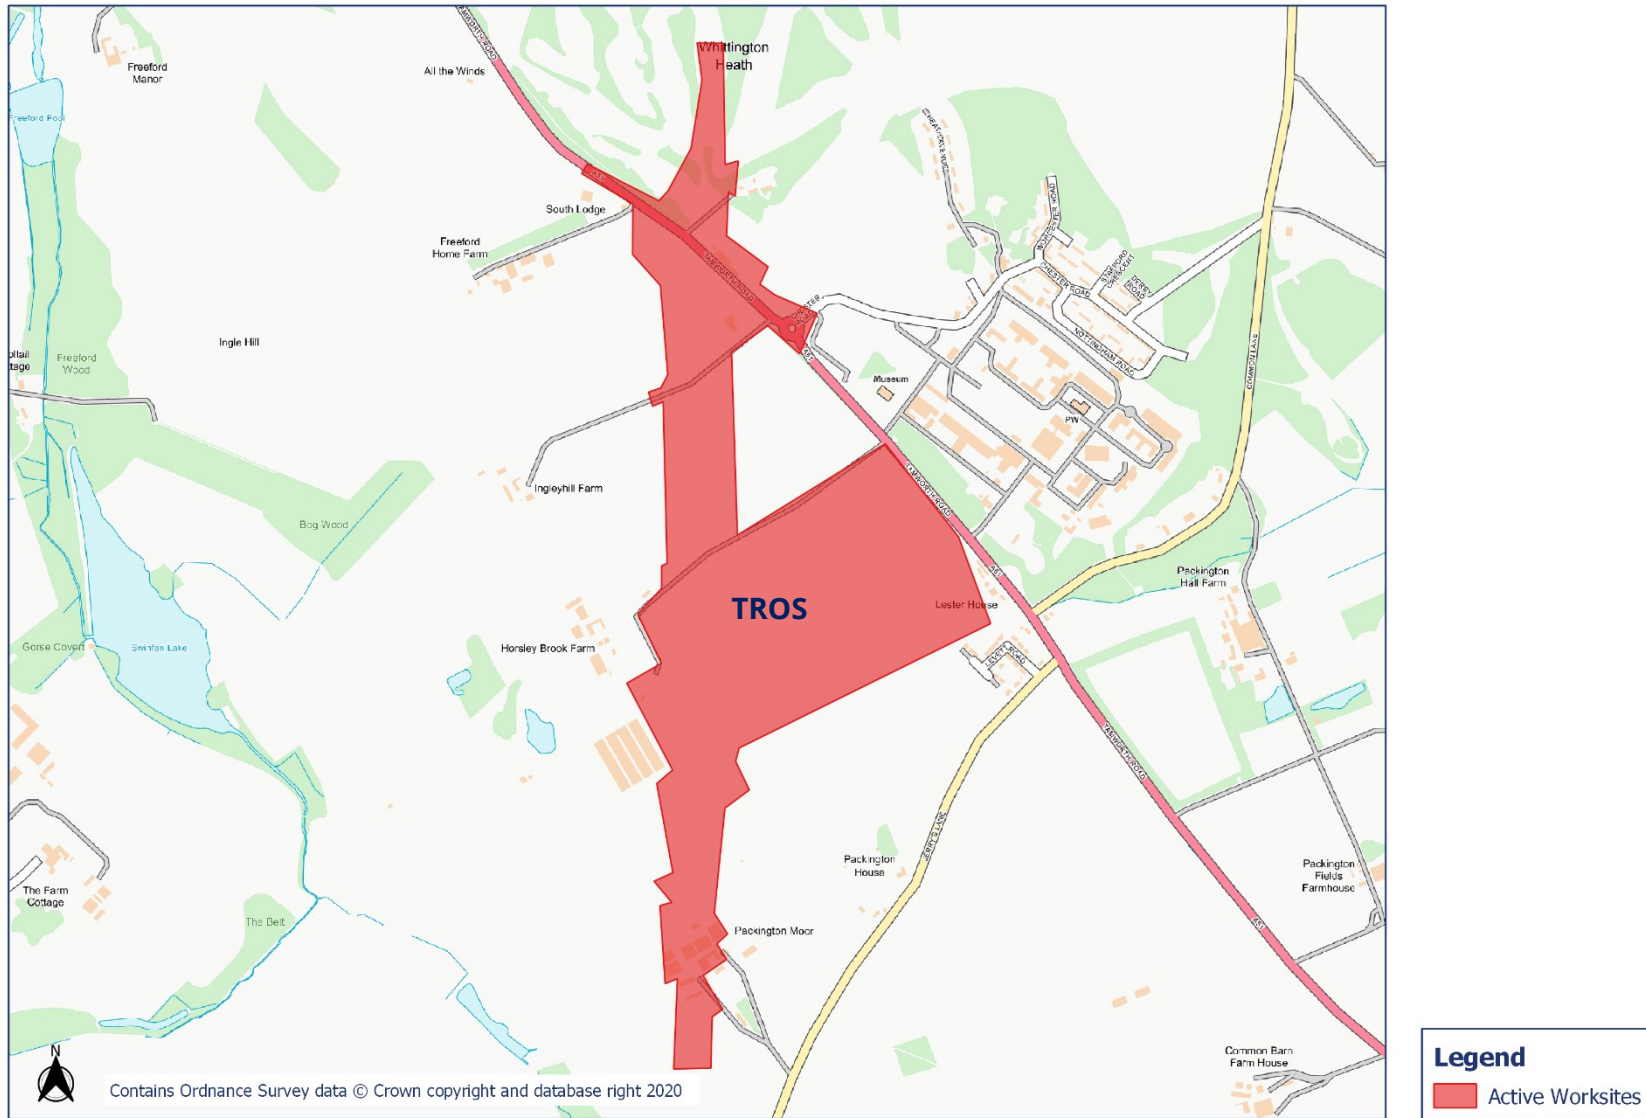






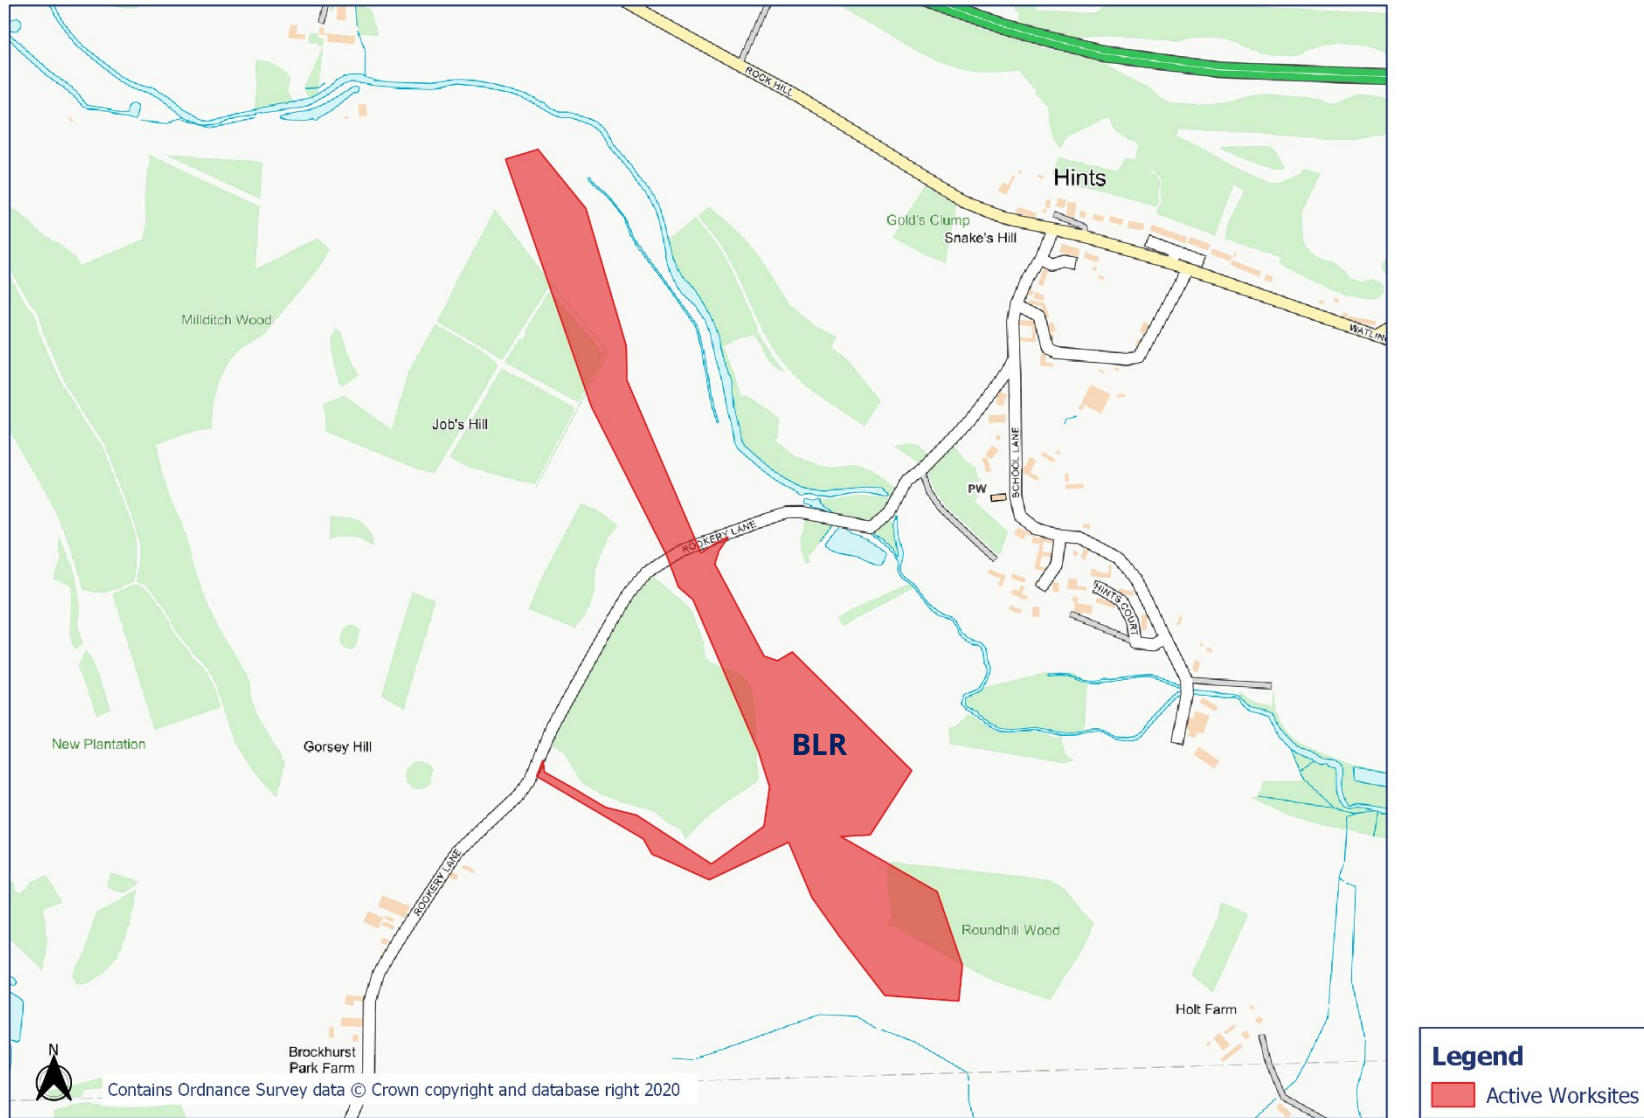


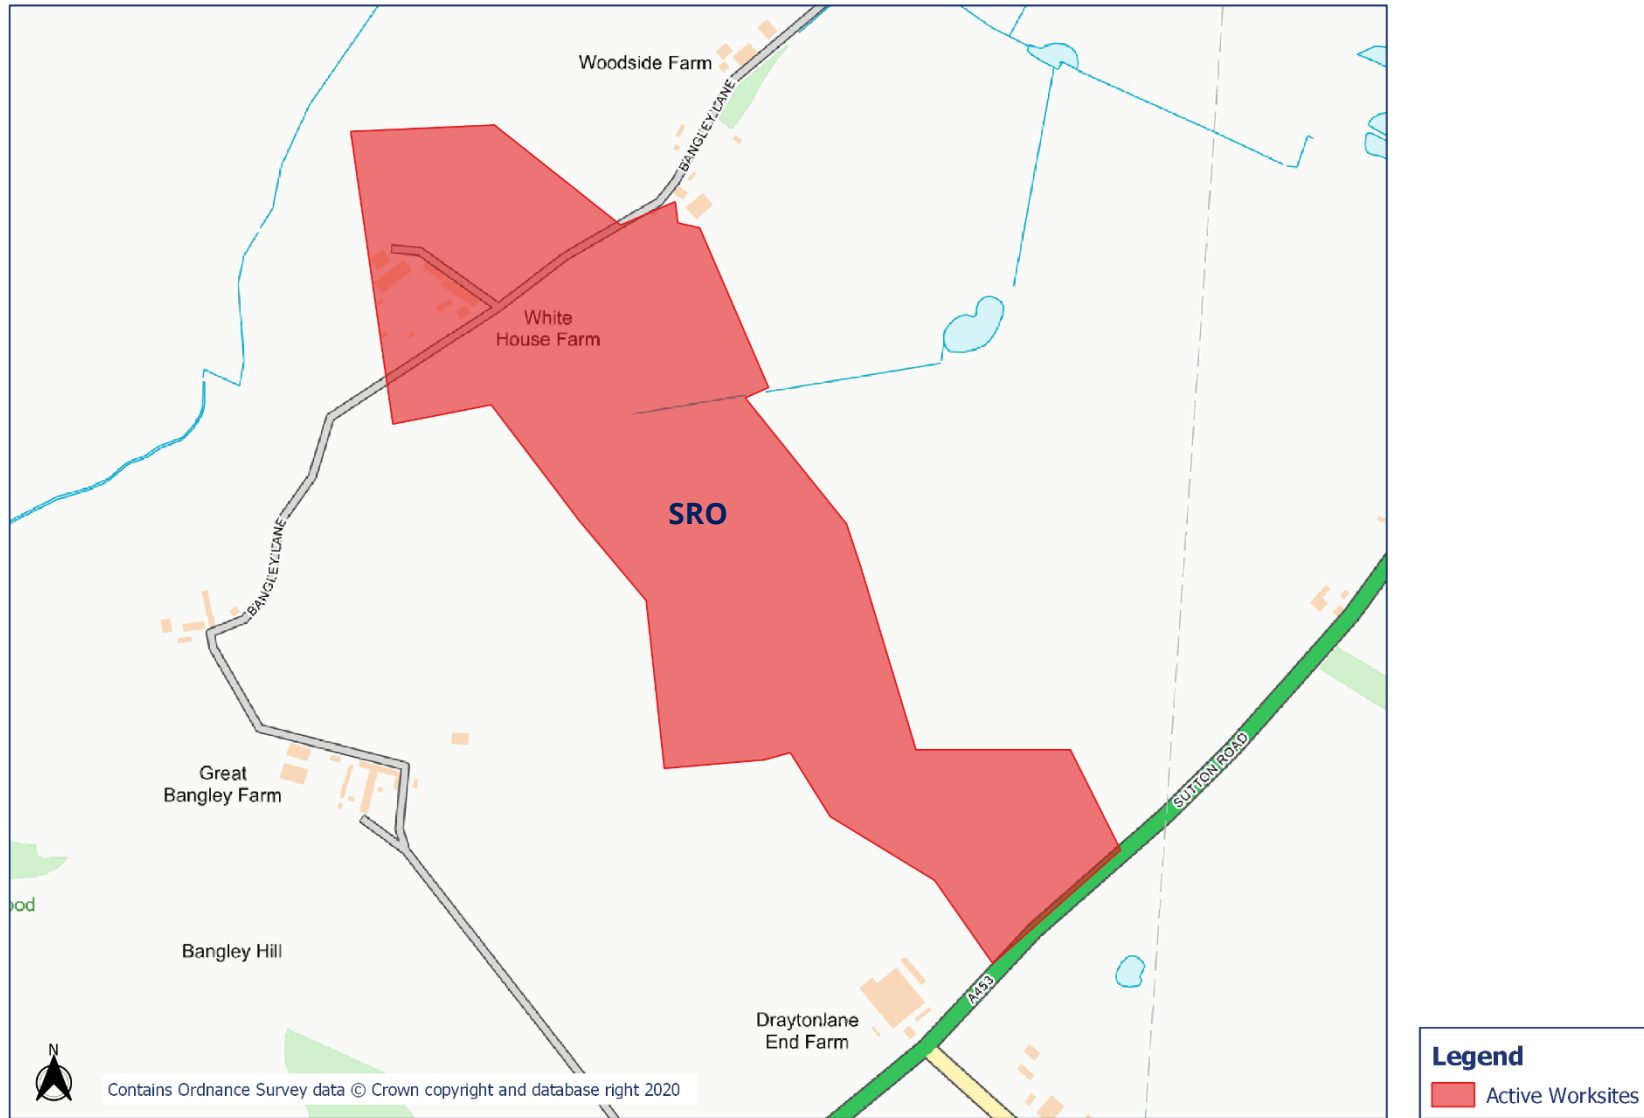



# Appendix B Monitoring Locations




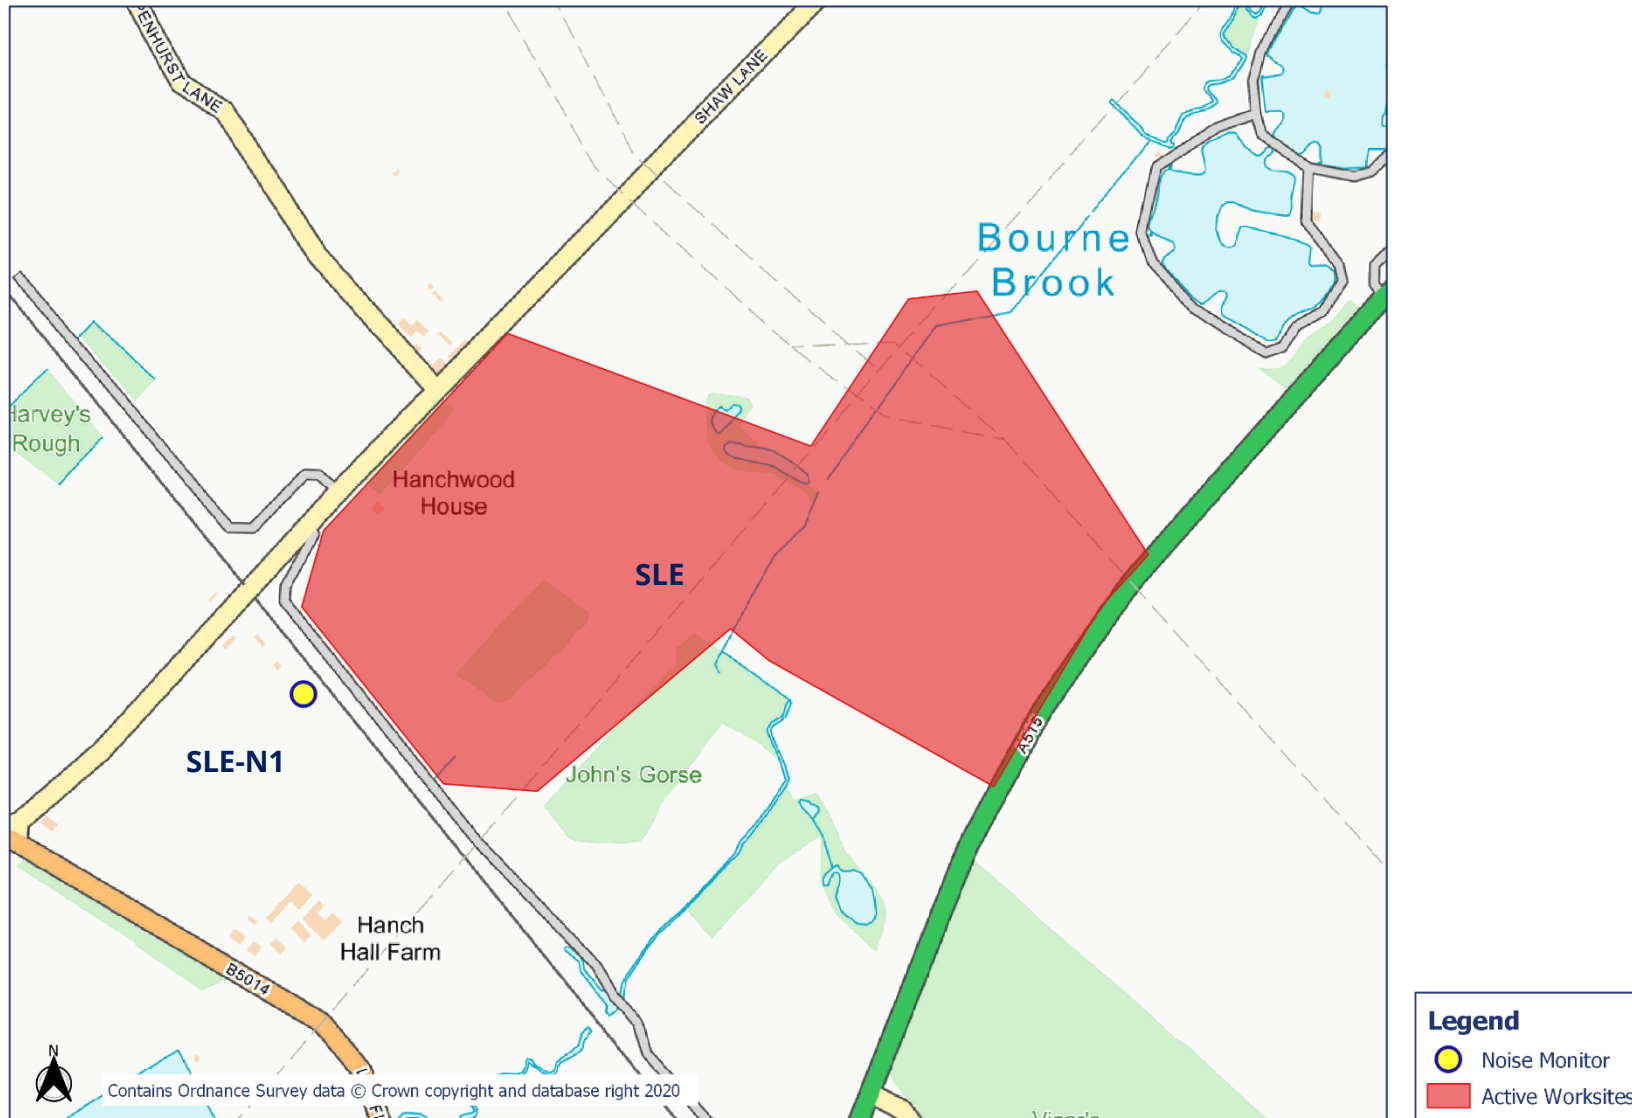

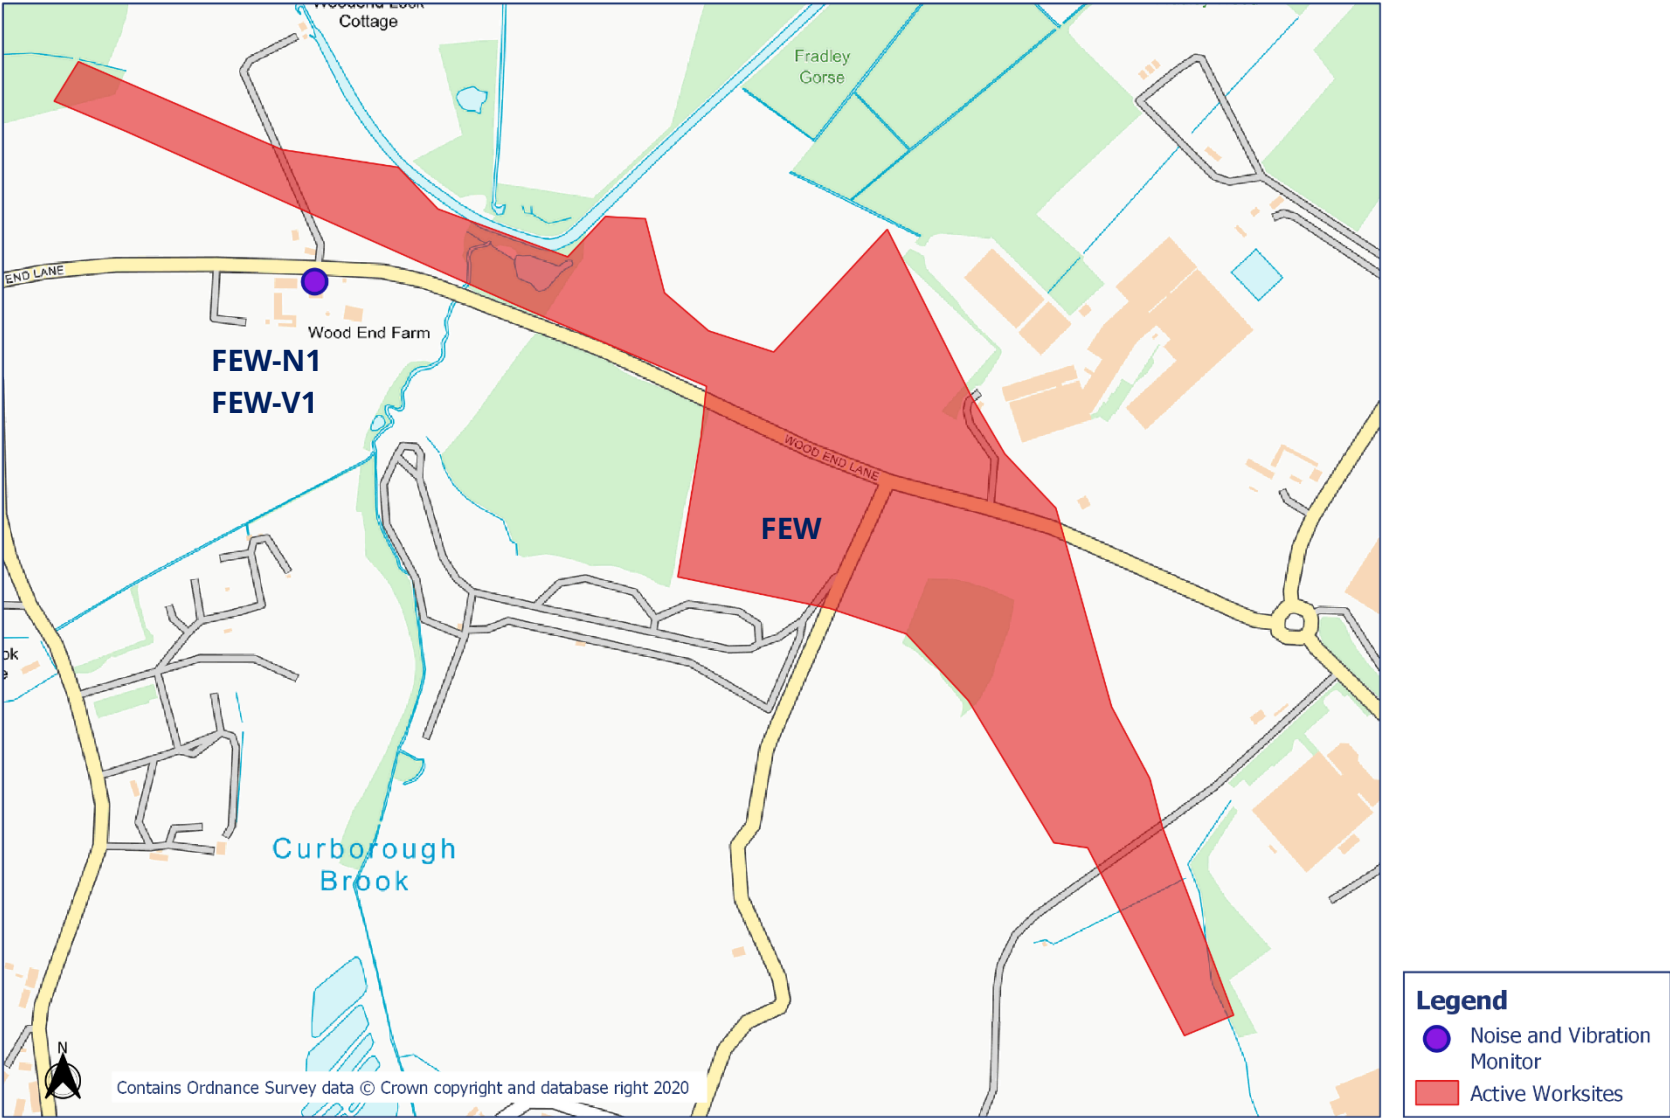

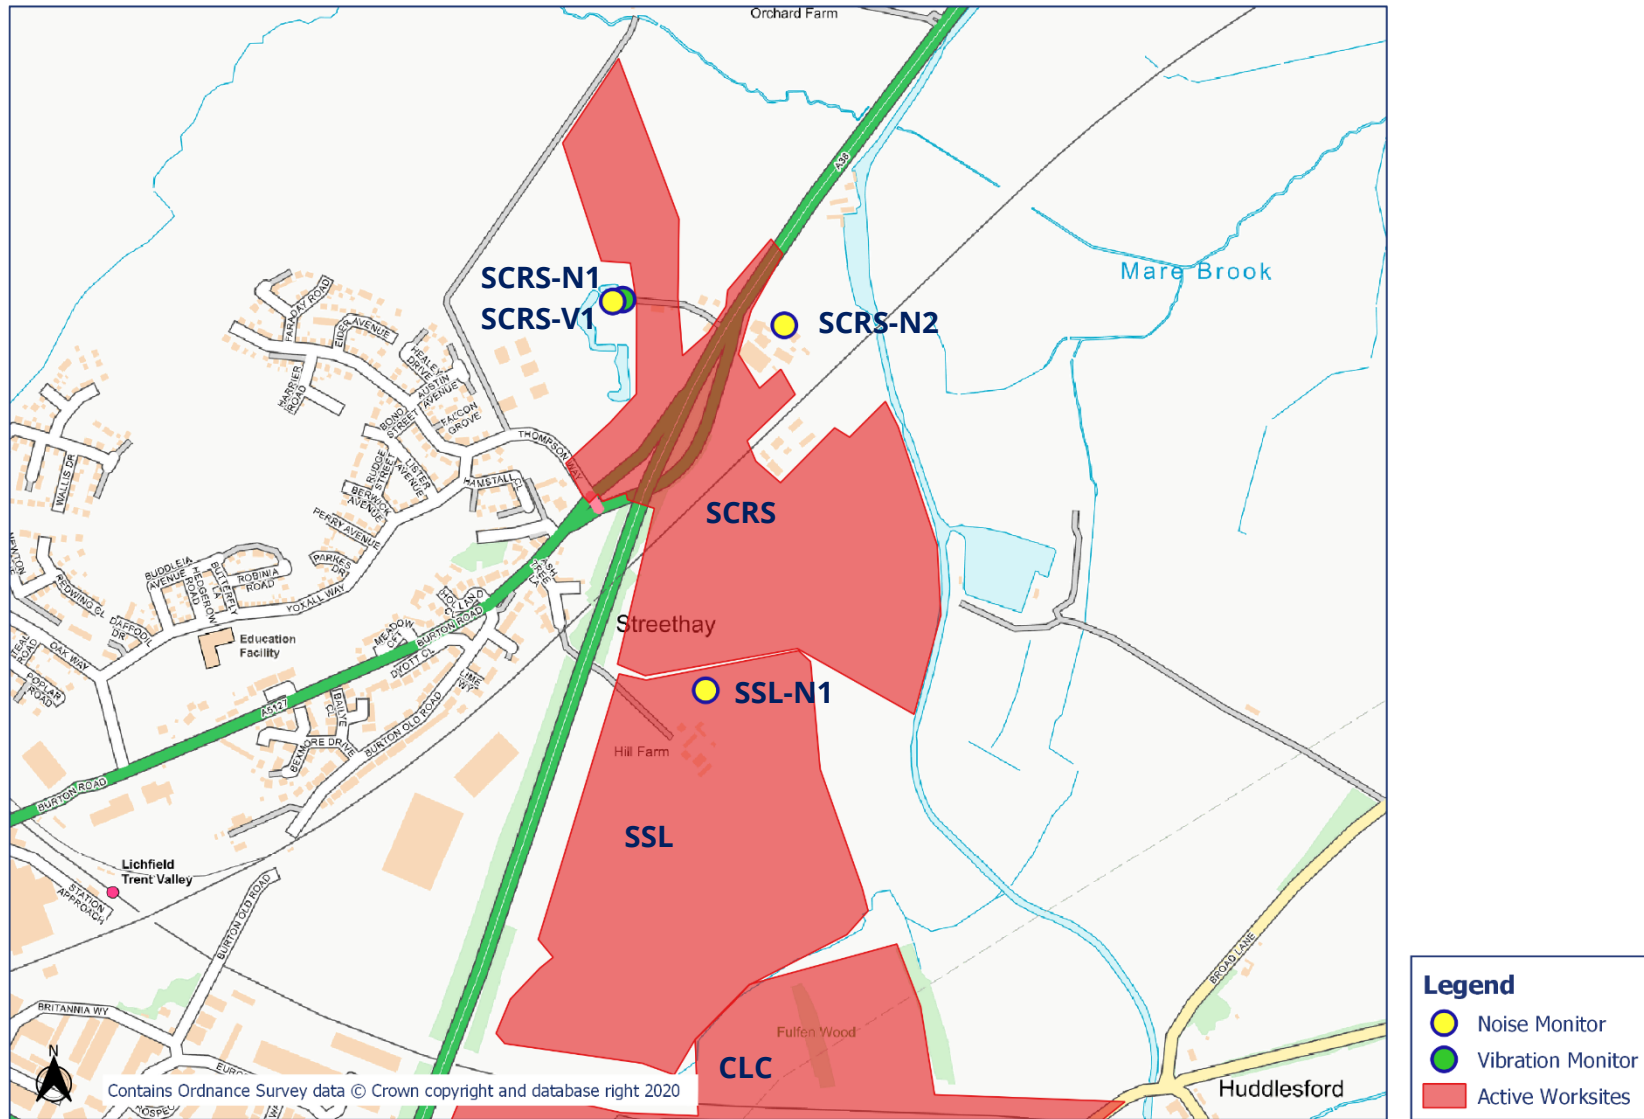


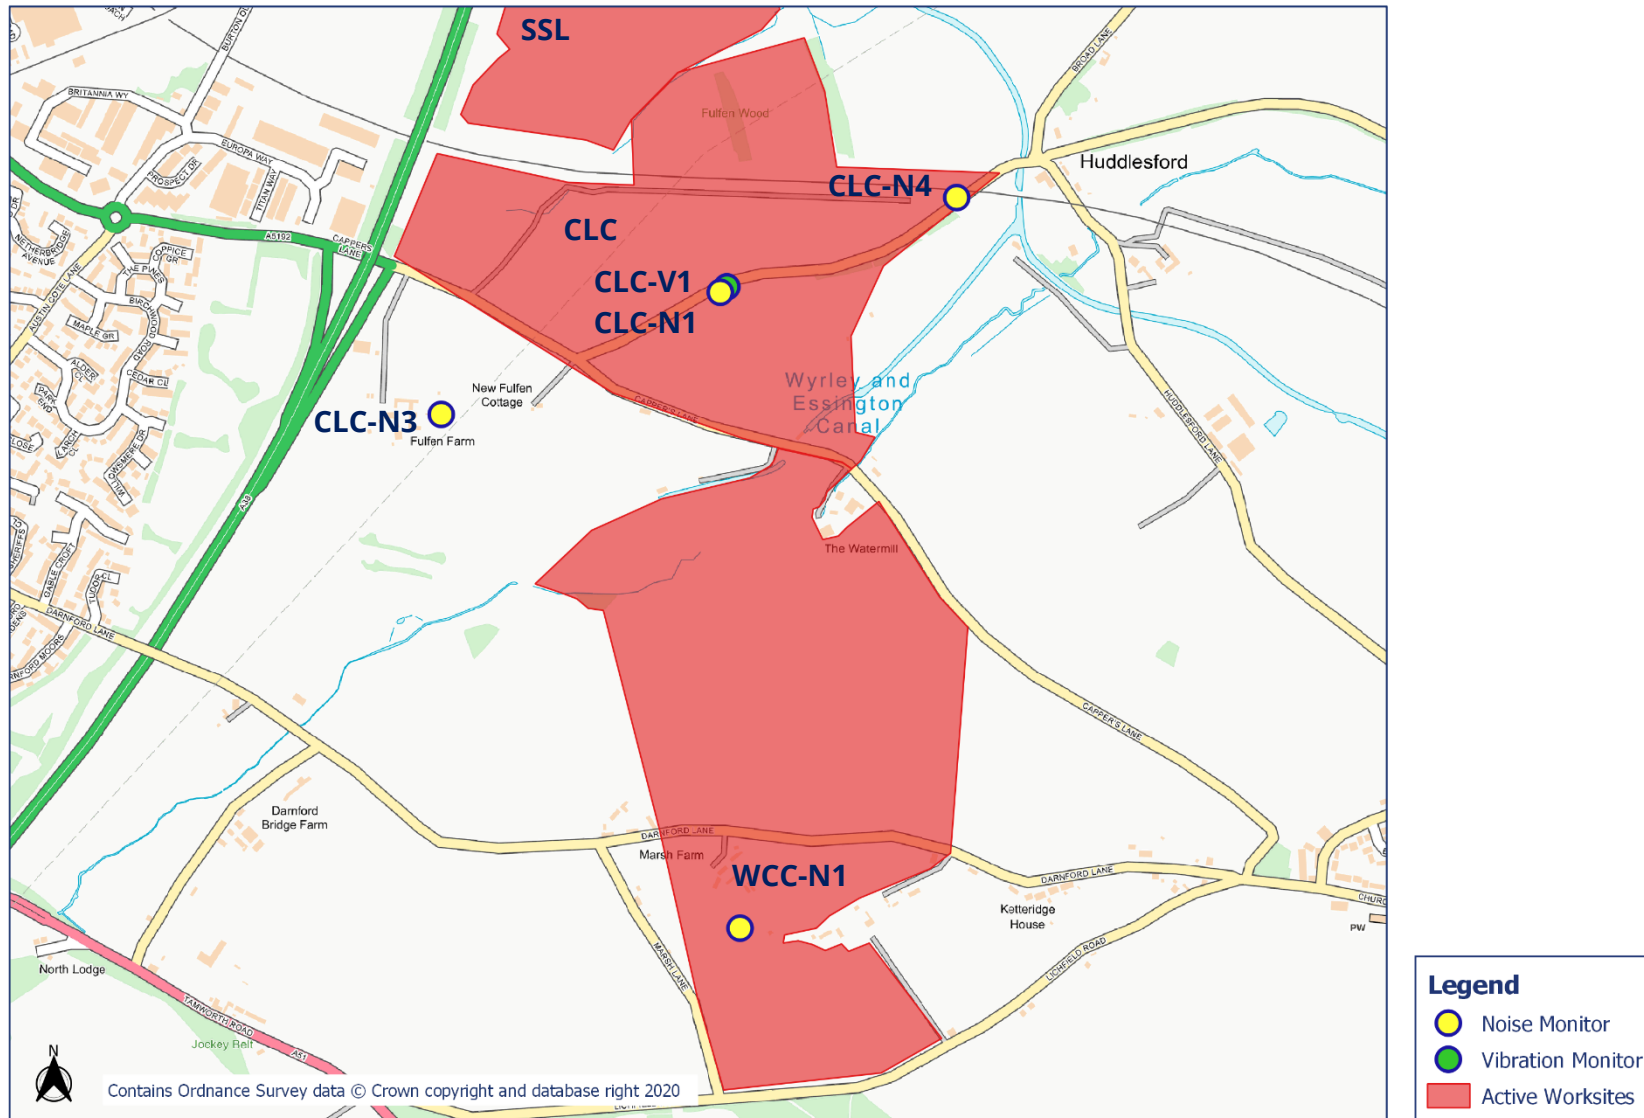


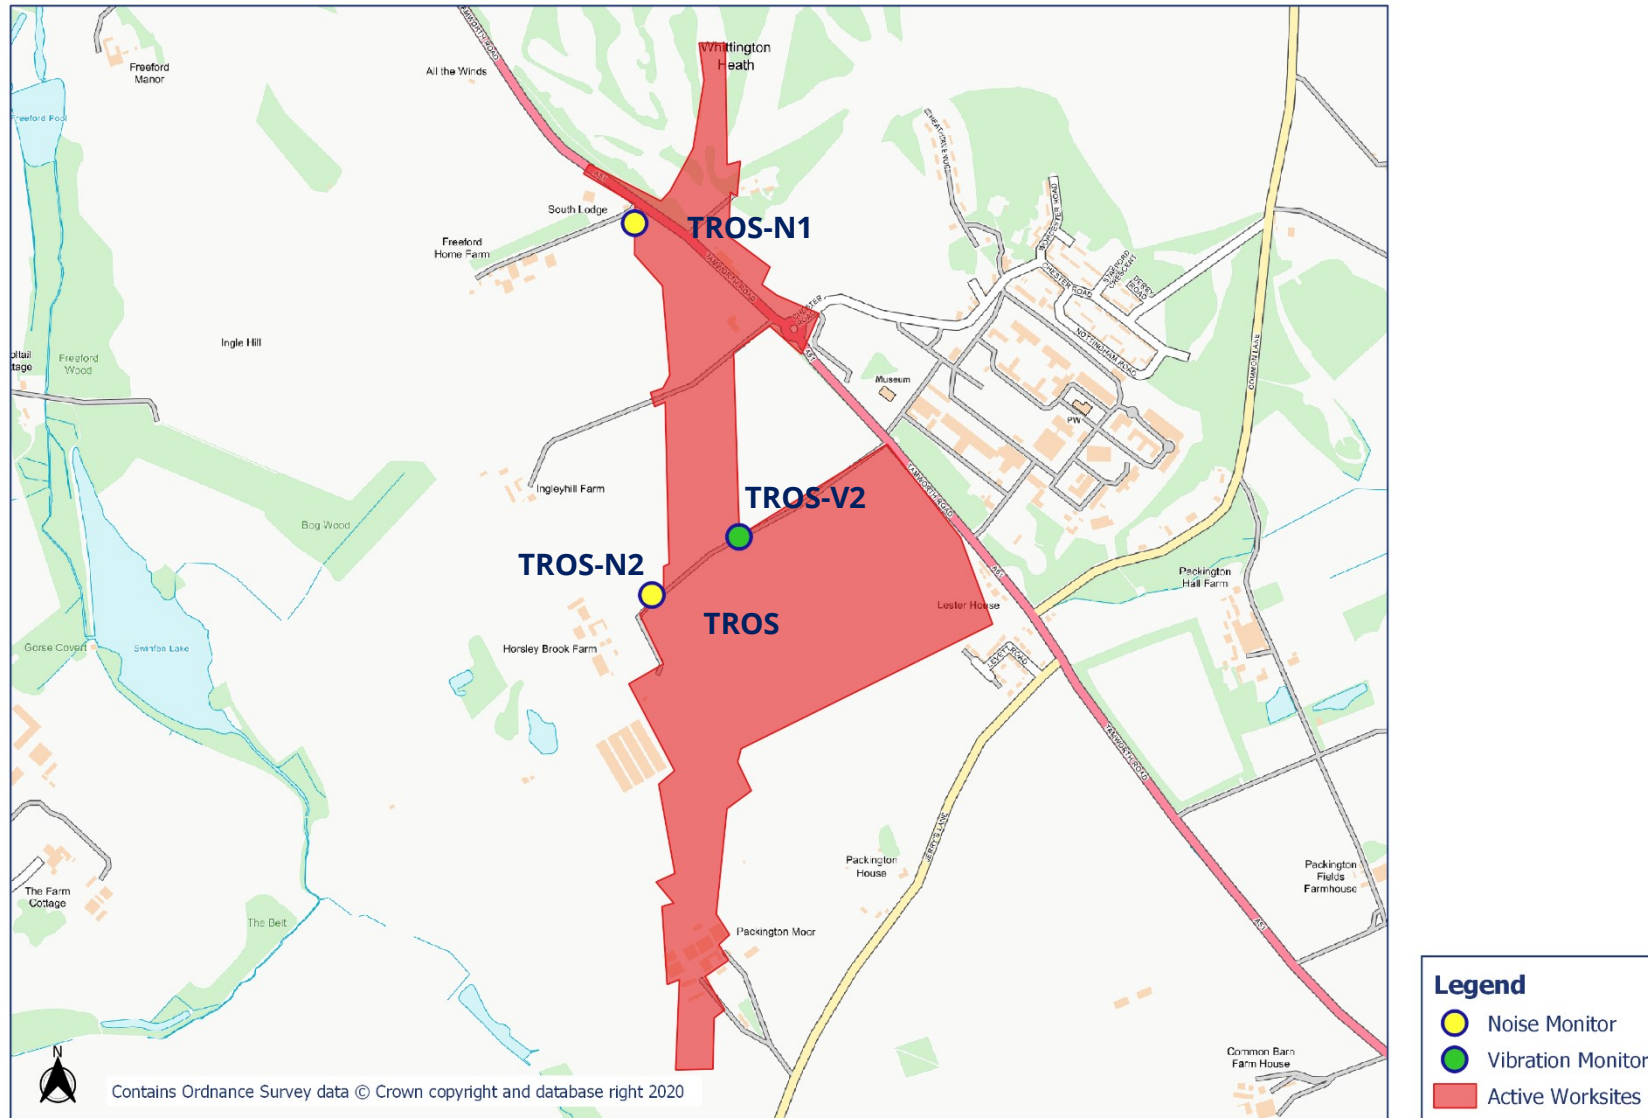





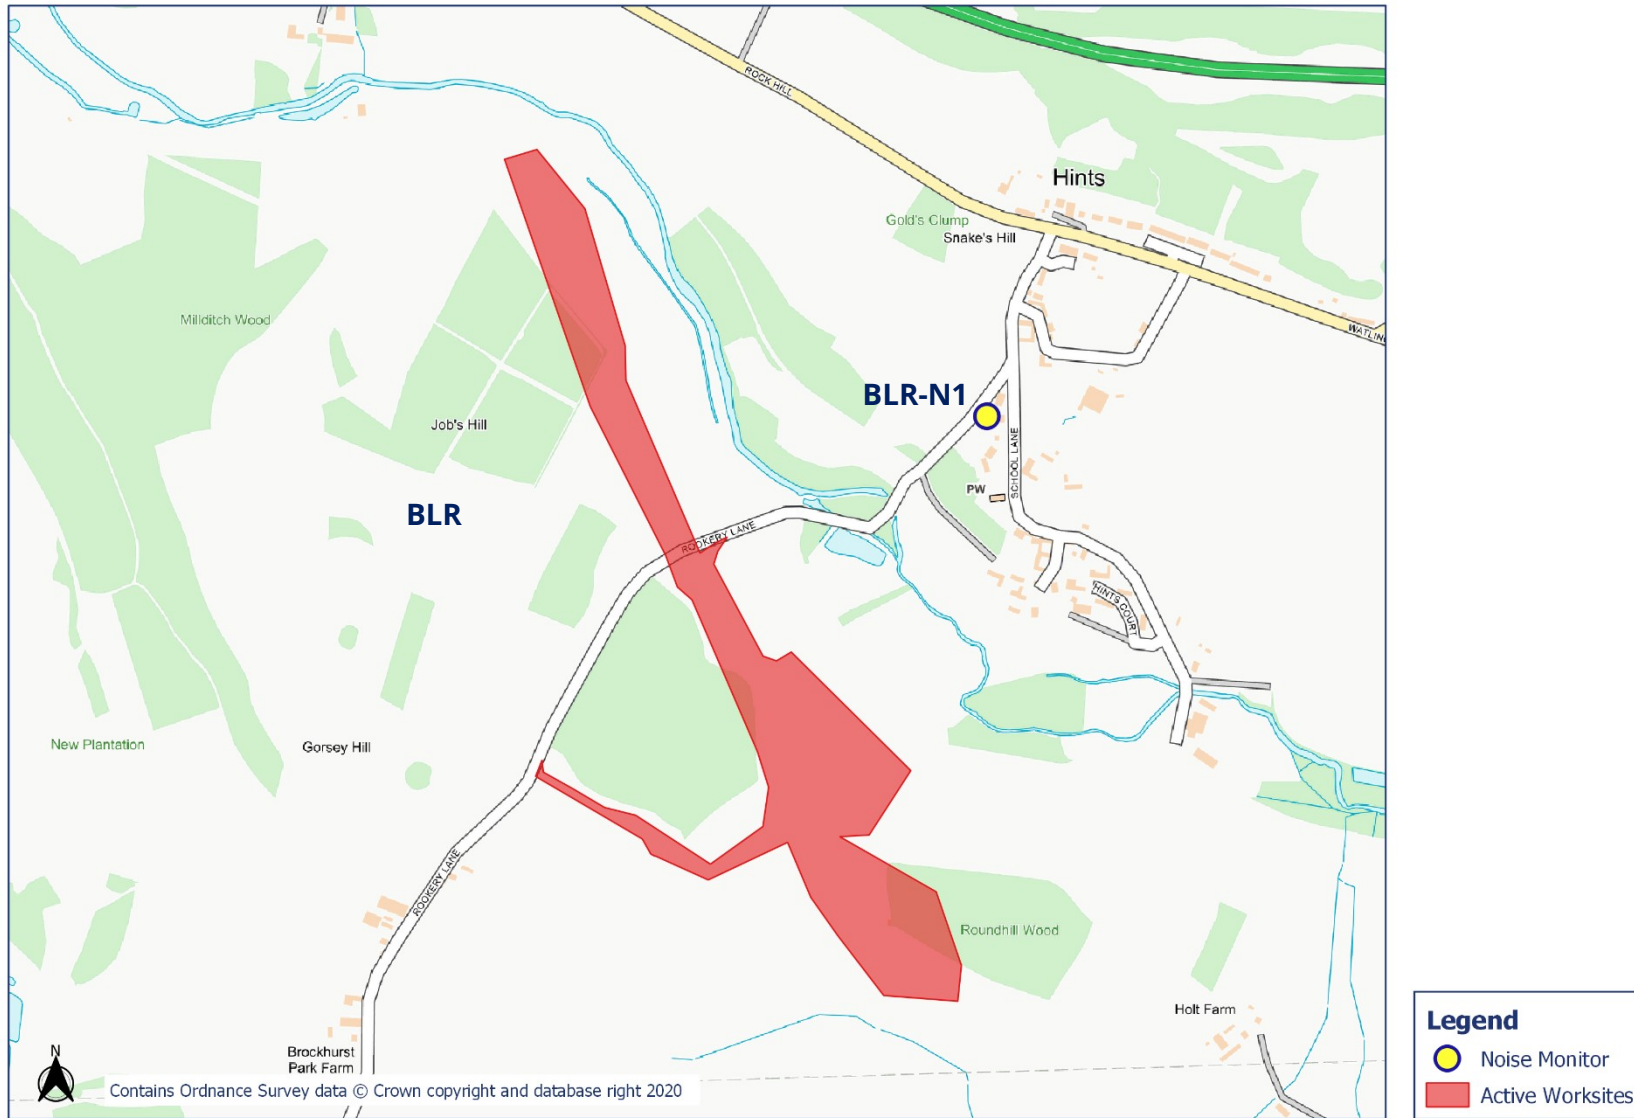

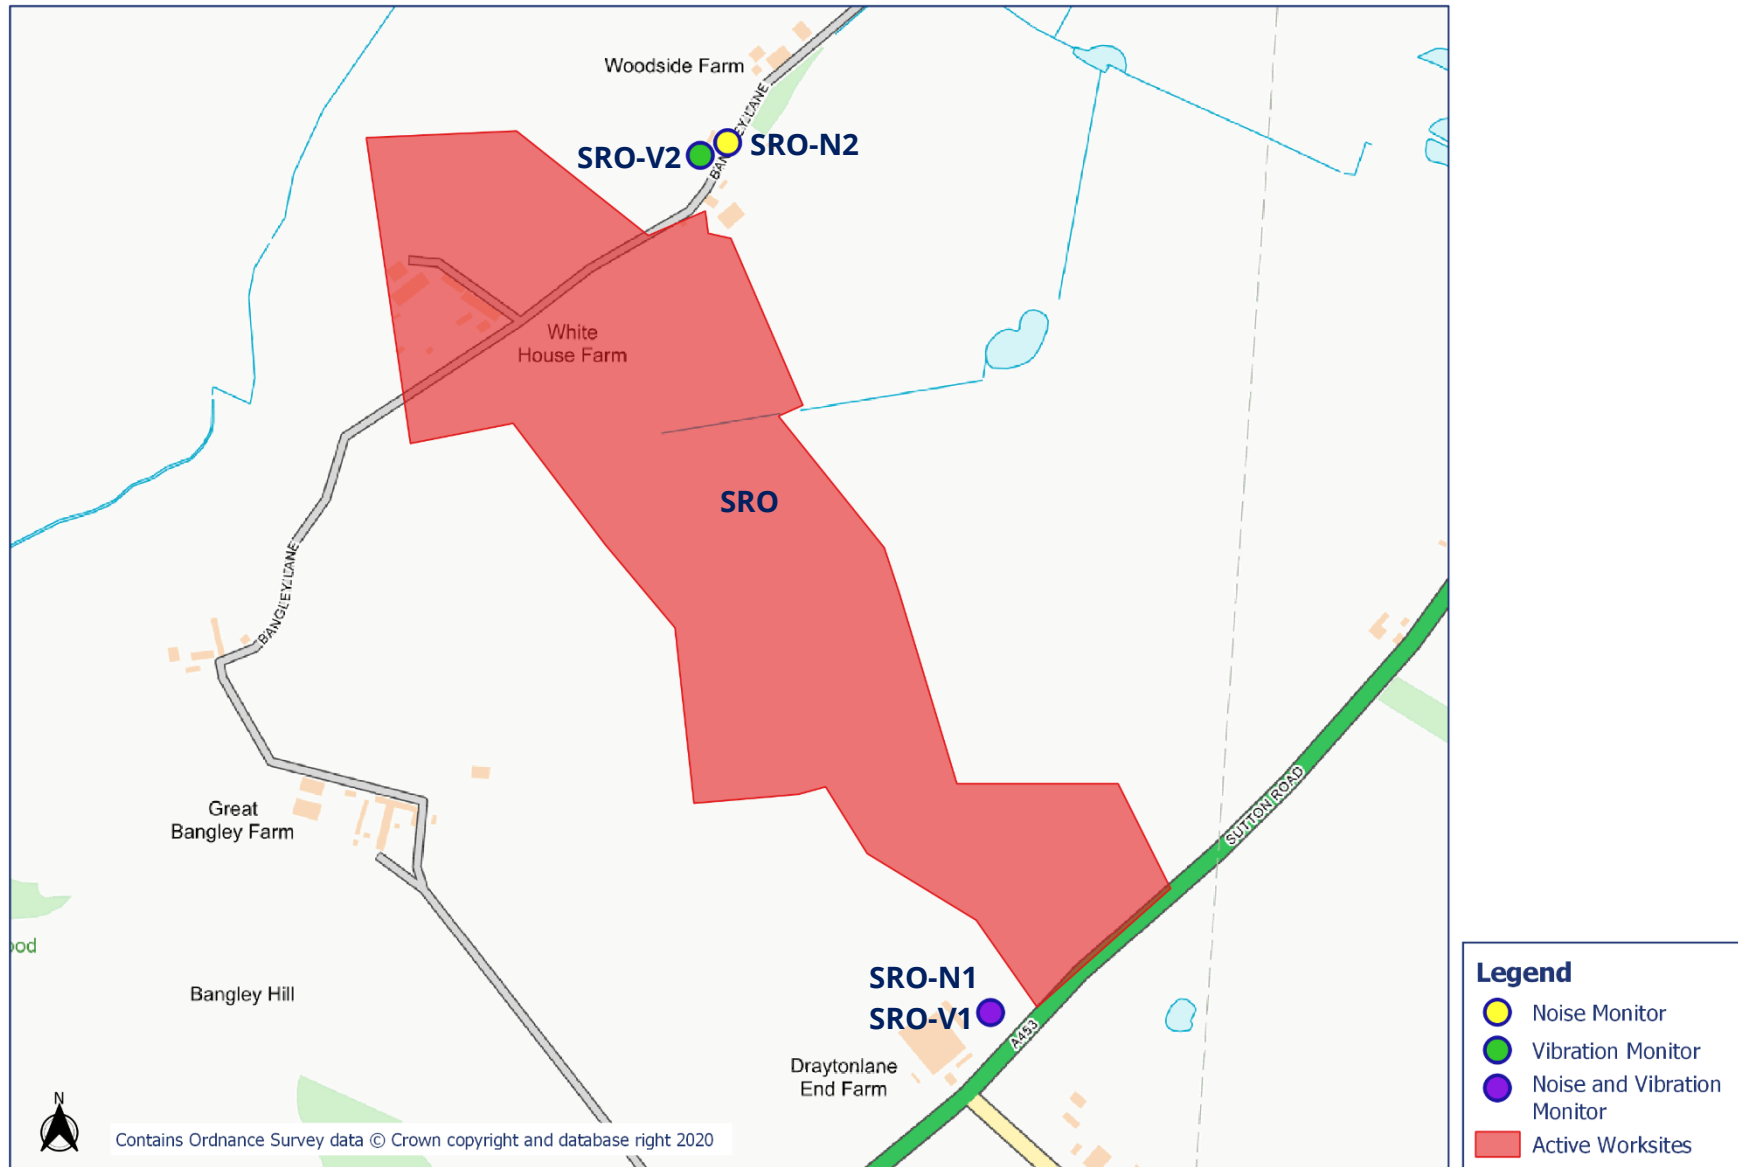








# Appendix C Data

## Noise

The following graphs show the hourly measured ambient noise level  $L_{Aeq,1h}$  and, where relevant, the averaged noise level  $L_{Aeq,T}$  values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the  $L_{Aeq,T}$  values in Table 3 of the main report.



### Worksite:SLE - Monitoring Ref: SLE-N1


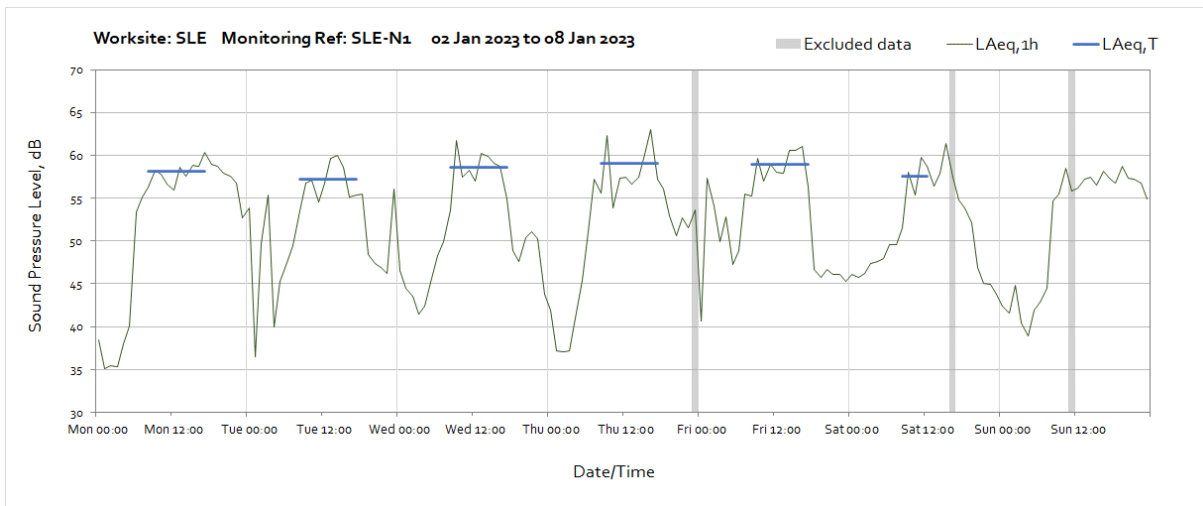
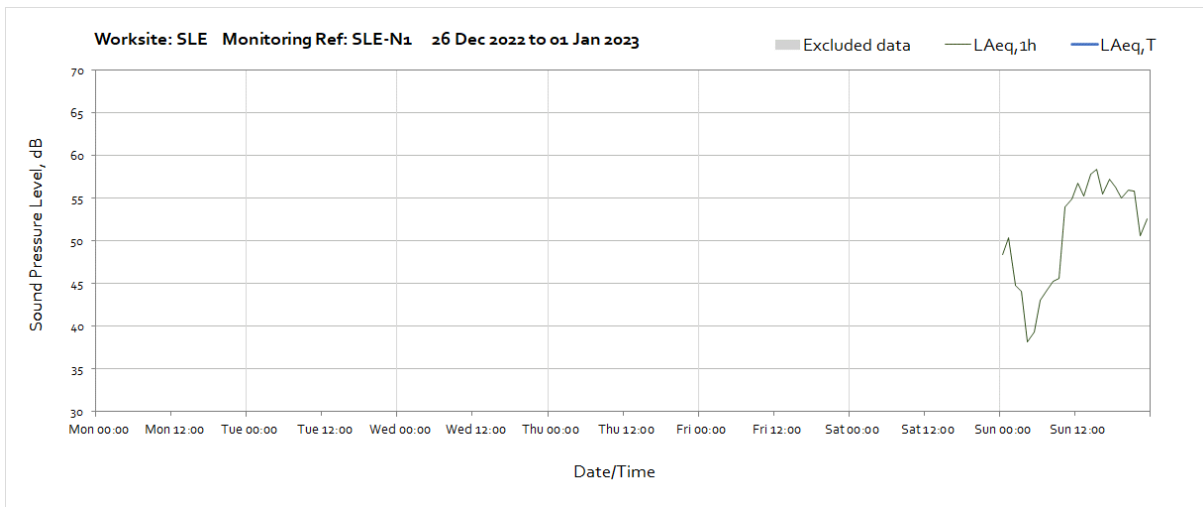


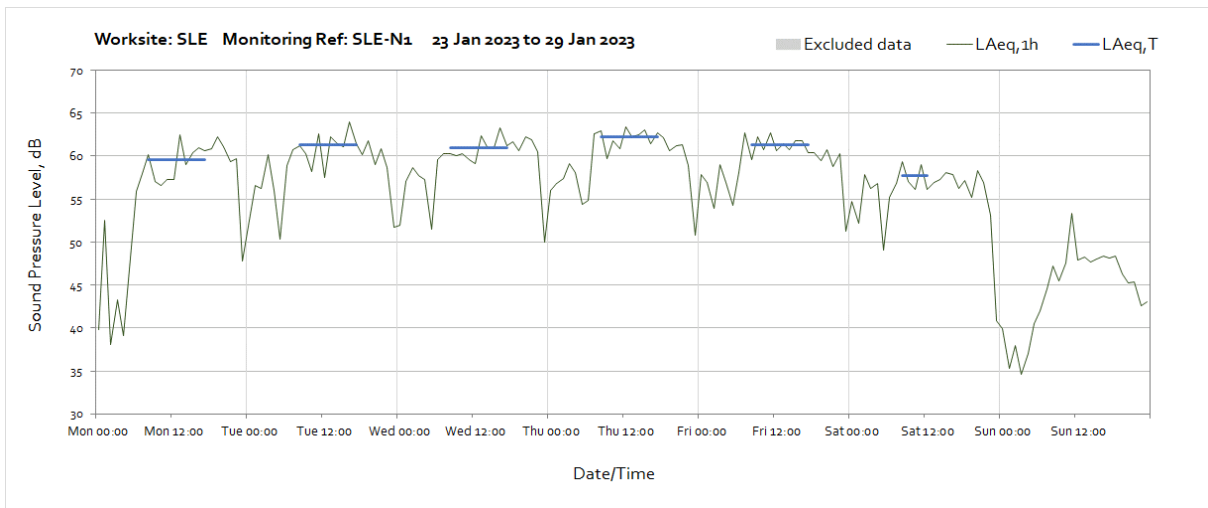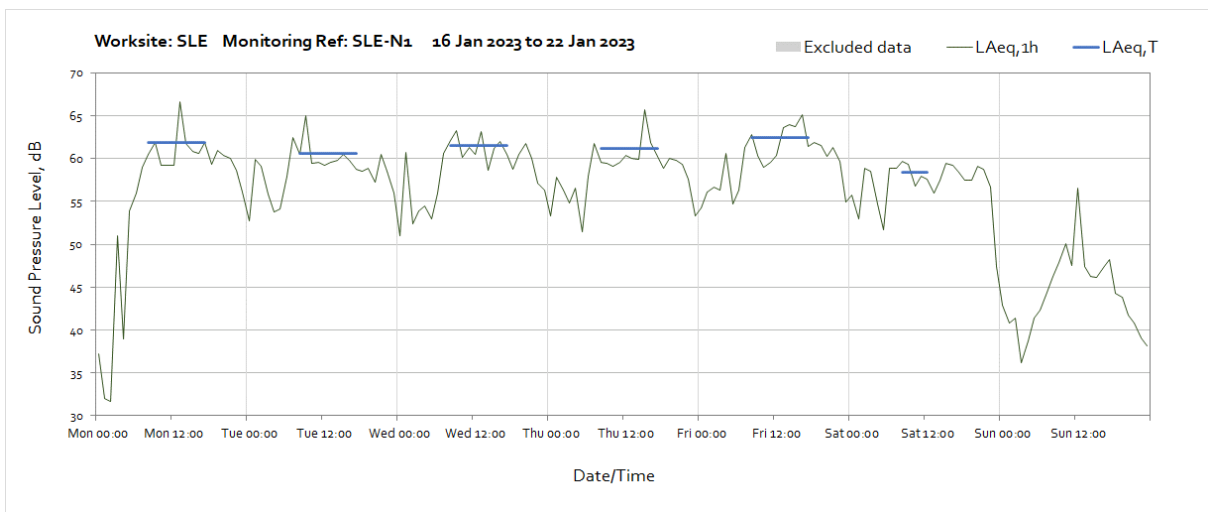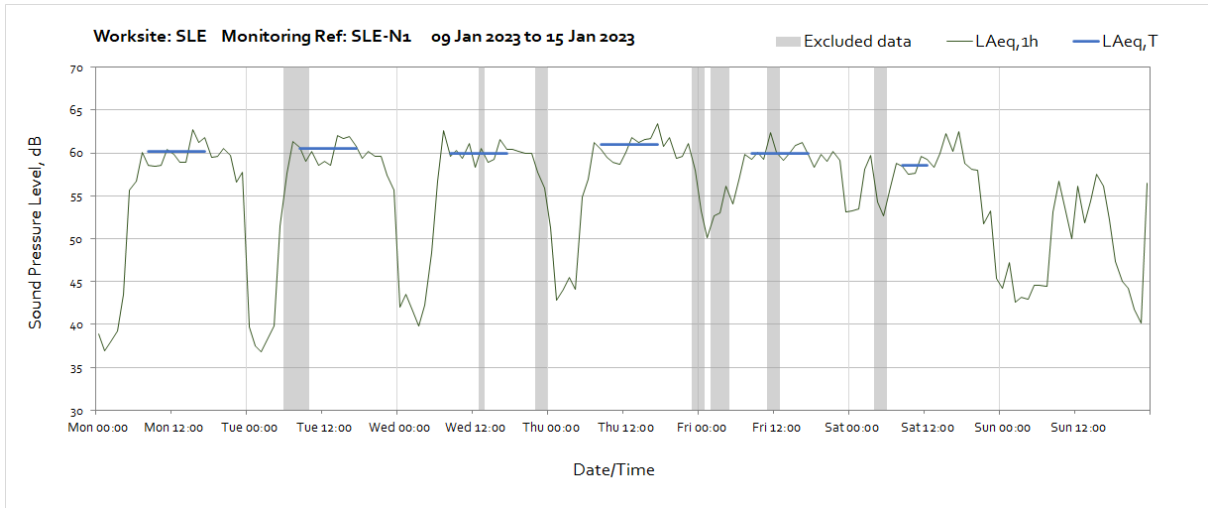





**Worksite:FEW – Monitoring Ref: FEW-N1**

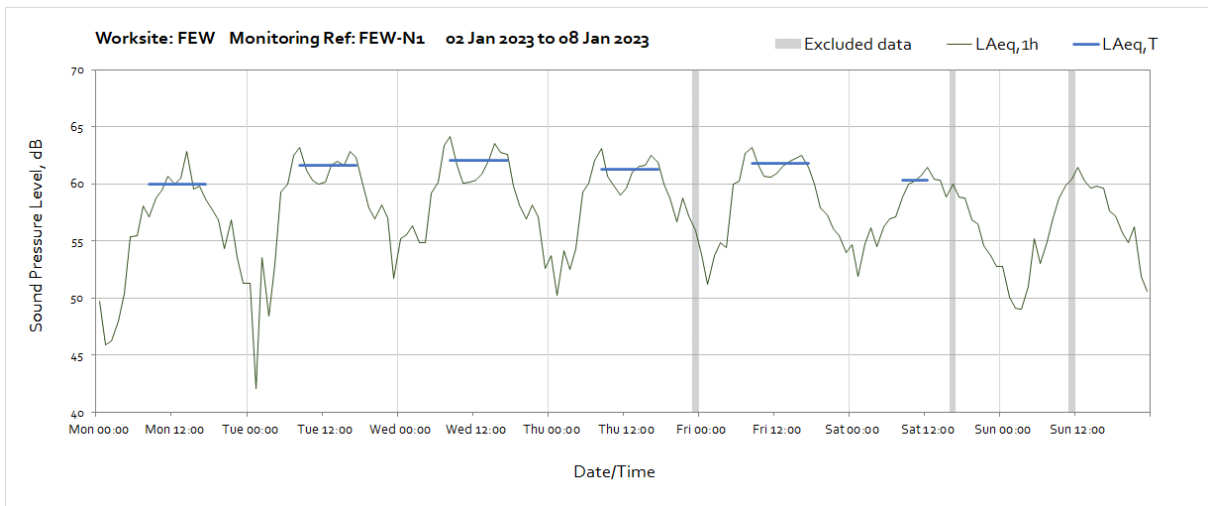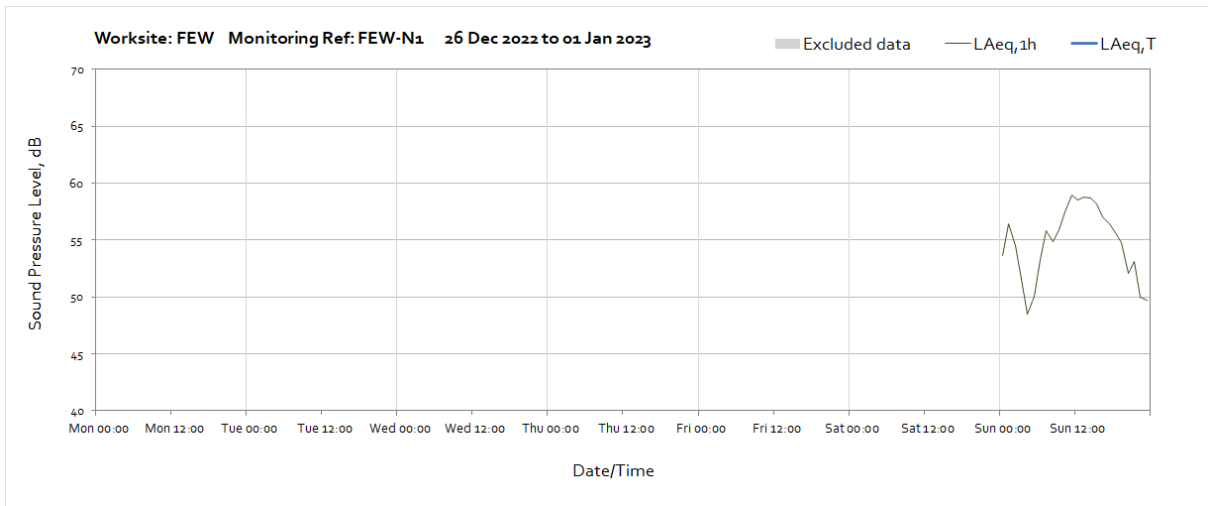

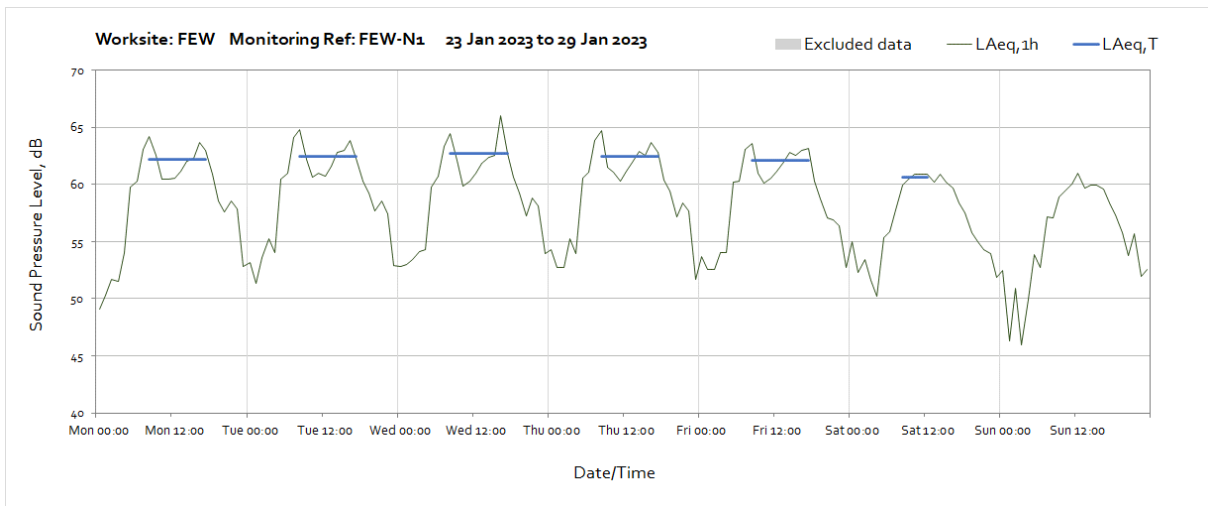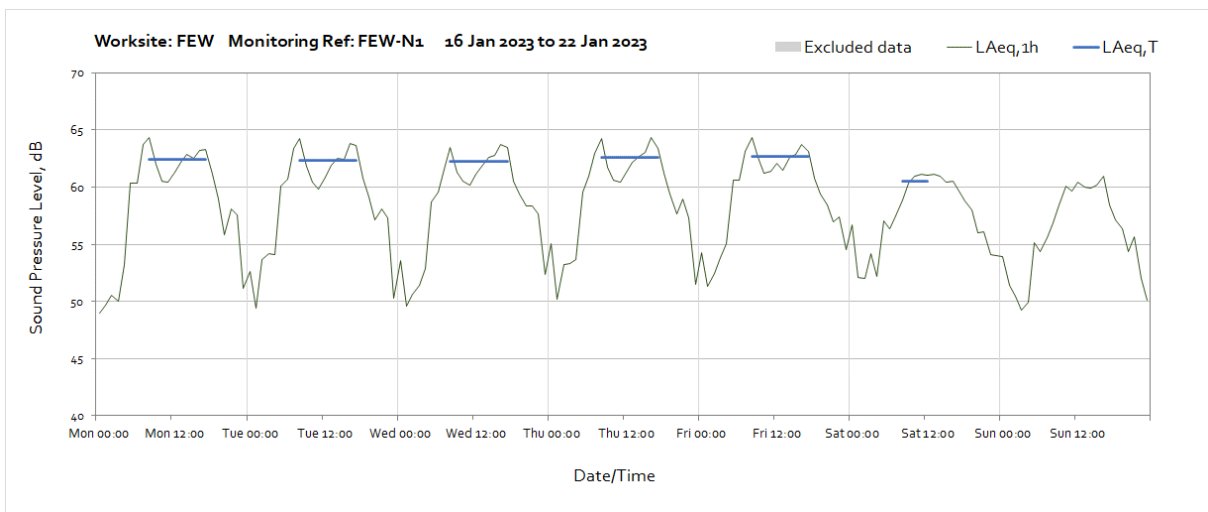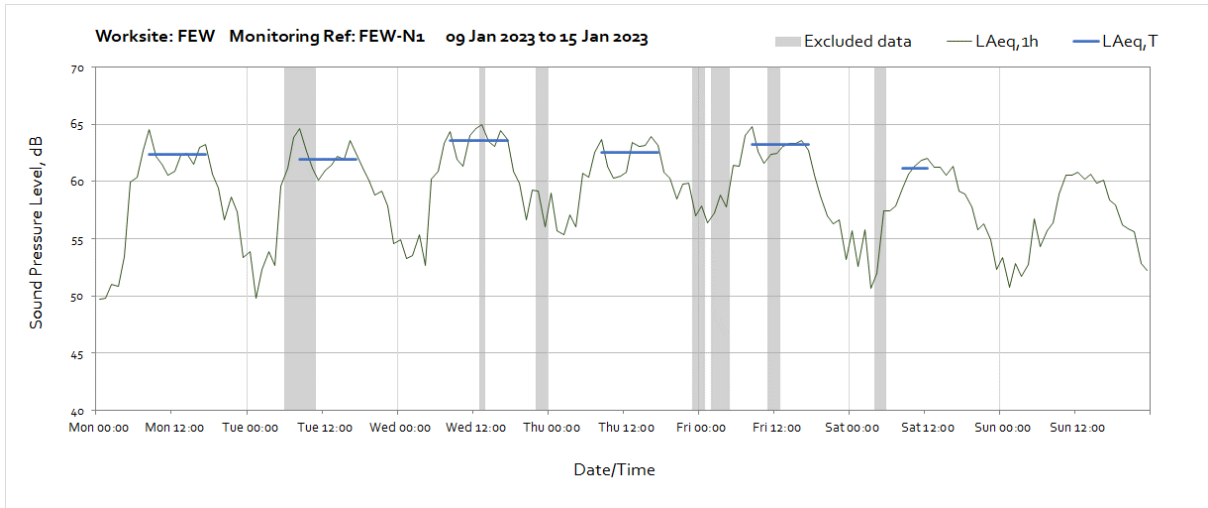




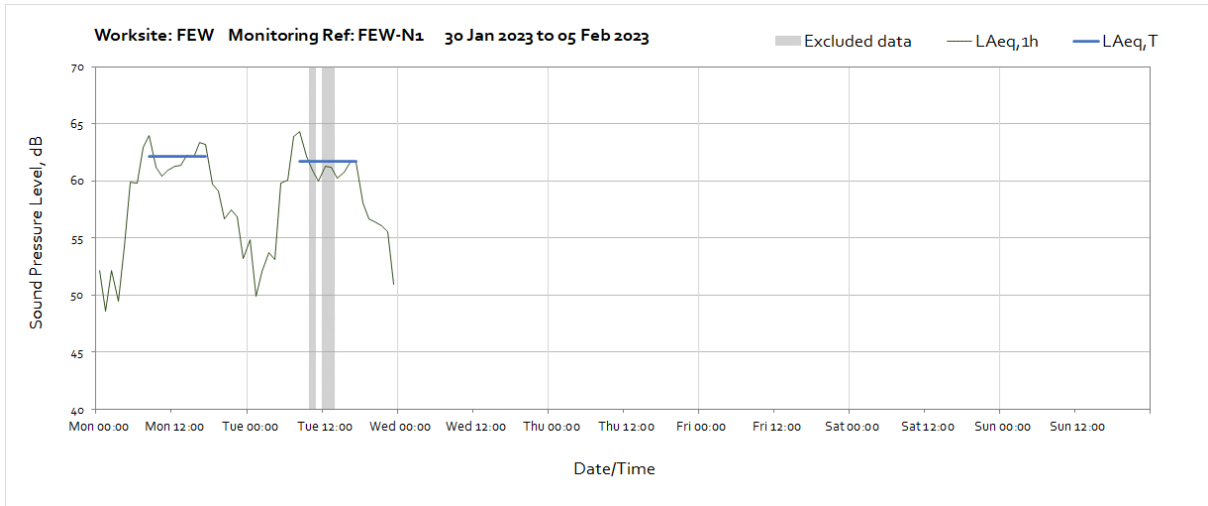



**Worksite:SCRS – Monitoring Ref: SCRS-N1**

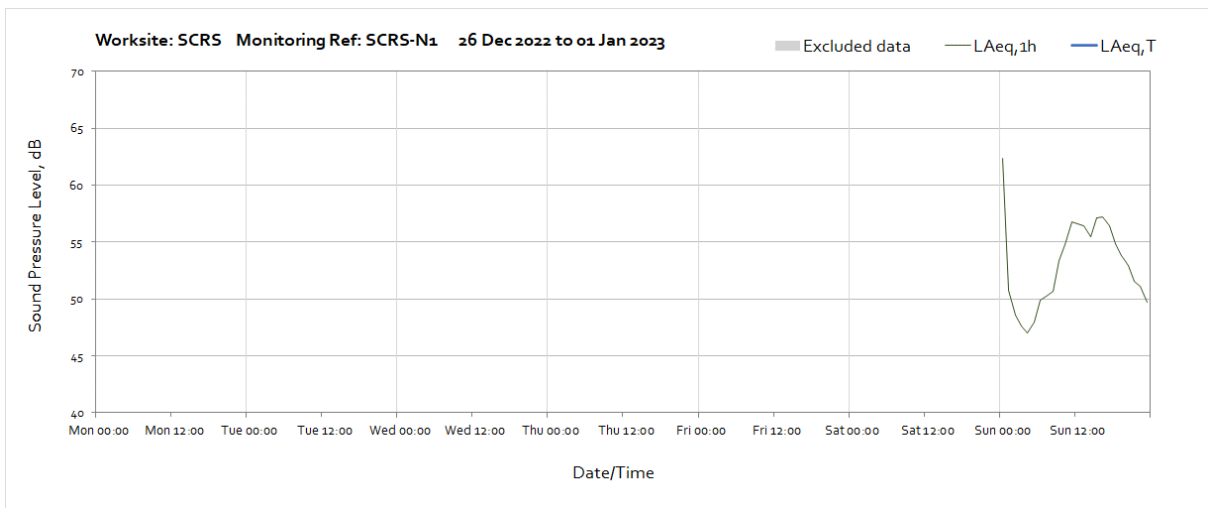


Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.

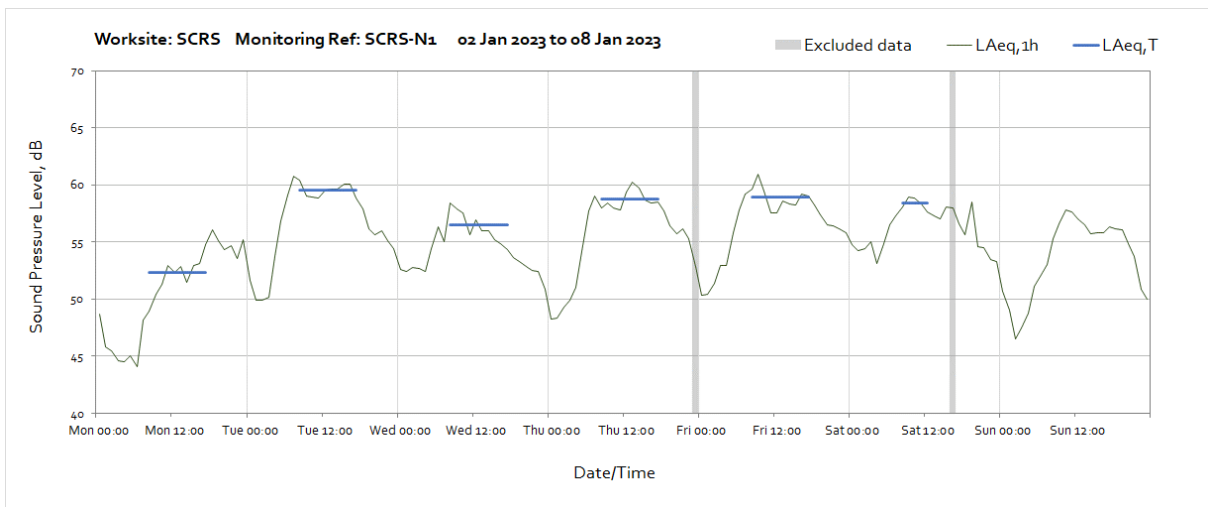

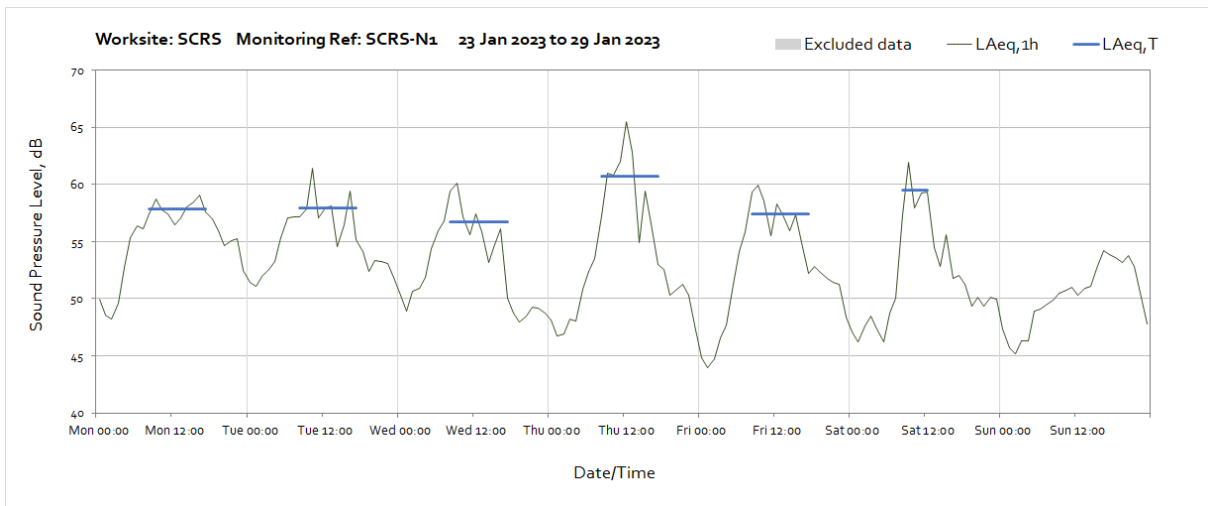
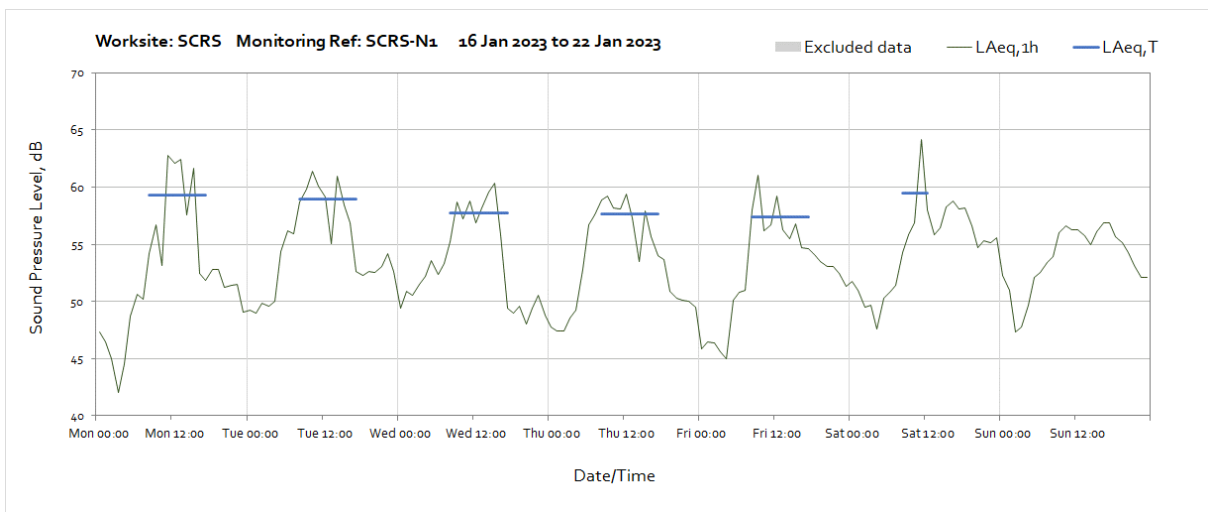
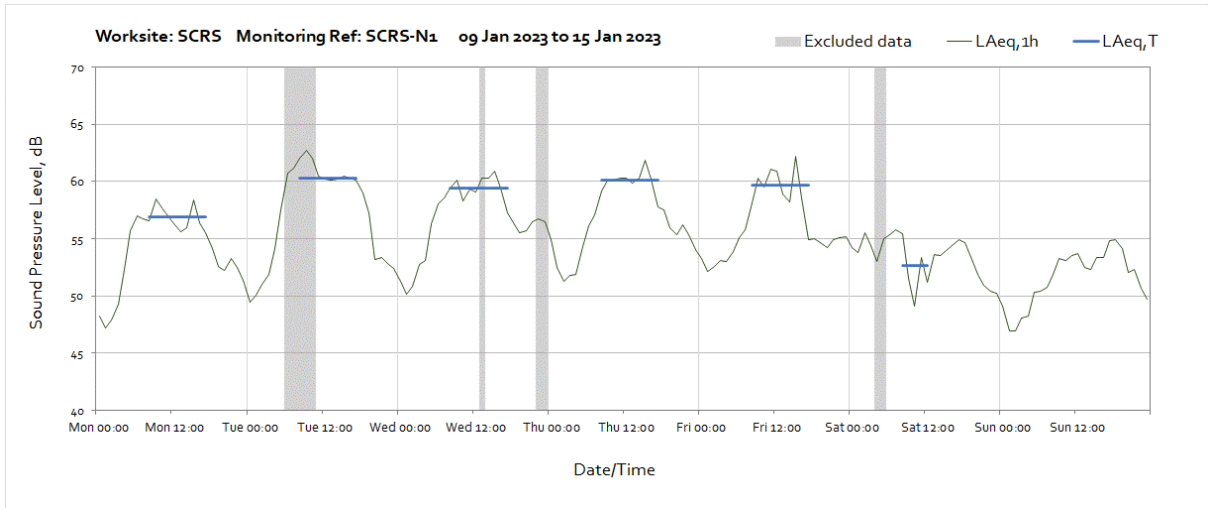


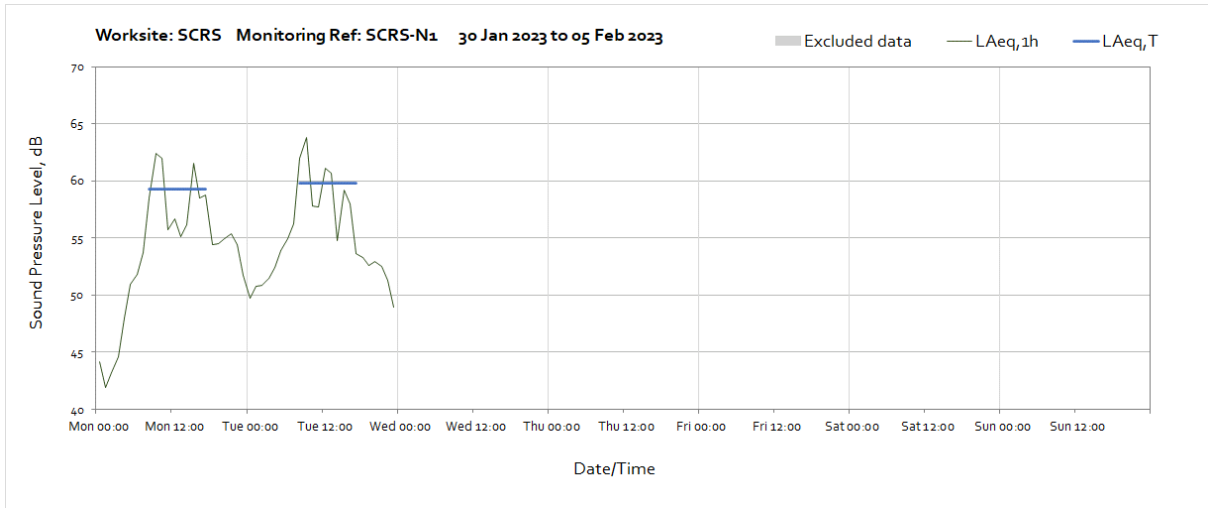


### Worksite:SCRS – Monitoring Ref: SCRS-N2

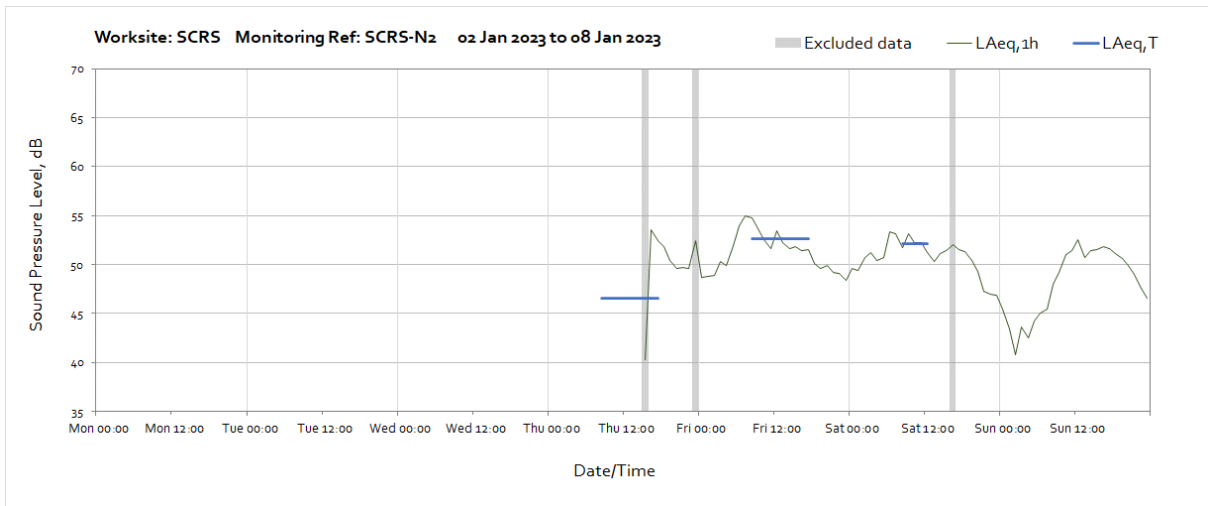


Note: Missing data between 00:00 on Sunday 1<sup>st</sup> January and 15:00 on Thursday 5<sup>th</sup> January was due to loss of power to the monitor from the solar panel supply.

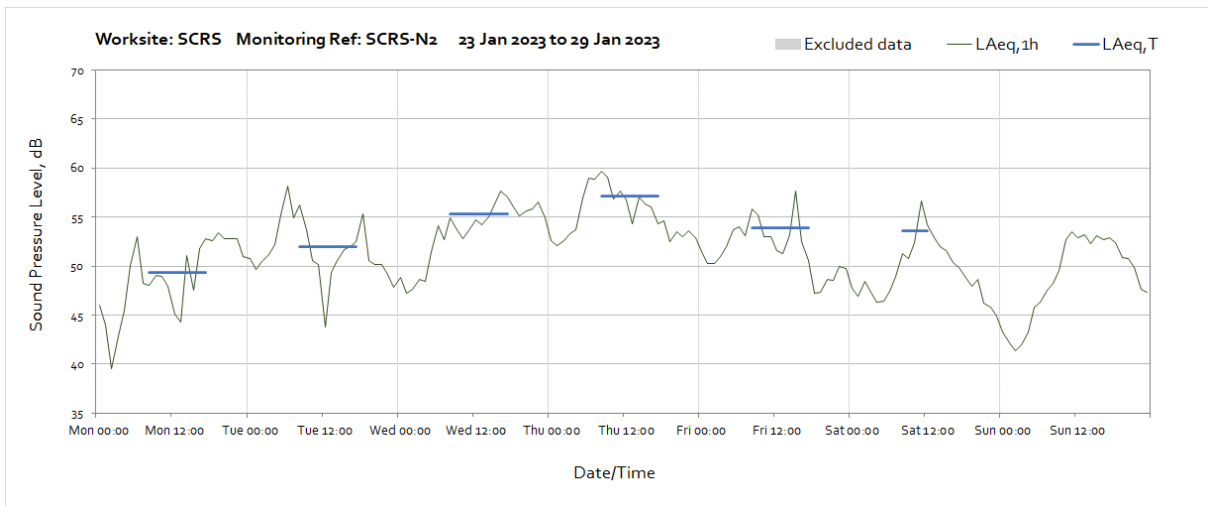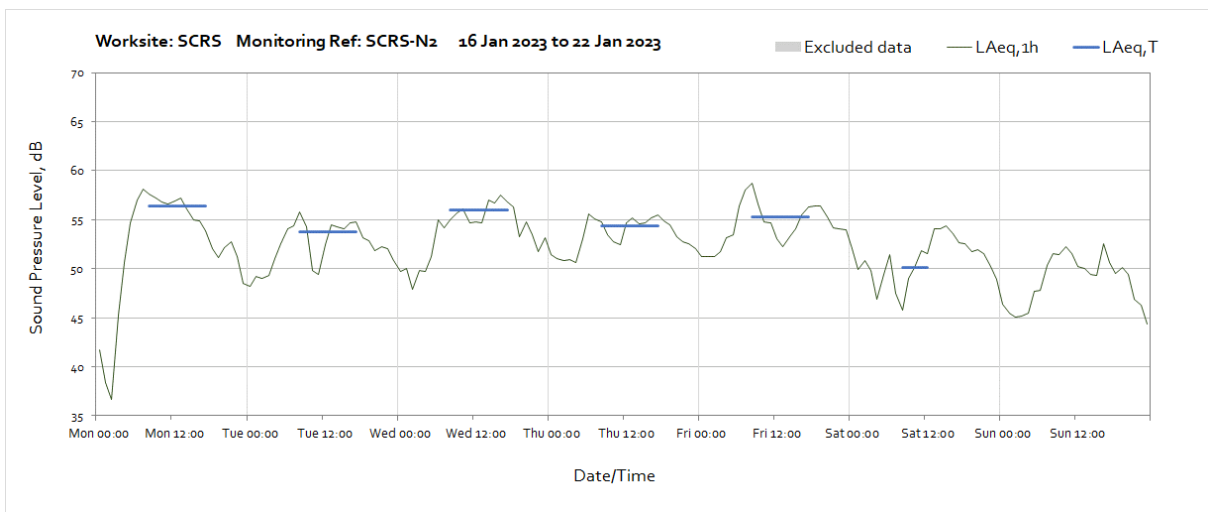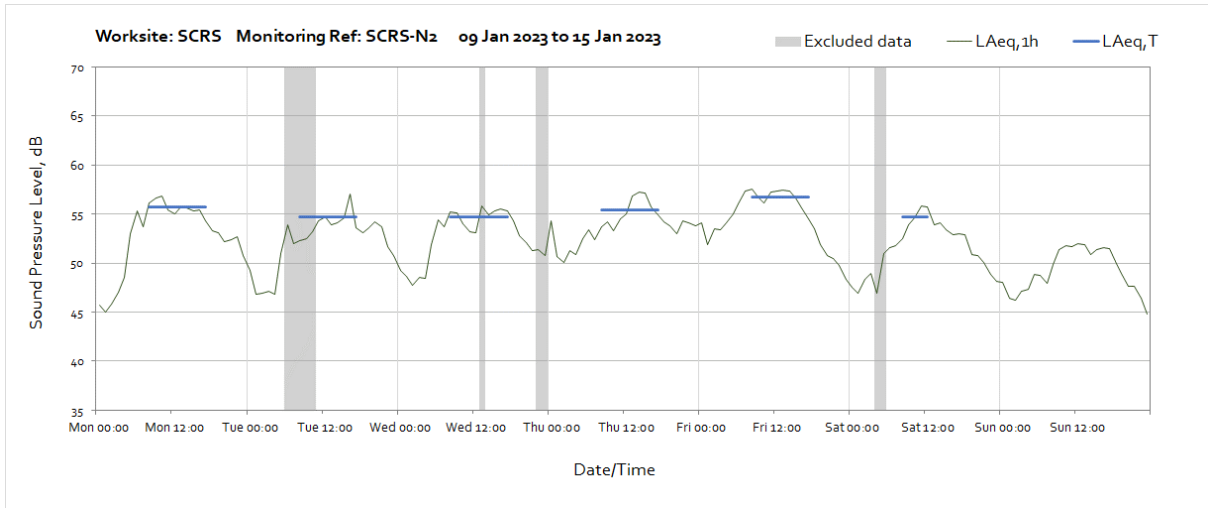



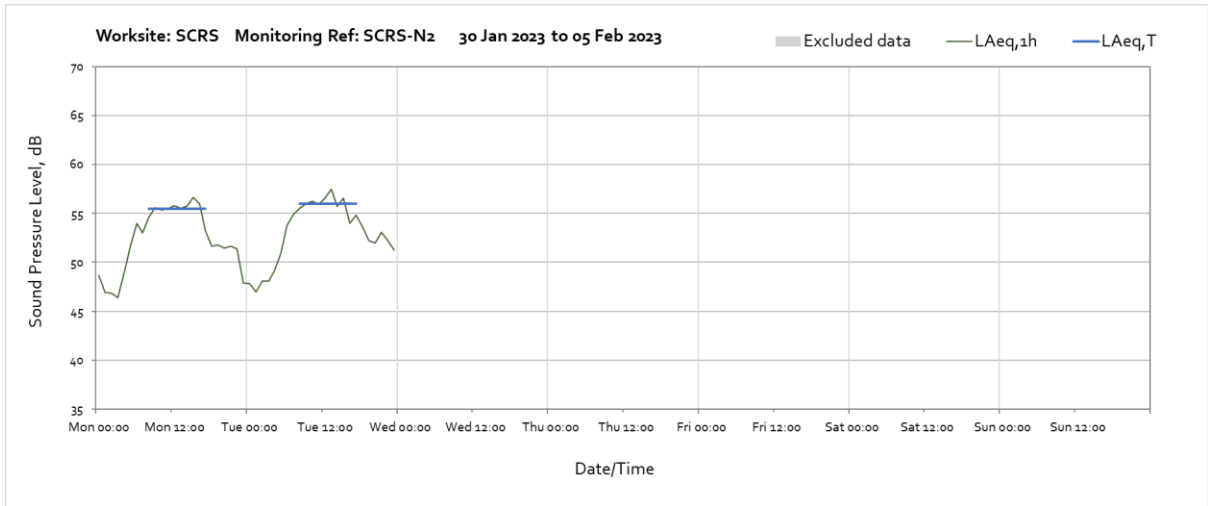



### Worksite: SCRS – Monitoring Ref: SSL-N1

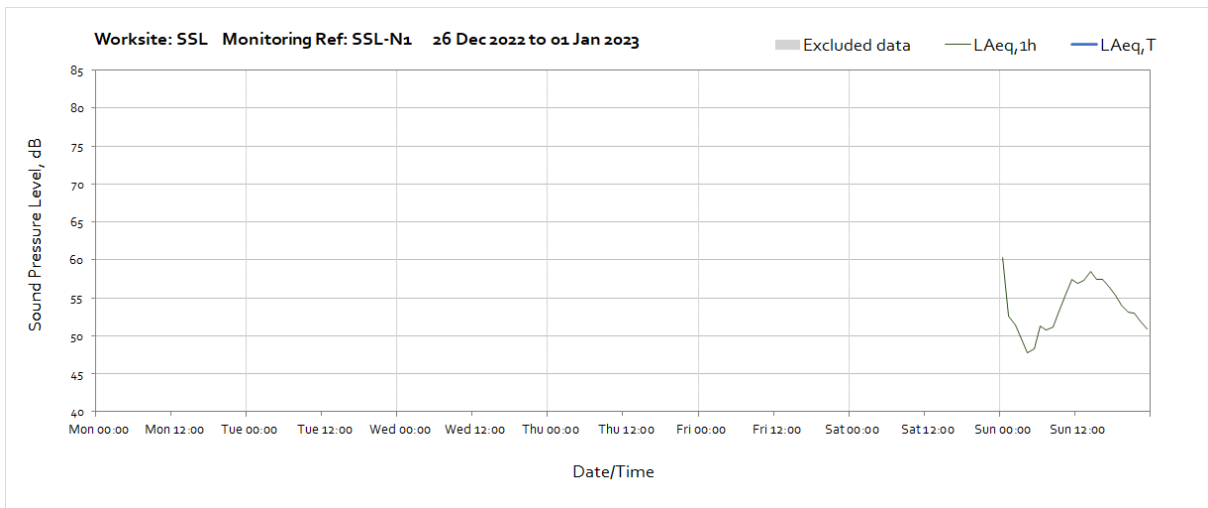


Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.



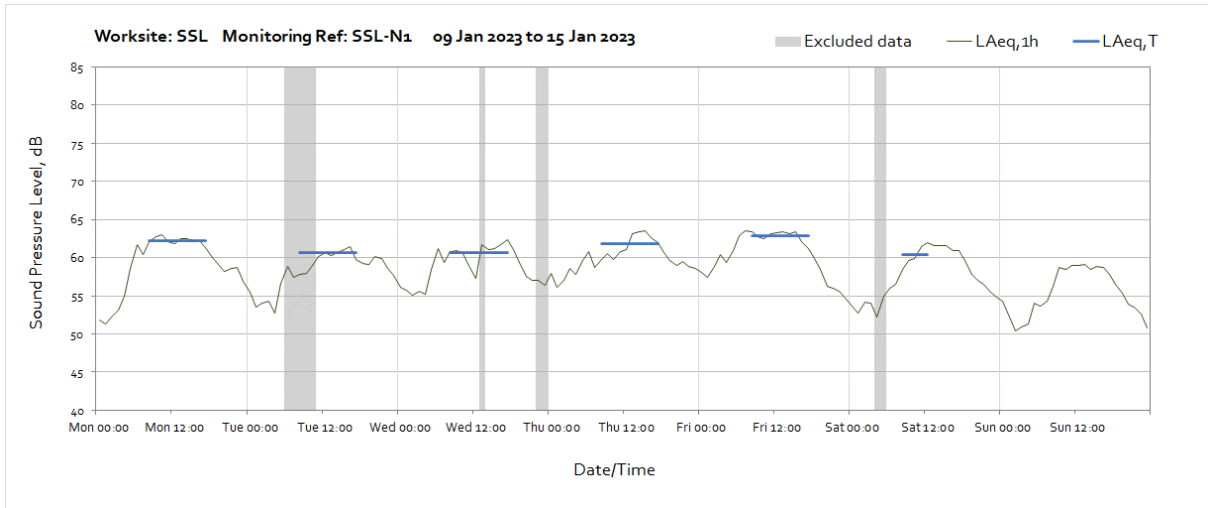




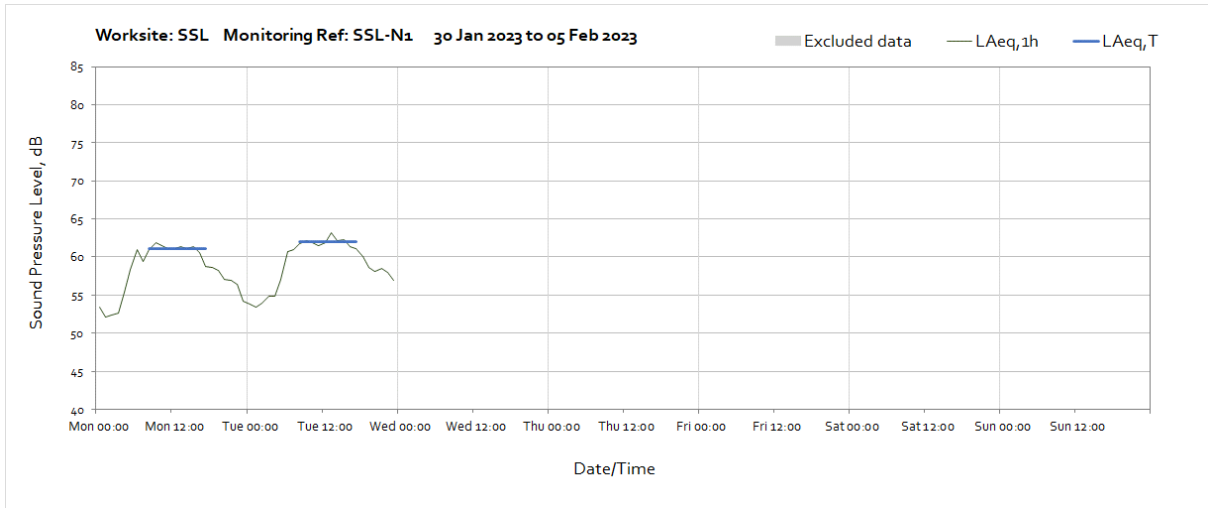



**Worksite: CLC – Monitoring Ref: CLC-N1**

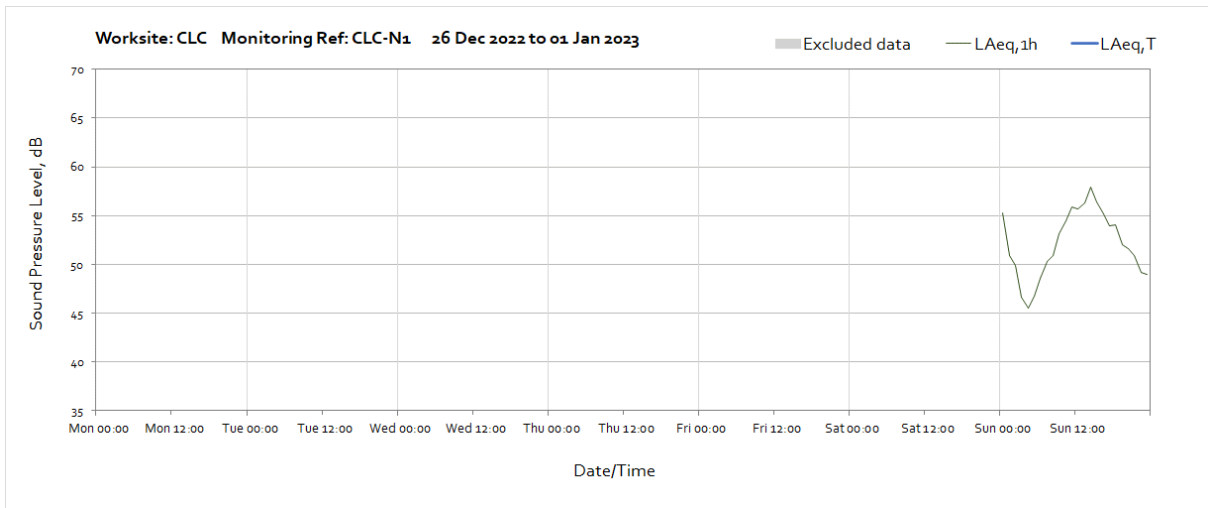


Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.

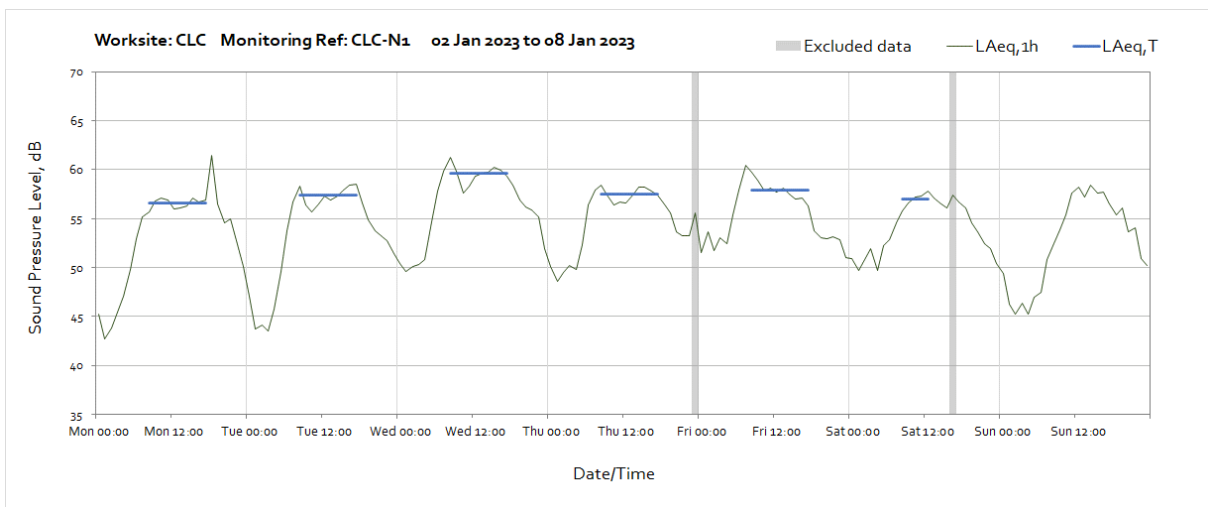

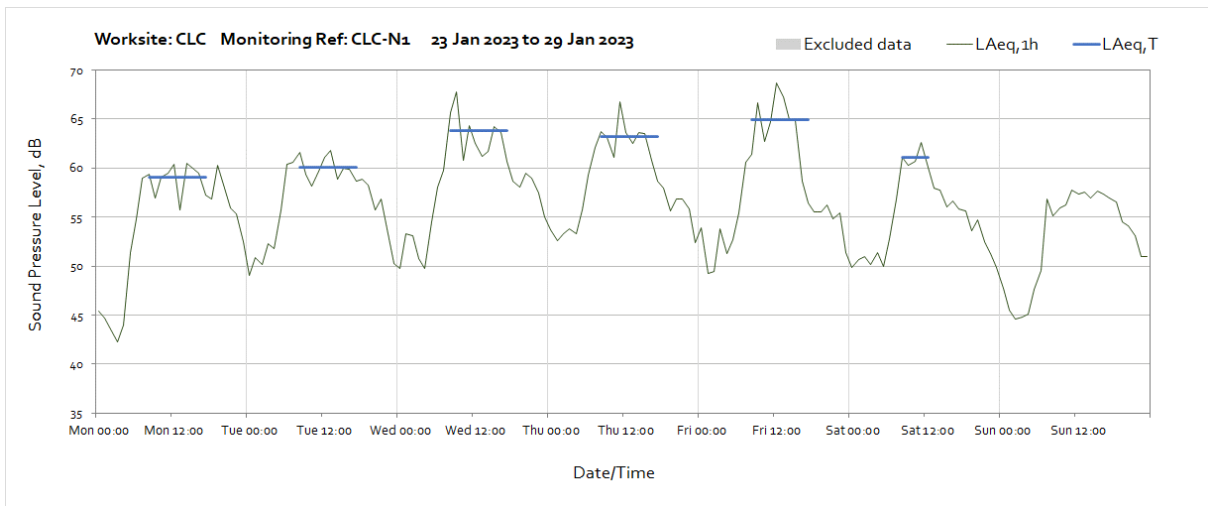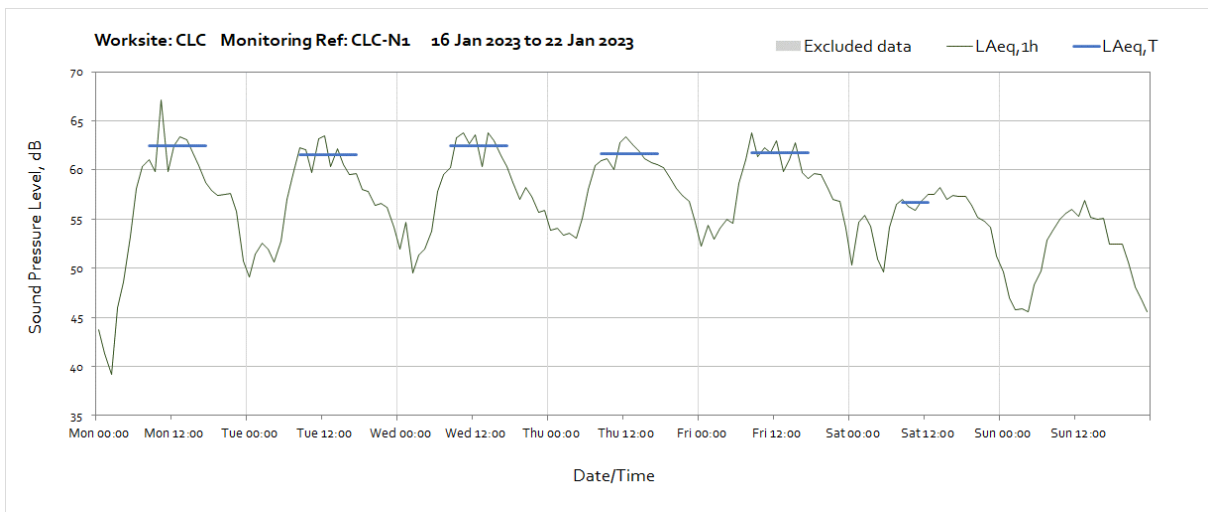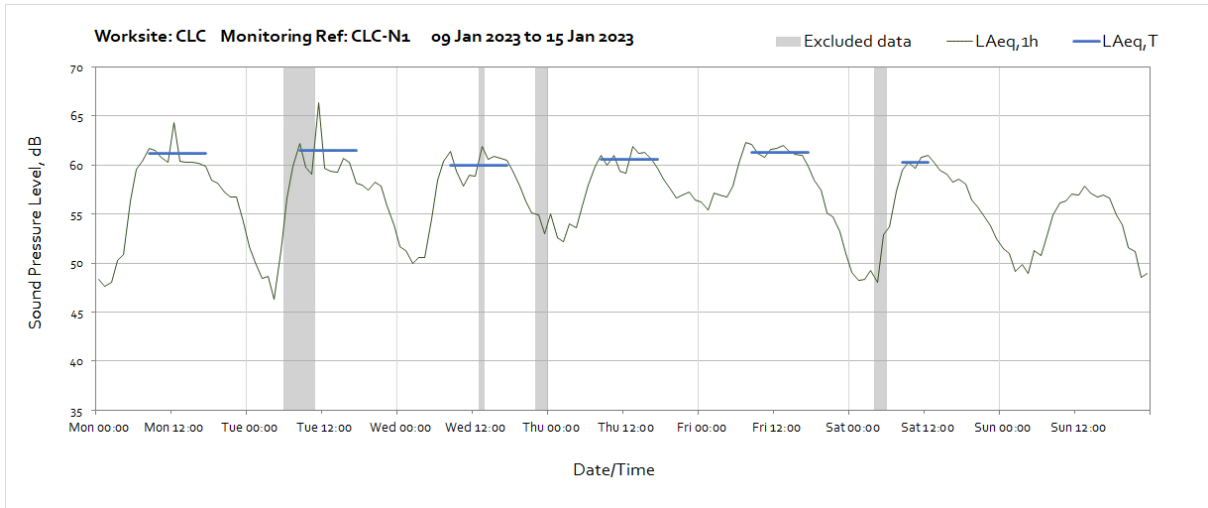




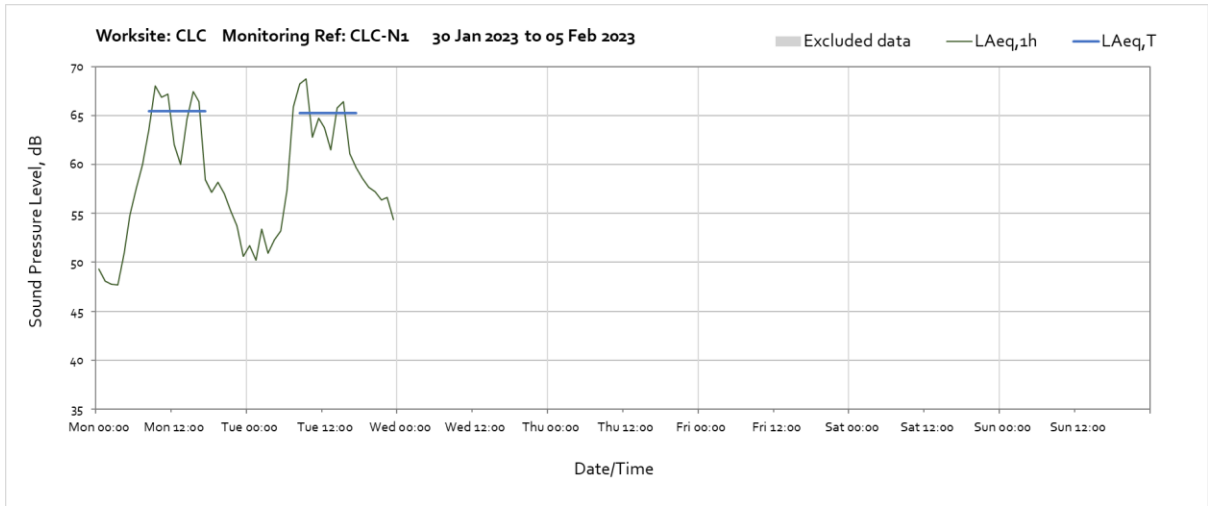


### Worksite: CLC - Monitoring Ref: CLC-N3

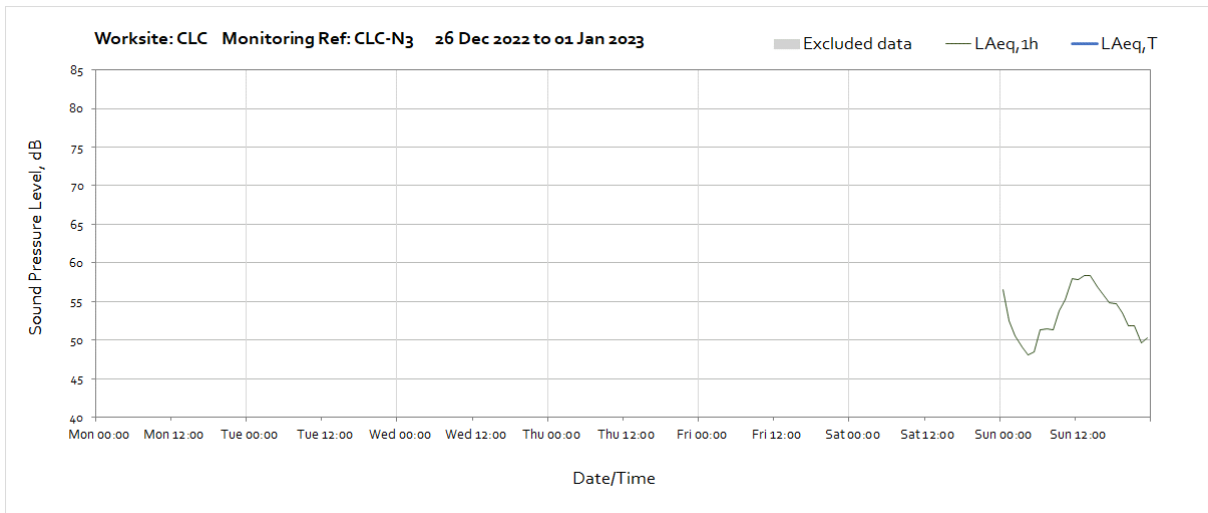

Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.

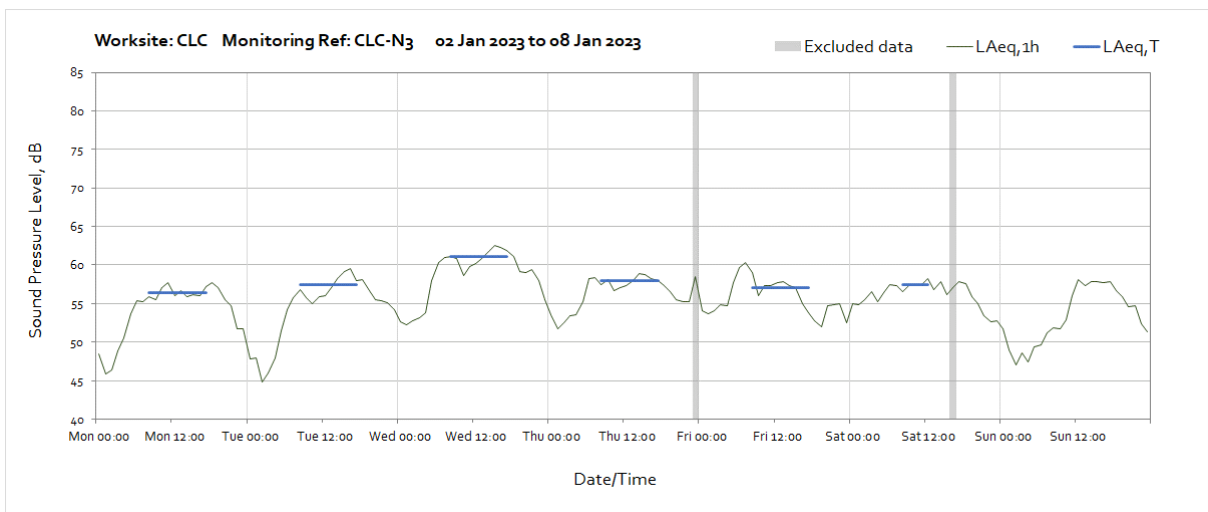


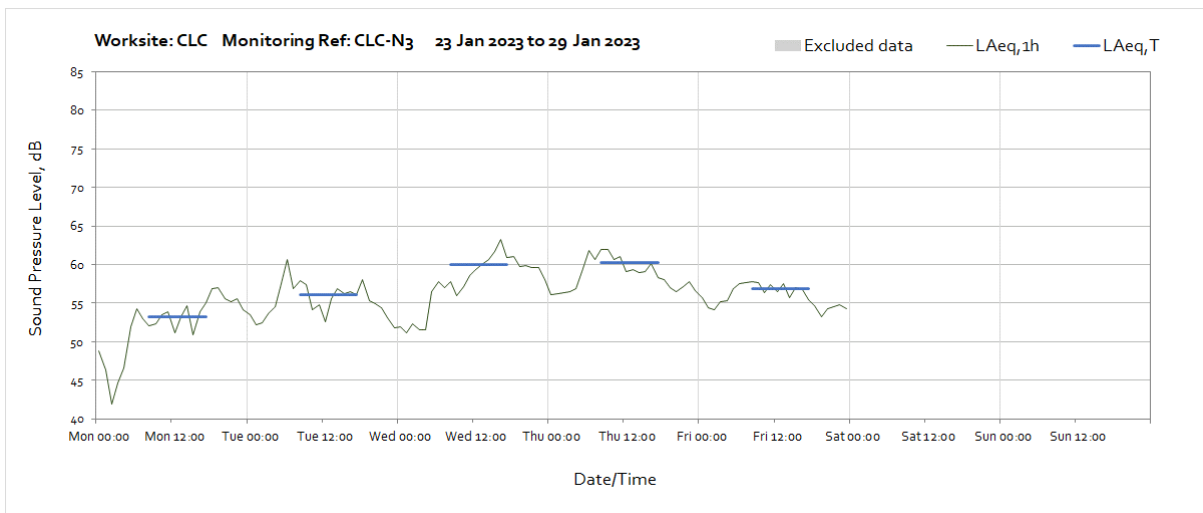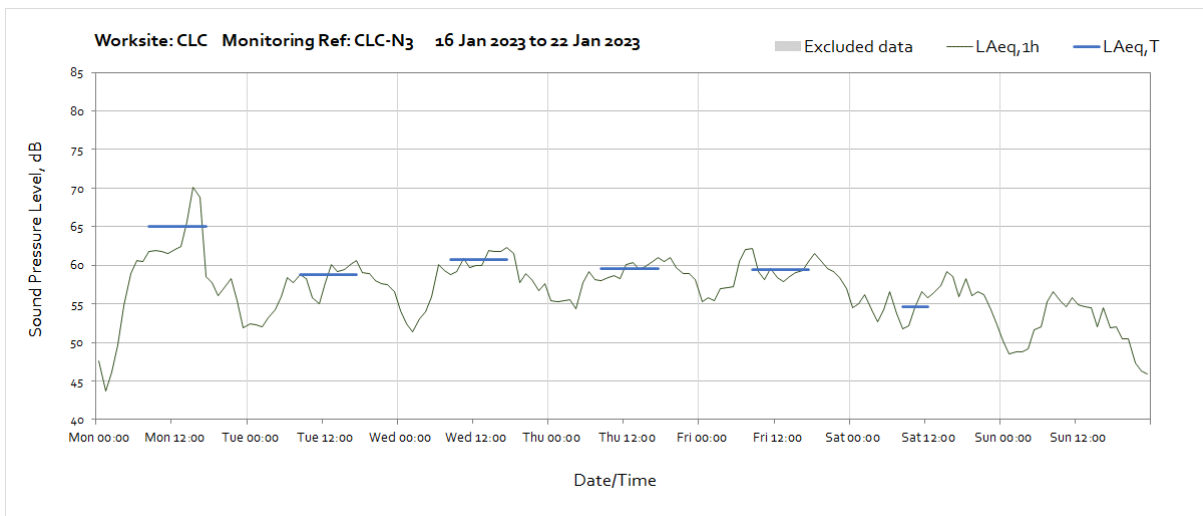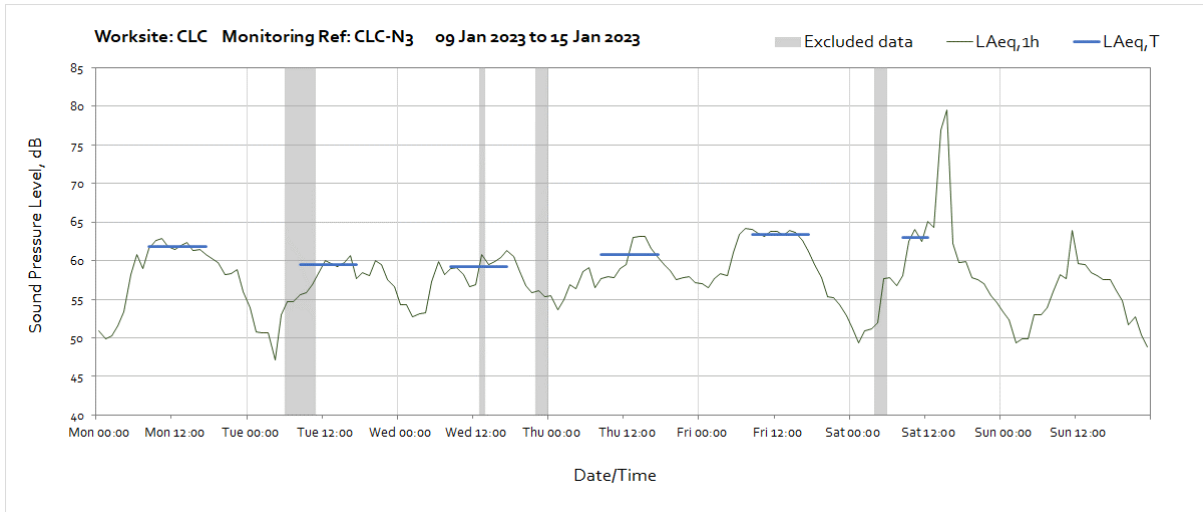



Note: Missing data from 00:00 on 28<sup>th</sup> January until the end of the month was due to monitor decommissioning.




OFFICIAL

## Worksite: CLC – Monitoring Ref: CLC-N4

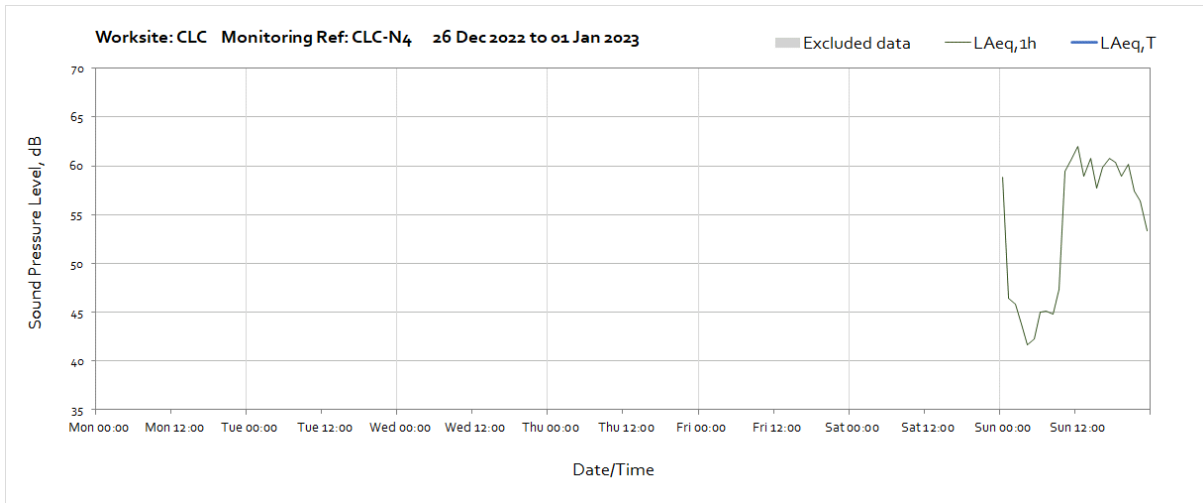


Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.

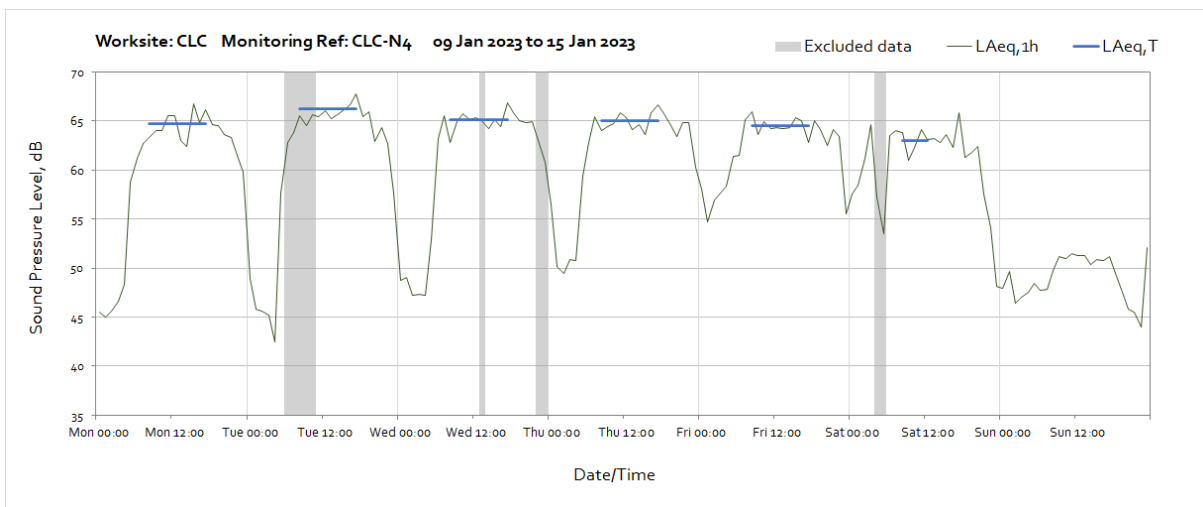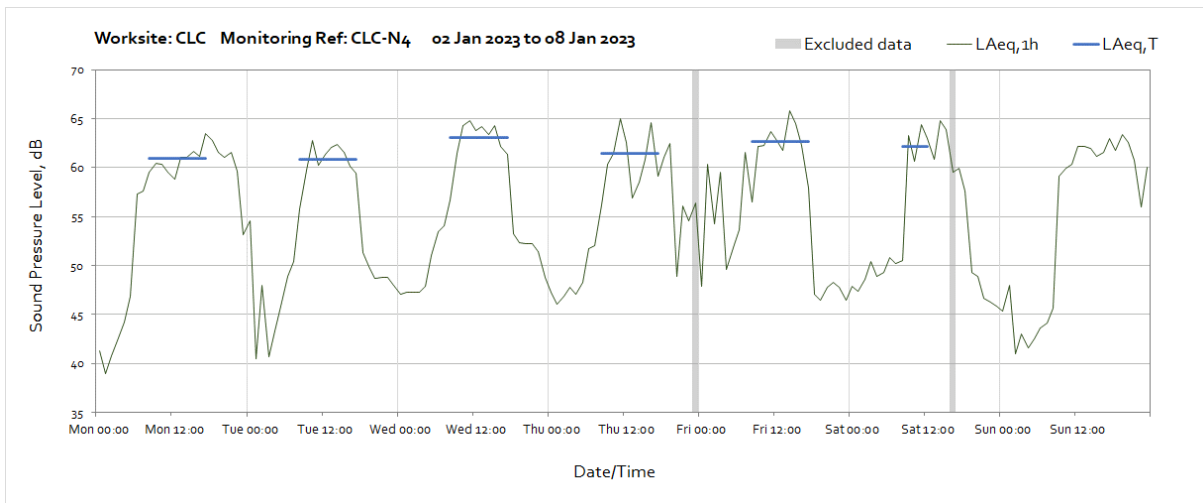

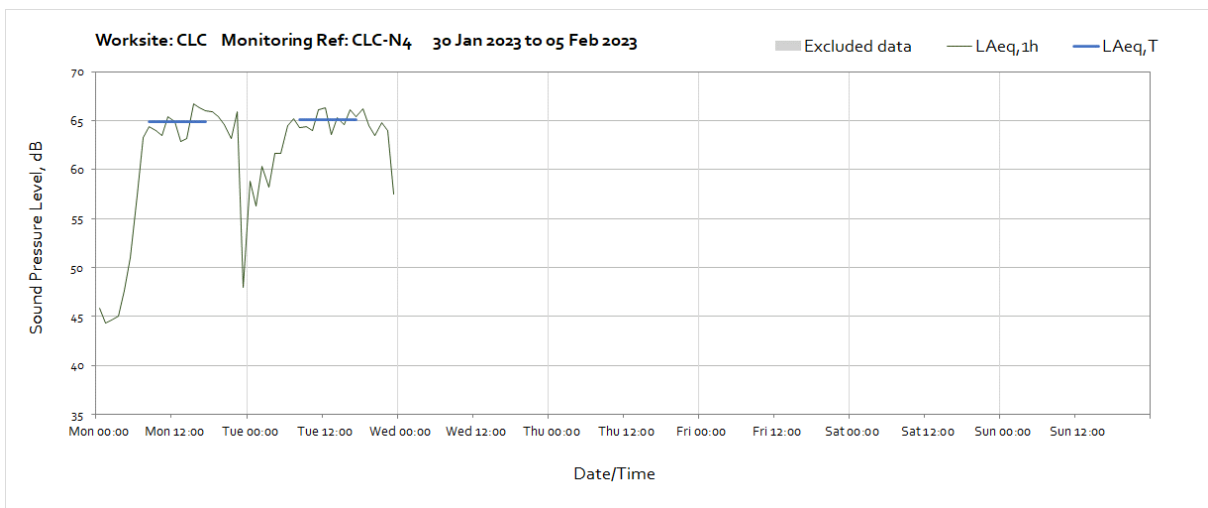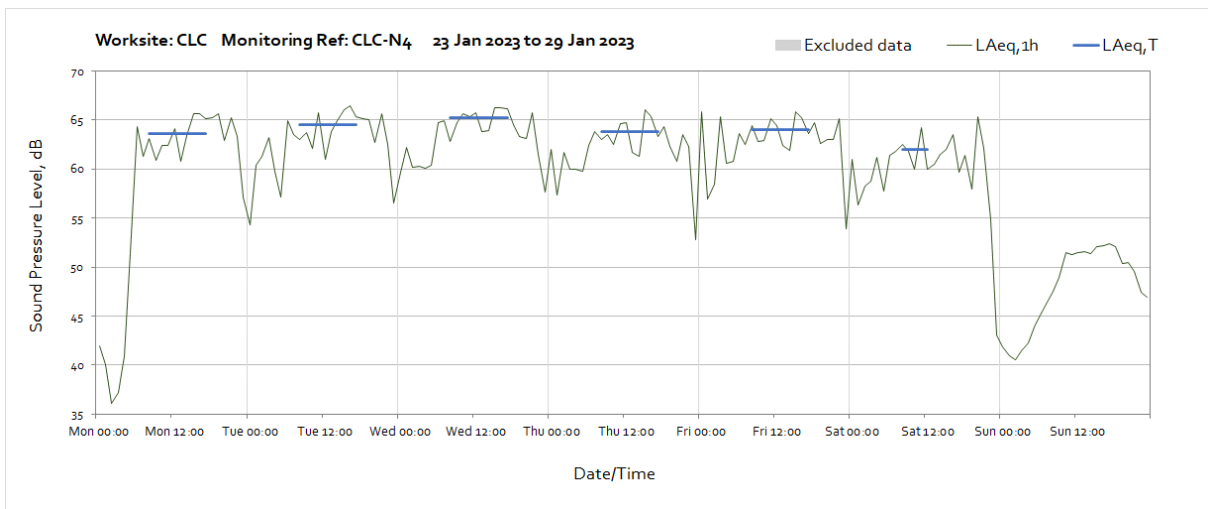
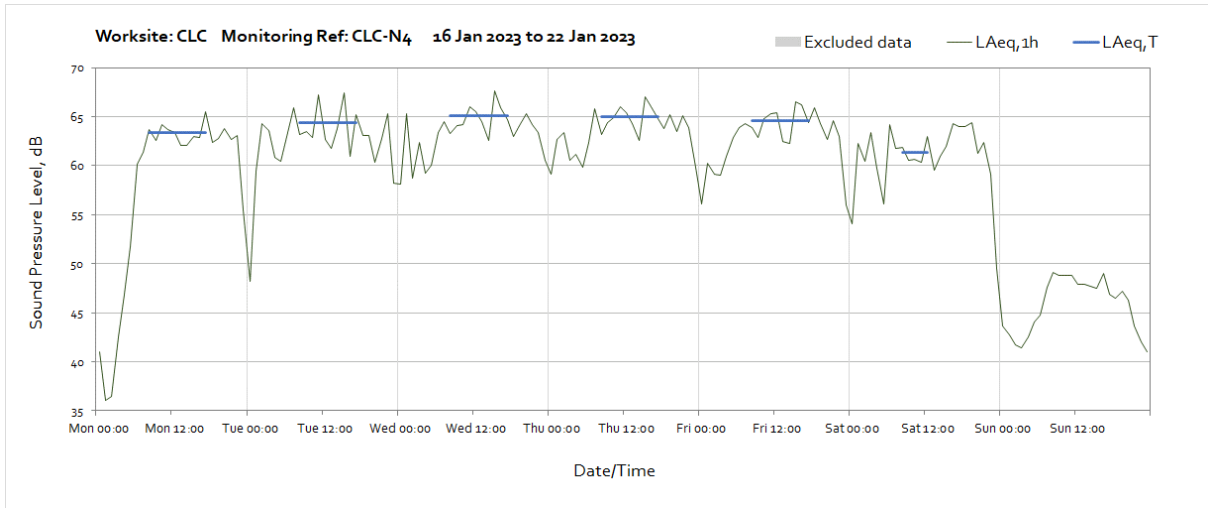







## Worksite:WCC – Monitoring Ref: WCC-N1



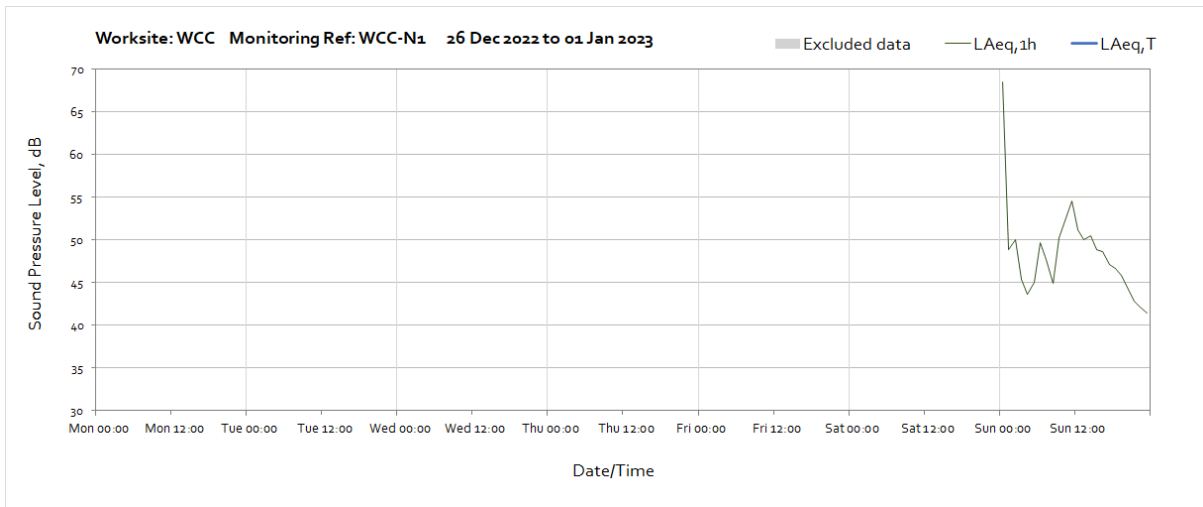





Note: High noise levels measured at 00:00 on Sunday 1<sup>st</sup> January were due to New Year Night celebration.

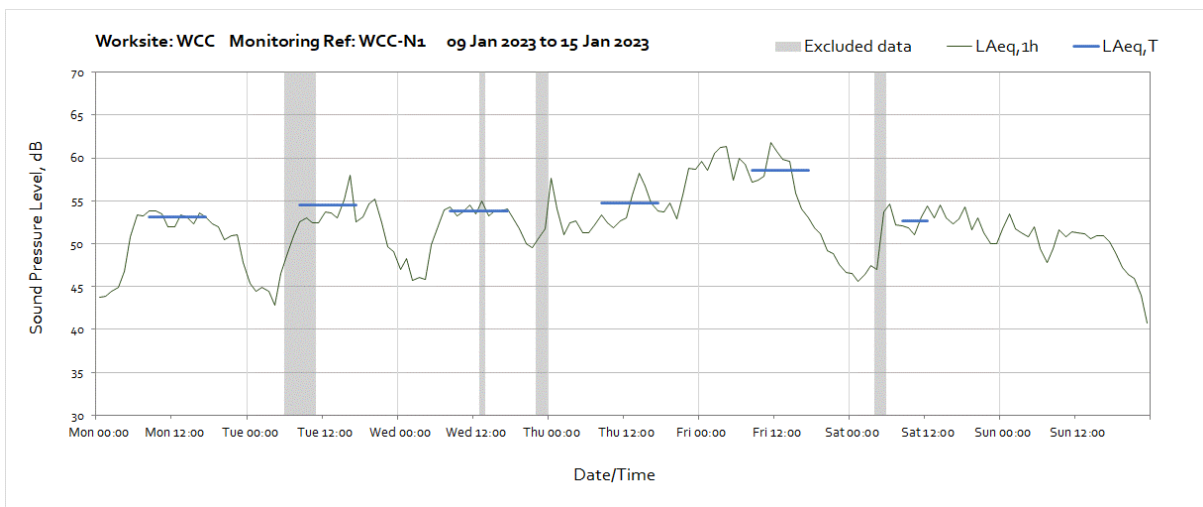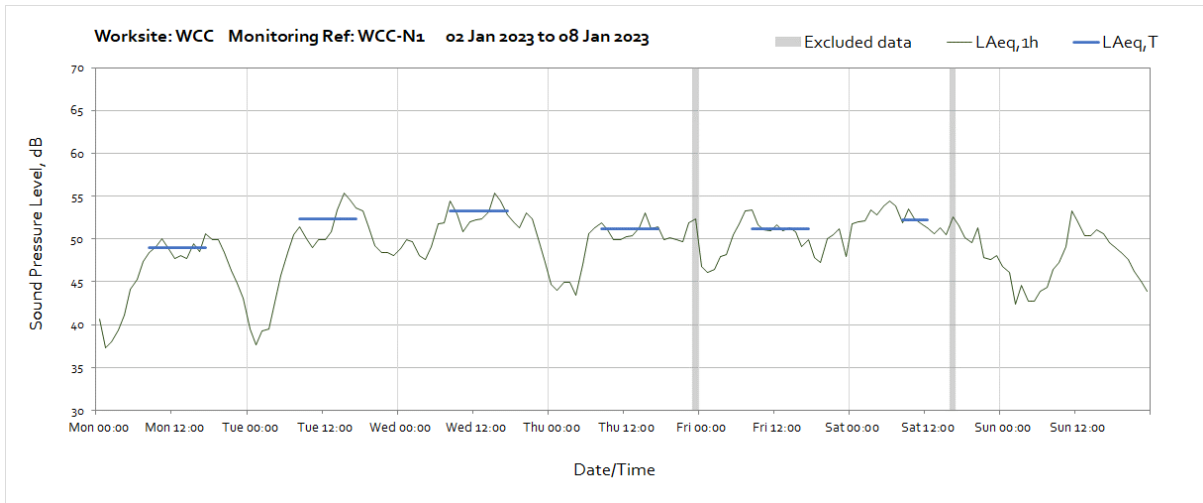

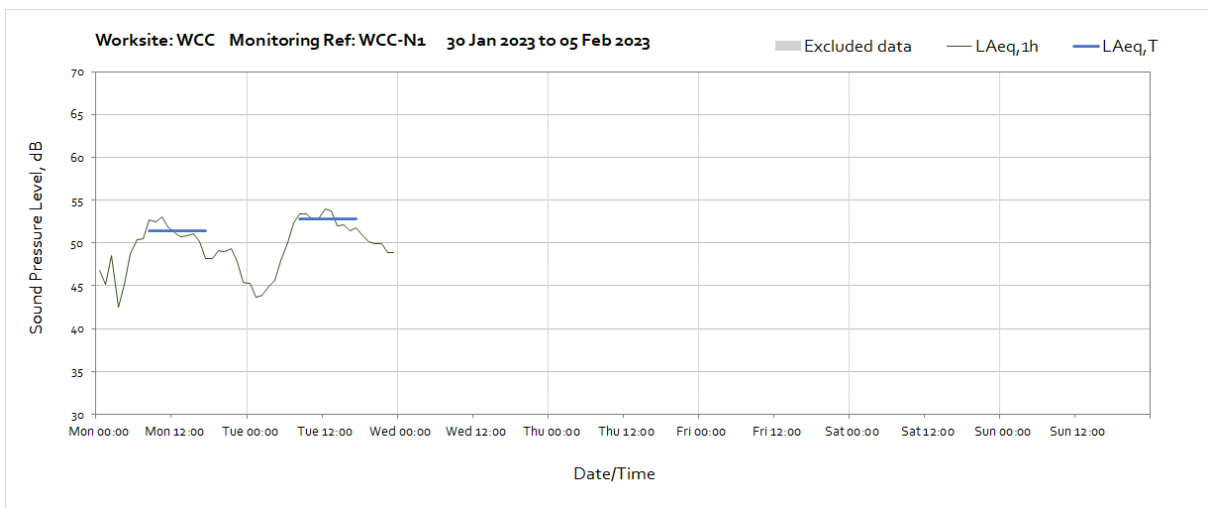
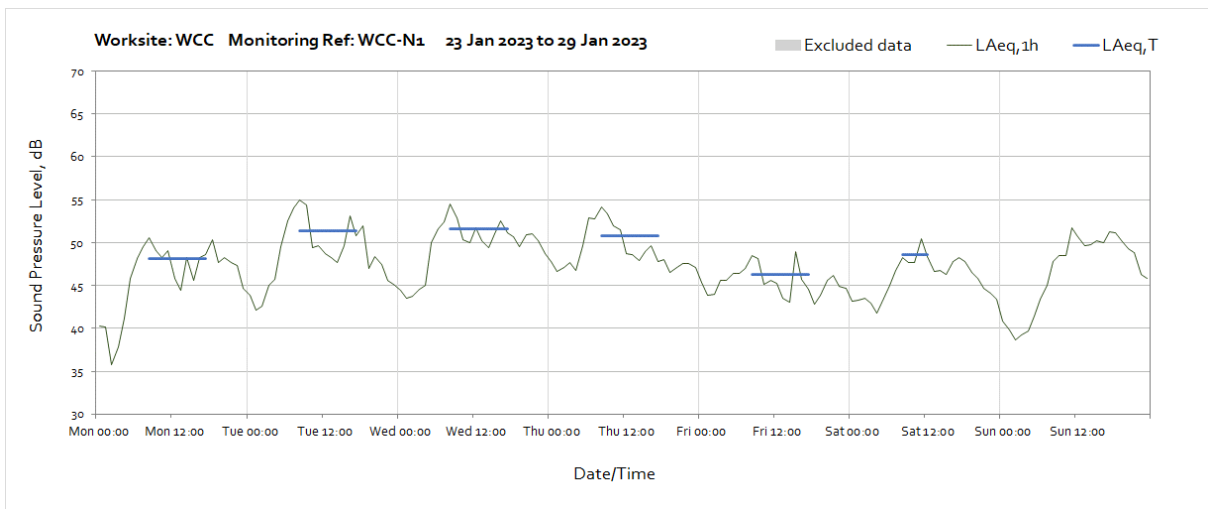
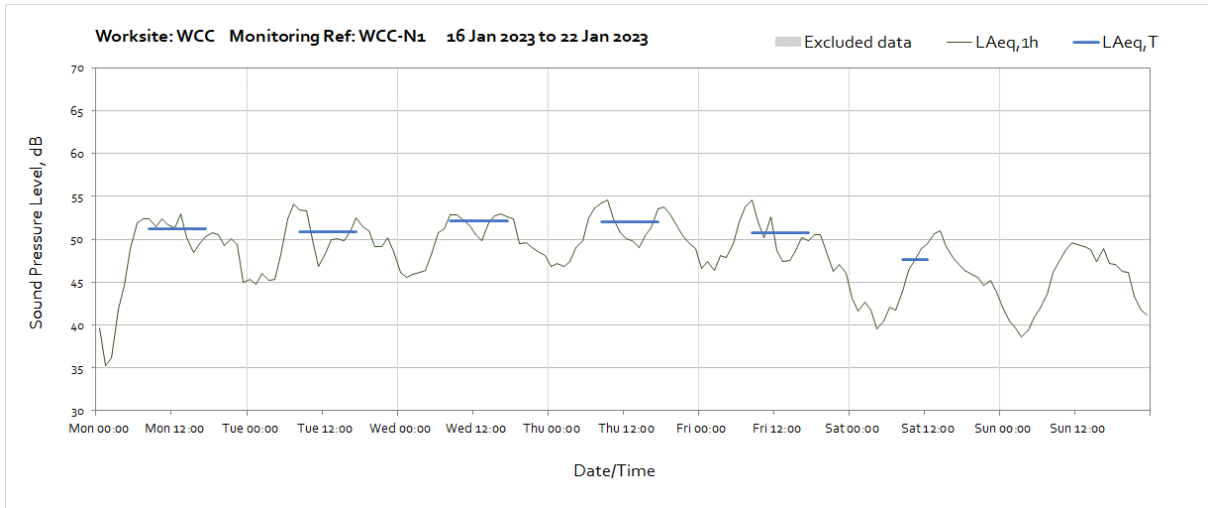




## Worksite:TROS – Monitoring Ref: TROS-N1

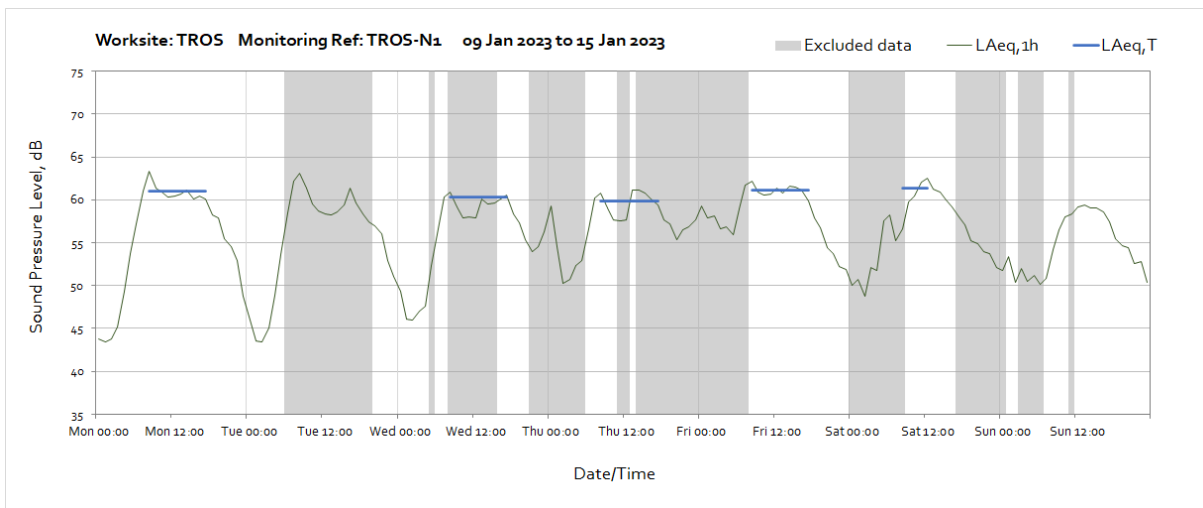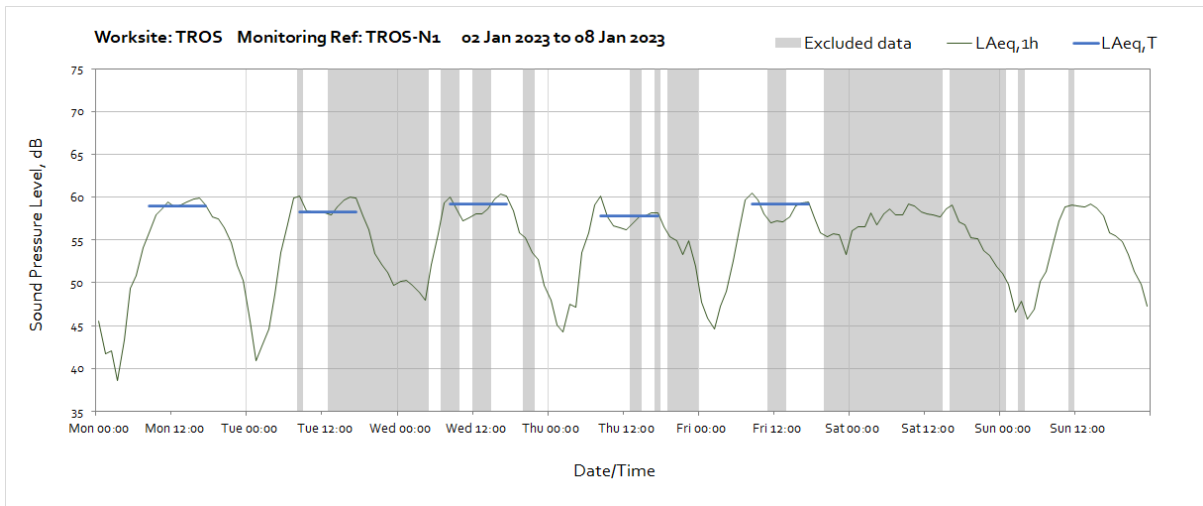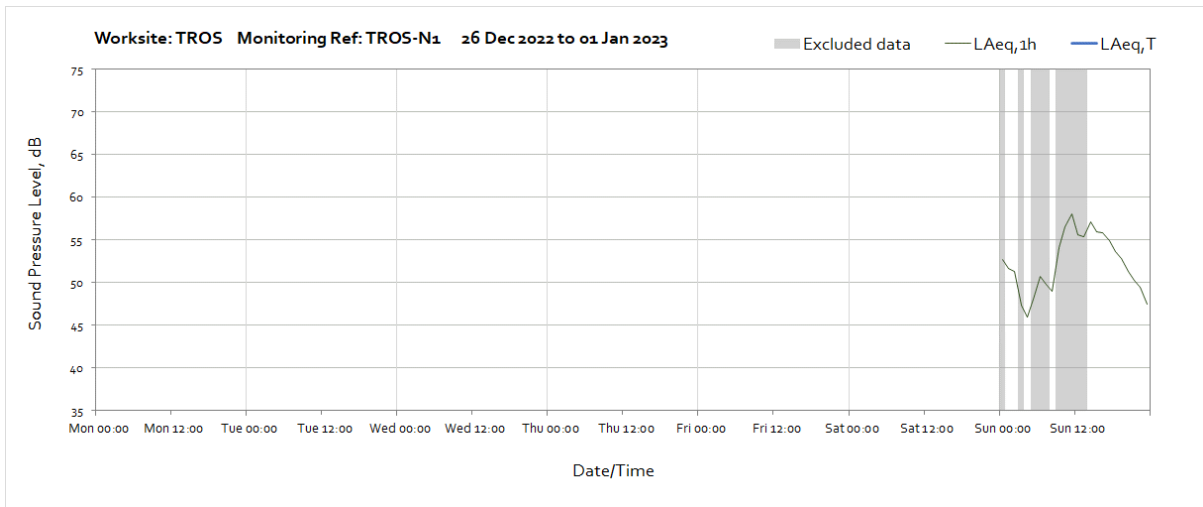

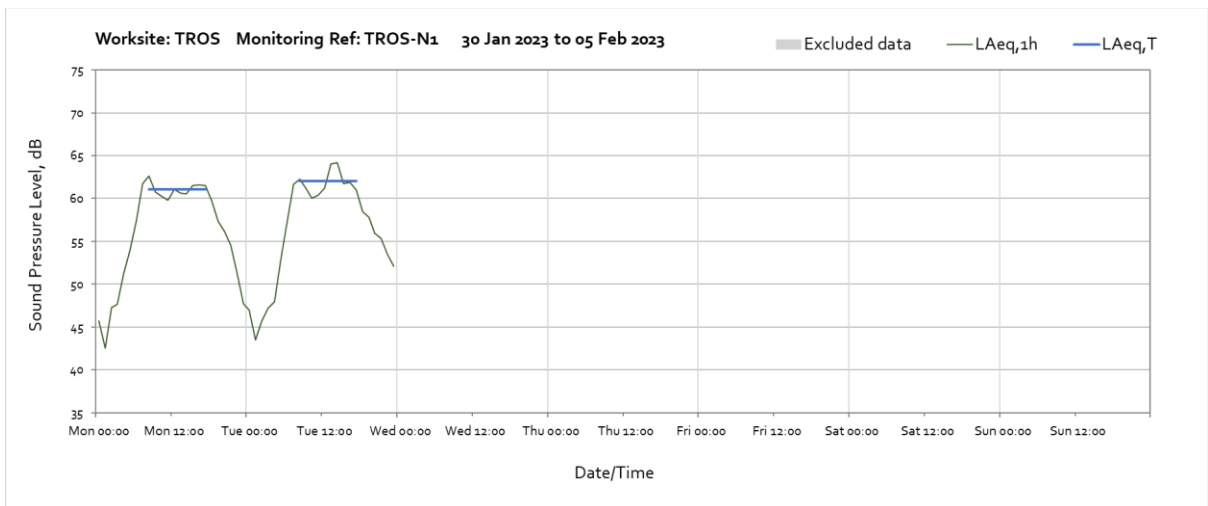
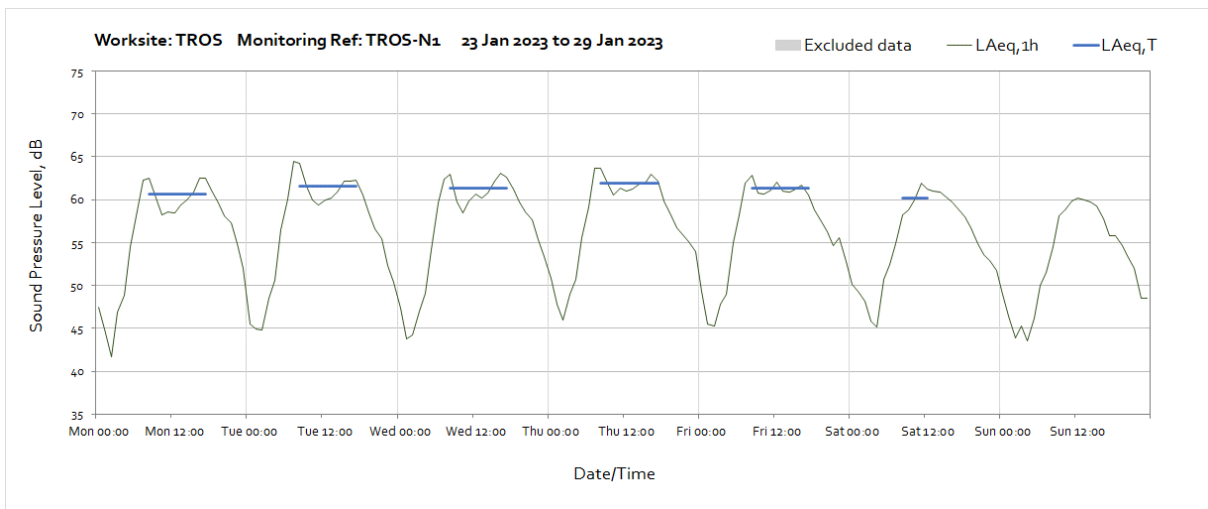
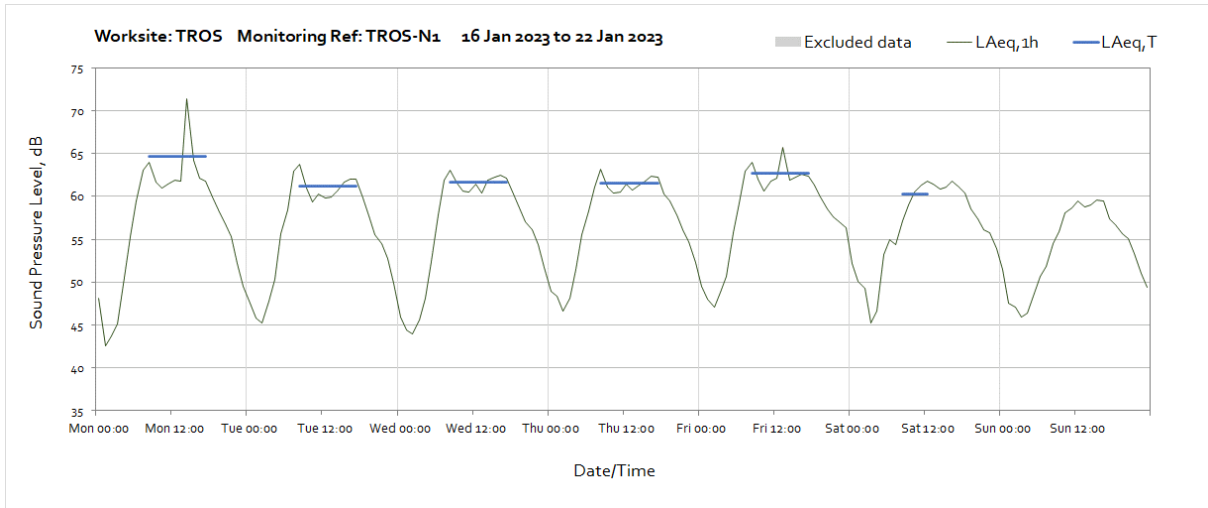





## Worksite:TROS – Monitoring Ref: TROS-N2

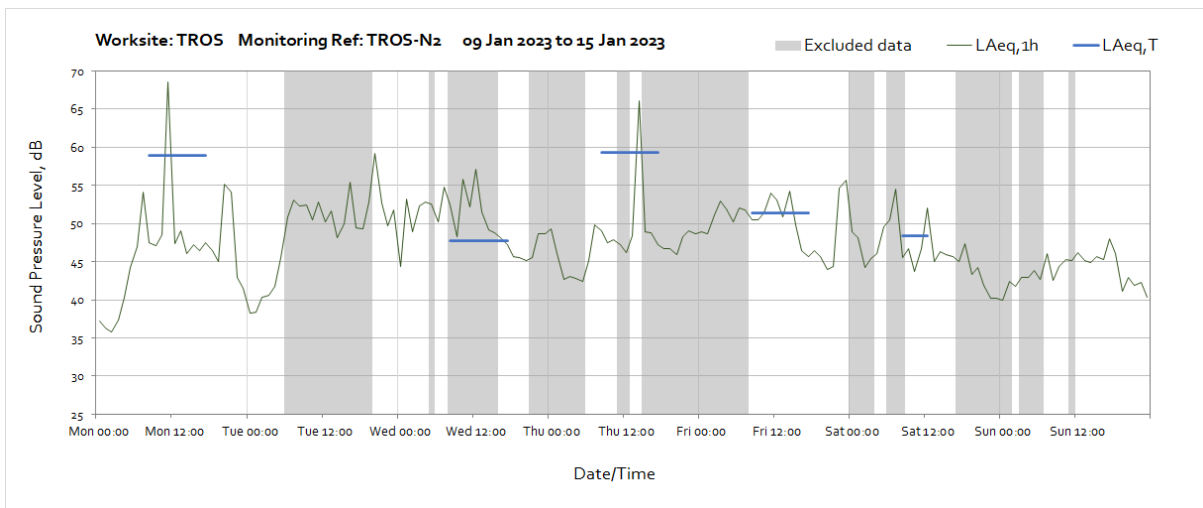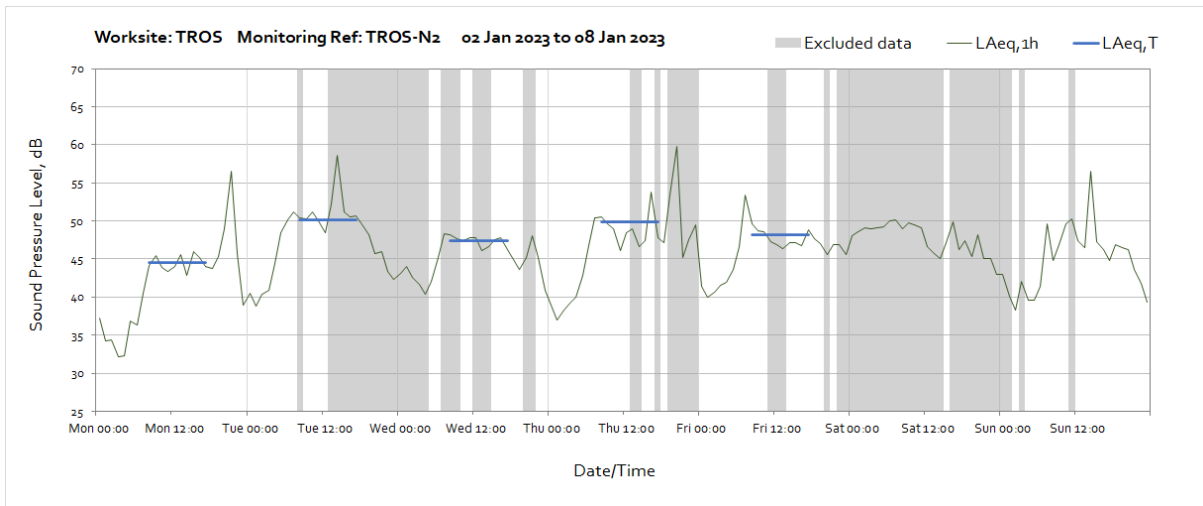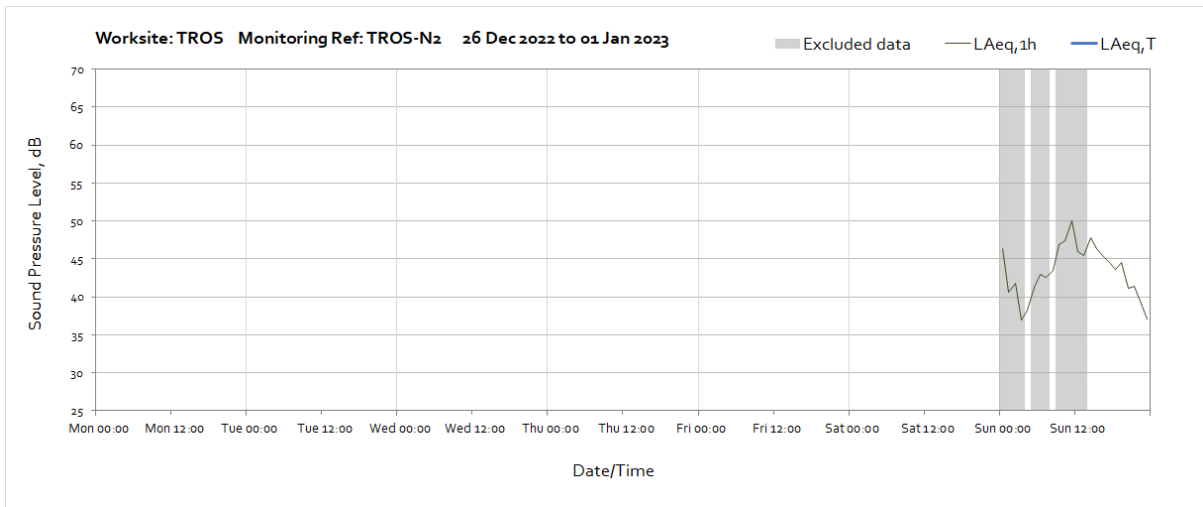

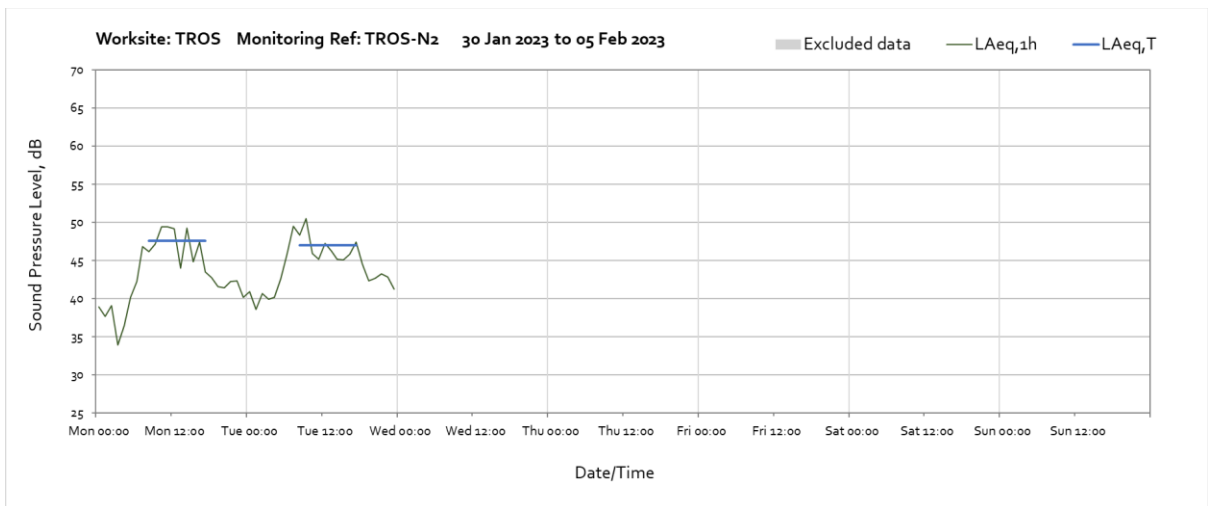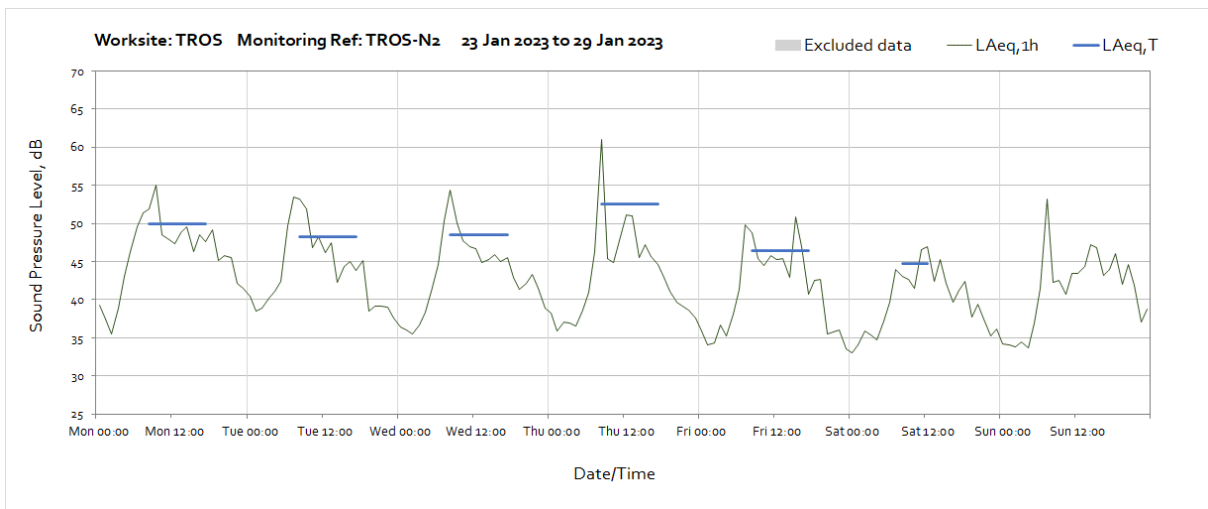




## Worksite:N23 – Monitoring Ref: N23-N1

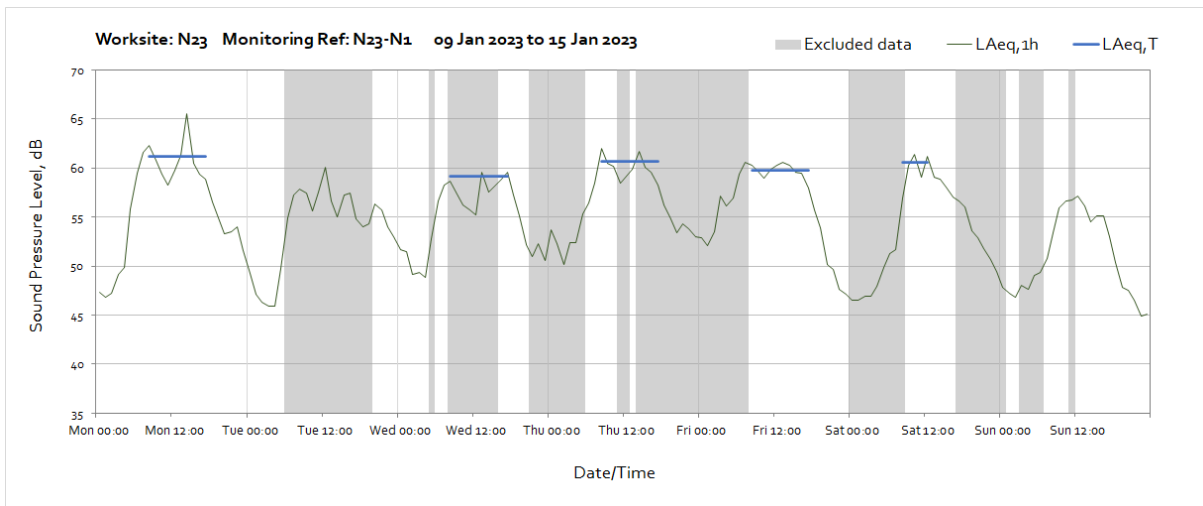
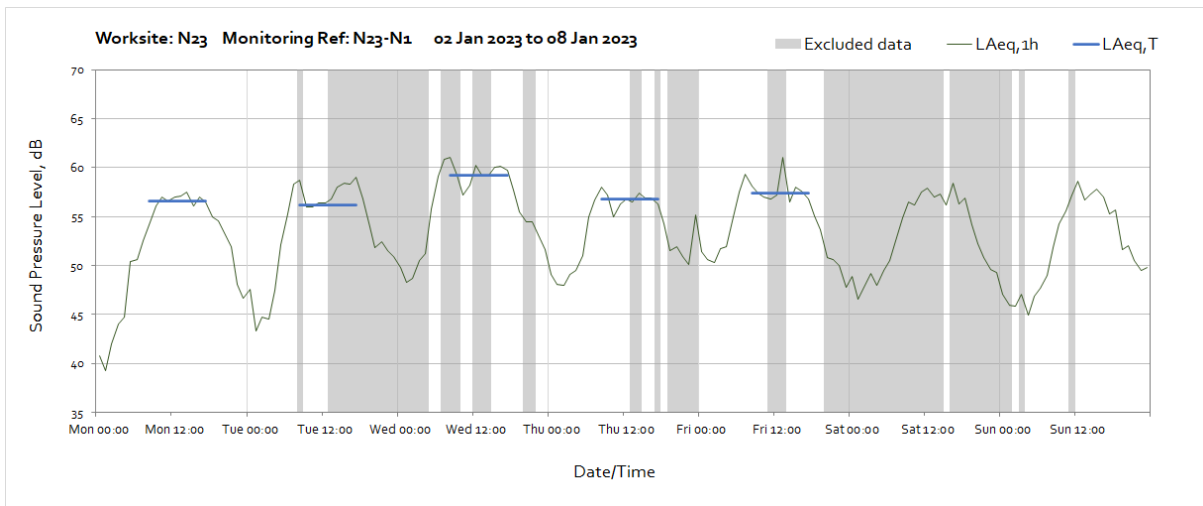
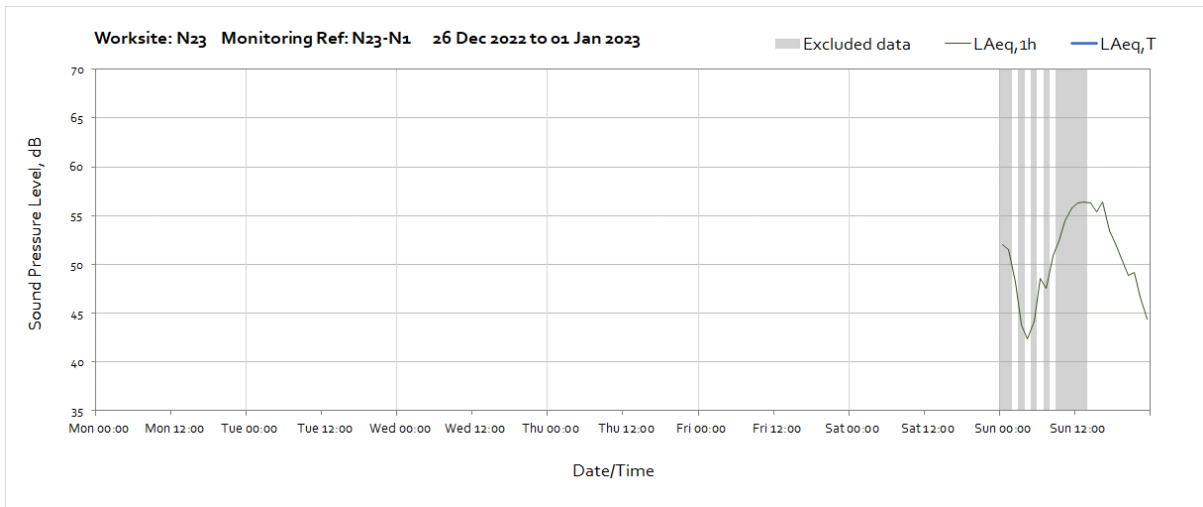


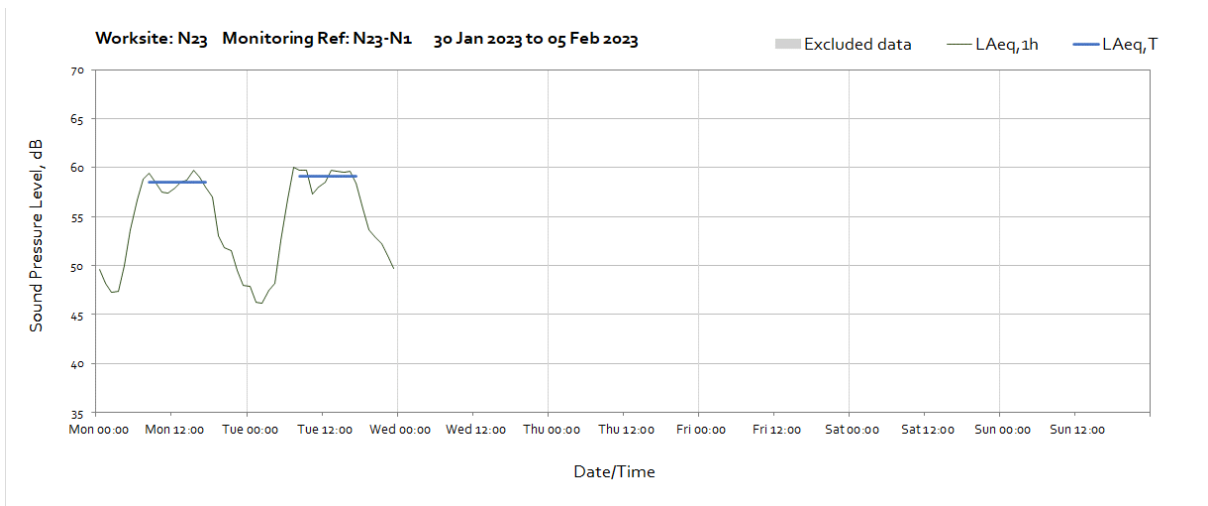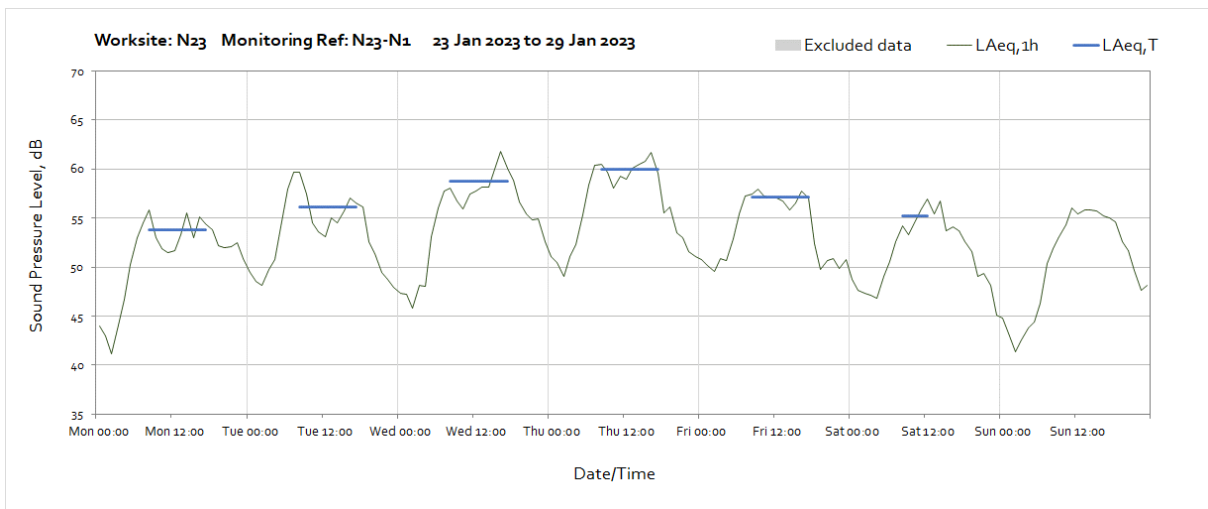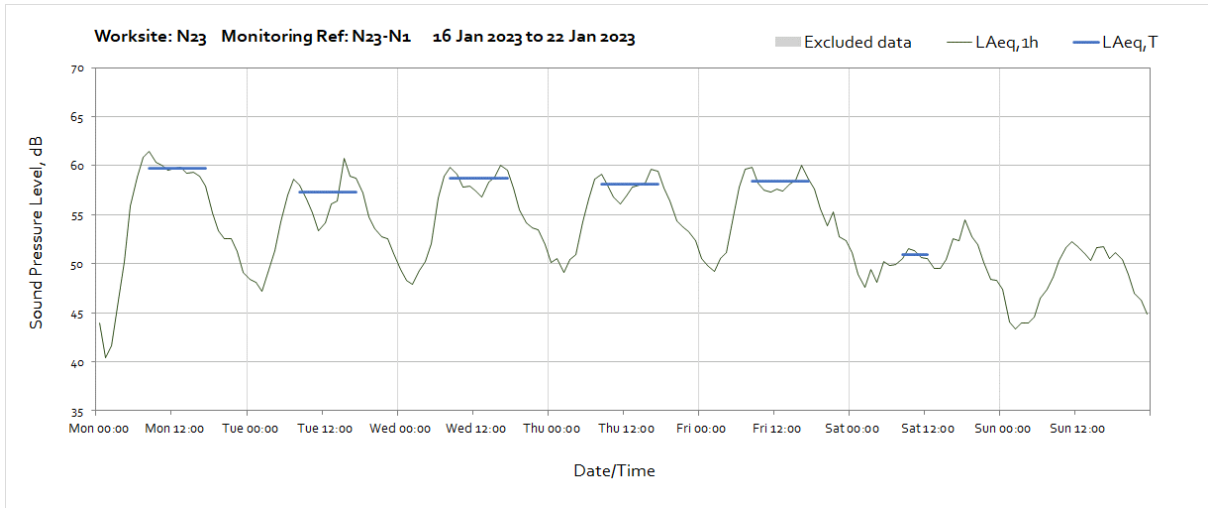








## Worksite: BLR – Monitoring Ref: BLR-N1

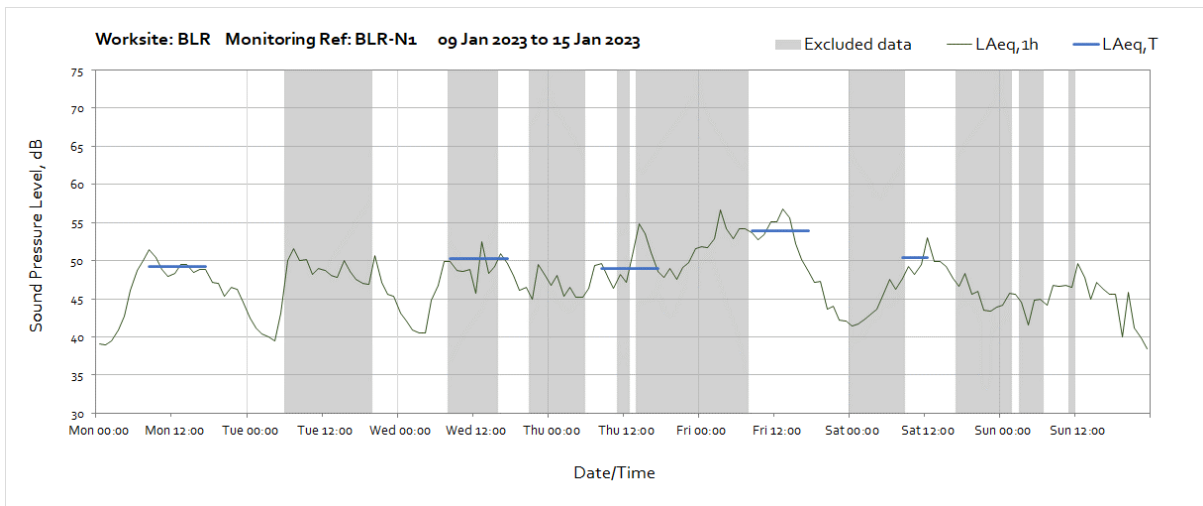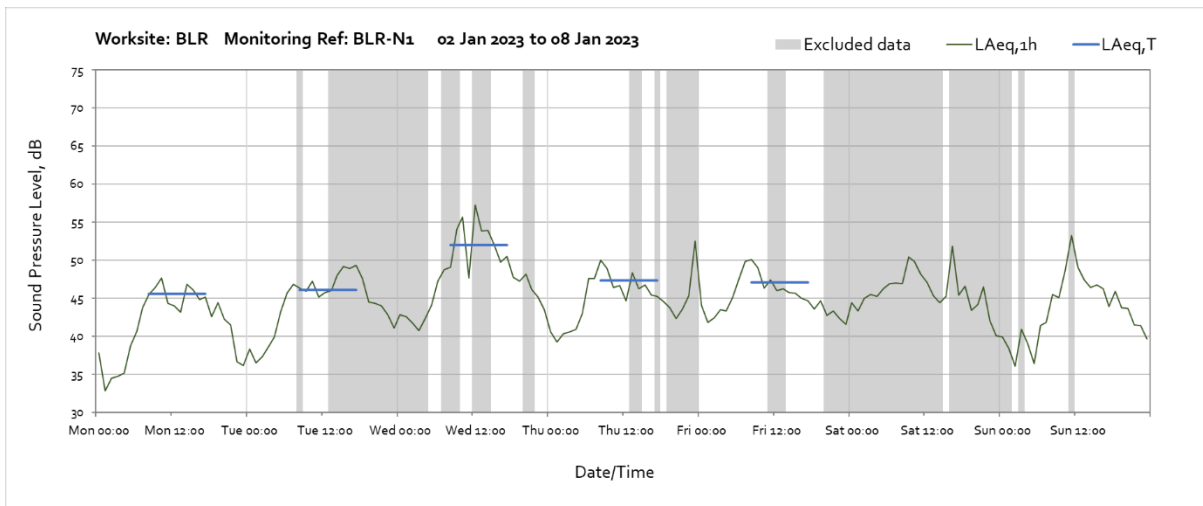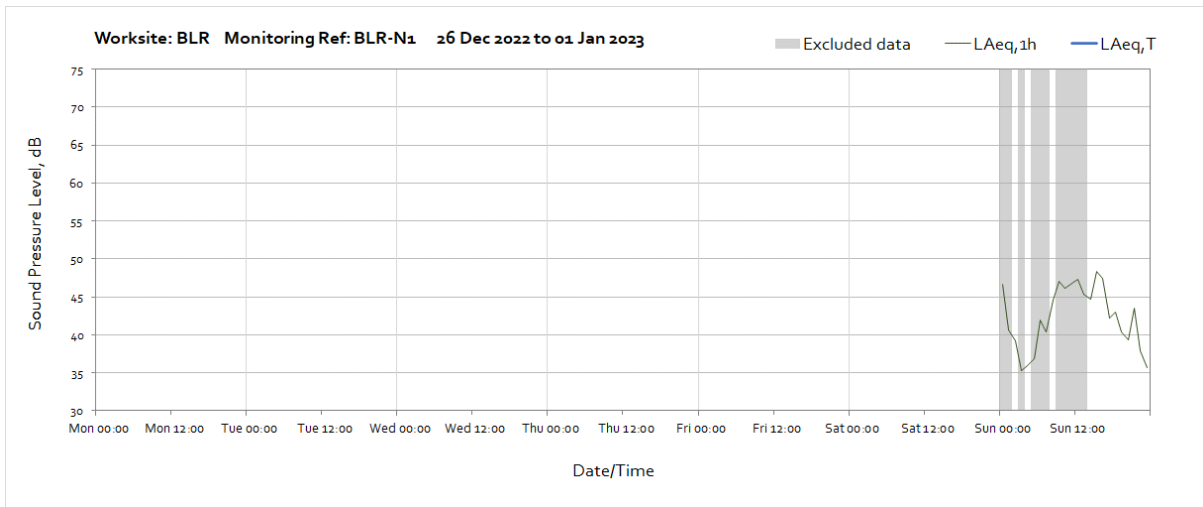

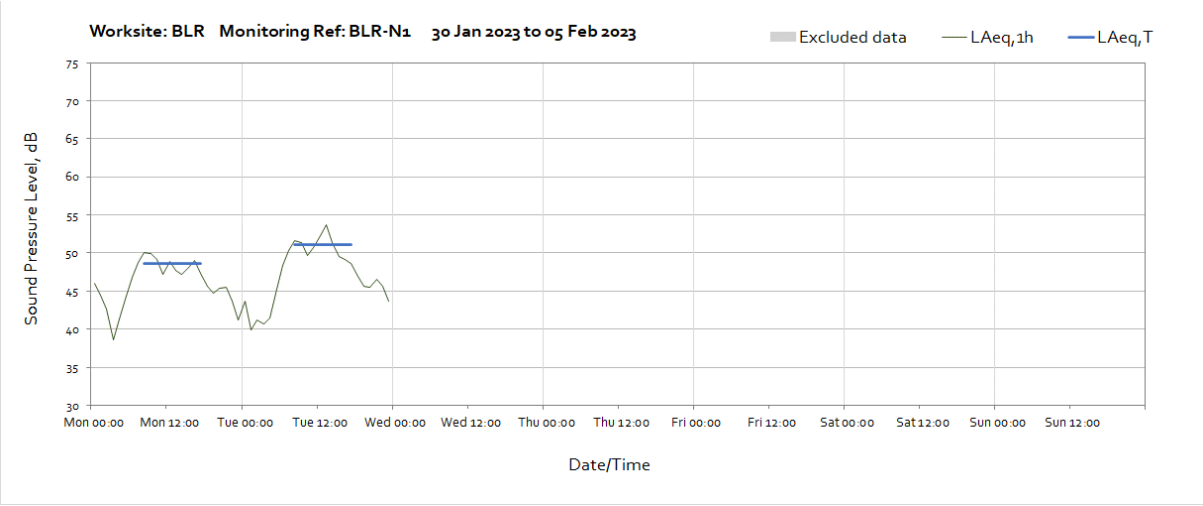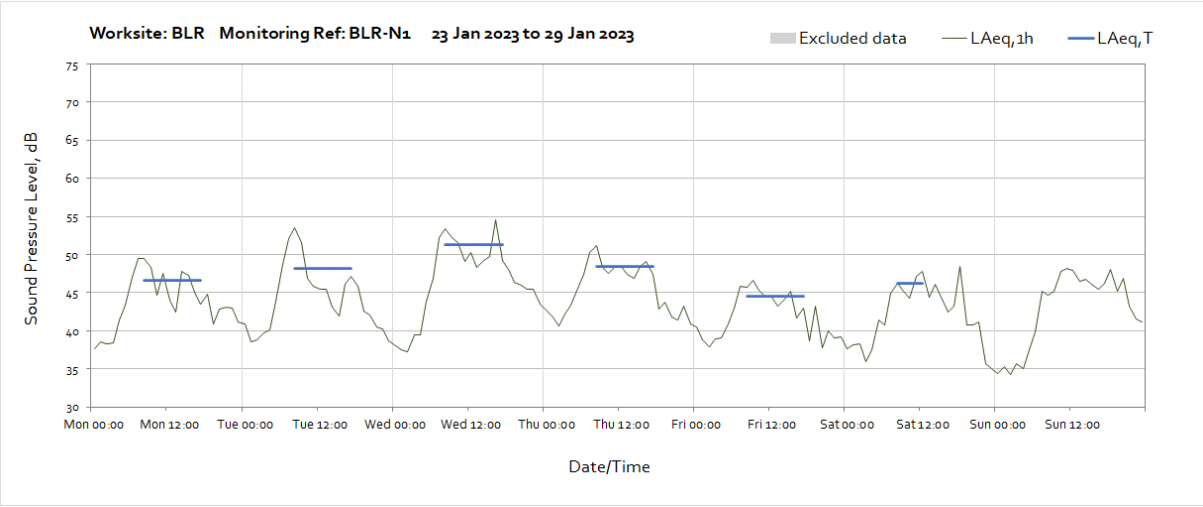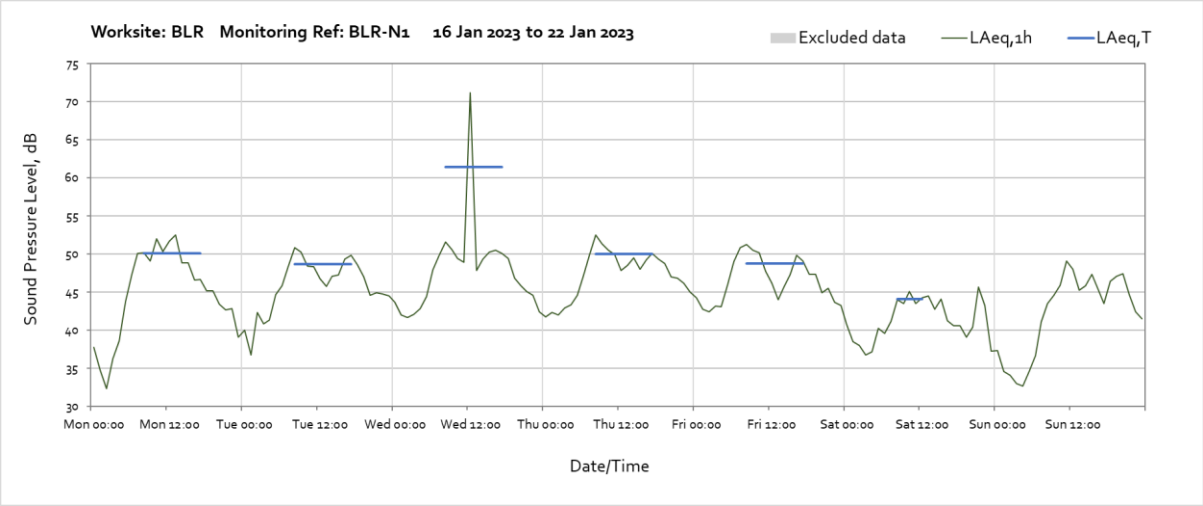


# Worksite: SRO – Monitoring Ref: SRO-N1

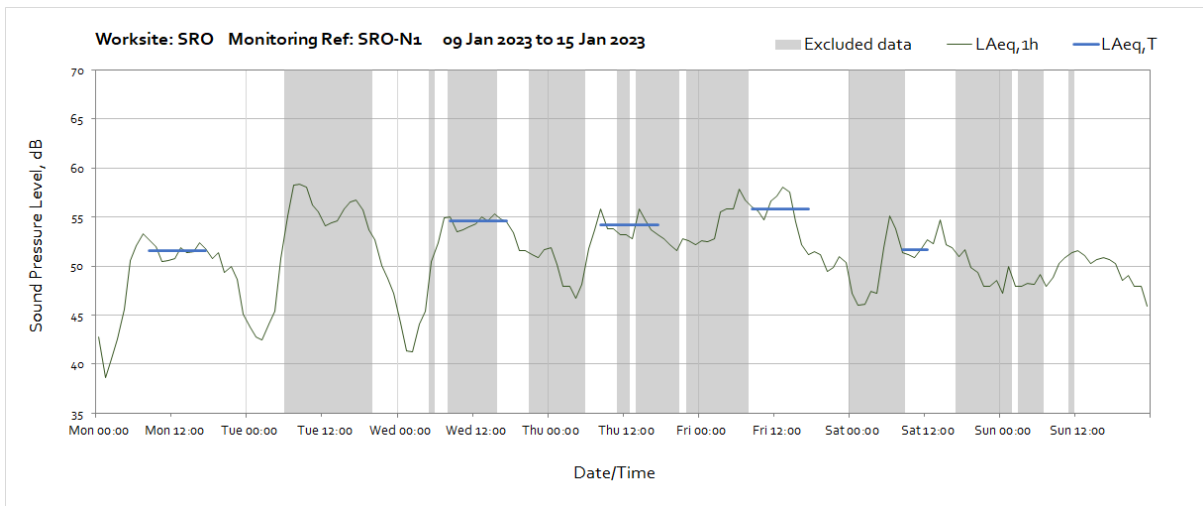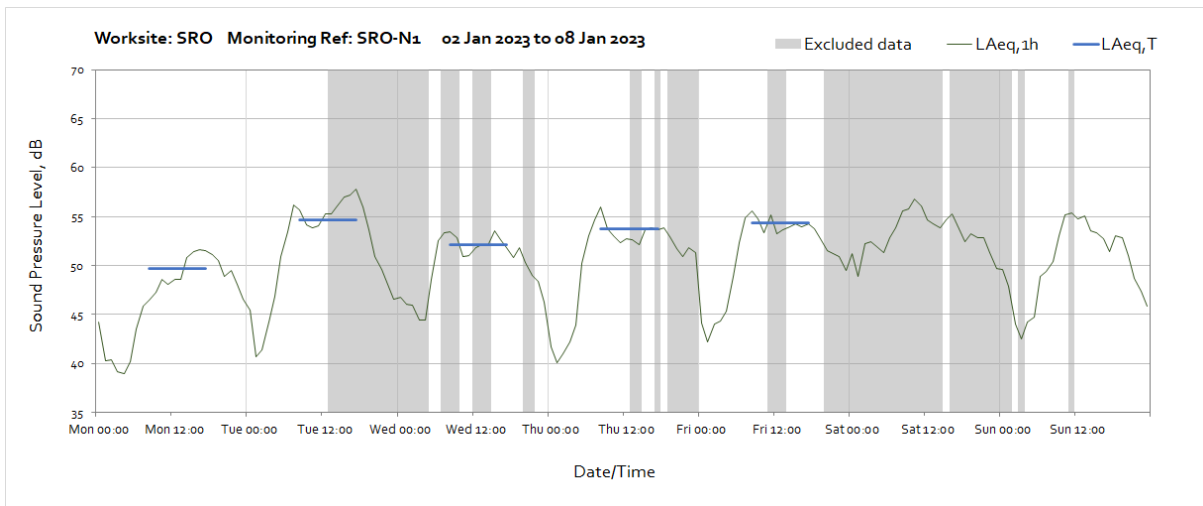
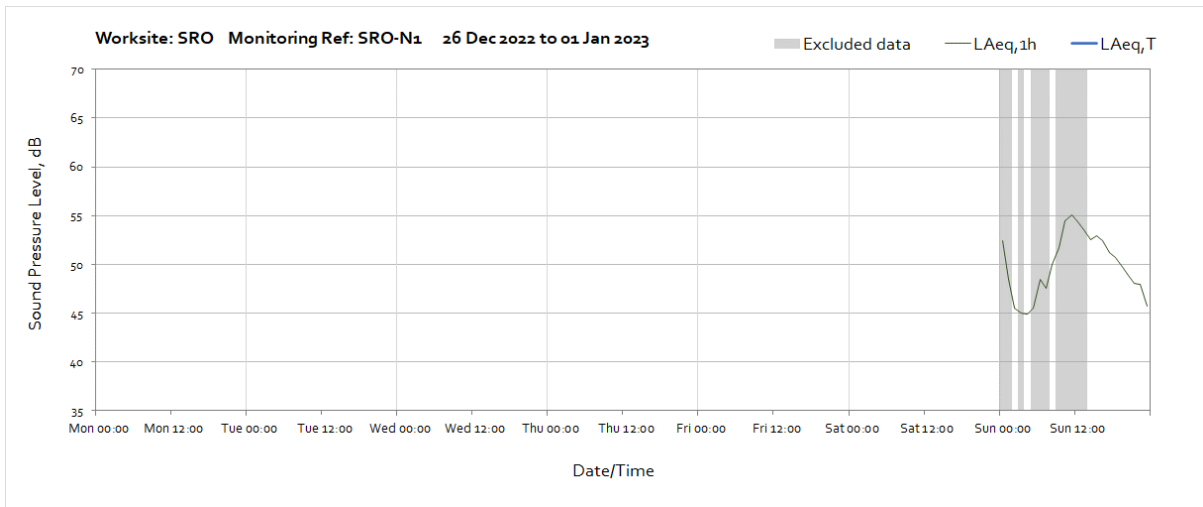


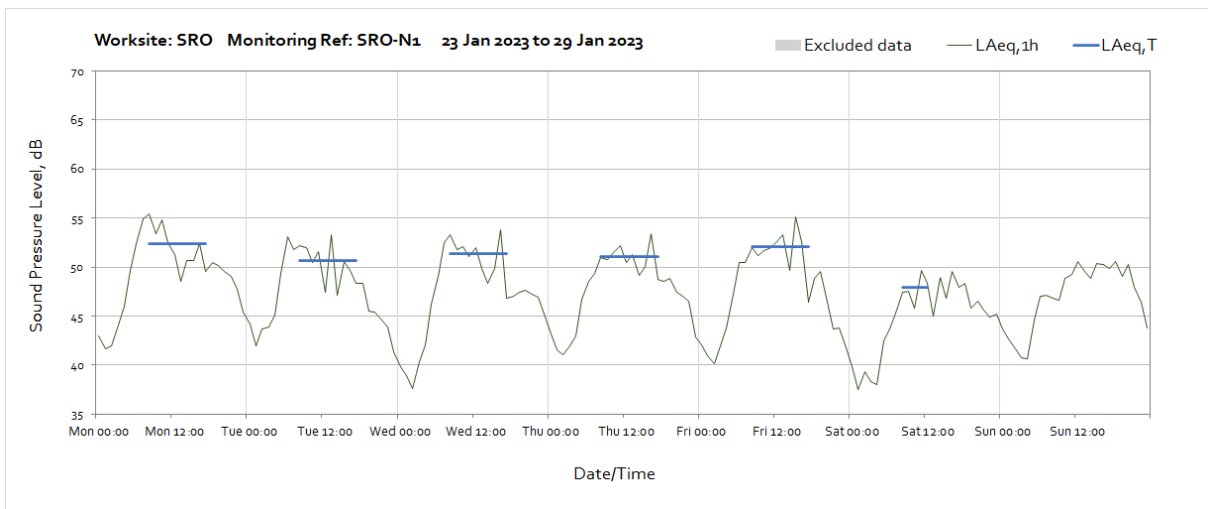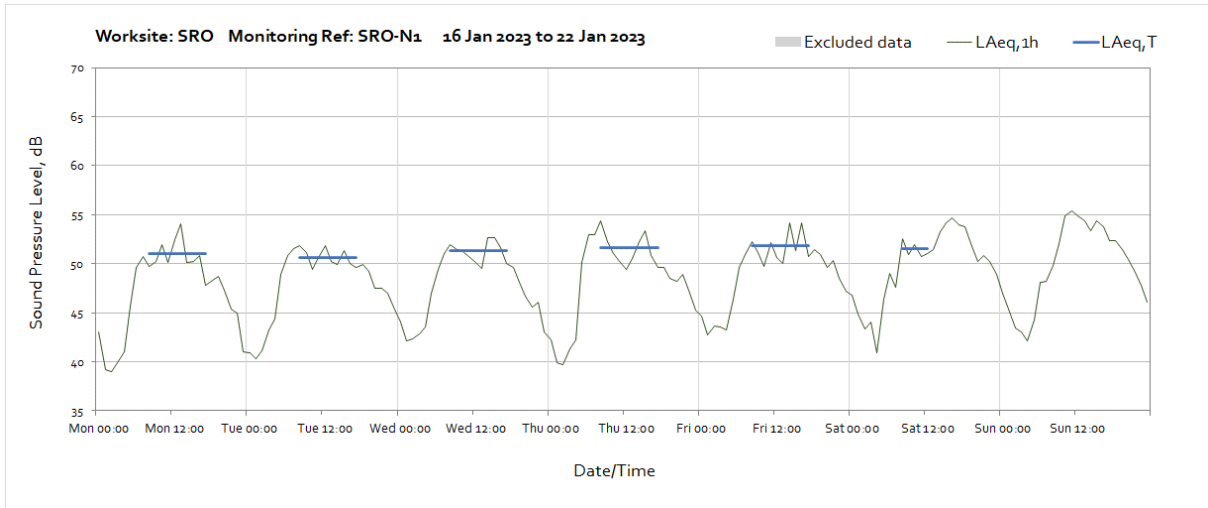

## Worksite: SRO – Monitoring Ref: SRO-N2

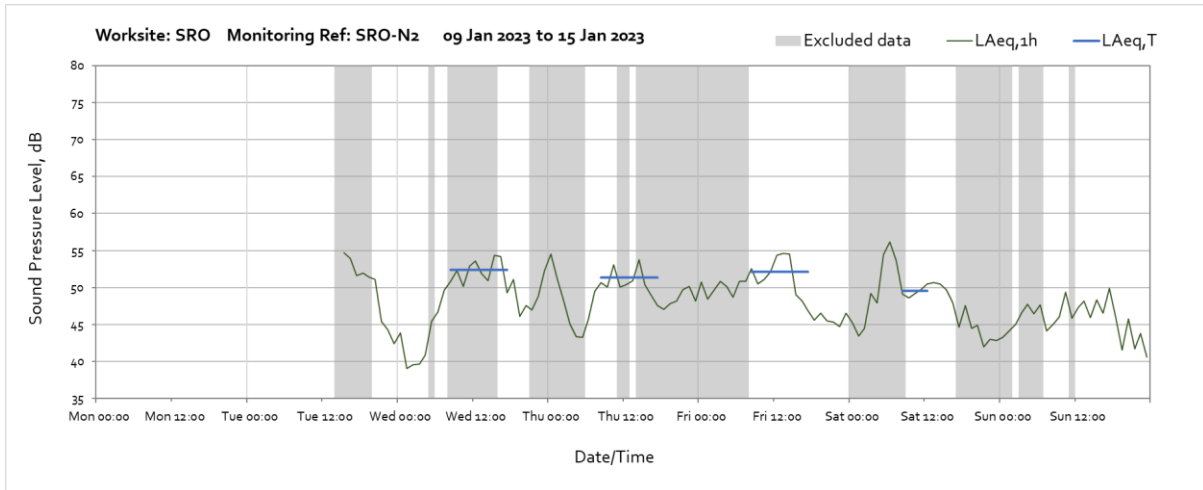

Note: Noise monitor installed at 14:00 on 10<sup>th</sup> January 2023.

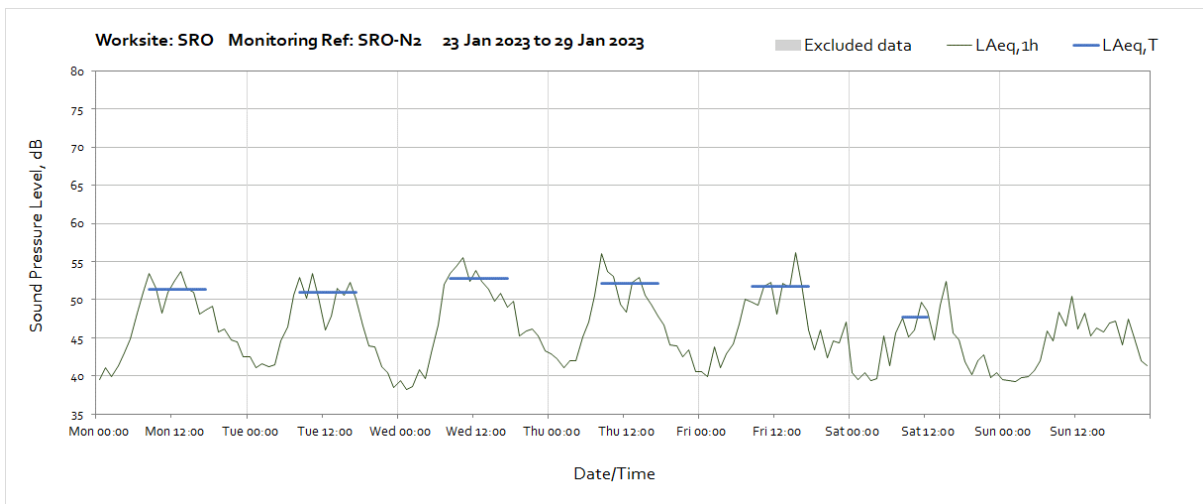
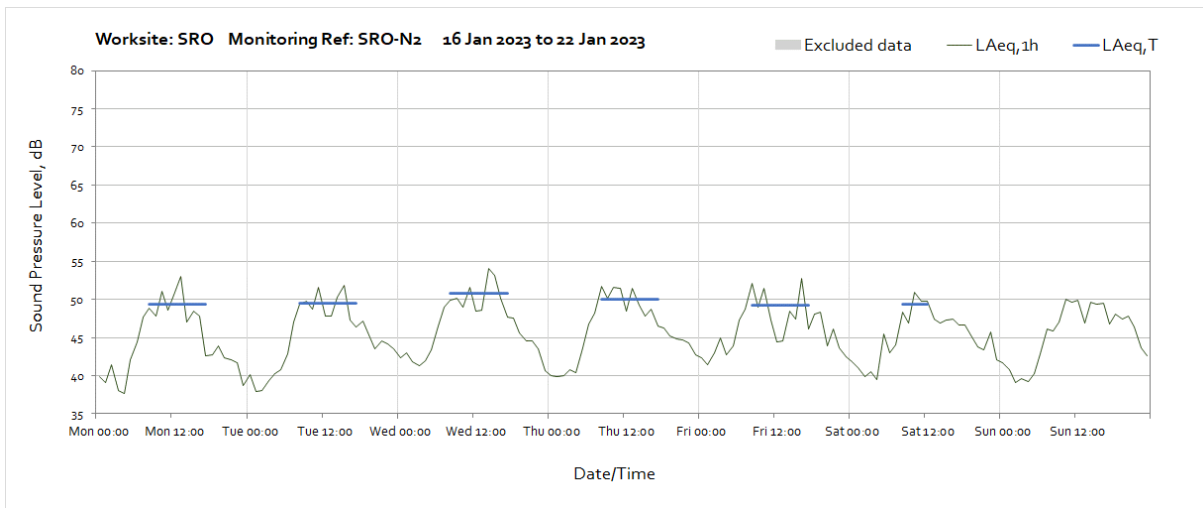






## Vibration


The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the resultant PPV due to vibration components on three orthogonal axis x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.

### Worksite: FEW – Monitoring Ref: FEW-V3

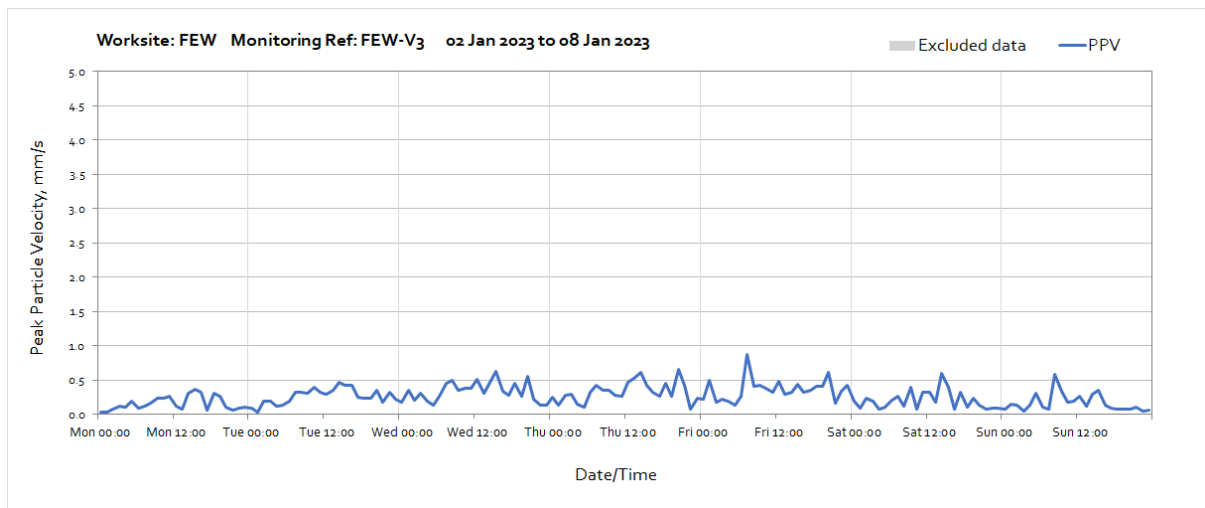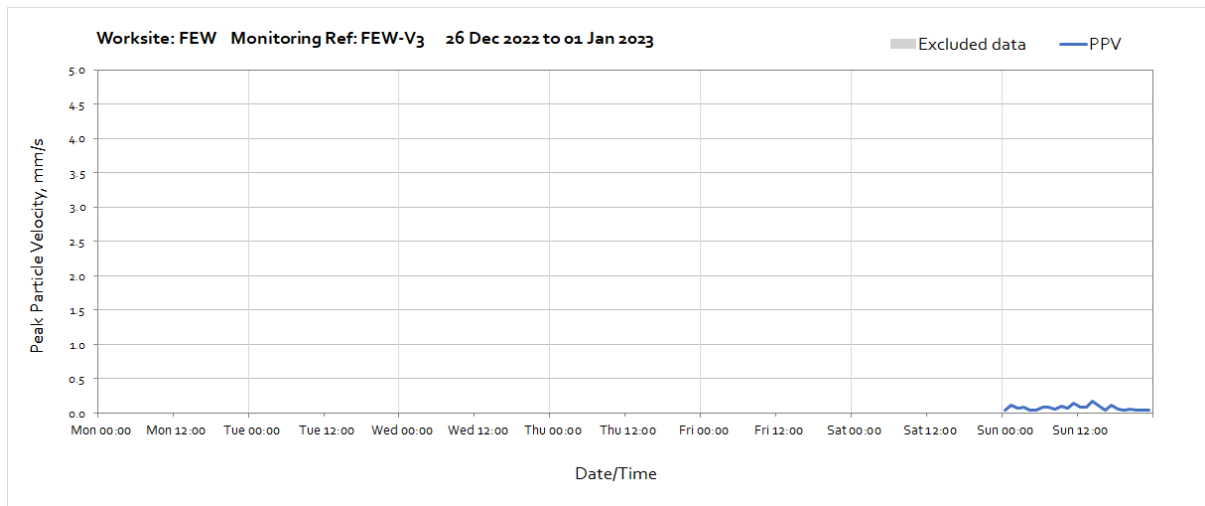


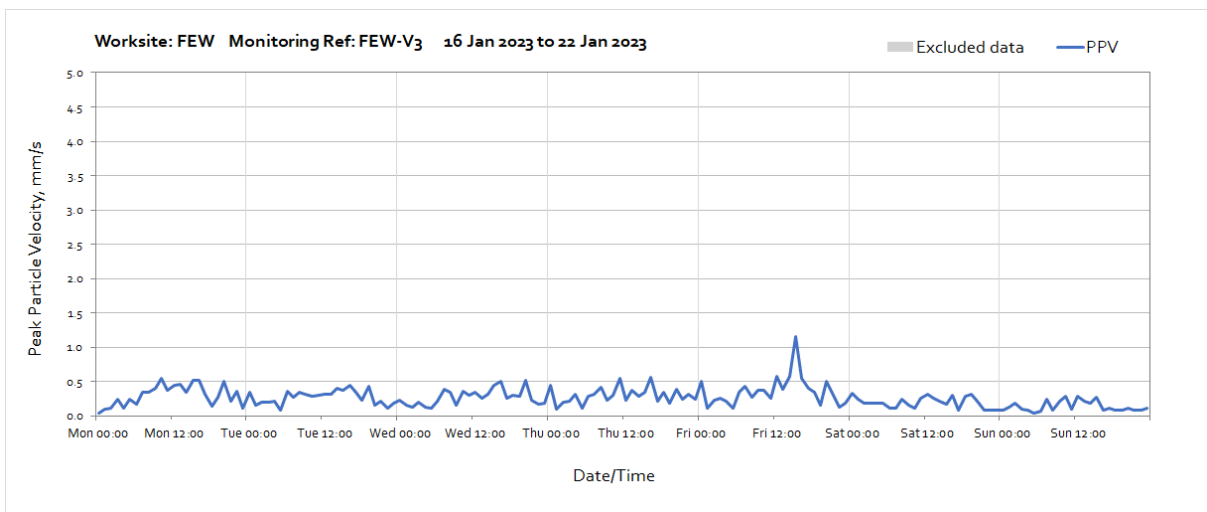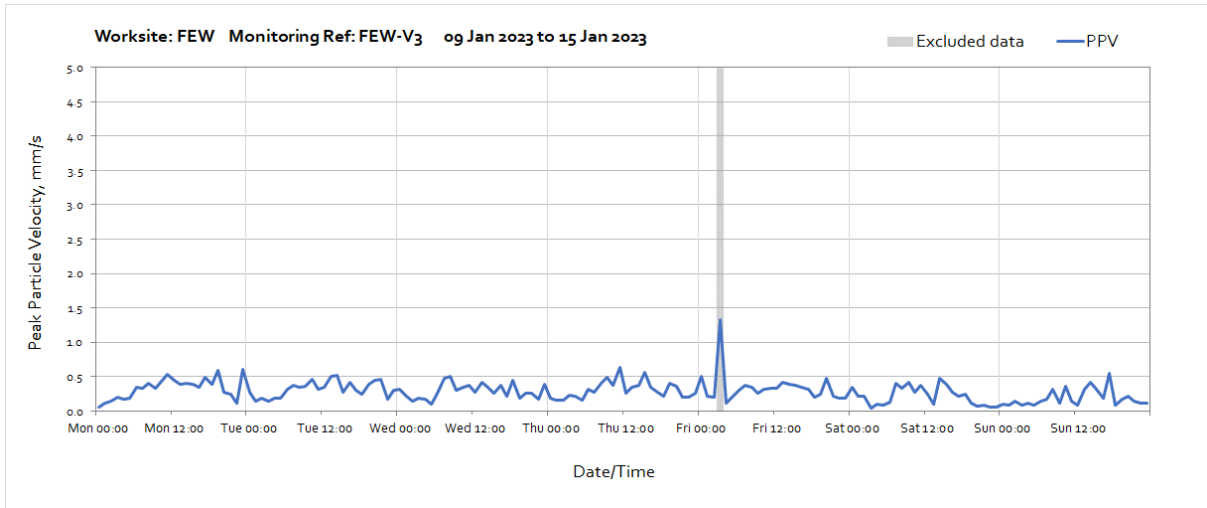

Note: High vibration levels measured at 15:00 on Friday 20<sup>th</sup> January was due to stripping works in the vicinity of the monitor.

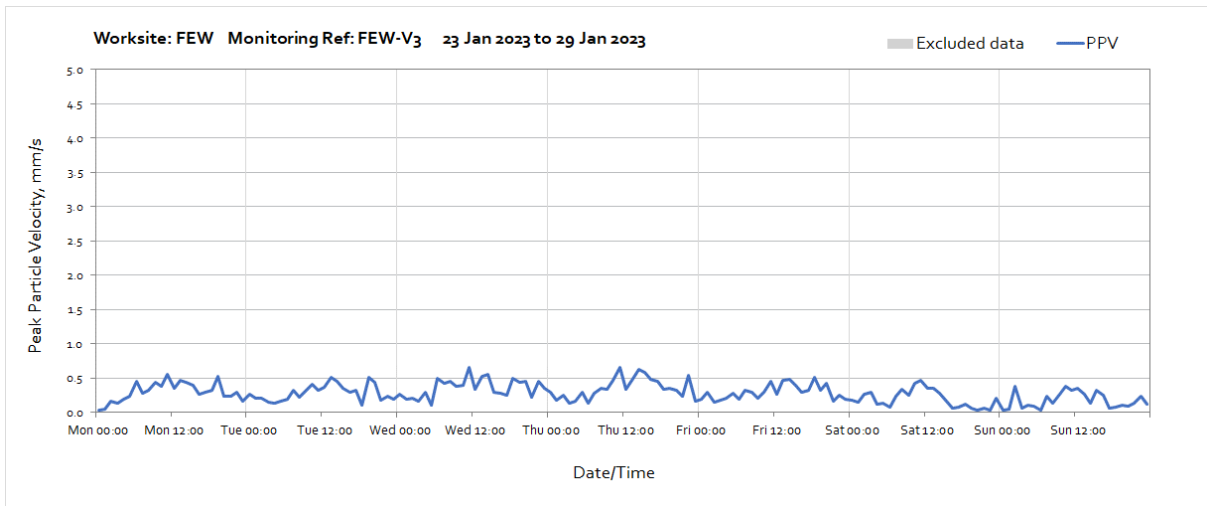





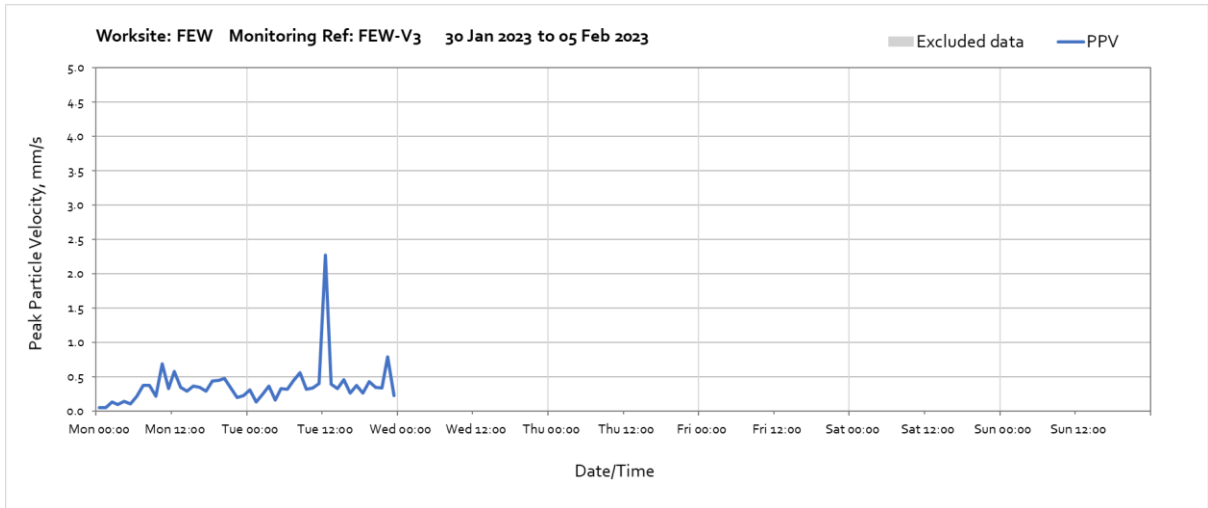


Note: High vibration levels measured at 12:00 on Tuesday 31<sup>st</sup> January was due to stripping works in the vicinity of the monitor.

### Worksite: SCRS – Monitoring Ref: SCRS-V1

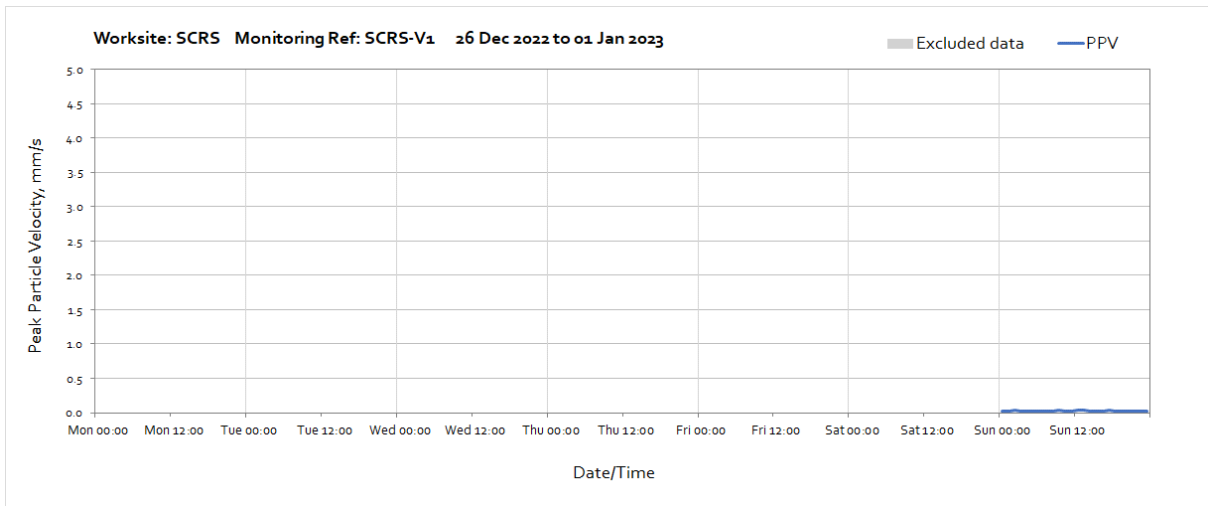



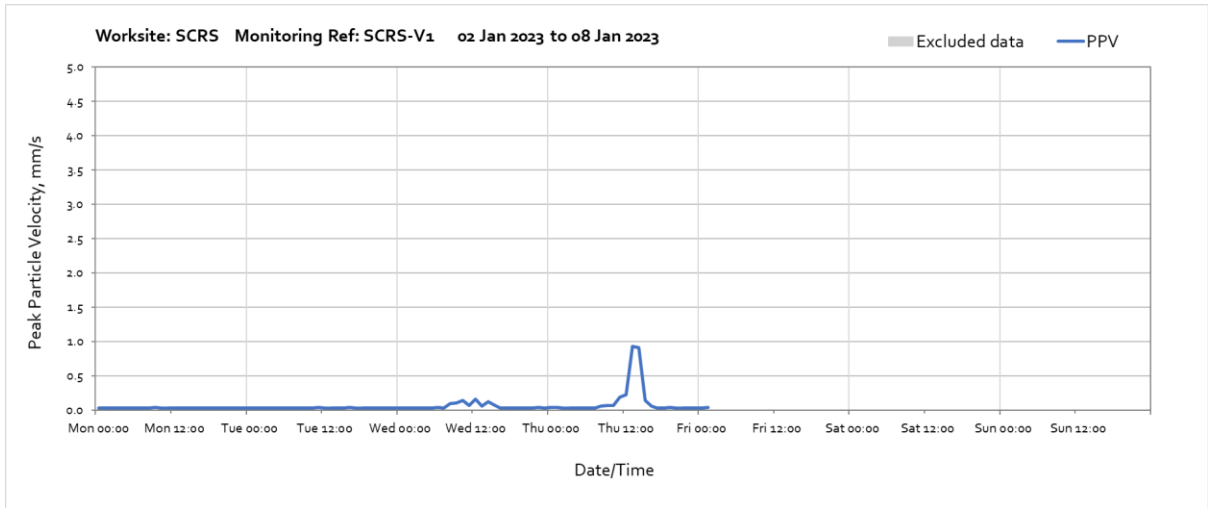


Note: Missing data from 02:00 on Friday 6<sup>th</sup> January till the end of the week was due to loss of power to the monitor from the solar panel supply.

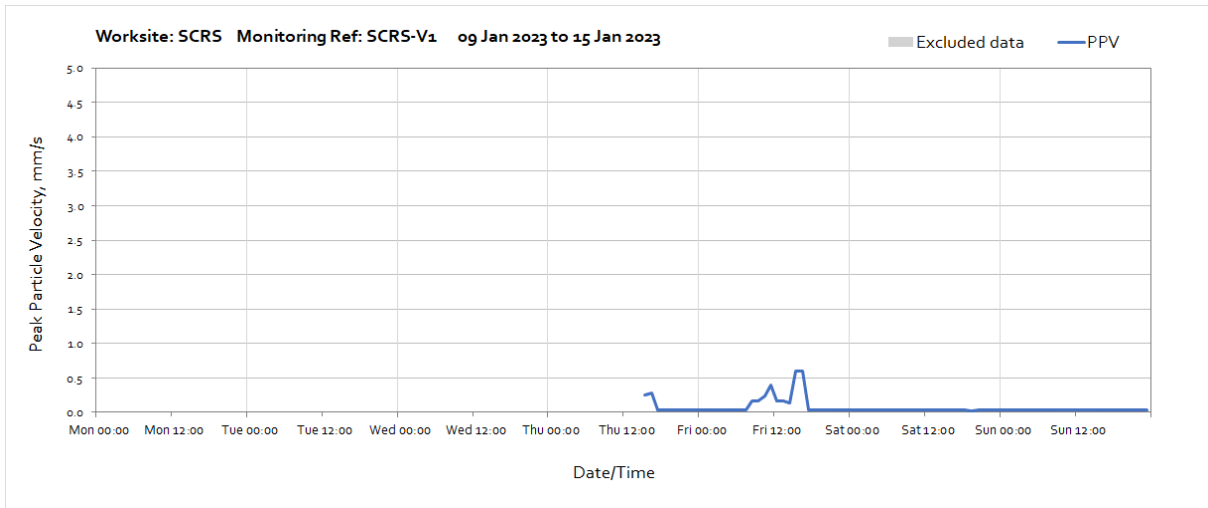


Note: Missing data between 00:00 on Monday 9<sup>th</sup> January and 15:00 on Thursday 12<sup>th</sup> January was due to loss of power to the monitor from the solar panel supply.



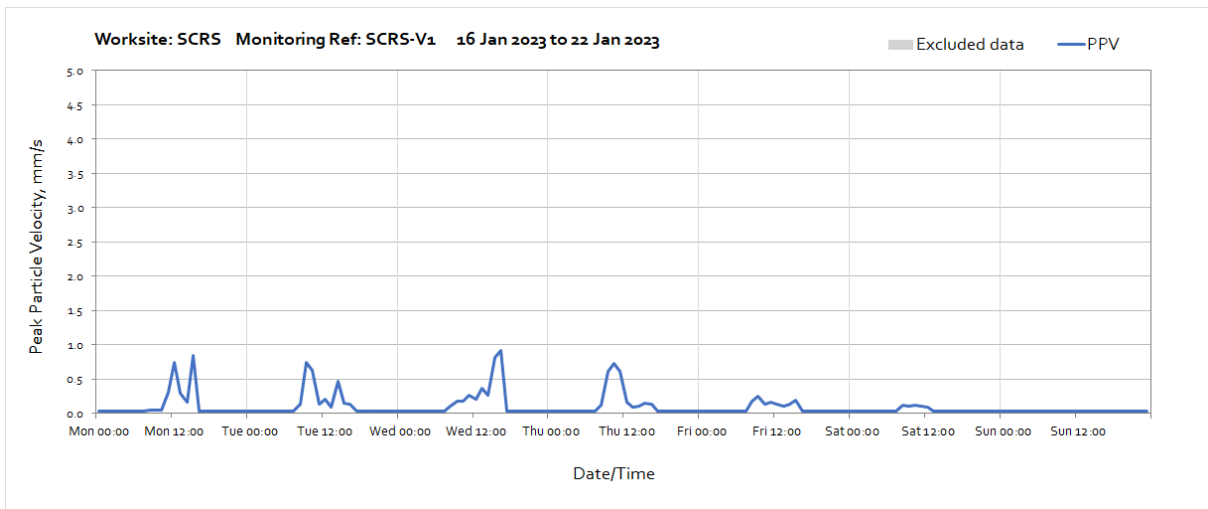


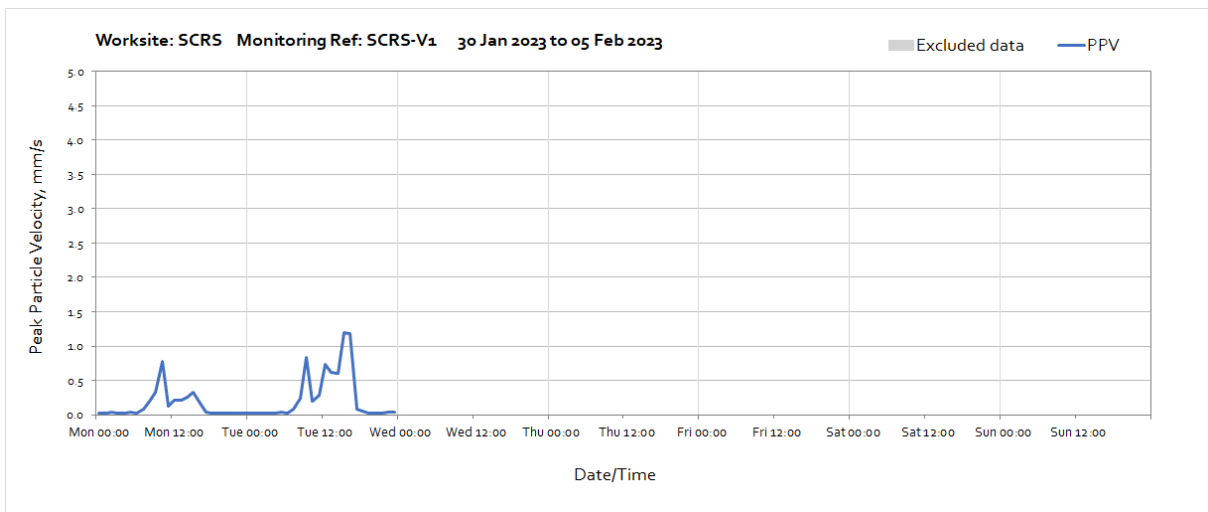
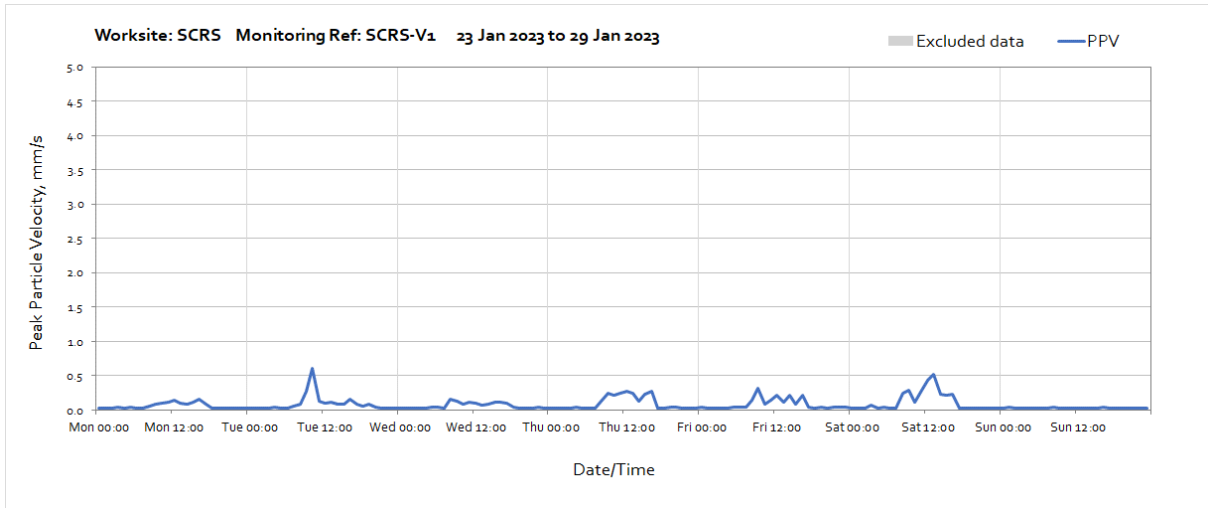


Note: High vibration levels measured between 15:00 and 17:00 on Monday 31<sup>st</sup> January was due to piling works in the vicinity of the monitor.


### Worksite: CLC – Monitoring Ref: CLC-V1



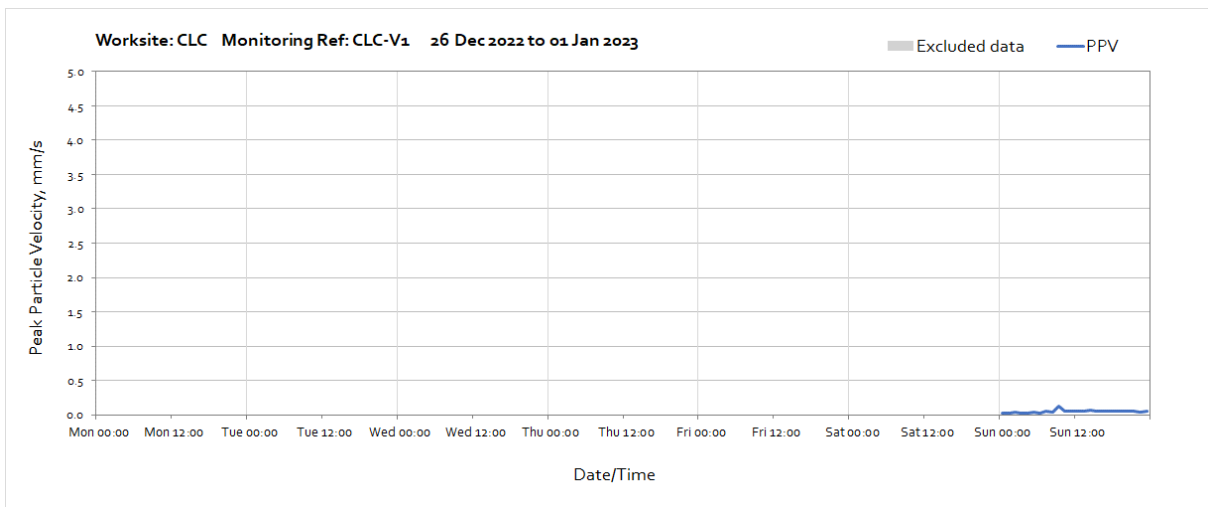


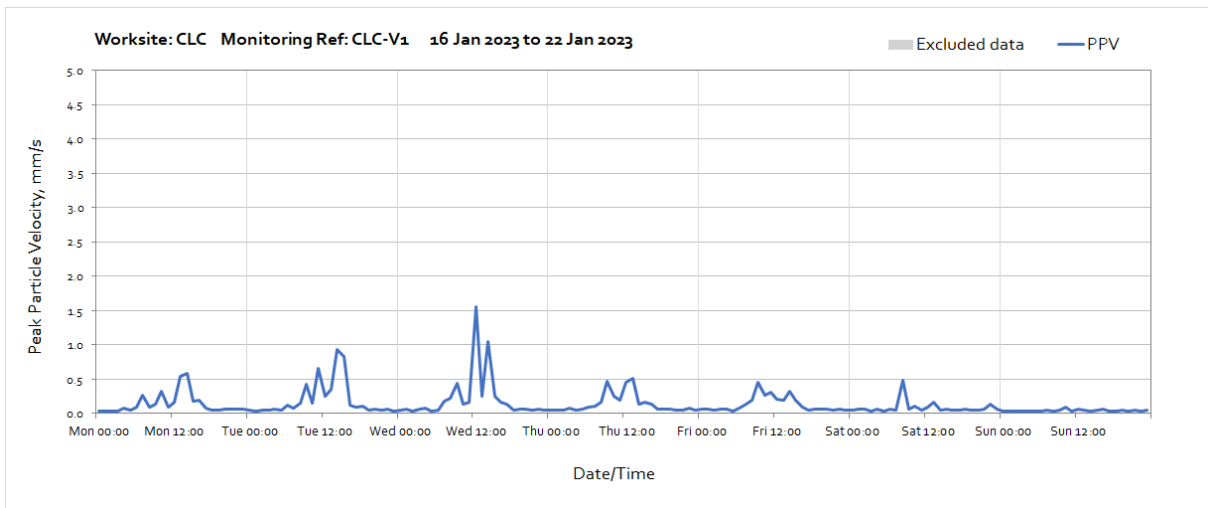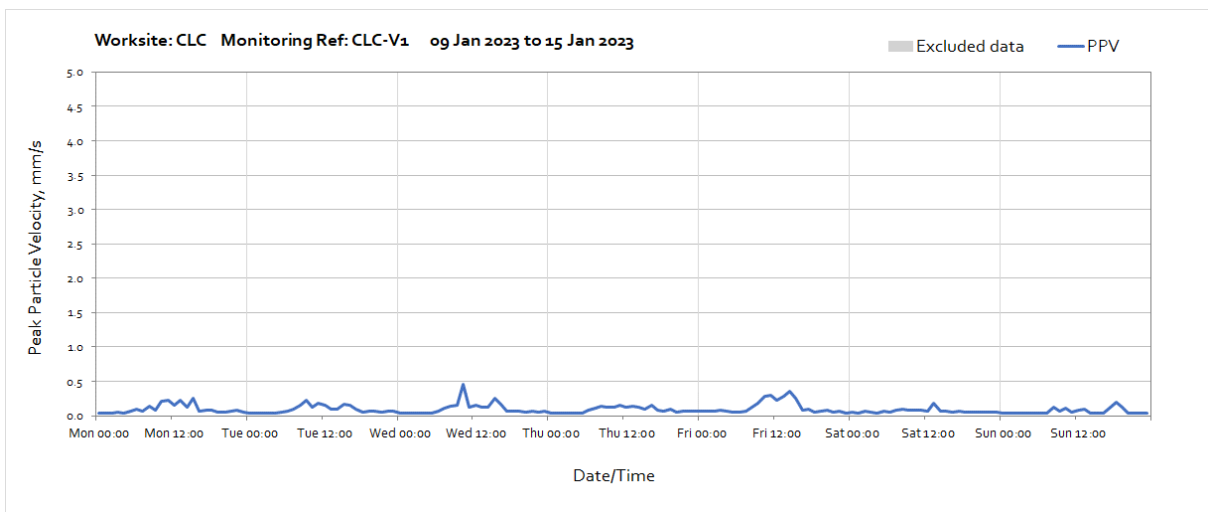
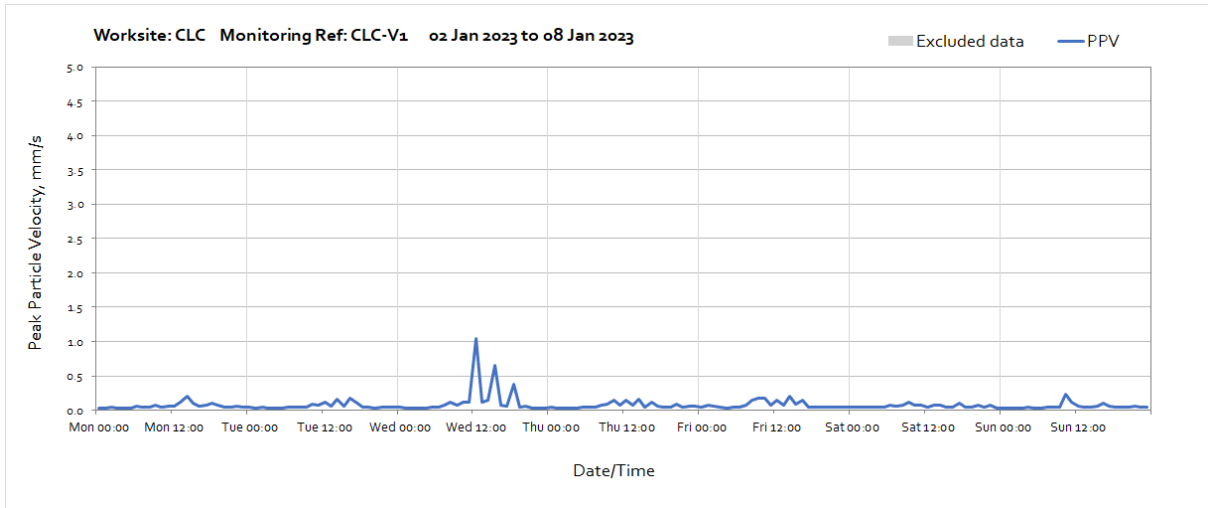


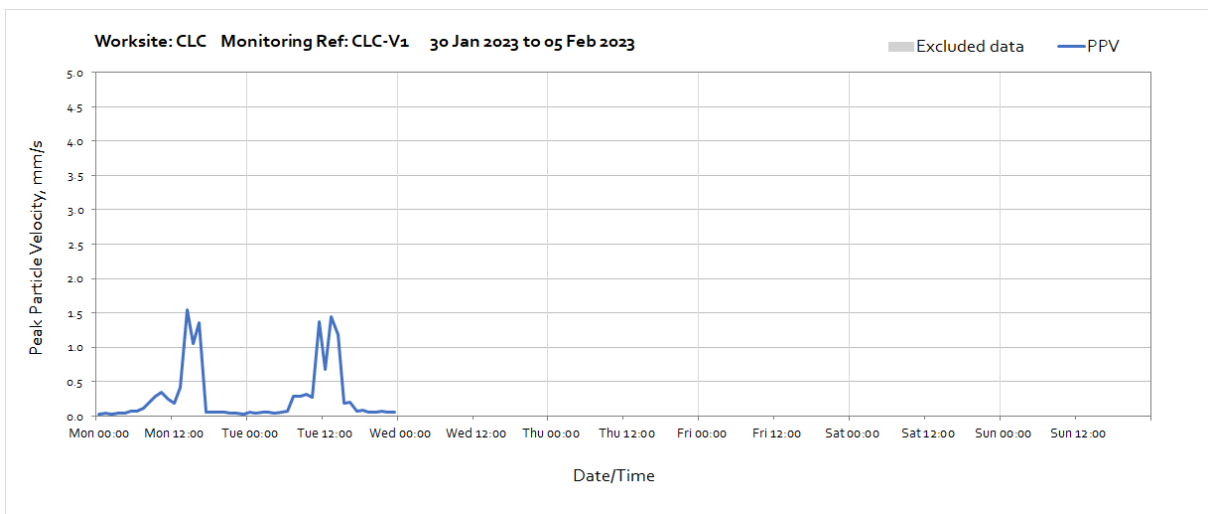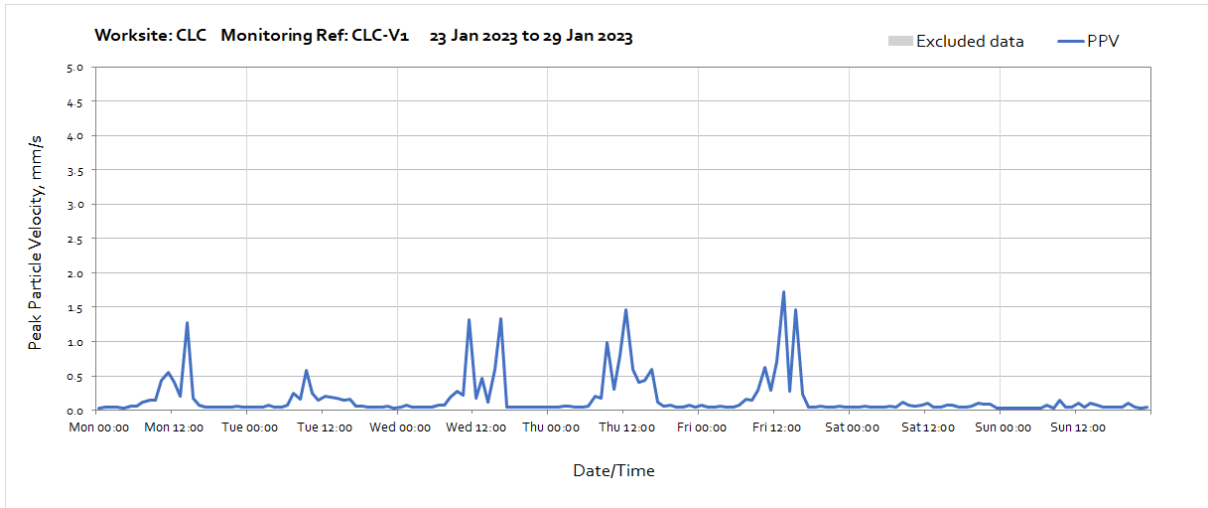


### Worksite: N23 – Monitoring Ref: N23-V1

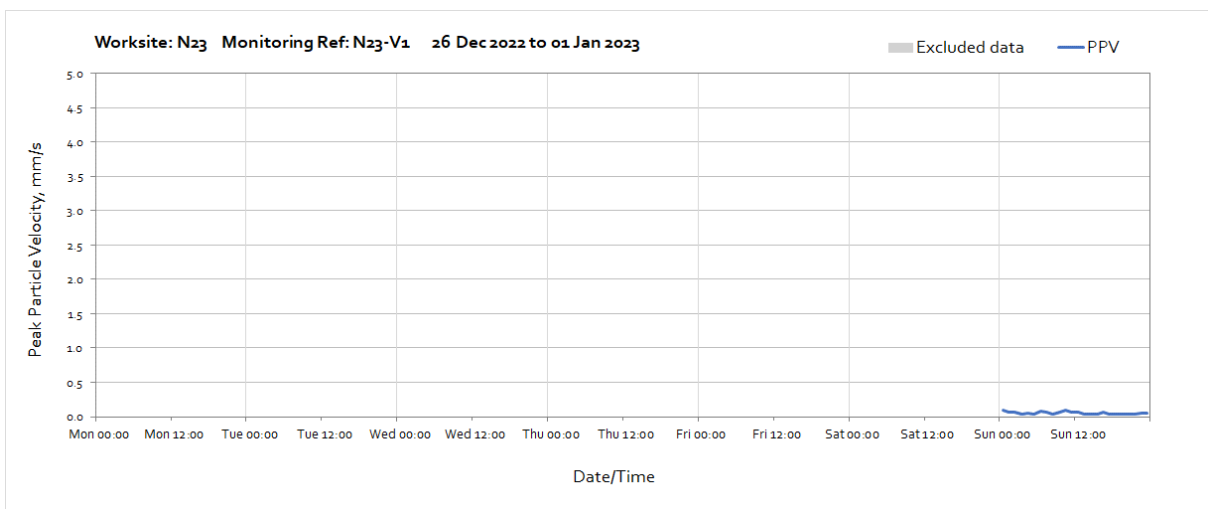


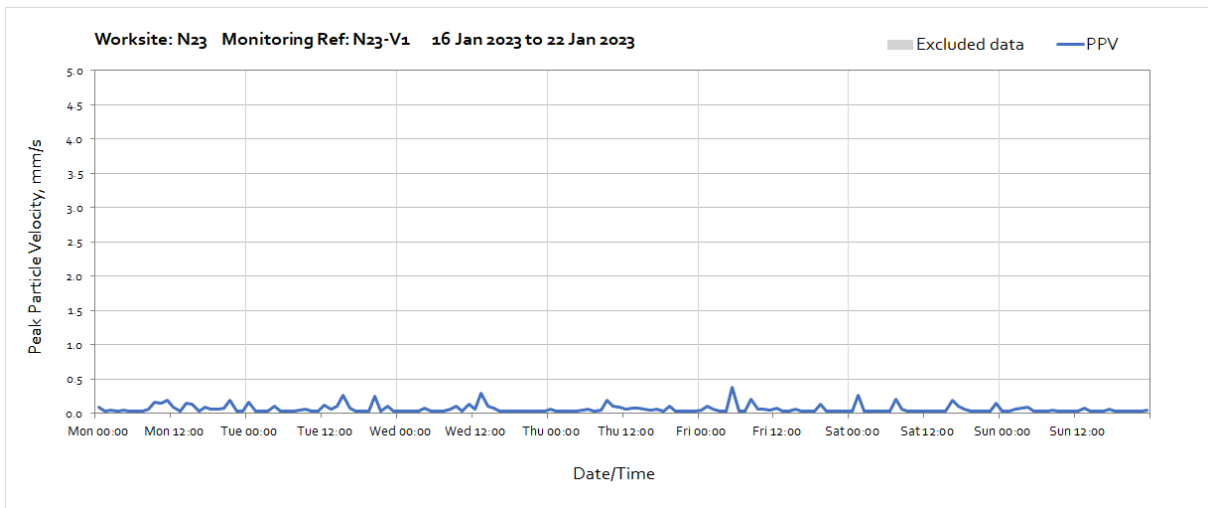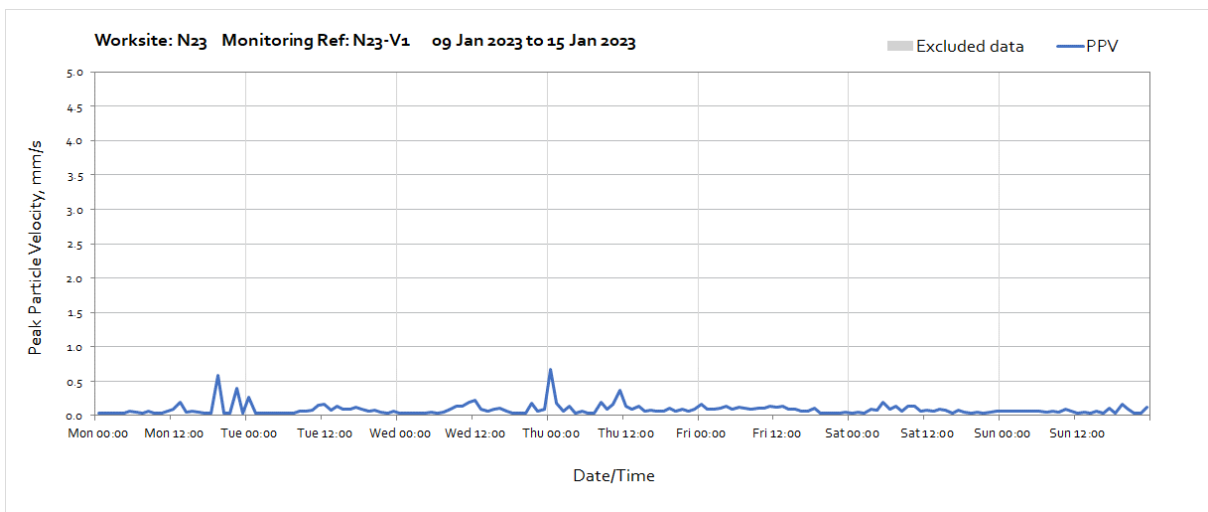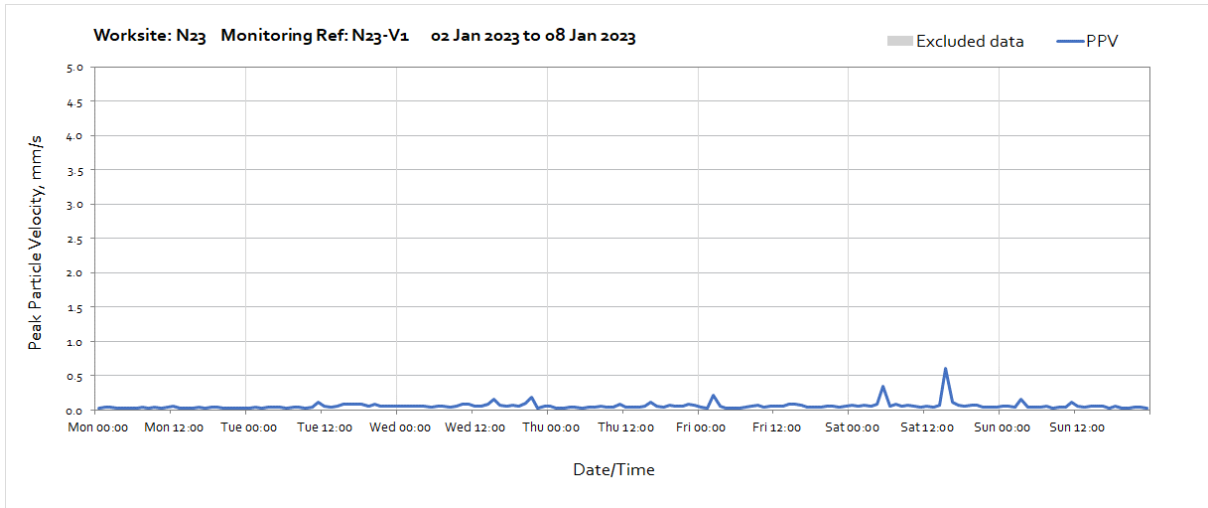

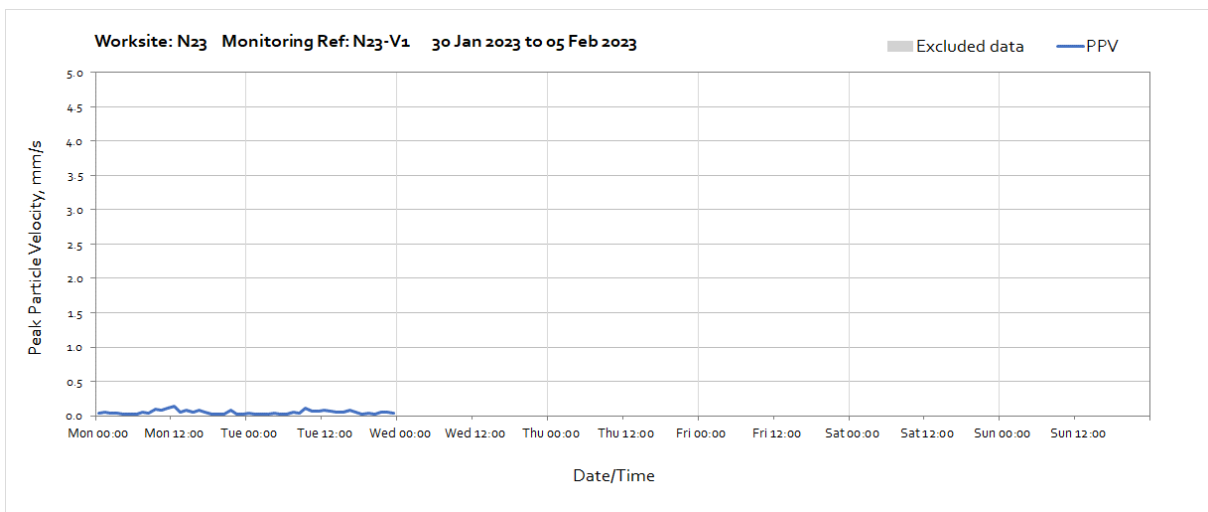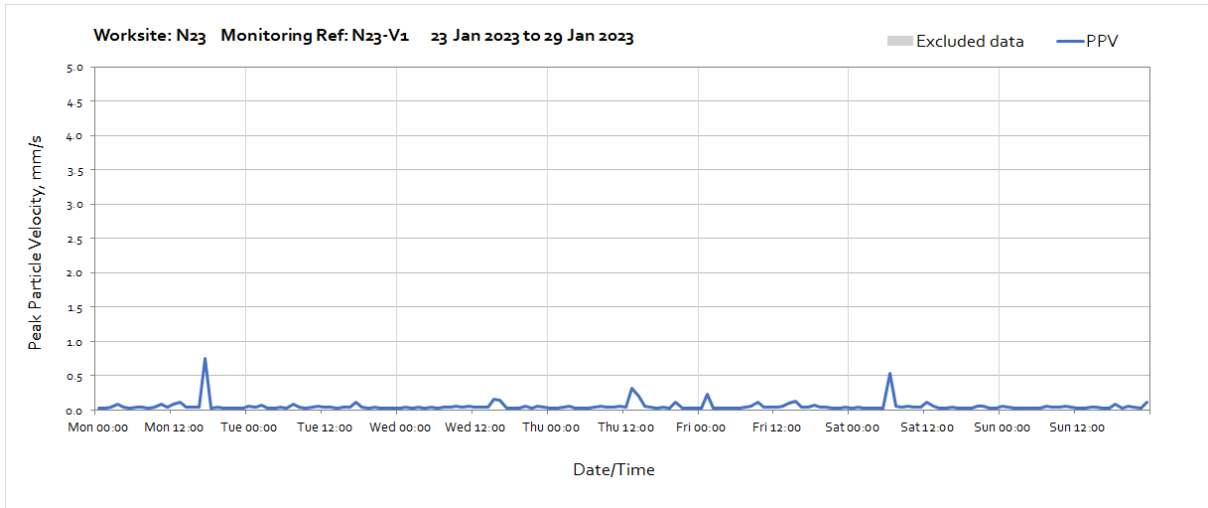


### Worksite: TROS – Monitoring Ref: TROS-V2

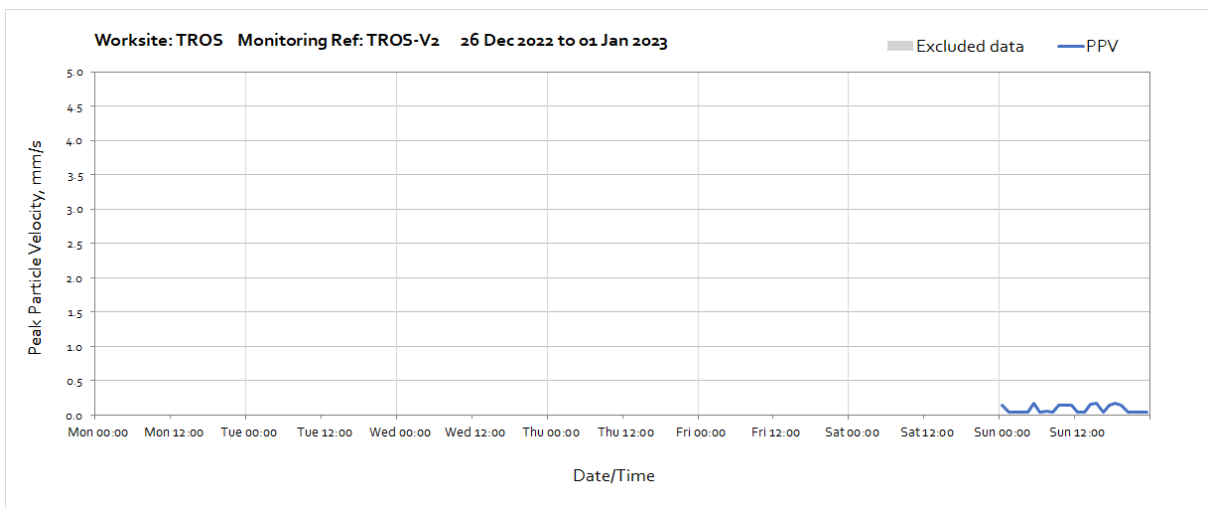


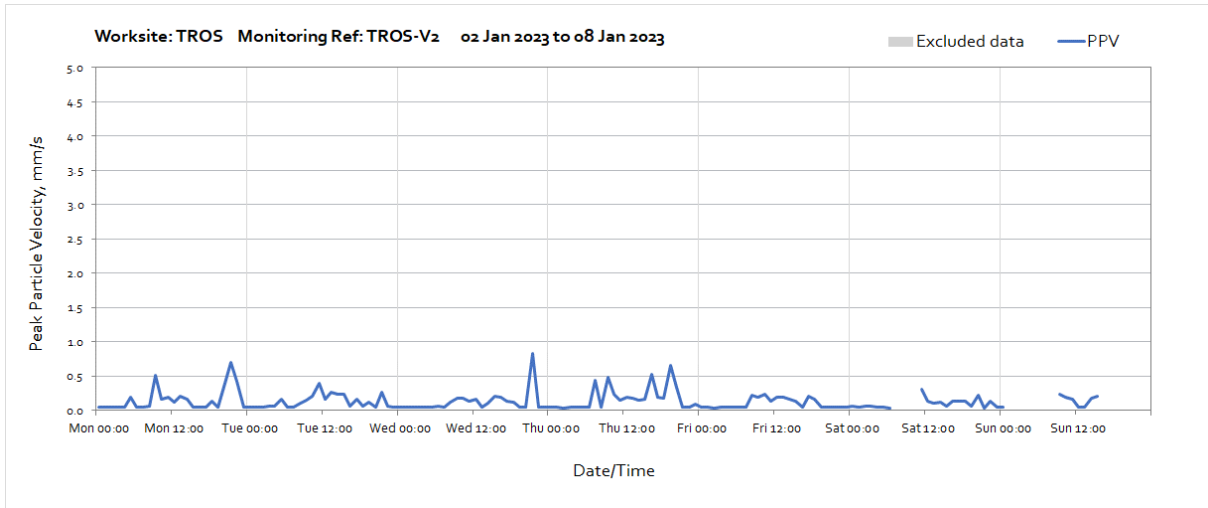

Note: Missing data between 07:00 and 11:00 on 7<sup>th</sup> January, between 01:00 and 09:00 on 8<sup>th</sup> January and from 16:00 on 8<sup>th</sup> January until the end of the week was due to loss of power to the monitor from the solar power supply.


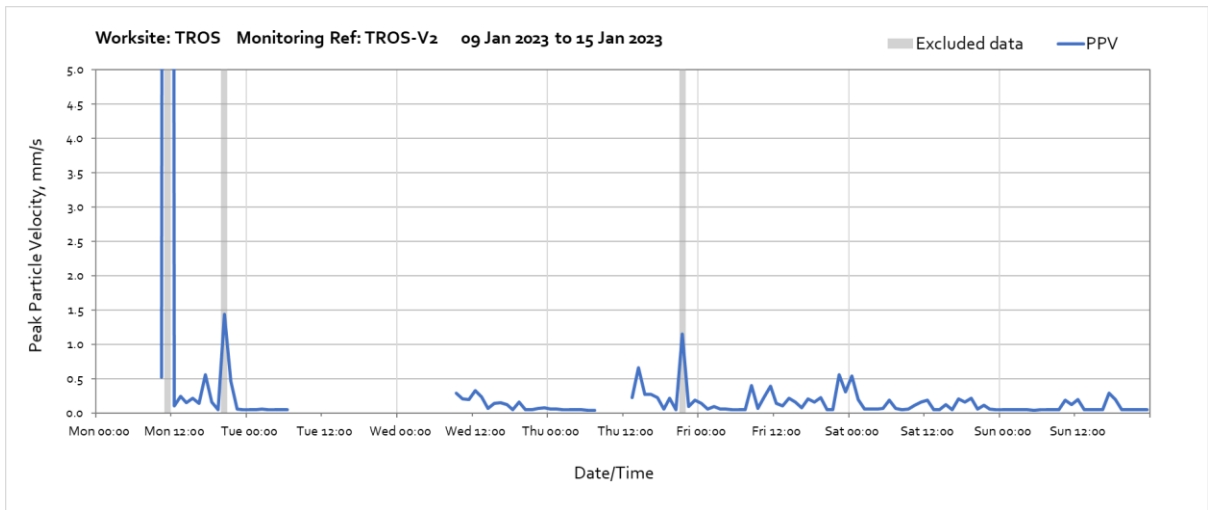


Note: Missing data from 00:00 to 10:00 on Monday 9<sup>th</sup> January, between 07:00 on 10<sup>th</sup> January and 09:00 on 11<sup>th</sup> January, between 08:00 and 13:00 on 12<sup>th</sup> January was due to loss of power to the monitor from the solar power supply.

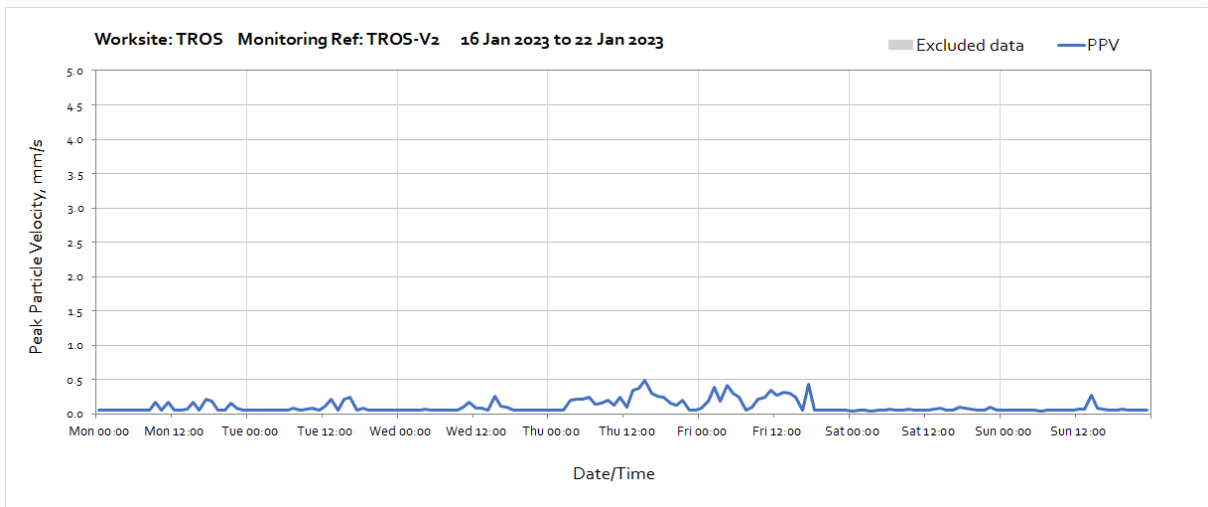





OFFICIAL





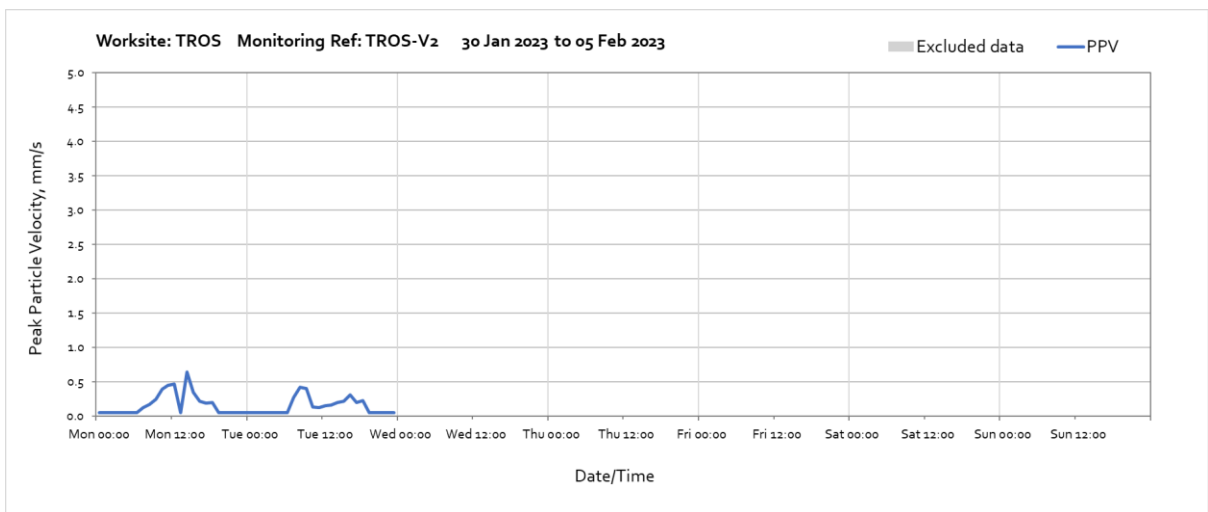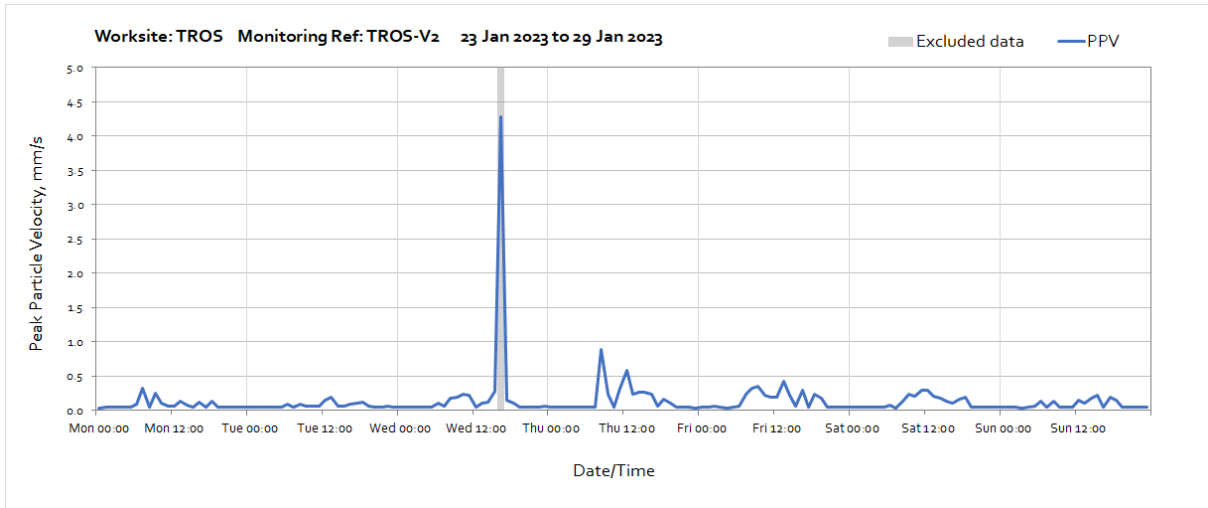

### Worksite: SRO - Monitoring Ref: SRO-V1

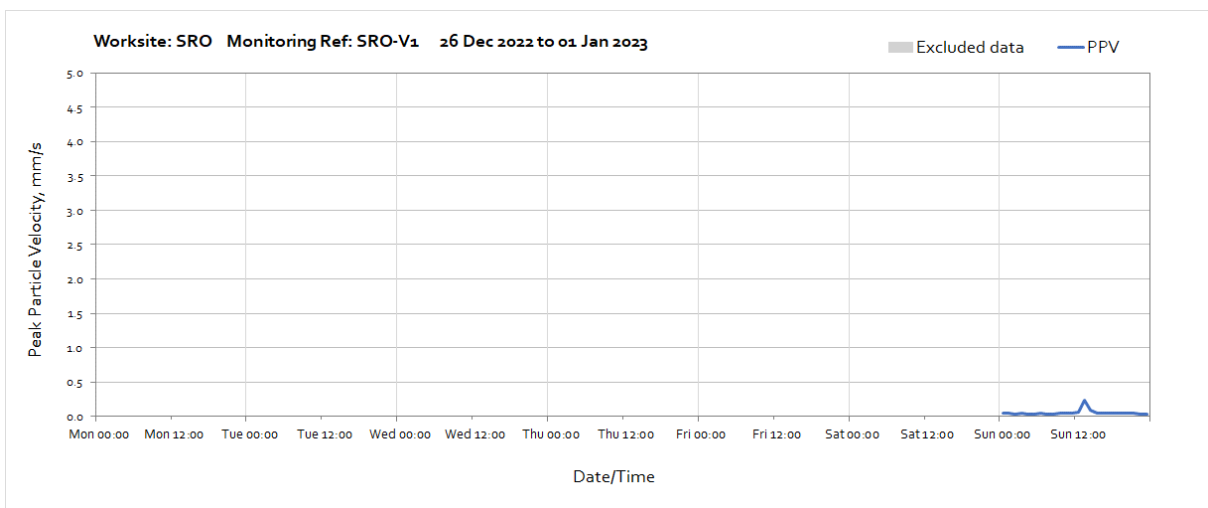

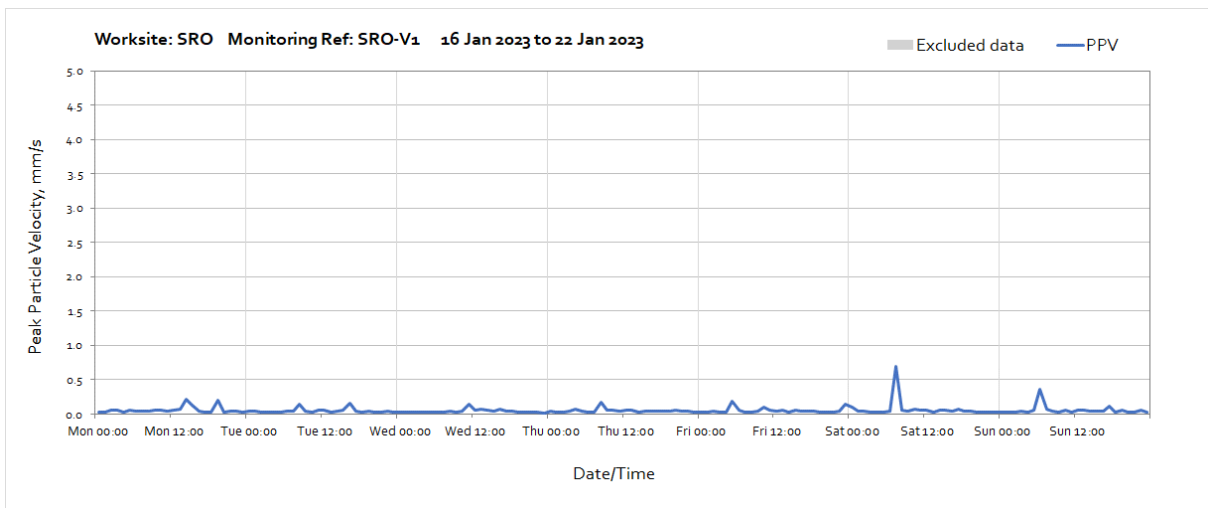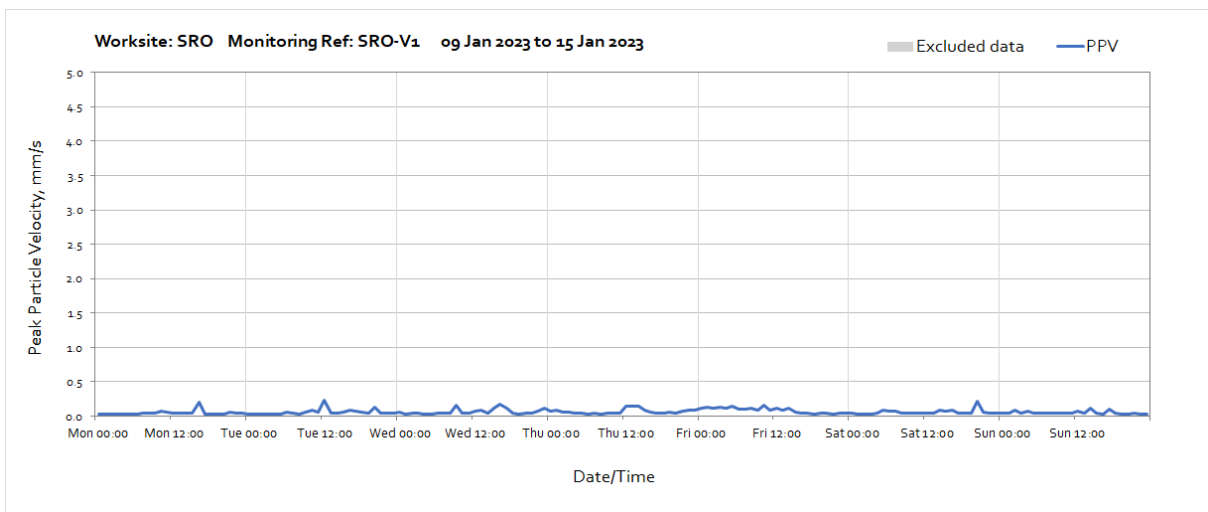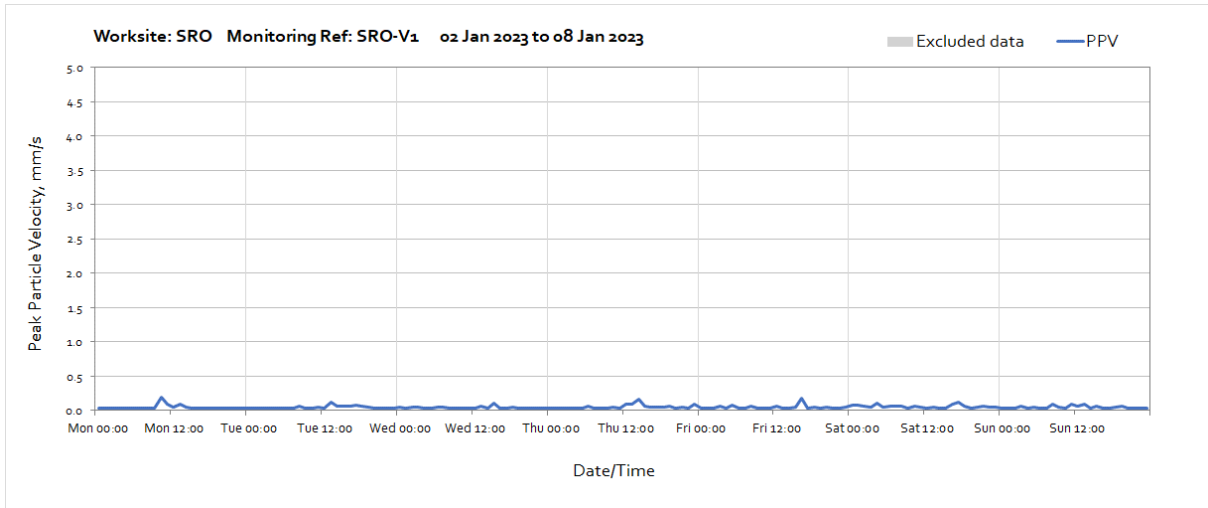

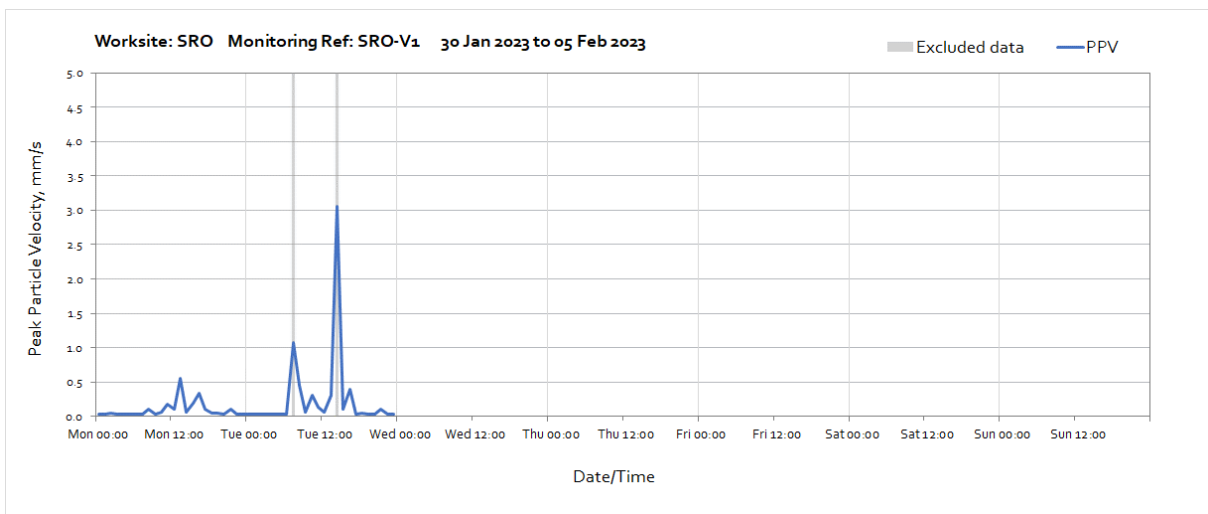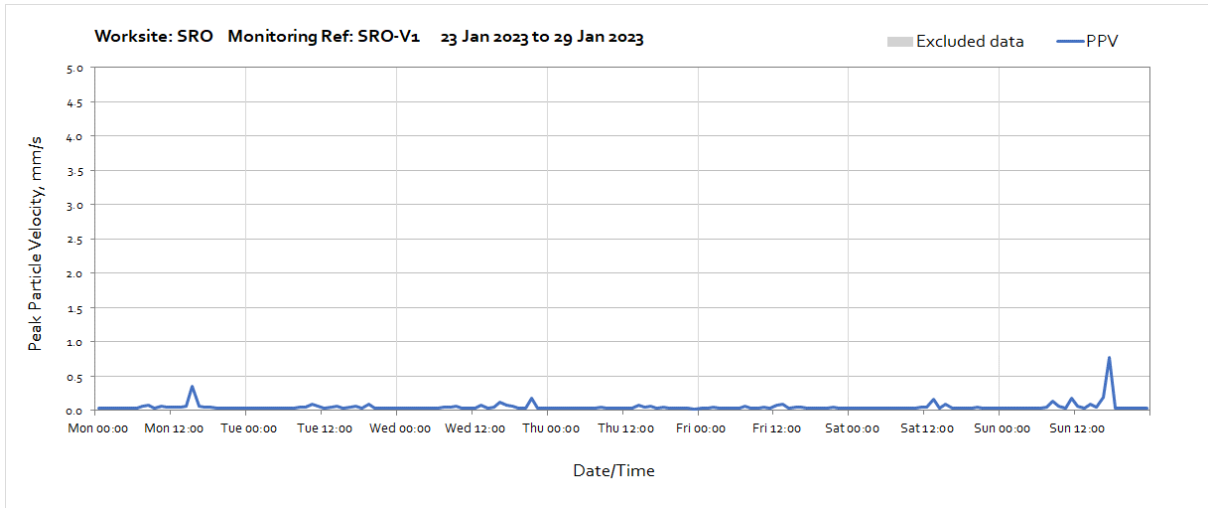

### Worksite: SRO – Monitoring Ref: SRO-V2

