April 2024



# Air Quality and Dust Monitoring Monthly Report - April 2024

Stratford-on-Avon District Council



High Speed Two (HS2) Limited has been tasked by the Department for Transport (DfT) with managing the delivery of a new national high speed rail network. It is a non-departmental public body wholly owned by the DfT.

High Speed Two (HS2) Limited, Two Snowhill Snow Hill Queensway Birmingham B4 6GA

Telephone: 08081 434 434

General email enquiries: HS2enquiries@hs2.org.uk

Website: www.gov.uk/hs2

A report prepared by EWCs and MWCCs on behalf of HS2 Ltd.

High Speed Two (HS2) Limited has actively considered the needs of blind and partially sighted people in accessing this document. The text will be made available in full on the HS2 website. The text may be freely downloaded and translated by individuals or organisations for conversion into other accessible formats. If you have other needs in this regard please contact High Speed Two (HS2) Limited.

© High Speed Two (HS2) Limited, 2024, except where otherwise stated.

Copyright in the typographical arrangement rests with High Speed Two (HS2) Limited.

This information is licensed under the Open Government Licence v2.0. To view this licence, visit www.nationalarchives.gov.uk/doc/open-governmentlicence/version/2 **OGL** or write to the Information Policy Team, The National Archives, Kew, London TW9 4DU, or e-mail: psi@nationalarchives.gsi.gov.uk. Where we have identified any third-party copyright information you will need to obtain permission from the copyright holders concerned.



### **Monthly Summary**

- 1.1.1 This Summary Report is published in fulfilment of commitments detailed in the High-Speed Rail (London-West Midlands) Environmental Minimum Requirements, Annex 1: Code of Construction Practice, for the nominated undertaker to present the results of air quality and dust monitoring undertaken in Stratford-on-Avon District (SoADC) during April 2024.
- 1.1.2 Figure 1 in Appendix A present the current worksites together with the dust monitoring locations.
- 1.1.3 This summary should be read in conjunction with the overview monitoring report monthly available from <a href="https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2">www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2</a>, which highlights: the applicable standards and guidance, as well as the air quality and dust monitoring methodologies to be implemented by nominated undertakers throughout construction.
- 1.1.4 The current worksites, as presented in Appendix A, Figure 1, include:

#### Southam worksite

- Installation of drainage and culverts
- Pond maintenance
- Topsoil stripping and material movement
- Further establishment of the site access road
- Bulk earthworks Southam Cutting, Windmill Hill & Ladbroke Cutting
- Southam Embankment bulk earthworks
- Embankment fill
- Earthworks for piling platform works at Ladbroke Grove Farm AOB.
- Earthworks for piling platform works at Lower Radbourne Farm AOB.
- Pouring of pilecap at Lower Radbourne Farm AOB
- Earthworks for piling platform works at Lower and Upper Radbourne viaducts
- Southam Culvert excavations.

#### **Harp Farm**

- Bulk earthworks
- Structures
- Utilities
- Installation of drainage and culverts
- Pond maintenance and water management
- Topsoil stripping and material movement
- Further establishment of the site access road and haul road
- Embankment fill


- Kineton Road & Radbourne Formworks
- Oxford Canal Viaduct south side piling
- River Itchen piling platform.

#### **Kineton Road**

- Bulk earthworks
- Structures
- Utilities
- Installation of drainage and culverts
- Pond maintenance and water management
- Topsoil stripping and material movement
- Further establishment of the site access road and haul road
- Embankment fill
- Kineton Road & Radbourne Formworks
- Oxford Canal Viaduct south side piling
- River Itchen piling platform.
- 1.1.5 Two (2) dust monitors are installed around these worksites, where works are underway. These sites returned a medium dust risk rating.
- 1.1.6 The dust monitoring location and results are presented in Appendix B, Table 1, together with line charts of monthly data from each dust monitor presented in Figure 2. All continuous dust monitoring is undertaken using indicative monitors. Despite being Environment Agency (MCERTS) certified, indicative monitors carry a higher level of uncertainty than reference monitors, and therefore cannot be strictly compared with Air Quality Standards for human health and the environment. The purpose of the monitoring undertaken is to ensure the effectiveness of the on-site mitigation.
- 1.1.7 The trigger level for  $PM_{10}$  concentrations of 190  $\mu$ g/m<sup>3</sup>, over a 1-hour period, in accordance with the updated guidance document 'Guidance on Monitoring in the Vicinity of Demolition and Construction Sites (October 2018)' has been applied.
- 1.1.8 No (0) dust trigger alerts were recorded during the monitoring period (April 2024).
- 1.1.9 There were no (0) complaints received during the reporting period (April 2024).

### **Appendix A - Worksites and Monitoring Locations**

Figure 1: Worksites and Monitoring Locations within SoADC

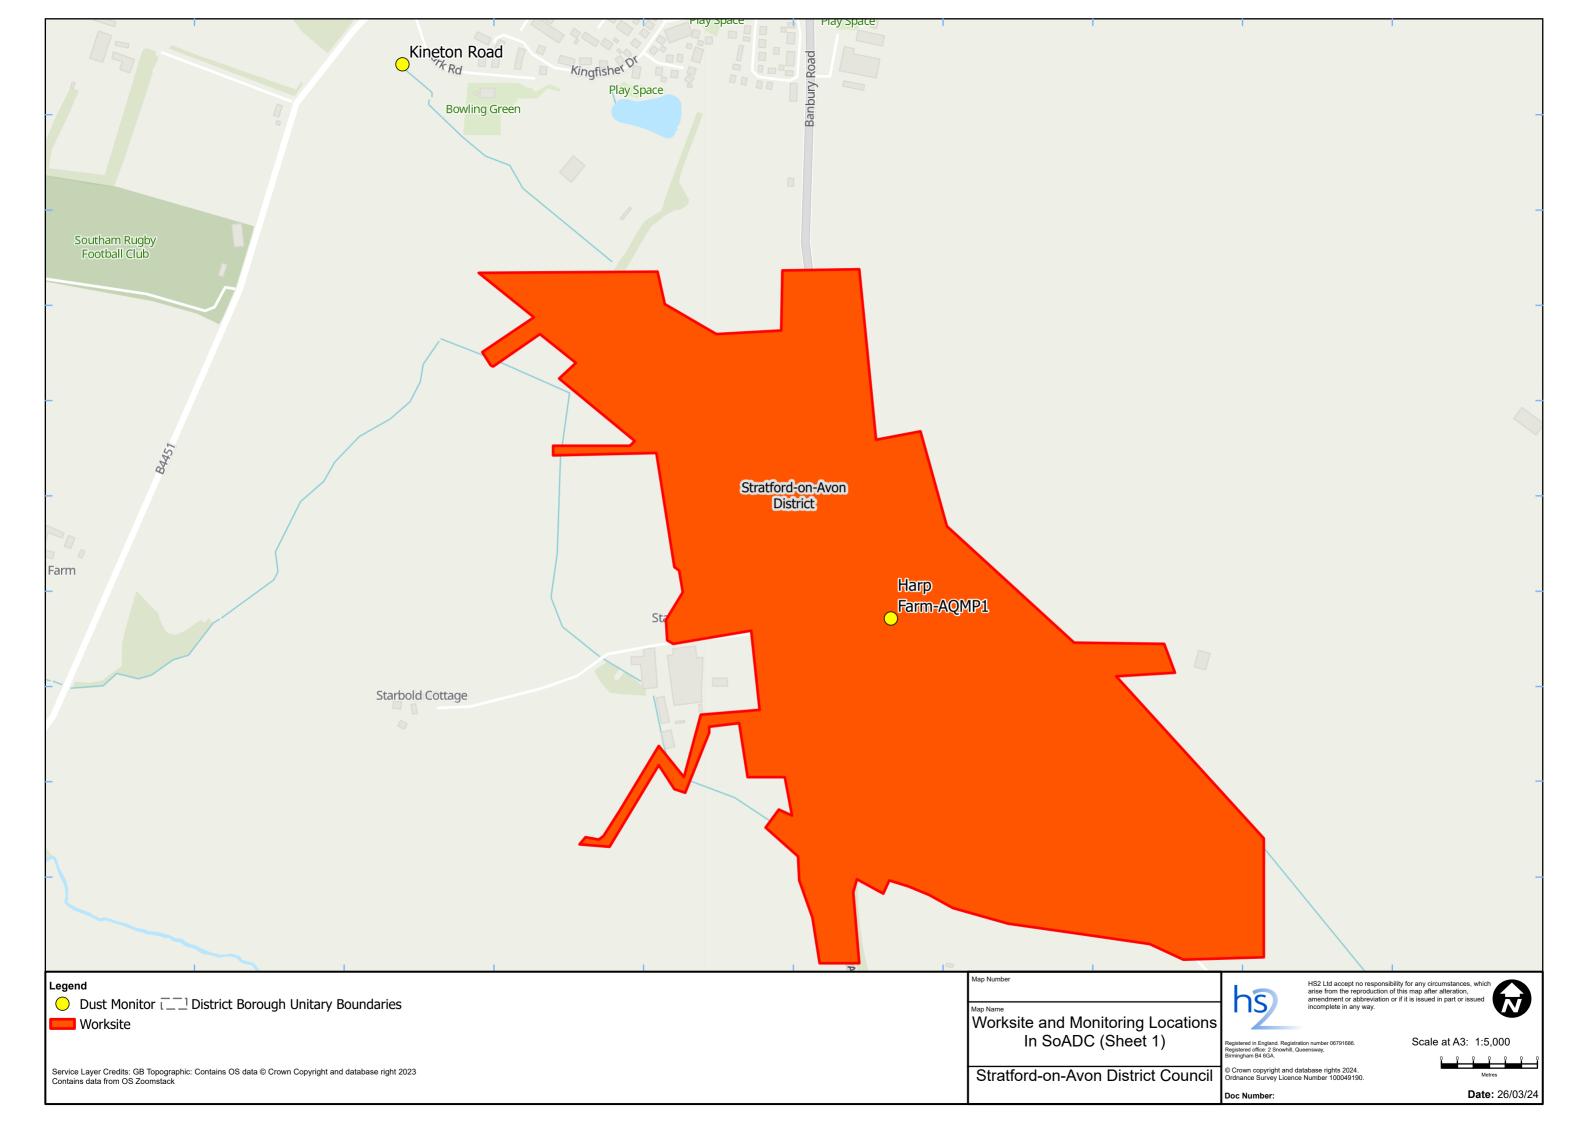

## **Appendix B - Dust Monitoring Results**

Table 1: Dust Monitoring Locations and Results

Monitoring site ID	Coordinates (X,Y)	Location description	Dust risk rating for site	Monitoring site active during period	Change to site since previous period report	Mean 1-hour PM10 concentration (µg/m3)	Minimum 1-hour PM10 concentration (µg/m3)	Maximum 1- hour PM10 concentration (µg/m3)	Number of 1- hour periods exceeding trigger level of 190 µg/m3	Data capture (%)
Harp Farm- AQMP1	441738, 260075	Site boundary adjacent property on Harp Farm	М	Yes	Yes	5.0	1.0	21.0	0	97.6
Kineton Rd	441092, 260808	Adjacent to Kineton Road roundabout	М	Yes	Yes	4.9	1.0	20.0	0	97.2

Figure 2: Construction dust 1-hour mean indicative PM<sub>10</sub> concentration for all dust monitors

