

# HS2

January 2025

## **Construction Noise and Vibration Monthly Report – November 2024**

### Solihull Metropolitan Borough Council

<b>Non-Technical Summary</b>	<b>1</b>
<b>Abbreviations and Descriptions</b>	<b>3</b>
<b>1      Introduction</b>	<b>4</b>
1.2    Measurement Locations	7
<b>2      Summary of Results</b>	<b>9</b>
2.1    Summary of Measured Noise Levels	9
2.2    Exceedances of the LOAEL and SOAEL	13
2.3    Exceedances of Trigger Level	16
2.1    Complaints	16
<b>Appendix A Site Locations</b>	<b>17</b>
<b>Appendix B Monitoring Locations</b>	<b>27</b>
<b>Appendix C Data</b>	<b>36</b>

## **List of tables**

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	7
Table 3: Summary of Measured dB LAeq Data over the Monitoring Period	10
Table 4: Summary of Measured PPV Data over the Monitoring Period	13
Table 5: Summary of Exceedances of LOAEL and SOAEL	14
Table 6: Summary of Total Exceedances of SOAEL	16
Table 7: Summary of Exceedances of Trigger Levels	16
Table 8: Summary of Complaints	16

# Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within the Solihull Metropolitan Borough Council (SMBC) during the month of November 2024.

Within this period noise and vibration monitoring was undertaken at the following worksites:

- Coleshill Heath Road worksite (ref.: CHR), where pond excavation, stockpile management, backfilling, temporary drainage, excavation, installation works, platform reinstatement works, laying materials, steel fixing, pile works, formwork, removal works, piling platform construction, piling, material deliveries, haul road maintenance and diversion works were underway.
- Bickenhill Cutting worksite (ref.: BIC), where bulk excavation, geotextile installation, platform construction, backfilling, remediation works, haul road construction, stockpile management, piling, plant installation, mobilisation and material deliveries were underway.
- Birmingham Interchange Station worksite (ref.: BIS), where backfilling, embankment works, drainage works, platform construction, kerbing, surfacing, de-vegetation, pile cropping, formwork, steel fixing and material deliveries were underway.
- Diddington Lane Embankment (ref.: DLE), where stockpile management, haul road maintenance, cutting works, excavation, pile testing, aggregate fill and removal, backfilling, removal works, investigation works, de-vegetation and material movements were underway.
- Blythe Bypass Embankment Worksit (ref.: BBE), where cofferdam excavation and steel fixing were underway.
- A452 compound (ref.: A452), where steel fixing and culvert works were underway.
- Park Lane Worksit (ref.: PL) where material stockpiling and movements, overbridge works, dig, cut and replace, backfilling and culvert works were underway.
- Balsall Common Viaduct Worksit (ref.: BCV) where installation of reinforcement bars and formwork, and backfilling were underway.
- Carol Green Rail Underbridge Worksit (ref.: CGRU), where diversion works and bridge works were underway.
- Waste Lane Overbridge and Satellite Worksit (ref.: WLOS), bridge works, vehicle movements and diversion works were underway.

OFFICIAL

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<https://www.gov.uk/government/publications/hs2-information-papers-environment>), were exceeded on two (2) occasions during the reporting period.

There were no exceedances of trigger levels as defined in Section 61 consents during the reporting period at any monitoring position.

No complaints were received during the monitoring period.

OFFICIAL

# Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
$L_{Aeq,T}$	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A-weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or $L_{Aeq,T}$	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, wind speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in m/s <sup>1.75</sup> .

OFFICIAL

# 1 Introduction

- 1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:
- monitoring the impact of construction works;
  - to investigate complaints, incidents and exceedance of trigger levels; or
  - monitoring the effectiveness of noise and vibration control measures.
- 1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the Solihull Metropolitan District (SMBC) for the period 1<sup>st</sup> to 30<sup>th</sup> of November 2024.
- 1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:
- Coleshill Heath Road worksite, ref.: CHR (see Plan 1 in Appendix A), where works activities included:
    - Pond excavation.
    - Stockpile management.
    - Backfilling.
    - Temporary drainage.
    - Excavation, including trestles and ditches.
    - Installation works, including pipes, SAAs, filter drain and manholes.
    - Laying materials.
    - Platform reinstatement works.
    - Steel fixing.
    - Pile works, including exposing piles.

OFFICIAL

- Formwork.
  - Removal works, including propping system.
  - Piling.
  - Piling platform construction.
  - Material deliveries.
  - Haul road maintenance.
  - Diversion works.
- Bickenhill Cutting worksite, ref.: BIC (see Plan 3 in Appendix A), where works activities included:
  - Bulk excavation.
  - Geotextile installation.
  - Platform construction.
  - Backfilling.
  - Remediation works, including ditch.
  - Haul road construction.
  - Stockpile management.
  - Piling.
  - Plant installation.
  - Mobilisation.
  - Material deliveries.
- Birmingham Interchange Station worksite, ref.: BIS (see Plan 3 in Appendix A), where works activities included:
  - Backfilling.
  - Embankment works, including filling verge.
  - Drainage works, including glass sand fill.
  - Platform construction.
  - Kerbing.
  - Surfacing.
  - De-vegetation.
  - Pile cropping.
  - Formwork.
  - Steel fixing.

OFFICIAL

- Material deliveries.
- Diddington Lane Embankment worksite: ref.: DLE (see Plan 3 in Appendix A), where works activities included:
  - Stockpile management.
  - Haul road maintenance.
  - Cutting works.
  - Excavation.
  - Pile testing.
  - Aggregate fill and removal.
  - Backfilling.
  - Removal works, including bricks, temporary works and tarmac waste.
  - Investigation works.
  - De-vegetation.
  - Material movements.
- Blythe Bypass Embankment worksite, reference - BBE (see plan 4 in Appendix A), where works activities included:
  - Cofferdam excavation.
  - Steel fixing.
- A452 worksite, reference - A452 (see plan 5 in Appendix A), where work activities included:
  - Steel fixing.
  - Culvert works.
- Park Lane worksite, reference - PL (see plan 6 in Appendix A), where work activities included:
  - Material stockpiling and movement.
  - Overbridge works.
  - Dig, cut and replace.
  - Backfilling.
  - Culvert works.
- Balsall Common Viaduct worksite, reference - BCV (see plan 7 in Appendix A), where work activities included:
  - Installation of reinforcement bars and formwork.
  - Backfilling.

OFFICIAL

- Carol Green Rail Underbridge worksite, reference - CGRU (see plan 7 in Appendix A), where work activities included:
  - Diversion works.
  - Bridge works.
- Waste Lane Overbridge and Satellite worksite, reference WLOS (see plan 8 in Appendix A), where work activities included:
  - Bridge works.
  - Vehicle movements.
  - Diversion works.

1.1.4 Applicable standards, guidance, and monitoring methodology are outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2>. Noise and vibration monitoring reports for previous months can also be found at this location.

## 1.2 Measurement Locations

- 1.2.1 Eighteen (18) noise and ten (10) vibration monitoring installations were active in November in the SMBC area. Table 2 summarises the location of noise and vibration monitoring installations within the SMBC area in November 2024.
- 1.2.2 Maps showing the position of noise monitoring installations are presented in Appendix B.

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
CHR	CHR-1	Coleshill Heath Road, Coleshill Heath, Solihull
	CHRU-1	276 Yorkminster Drive, Birmingham
	CHRU-V1	276 Yorkminster Drive, Birmingham
BIC	BIC-1	Park Farm Barns, Chester Rd, Marston Green, Coventry
BIS	BIS-1	Hollywell Brook, Middle Bickenhill Lane, Solihull
DLE	DLE-1	Hampton Hill Hounds, Nursery Cottage, Coventry Road, Bickenhill
	DLE-2	Diddington Ln, Hampton in Arden
	DLE-V1	Hampton Hill Farmhouse, Coventry Road
BBE	BBE-1	Patrick Farm House, Meriden Road, Hampton in Arden

OFFICIAL

<b>Worksite Reference</b>	<b>Measurement Reference</b>	<b>Address</b>
	BBE-V1	Patrick Farm House, Meriden Road, Hampton in Arden
A452	A452-1	Marsh House Farm, Brandocks Marsh, Solihull
	A452-V1	Mercote Cottage, Marsh House, Farm Lane, Brandocks Marsh, Solihull
PL	PL-1	(east of) Final Home, Park Lane, Balsall Common
	PL-2	(north of) The Laurel, Lavender Hall Lane, Balsall Common
	PL-3	(north-east of) Holly Acre Lodge, Kenilworth Road, Solihull
	PL-5	Lavender Hall Lane, Balsall Common, Solihull
	PL-V2	(east of) Final Home, Park Lane, Balsall Common, Coventry, West Midlands
	PL-V3	Lavender Hall Lane, Balsall Common, Solihull
	PL-V4	(north-east of) Holly Acre Lodge, Kenilworth Road, Berkswell, Solihull
BCV	BCV-1	(north-west of) Cherry Tree Cottage, Truggist Lane, Balsall Common, Solihull
	BCV-V6	(north-west of) Cherry Tree Cottage, Truggist Lane, Balsall Common, Solihull
CGRU	CGRU-1	(west of) The Stables, Truggist Lane, Balsall Common, Solihull
	CGRU-3	Annora House, 314 Station Rd, Balsall Common
WLOS	WLOS-1	(south of) 19 Hodgetts Lane, Burton Green, Warwickshire
	WLOS-2	Little Beanitt Farm, Waste Lane, Balsall Common, Solihull
	WLOS-3	(north of) Dragonflies, Waste Lane, Balsall Common, Solihull
	WLOS-V1	19 Hodgetts Lane, Burton Green, Warwickshire
	WLOS-V2	Little Beanitt Farm, Waste Lane, Balsall Common, Solihull

OFFICIAL

## **2 Summary of Results**

### **2.1 Summary of Measured Noise Levels**

2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The  $L_{Aeq,T}$  is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period  $L_{Aeq,T}$  that was found to occur within the month.

Table 3: Summary of Measured dB LAeq Data over the Monitoring Period

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Saturday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Sunday / Public Holiday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
CHR	CHRU-1	276 Yorkminster Drive, Birmingham	Free field	61.0 (82.6)	62.8 (79.9)	58.3 (67.1)	58.0 (73.6)	59.8 (92.3)	62.4 (87.7)	64.5 (86.7)	61.8 (80.4)	63.8 (92.2)	61.4 (90.6)	69.7 (92.0)	60.2 (81.9)
	CHR-1	Coleshill Heath Road, Coleshill Heath, Solihull	Free field	64.5 (68.2)	64.6 (65.7)	63.2 (64.7)	62.4 (75.5)	59.7 (67.6)	61.3 (63.1)	63.6 (65.6)	63.5 (65.6)	62.7 (67.2)	58.1 (62.8)	63.3 (69.0)	58.8 (63.7)
BIC	BIC-1	Park Farm Barns, Chester Rd, Marston Green	Free field	56.6 (60.9)	55.1 (57.3)	54.6 (58.2)	53.3 (57.8)	51.5 (60.9)	54.2 (56.9)	54.6 (58.5)	54.4 (58.4)	53.5 (58.3)	51.7 (58.2)	54.4 (57.9)	51.1 (58.2)
BIS	BIS-1	Hollywell Brook, Middle Bickenhill Lane, Solihull	Free field	55.4 (59.2)	54.3 (64.2)	53.6 (57.8)	52.9 (57.2)	50.7 (58.9)	52.6 (57.6)	52.7 (57.2)	52.3 (57.9)	51.7 (56.5)	50.6 (54.8)	54.4 (58.0)	51.4 (58.3)
DLE	DLE-1	Hampton Hill Farmhouse, Coventry Road	Free field	52.8 (57.4)	54.8 (58.1)	54.0 (58.9)	52.7 (65.4)	49.0 (56.7)	49.9 (51.6)	52.4 (54.1)	50.0 (50.8)	54.2 (58.4)	48.3 (51.4)	52.5 (56.6)	49.8 (54.6)
	DLE-2	Diddington Ln, Hampton in Arden	Free field	54.9 (54.9)	53.8 (53.8)	51.6 (52.9)	52.0 (54.2)	49.9 (54.7)	52.6 (52.6)	54.2 (54.2)	48.1 (48.1)	54.1 (57.7)	50.2 (52.4)	-* -*	-* -*
BBE	BBE-1	Patrick Farm House	Free field	55.5 (57.5)	60.9 (64.0)	53.9 (61.7)	51.5 (54.9)	49.1 (67.0)	51.6 (52.4)	55.2 (61.3)	52.6 (54.1)	51.6 (54.2)	47.0 (49.9)	52.2 (54.4)	47.8 (53.6)

OFFICIAL

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Saturday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Sunday / Public Holiday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
A452	A452-1	Marsh House Farm	Free field	56.7 (61.0)	56.7 (61.4)	52.7 (56.4)	49.3 (53.5)	46.2 (55.0)	52.7 (61.2)	53.8 (55.5)	53.1 (56.0)	52.0 (64.0)	46.0 (50.5)	53.0 (62.6)	46.2 (56.2)
PL	PL-1	Park Lane	Free field	55.1 (57.9)	59.6 (62.2)	56.4 (64.9)	48.5 (61.8)	45.8 (53.7)	51.6 (54.0)	54.4 (61.5)	51.0 (54.8)	51.2 (60.4)	46.0 (52.2)	49.4 (54.4)	45.6 (54.9)
	PL-2	The Laurel	Free field	50.5 (53.2)	54.7 (65.3)	50.6 (53.5)	47.6 (51.0)	42.7 (52.7)	48.4 (52.2)	50.8 (52.6)	49.3 (50.9)	50.4 (63.2)	42.3 (45.6)	48.3 (51.7)	41.9 (49.5)
	PL-3	Holly Acre Lodge	Free field	58.6 (61.7)	58.4 (60.6)	55.6 (57.9)	52.0 (56.9)	48.8 (57.8)	54.8 (56.5)	57.1 (59.2)	56.7 (59.2)	54.7 (59.1)	49.6 (53.5)	54.3 (58.8)	47.2 (58.1)
	PL-5	Lavender Hall Lane	Free field	61.5 (63.0)	62.2 (63.4)	61.3 (62.0)	58.9 (61.3)	53.1 (59.9)	57.5 (57.6)	62.0 (62.5)	62.4 (63.0)	59.9 (62.5)	55.1 (56.3)	61.0 (63.1)	51.9 (57.6)
BCV	BCV-1	Cherry Tree Cottage	Free field	58.0 (60.4)	63.2 (68.6)	58.0 (66.5)	56.1 (68.4)	51.0 (56.3)	54.5 (55.6)	64.0 (64.1)	56.4 (57.1)	56.2 (61.6)	48.4 (53.5)	55.6 (58.9)	50.1 (54.6)
CGRU	CGRU-1	The Stables	Free field	52.4 (54.3)	60.2 (67.6)	52.8 (58.9)	52.0 (55.0)	50.9 (58.5)	51.3 (53.6)	51.6 (53.7)	52.5 (55.1)	51.5 (62.6)	50.1 (54.8)	50.1 (53.9)	49.1 (56.2)
	CGRU-3	Annora House, 314 Station Rd	Free field	54.9 (58.6)	65.2 (69.6)	52.4 (55.6)	50.2 (53.0)	47.1 (54.8)	50.4 (51.2)	51.8 (53.0)	50.1 (51.7)	52.3 (63.5)	48.6 (60.1)	49.7 (57.1)	46.9 (55.5)

OFFICIAL

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Saturday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Sunday / Public Holiday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
WLOS	WLOS-1	19 Hodgetts Lane	Façade	46.4 (50.2)	60.8 (69.4)	44.3 (62.1)	41.6 (56.8)	36.6 (48.4)	45.6 (46.9)	59.1 (60.9)	48.6 (55.9)	45.9 (55.3)	37.6 (45.3)	41.5 (52.0)	34.4 (42.8)
	WLOS-2	Waste Lane (East)	Free field	50.4 (57.1)	53.8 (56.5)	48.4 (53.6)	45.4 (55.1)	40.5 (52.3)	45.3 (47.2)	51.7 (52.9)	47.3 (50.4)	47.5 (54.3)	41.1 (56.9)	48.5 (58.4)	40.2 (48.1)
	WLOS-3	Waste Lane (West)	Free field	59.0 (63.8)	59.8 (62.7)	57.4 (61.8)	54.1 (60.8)	48.5 (59.6)	53.8 (57.7)	57.4 (61.1)	57.5 (61.5)	56.3 (61.8)	48.4 (53.2)	56.4 (60.3)	48.3 (57.5)

\* Missing data due to poor solar conditions impacting the monitoring station.

OFFICIAL

- 2.1.2 Table 4 presents a summary of the measured vibration levels at the monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
CHR	CHRU-V1	276 Yorkminster Drive, Birmingham	2.74 (X-axis)
DLE	DLE-V1	Hampton Hill Farmhouse, Coventry Road	1.19 (Y-axis)
BBE	BBE-V1	Patrick Farm House,	2.15 (Y-axis)
A452	A452-V1	Mercote Cottage, Marsh House, Farm Lane, Brandocks Marsh, Solihull	2.48 (Z-axis)
PL	PL-V2	(east of) Final Home, Park Lane, Balsall Common	0.88 (X-axis)
	PL-V3	Lavender Hall Lane, Balsall Common, Solihull	112.45 (X-axis)
	PL-V4	(north-east of) Holly Acre Lodge, Kenilworth Road, Berkswell, Solihull	1.70 (Y-axis)
BCV	BCV-V6	(north-west of) Cherry Tree Cottage, Truggist Lane, Balsall Common, Solihull	6.65 (Z-axis)
WLOS	WLOS-V1	19 Hodgetts Lane, Burton Green, Warwickshire	1.10 (Y-axis)
	WLOS-V2	Little Beanitt Farm, Waste Lane, Berkswell, Balsall Common, Solihull	0.89 (Z-axis)

- 2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly  $L_{Aeq}$  values and, where relevant, the  $L_{Aeq,T}$  values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location:  
<https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data>.

## 2.2 Exceedances of the LOAEL and SOAEL

- 2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more

OFFICIAL

loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".

- 2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."
- 2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAEls and SOAEls for construction noise.
- 2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
CHR	CHRU-1*	(east of) 276 Yorkminster Drive, Birmingham	All Days	All Periods	Not applicable**	No exceedance
	CHR-1*	Coleshill Heath Road	All Days	All Periods	Not applicable**	No exceedance
BIC	BIC-1	Park Farm Barns	All Days	All Periods	No exceedance	No exceedance
BIS	BIS-1*	Hollywell Brook, Middle Bickenhill Lane	All Days	All Periods	No exceedance	No exceedance
DLE	DLE-1*	Hampton Hill Farmhouse, Coventry Road	Weekday Night	1900-2200 2200-0700	Not applicable**	1 2

OFFICIAL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
	DLE-2*	Diddington Ln, Hampton in Arden	All Days	All Periods	Not applicable**	No exceedance
BBE	BBE-1*	Patrick Farm House	All Days	All Periods	No exceedance	No exceedance
A452 Compound	A452-1	Marsh House Farm	All Days	All Periods	No exceedance	No exceedance
PL	PL-1*	Park Lane	All Days	All Periods	No exceedance	No exceedance
	PL-2	The Laurel	All Days	All Periods	No exceedance	No exceedance
	PL-3*	Holly Acre Lodge	All Days	All Periods	No exceedance	No exceedance
	PL-5	Lavender Hall Lane	Weekday	0800-1800	2	No exceedance
BCV	BCV-1*	Cherry Tree Cottage	Weekday	0800-1800	1	No exceedance
CGRU	CGRU-1*	The Stables	All Days	All Periods	No exceedance	No exceedance
	CGRU-3*	Annora House, 314 Station Rd	All Days	All Periods	No exceedance	No exceedance
WLOS	WLOS-1*	19 Hodgetts Lane	All Days	All Periods	No exceedance	No exceedance
	WLOS-2	Waste Lane (East)	All Days	All Periods	No exceedance	No exceedance
	WLOS-3*	Waste Lane (West)	All Days	All Periods	No exceedance	No exceedance

\*A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

\*\* The LOAEL has not been assessed due to high baseline levels.

2.2.6 Exceedances of the LOAEL were recorded at two (2) noise monitoring locations during weekday daytime periods.

2.2.7 For the purpose of reporting the number of days where the SOAEL is exceeded, multiple exceedances of the SOAEL in a 24-hour period would be counted as a single exceedance during that day. Over the reporting period, the overall number of SOAEL exceedances at each measurement location is shown in Table 6 and may be lower than the total sum of individual exceedances reported in Table 5 for each location.

Table 6: Summary of Total Exceedances of SOAEL

Worksite Reference	Measurement Reference	Monitor Address	Total of SOAEL exceedances in the month
DLE	DLE-1	Hampton Hill Farmhouse, Coventry Road	2

- 2.2.8 Two (2) SOAEL exceedances were recorded due to HS2 construction works during November 2024. The exceedances occurred at DLE-1 during weekday evening and night periods.

## 2.3 Exceedances of Trigger Level

- 2.3.1 Table 7 provides a summary of exceedances of the S61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 7: Summary of Exceedances of Trigger Levels

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	Identified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-

## 2.1 Complaints

- 2.1.1 Table 8 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.

Table 8: Summary of Complaints


Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
-	-	-	-	-

OFFICIAL

# **Appendix A Site Locations**

OFFICIAL


# Worksite Identification Plan - Overview

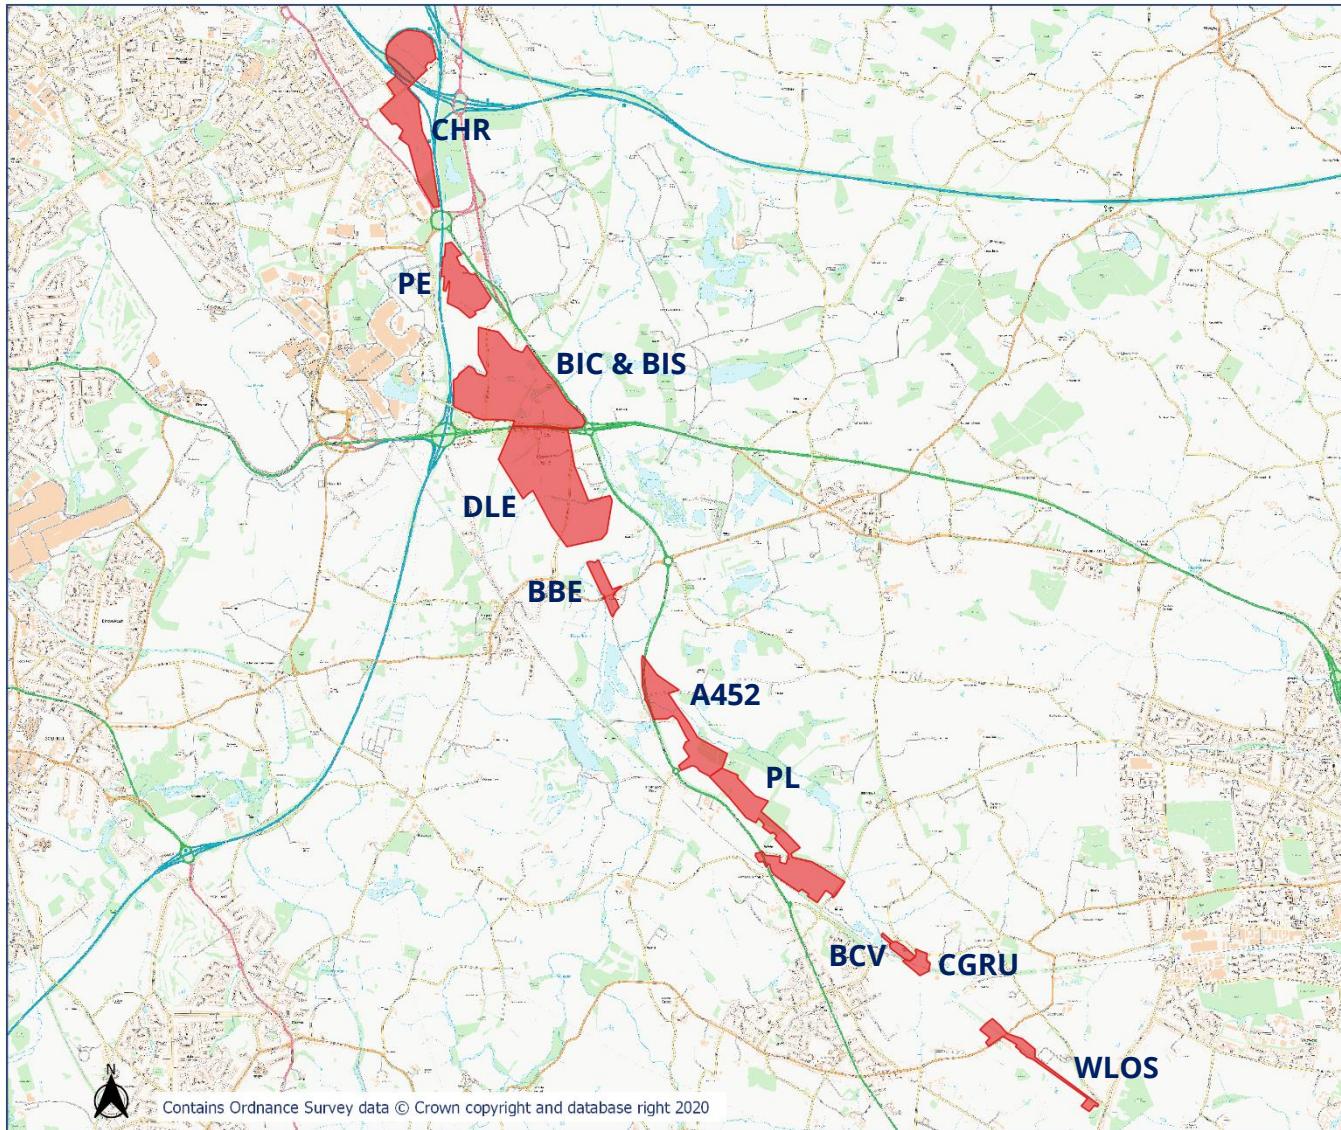

**Legend**  
■ Active Worksites

OFFICIAL


# Worksite Identification Plan - 1

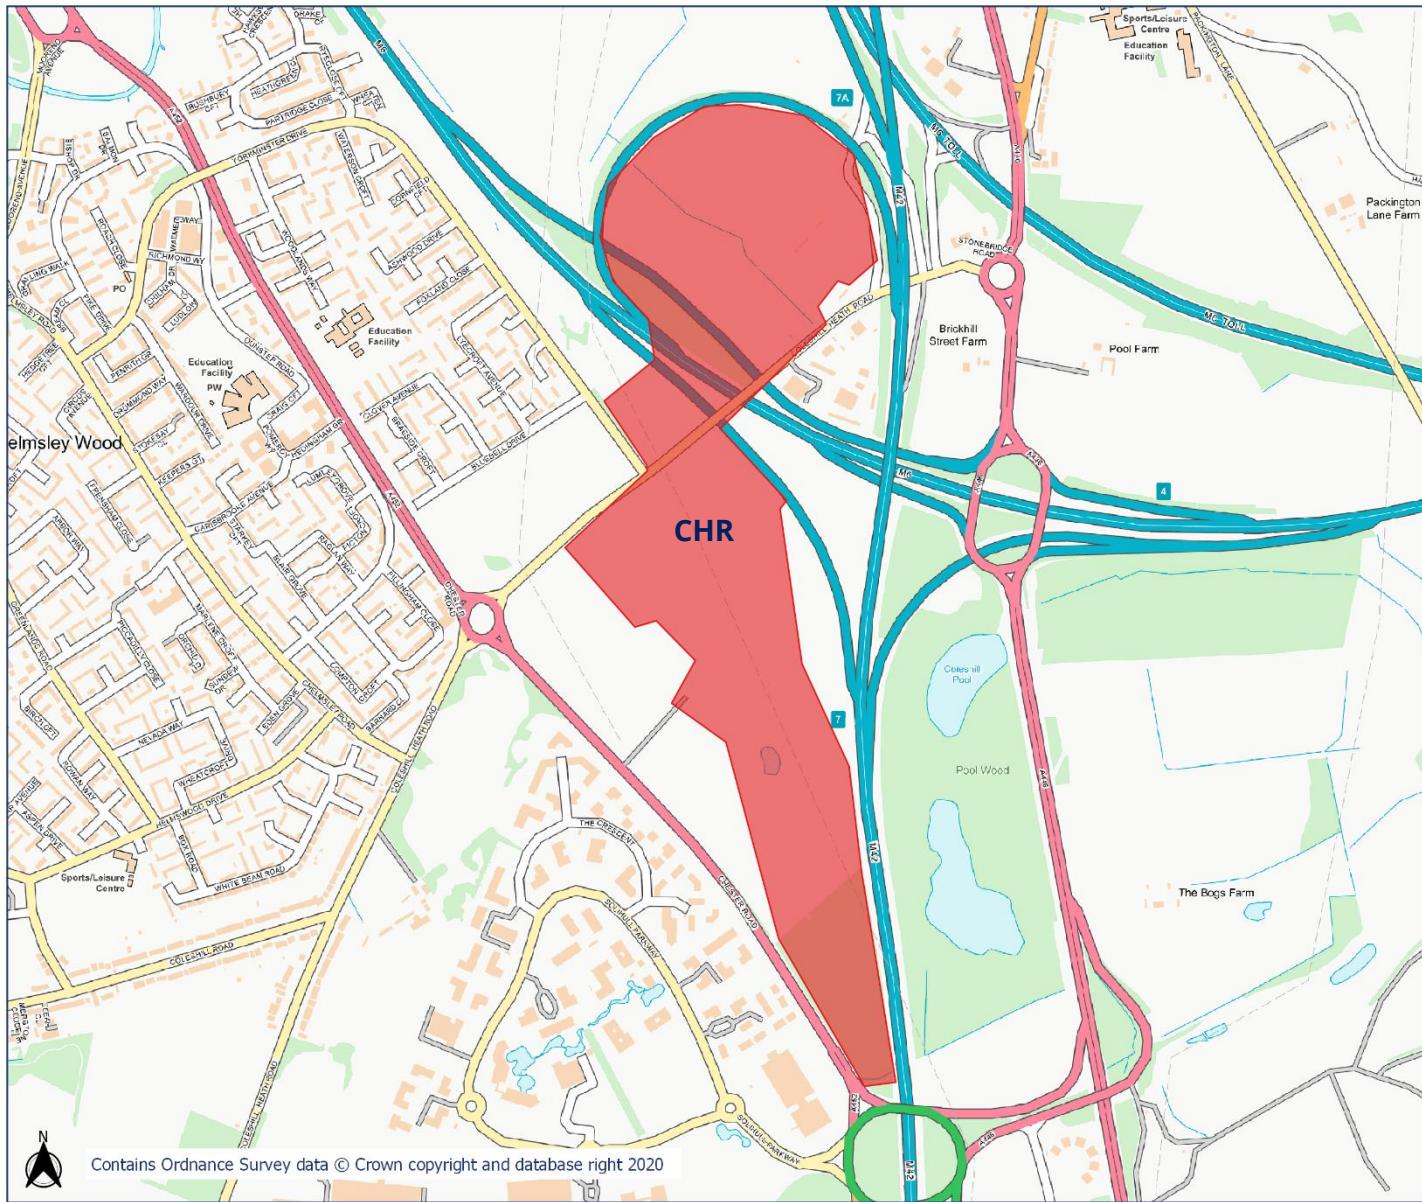

**Legend**  
■ Active Worksites

OFFICIAL


## Worksite Identification Plan - 2

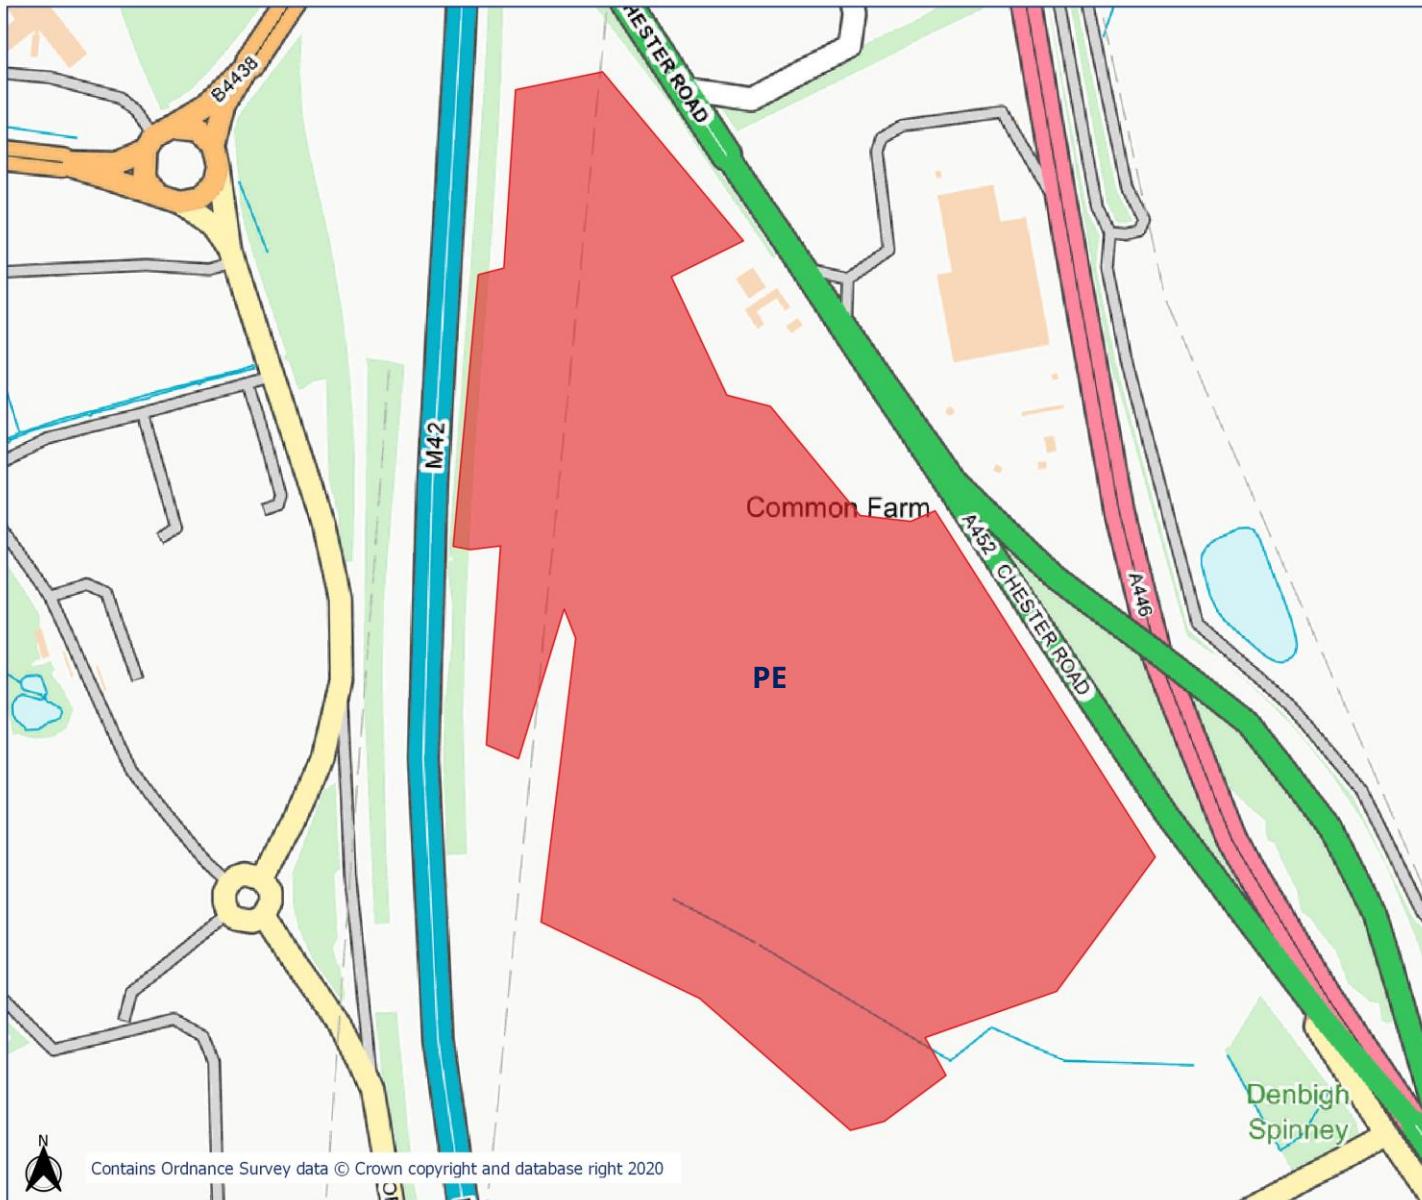

**Legend**  
■ Active Worksites

OFFICIAL

## **Worksite Identification Plan - 3**

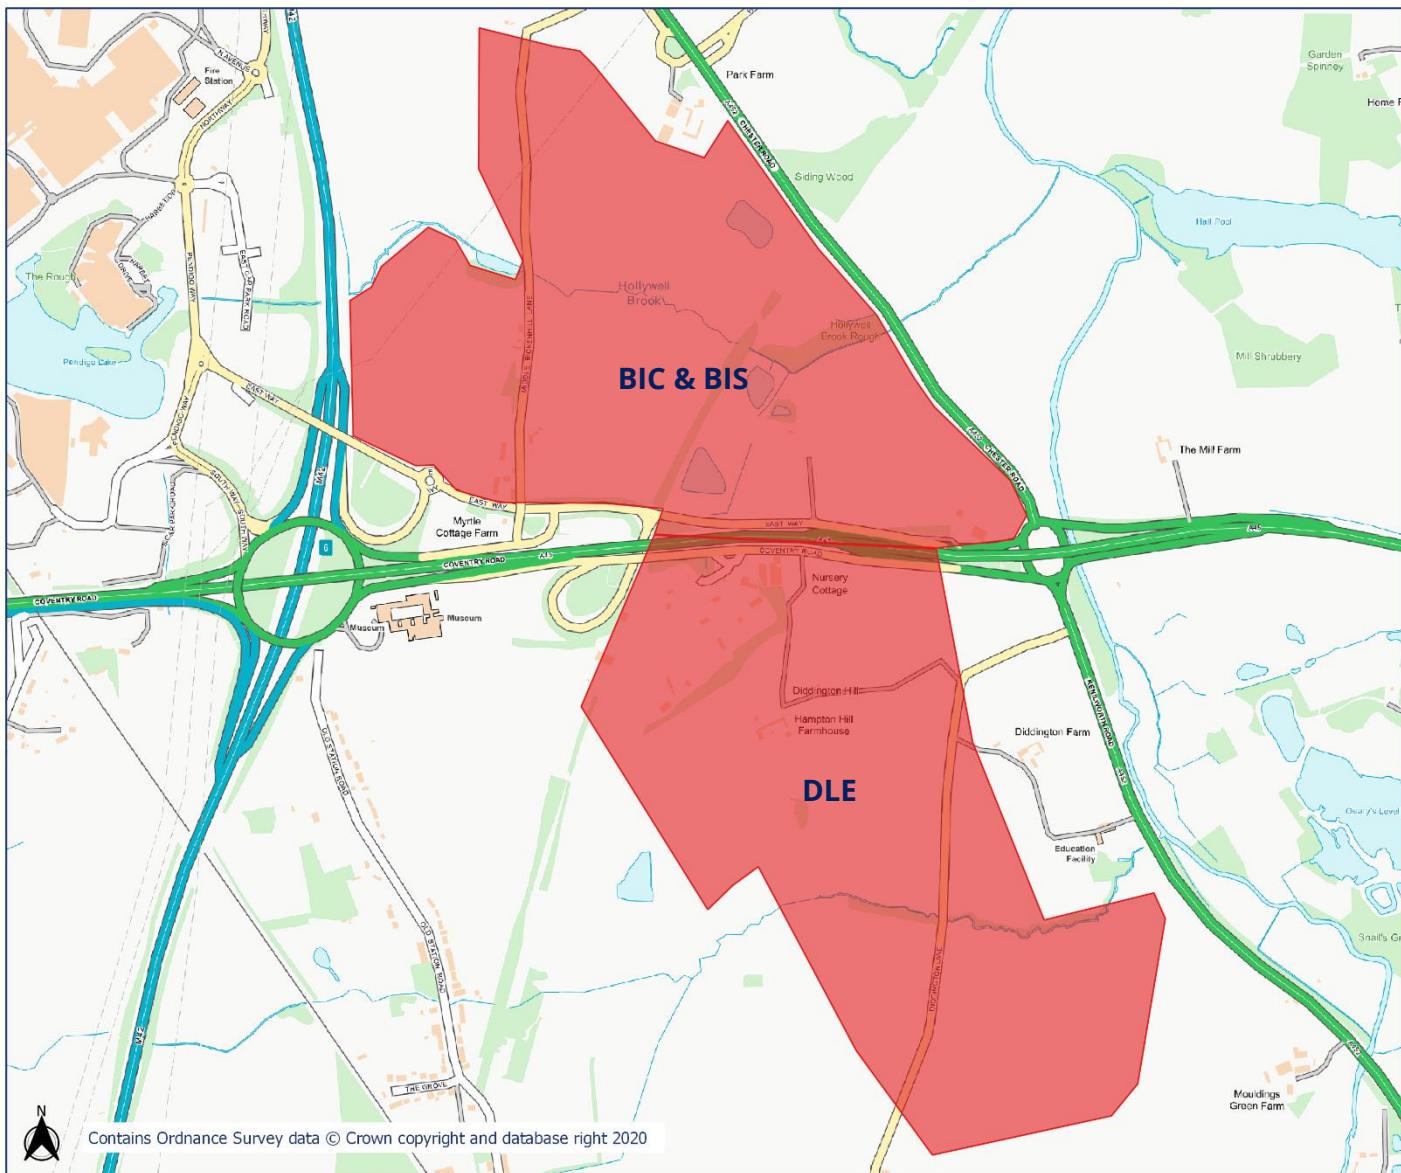

OFFICIAL


## Worksite Identification Plan - 4



**Legend**  
■ Active Worksites

OFFICIAL


## Worksite Identification Plan - 5

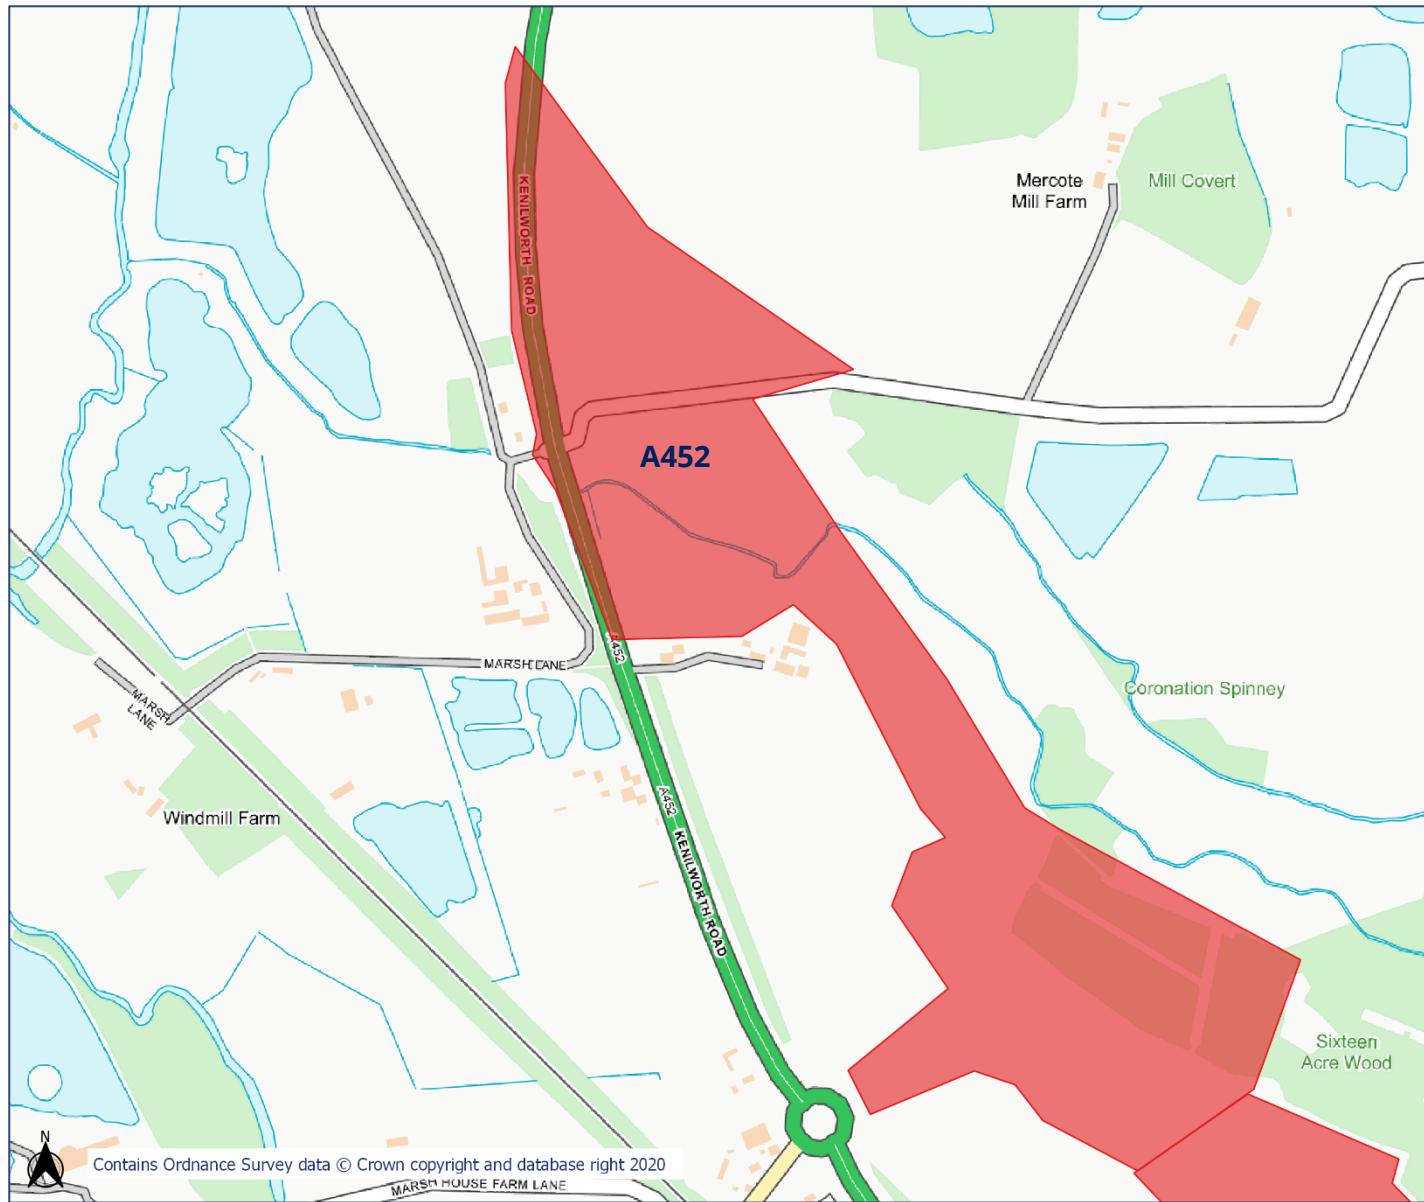

**Legend**  
■ Active Worksites


OFFICIAL

## Worksite Identification Plan - 6

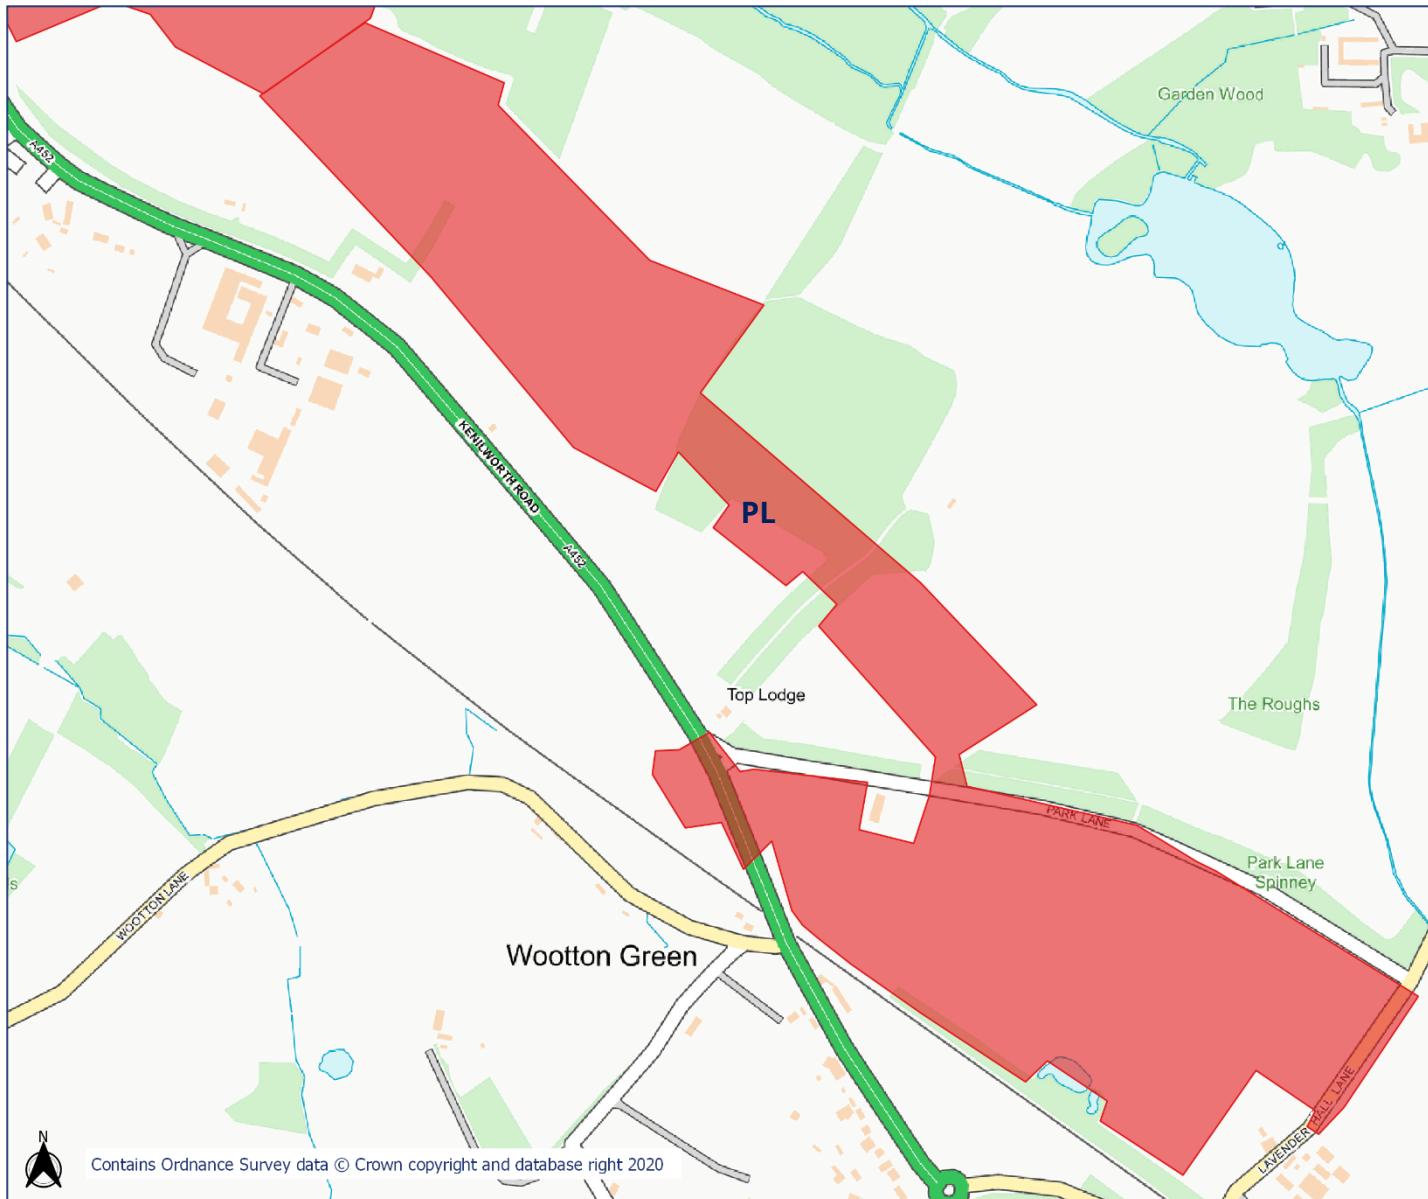


OFFICIAL

## Worksite Identification Plan - 7

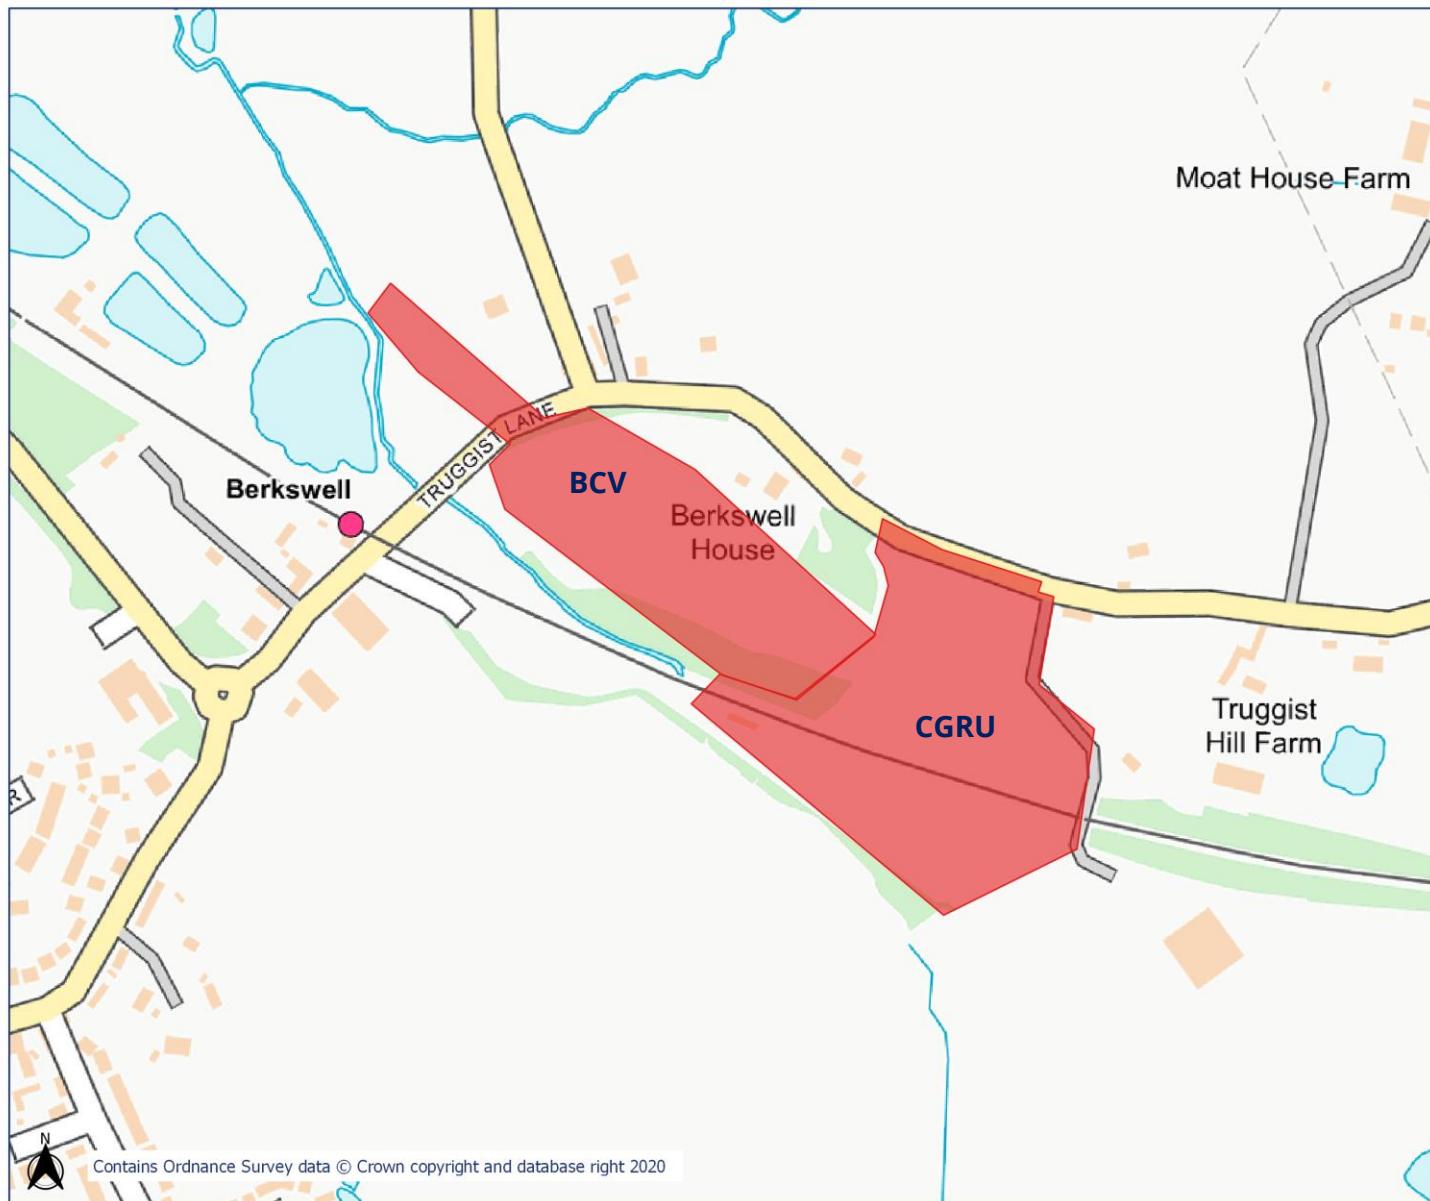

OFFICIAL

## Worksite Identification Plan - 8

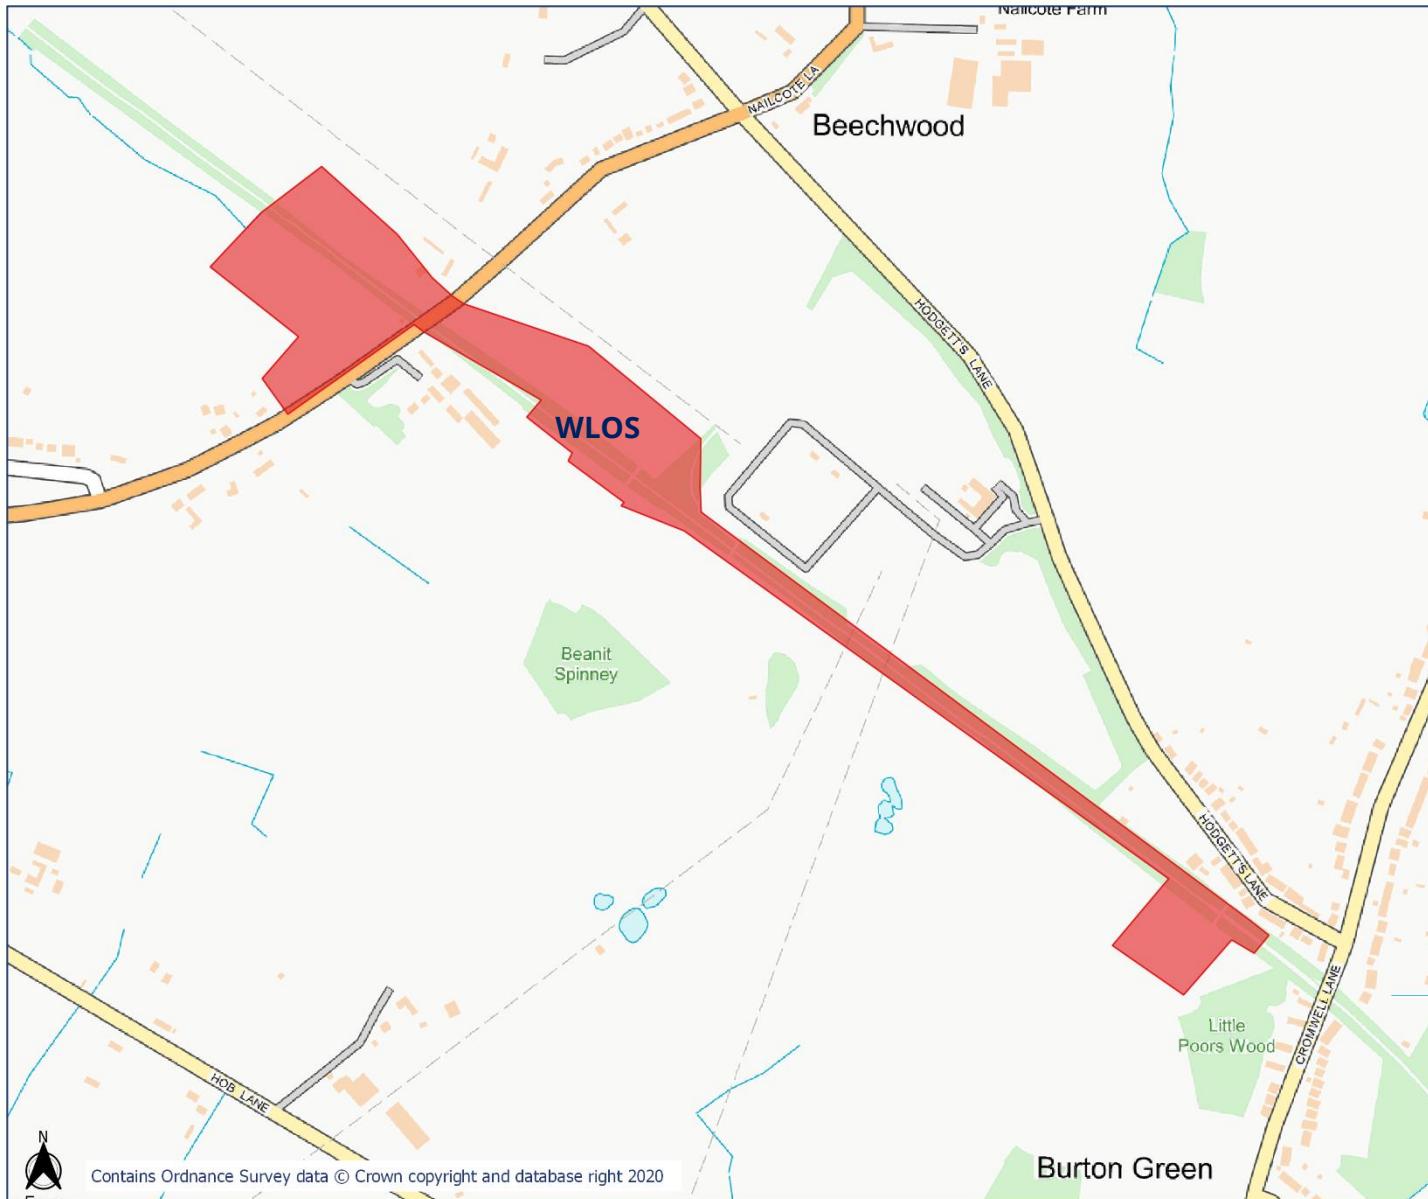


OFFICIAL

# **Appendix B Monitoring Locations**

OFFICIAL


# Noise and Vibration Monitoring Plan - 1

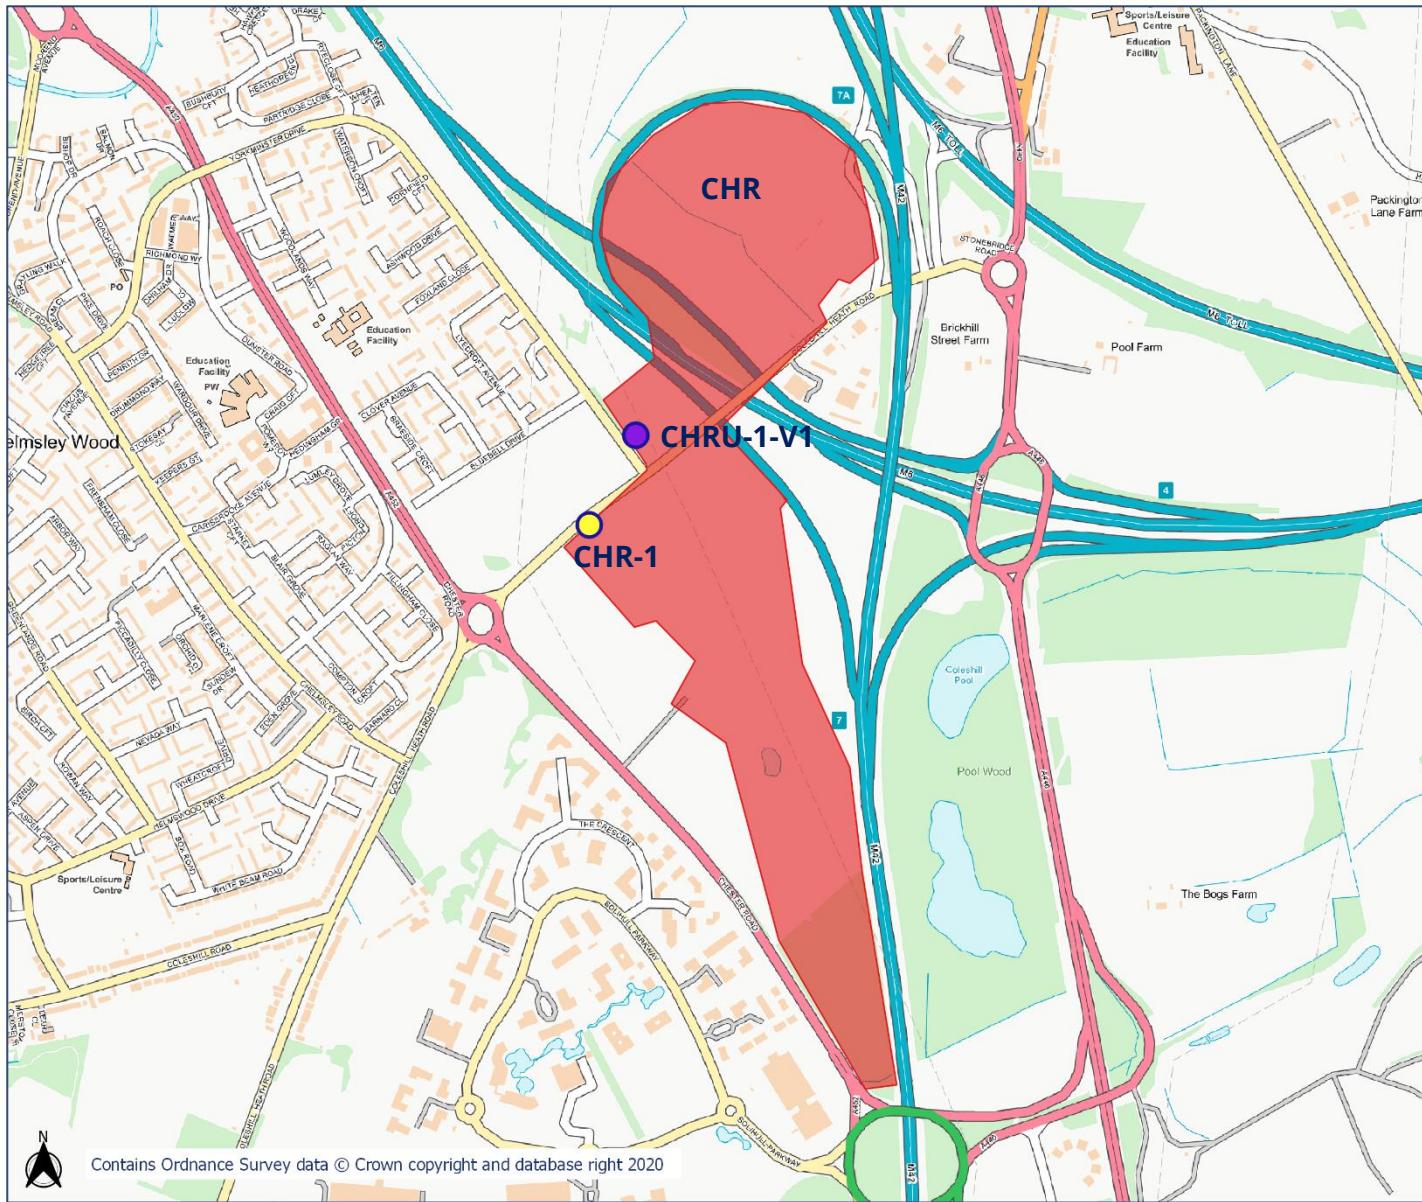

Legend		
<span style="color: yellow;">●</span>	Noise Monitor	
<span style="color: purple;">●</span>	Noise and Vibration Monitor	
<span style="color: red;">■</span>	Active Worksites	

OFFICIAL

## Noise and Vibration Monitoring Plan - 2

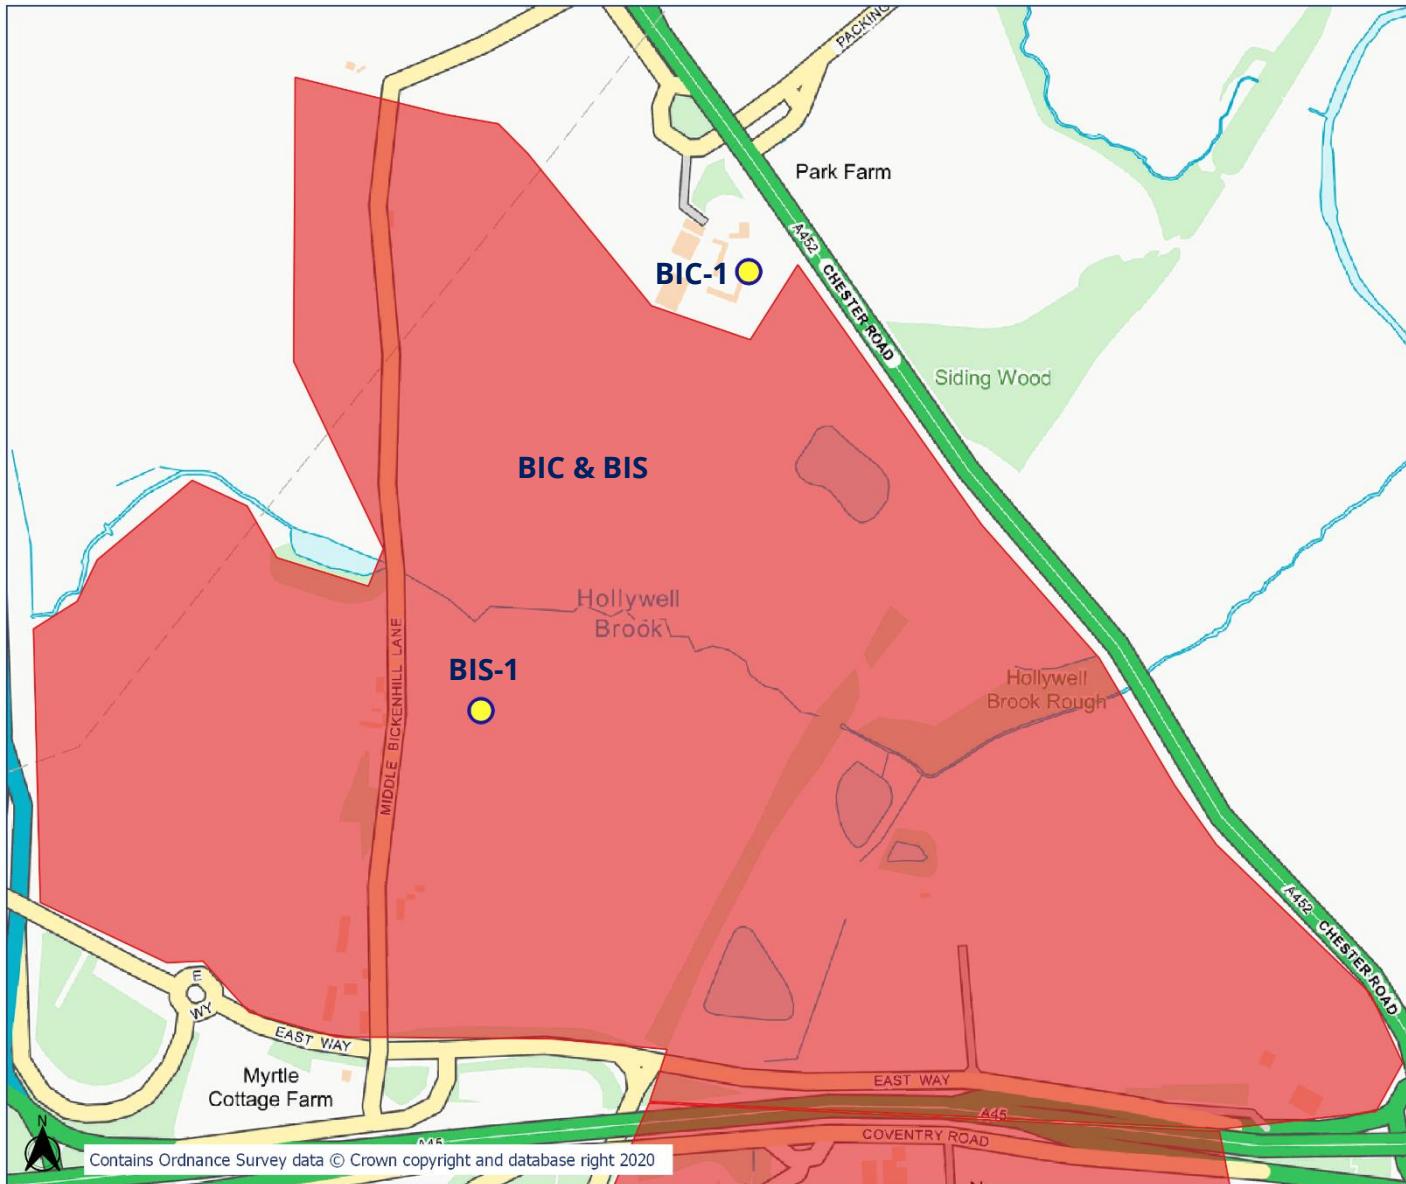


**Legend**

- Yellow circle: Noise Monitor
- Red shading: Active Worksites


OFFICIAL

## Noise and Vibration Monitoring Plan - 3

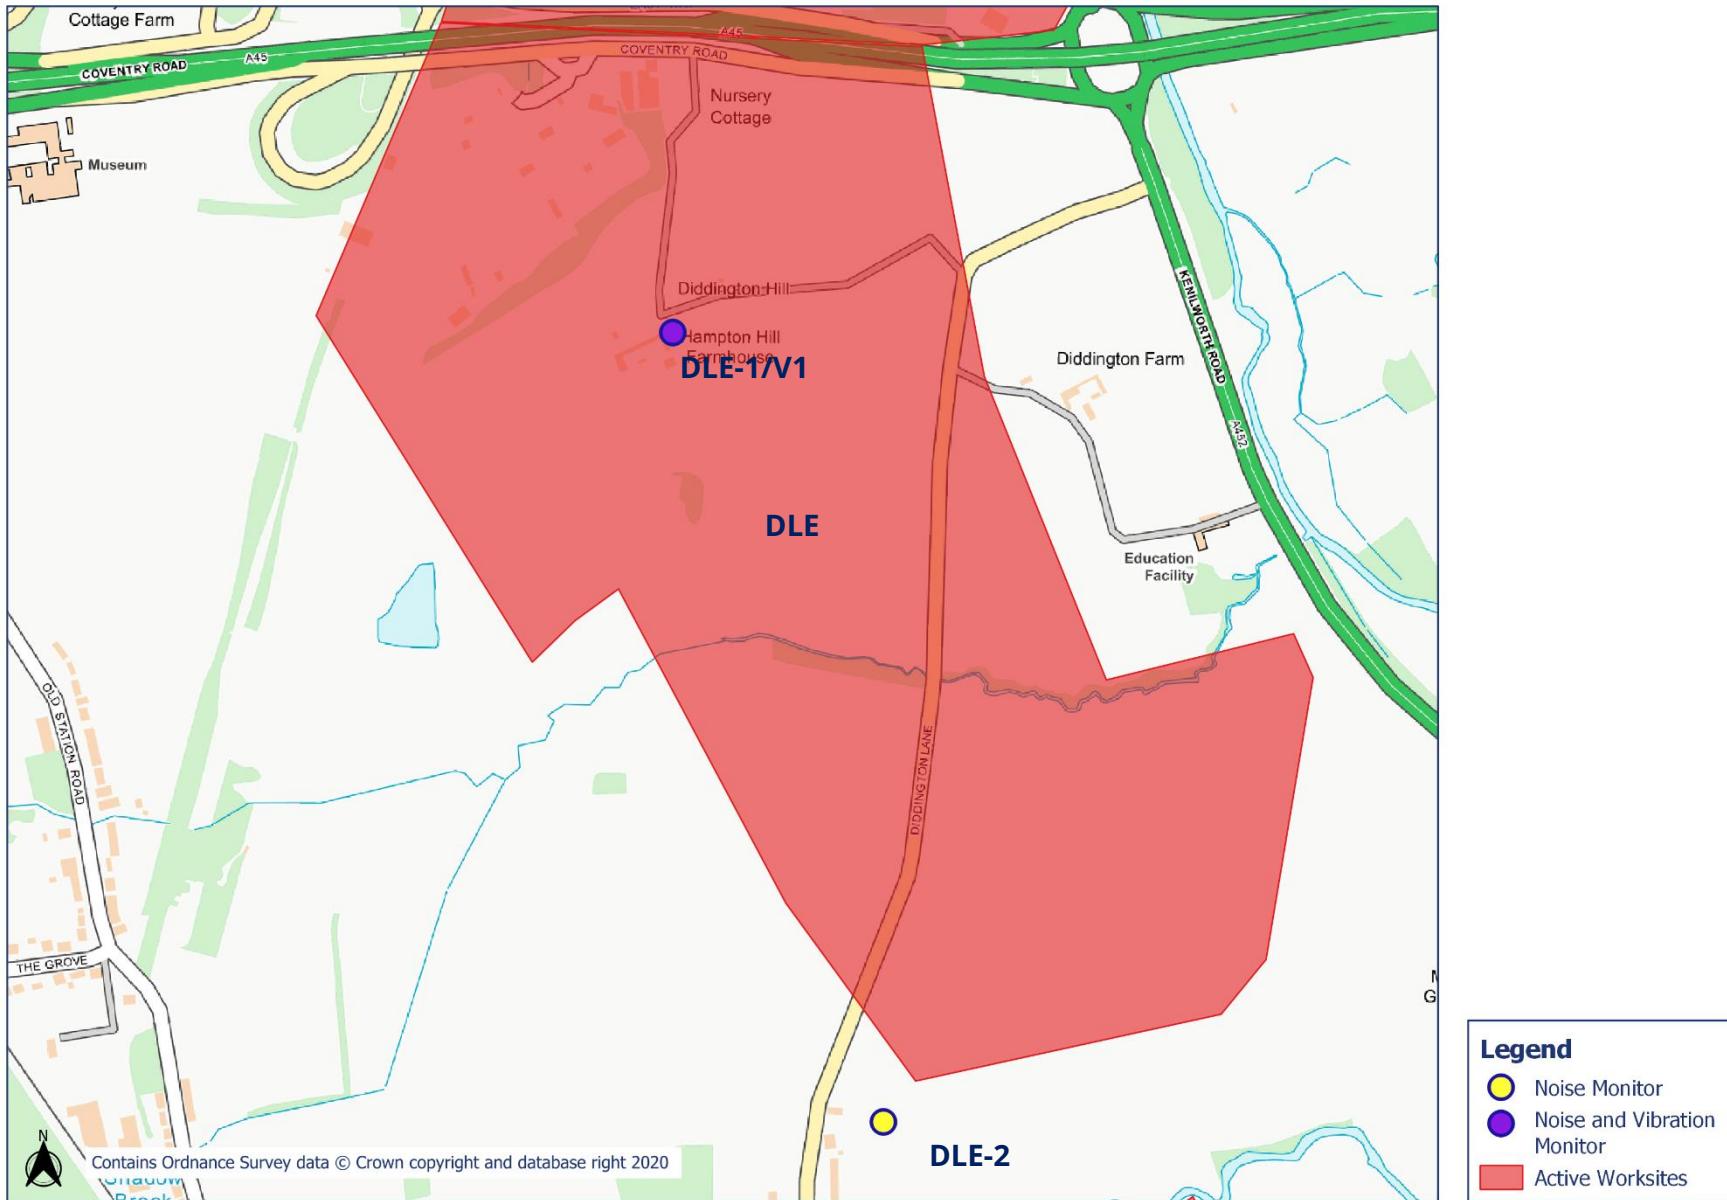


OFFICIAL

## Noise and Vibration Monitoring Plan - 4

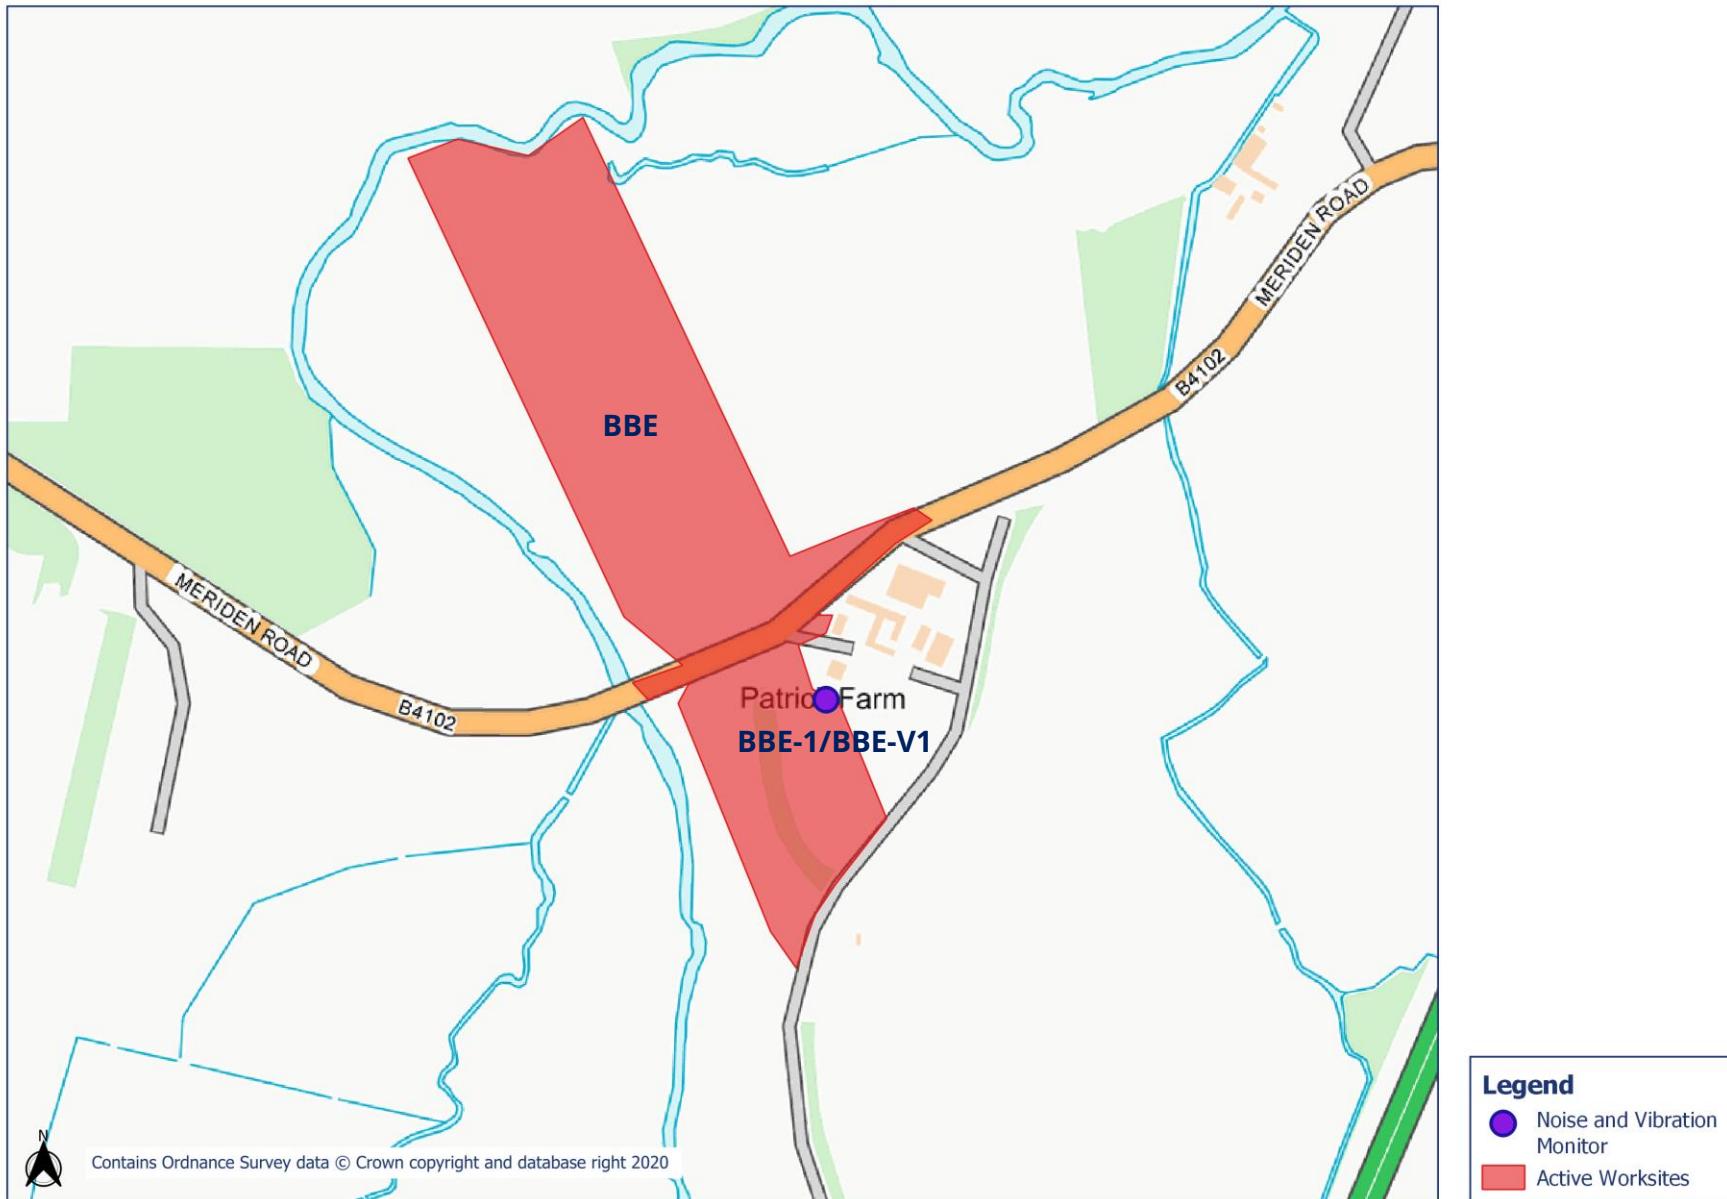

OFFICIAL

## Noise and Vibration Monitoring Plan - 5

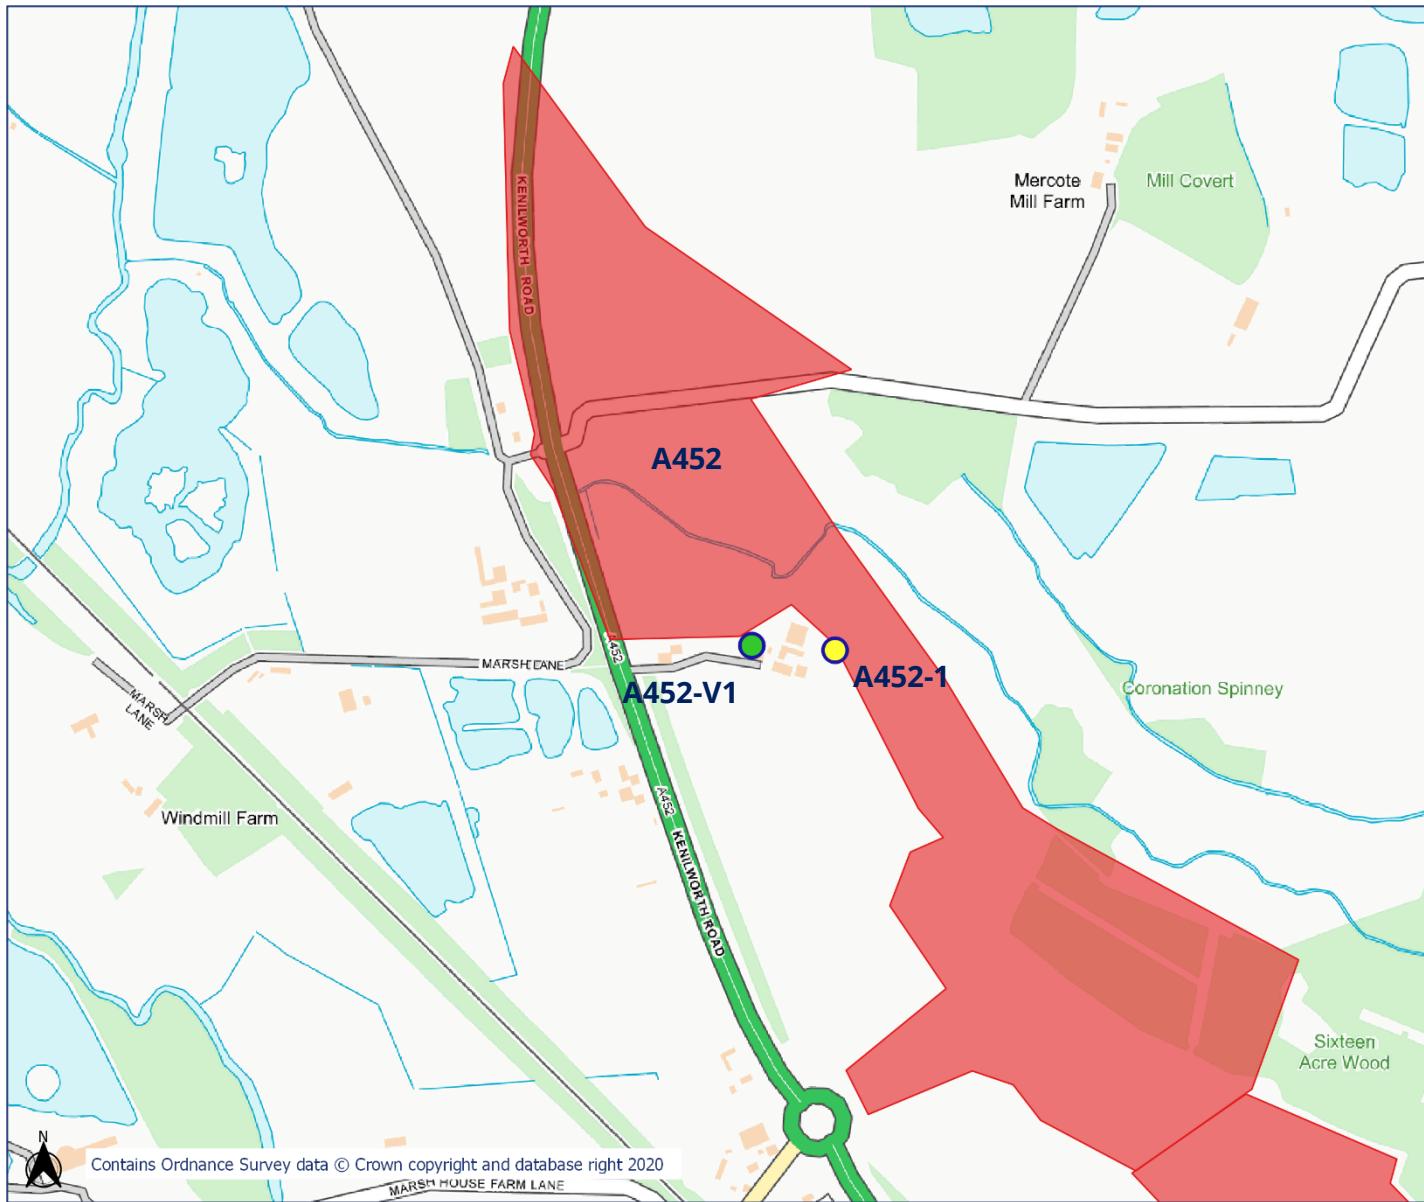


**Legend**

- Yellow circle: Noise Monitor
- Green circle: Vibration Monitor
- Red shaded area: Active Worksites

OFFICIAL


## Noise and Vibration Monitoring Plan - 6

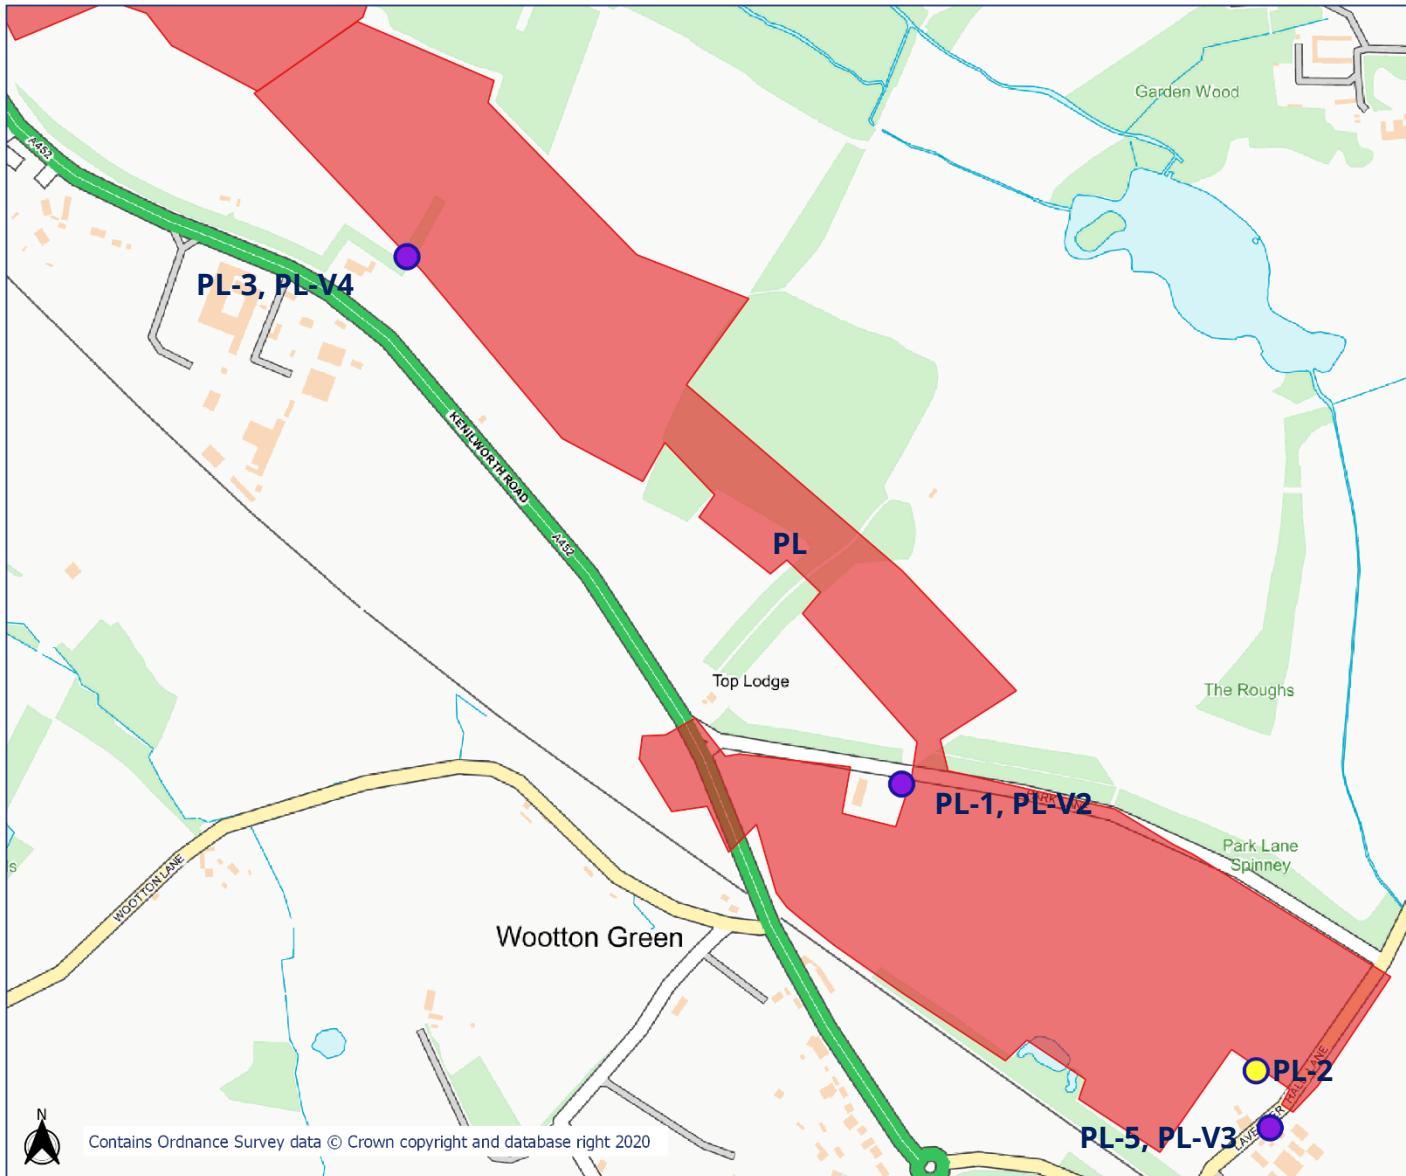

Legend	
Noise Monitor	Yellow circle
Noise and Vibration Monitor	Blue circle
Active Worksites	Red shaded area

OFFICIAL

## Noise and Vibration Monitoring Plan - 7

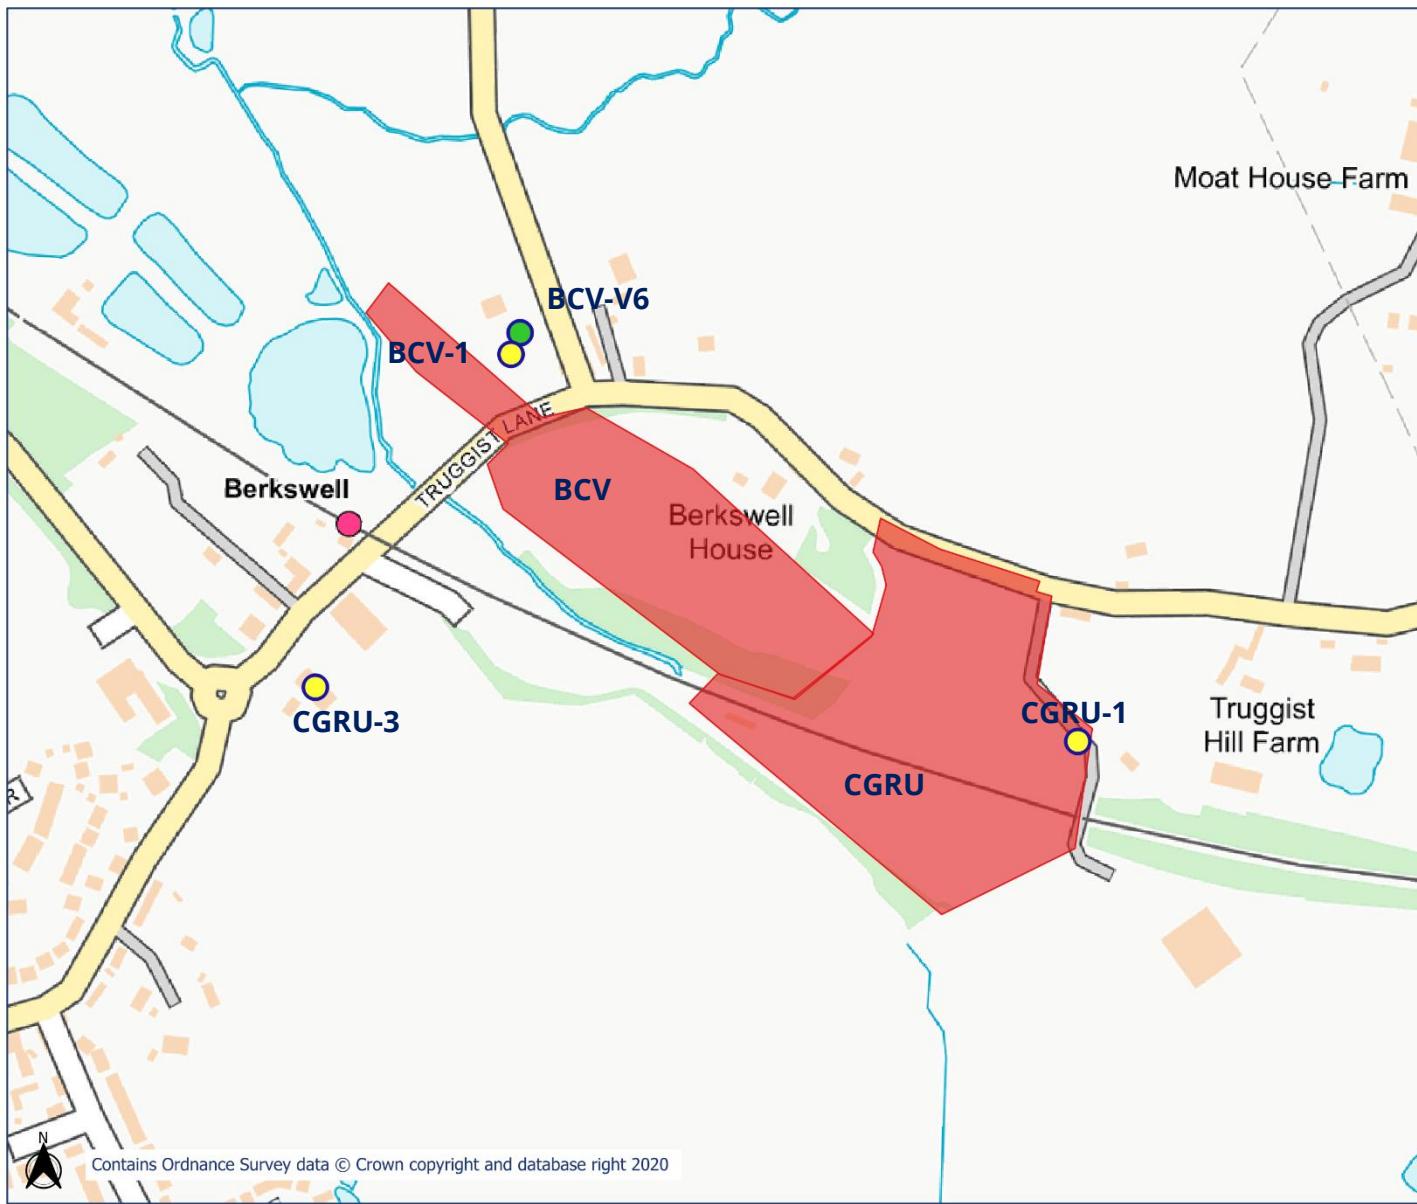


### Legend

- Noise Monitor (Yellow circle)
- Vibration Monitor (Green circle)
- Active Worksites (Red shaded area)

OFFICIAL

## Noise and Vibration Monitoring Plan - 8

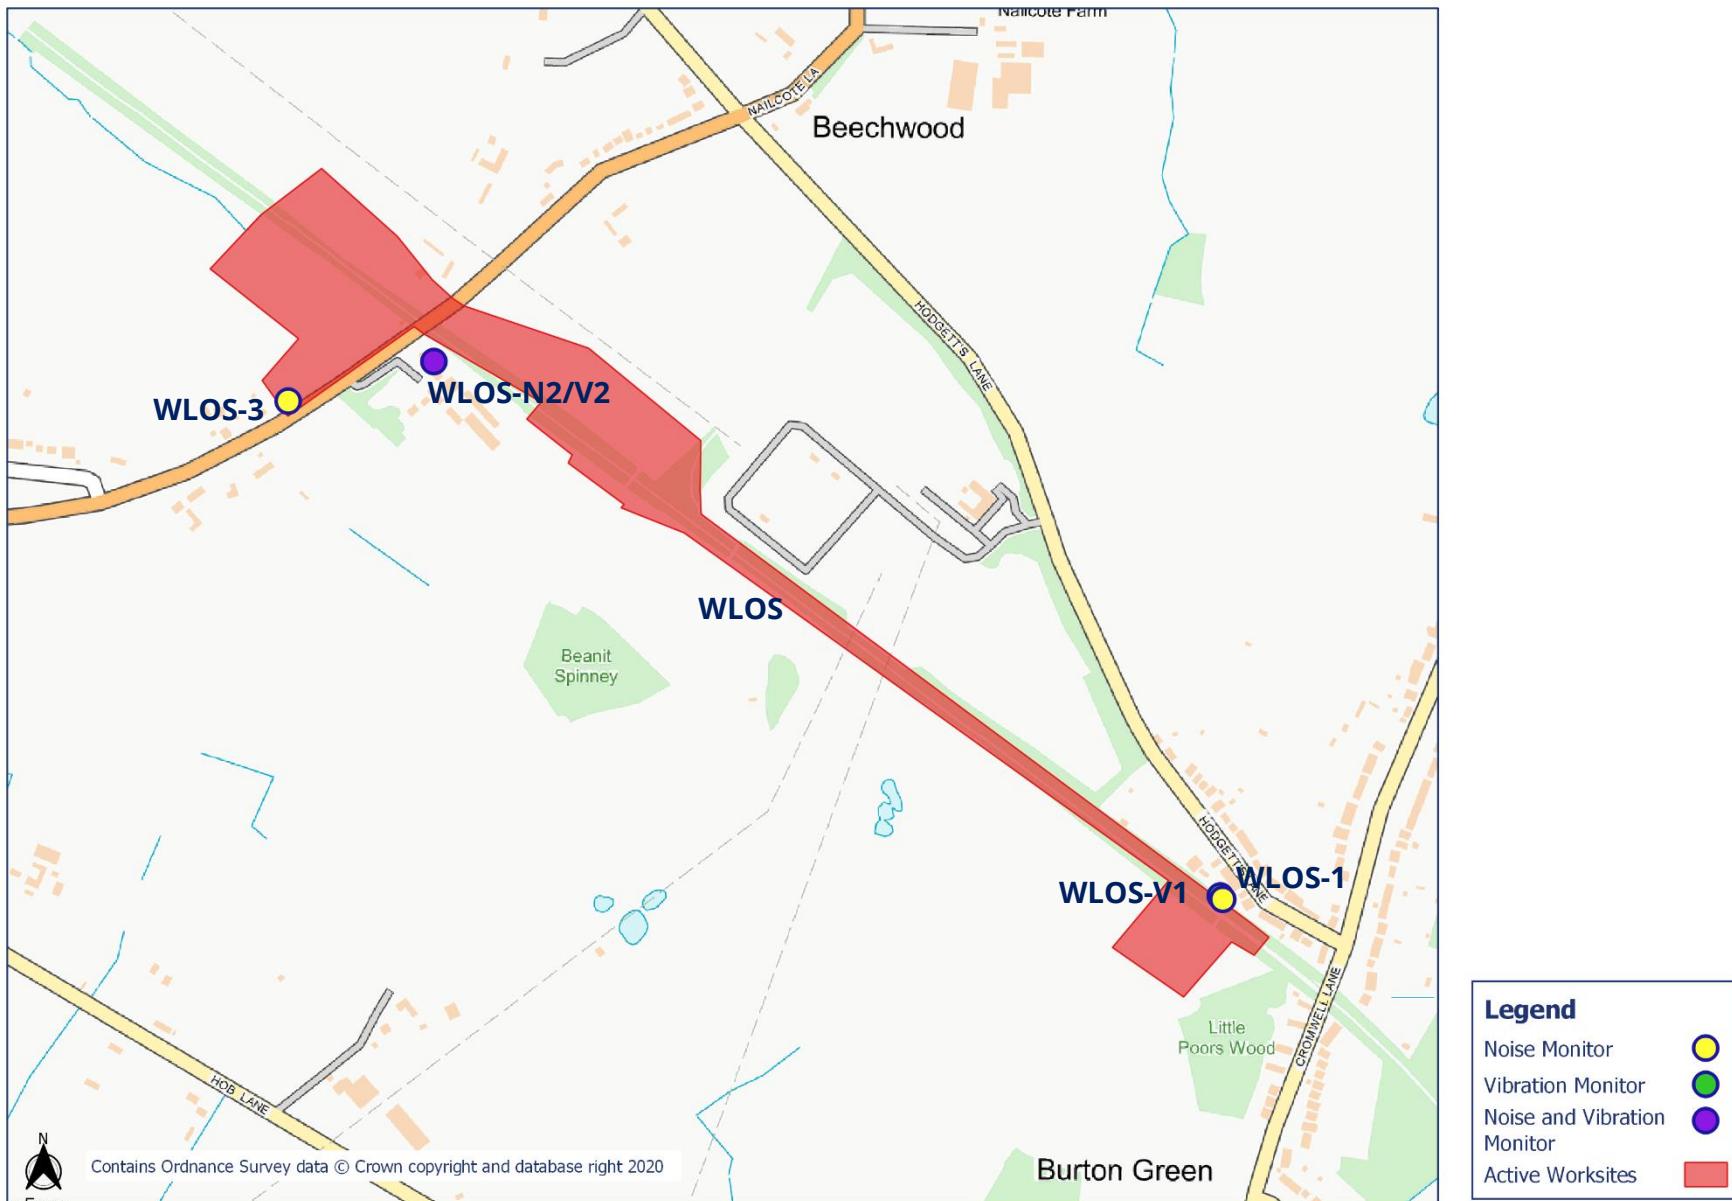



OFFICIAL

# Appendix C Data



## Noise

The following graphs show the hourly measured ambient noise level  $L_{Aeq,1h}$  and, where relevant, the averaged noise level  $L_{Aeq,T}$  values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods where noise levels are adversely affected by weather or only measured for part of the period, which are not representative of HS2 construction works, have been greyed out and excluded from the calculation of the  $L_{Aeq,T}$  values in the main report.

### Worksite: CHR - Monitoring Ref: CHRU-1


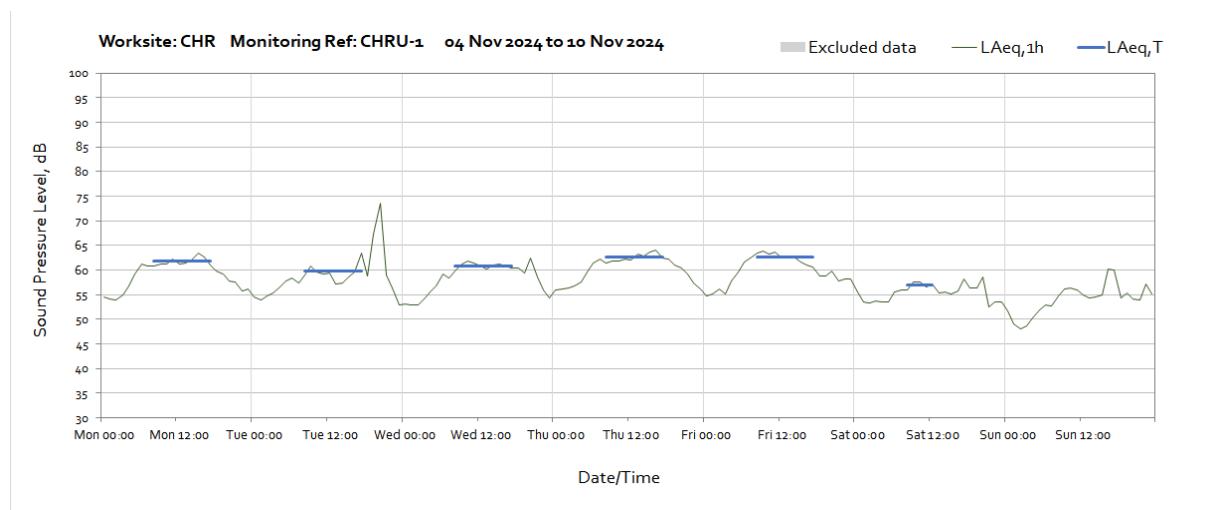
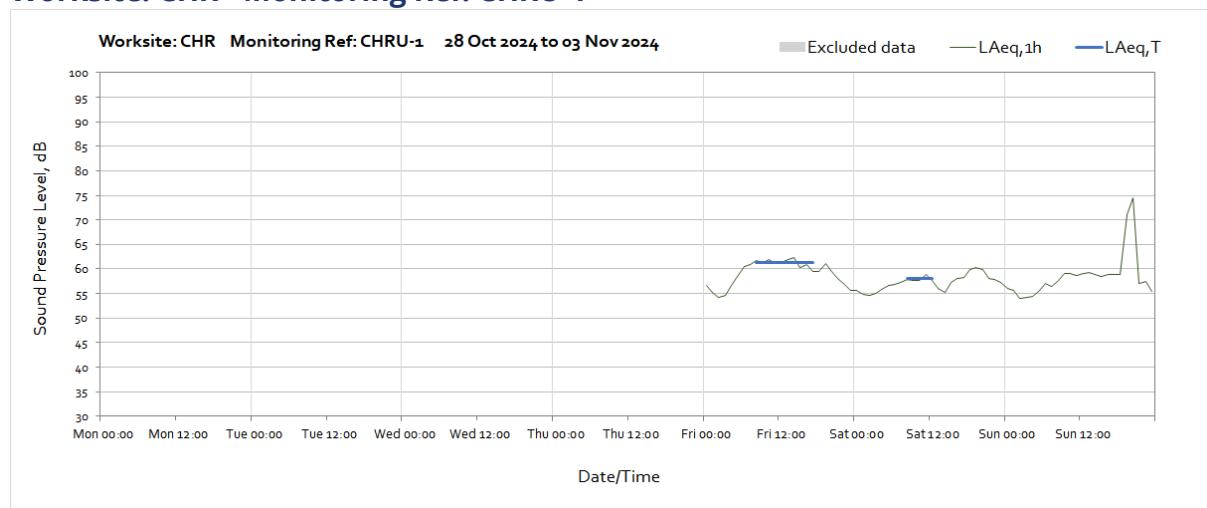


OFFICIAL

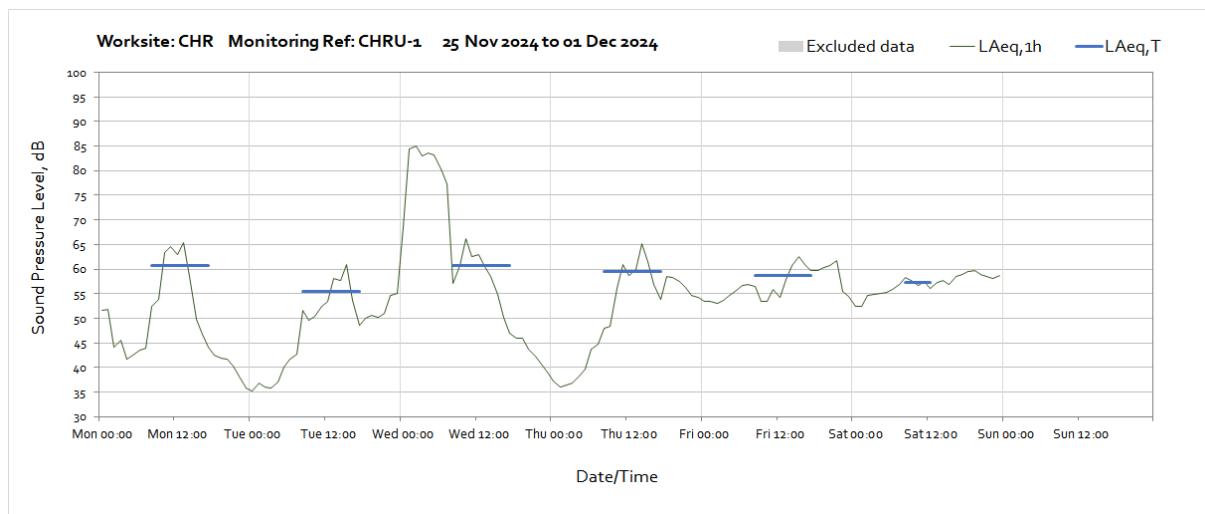
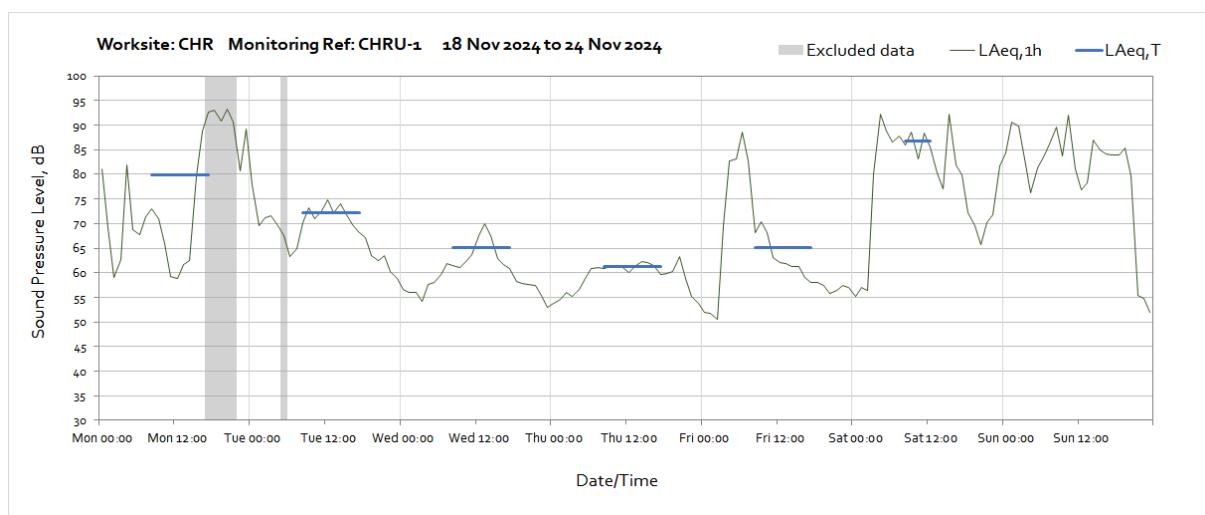


OFFICIAL

## Worksite: CHR - Monitoring Ref: CHR-1

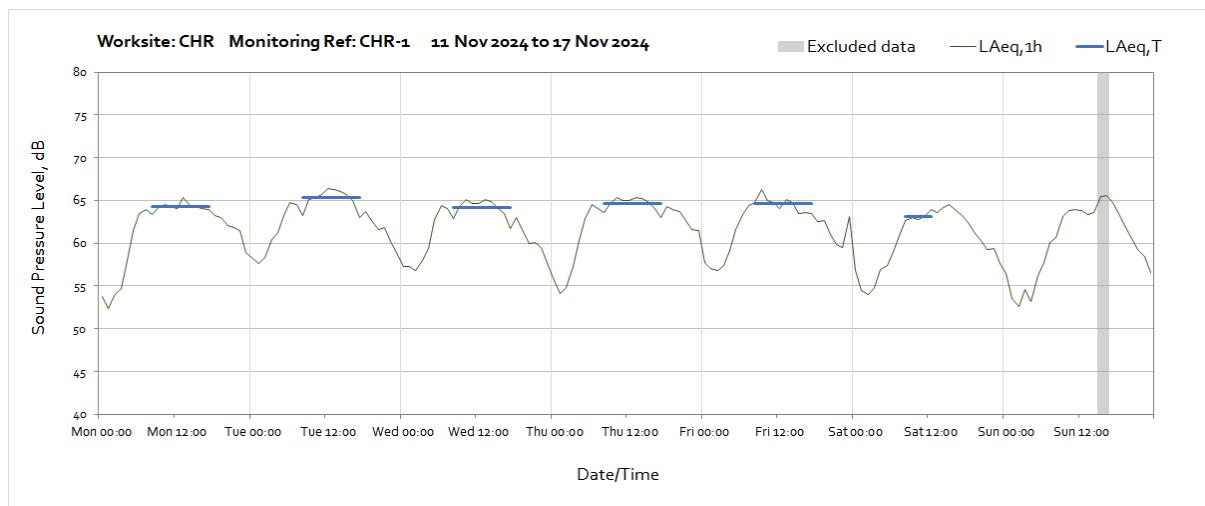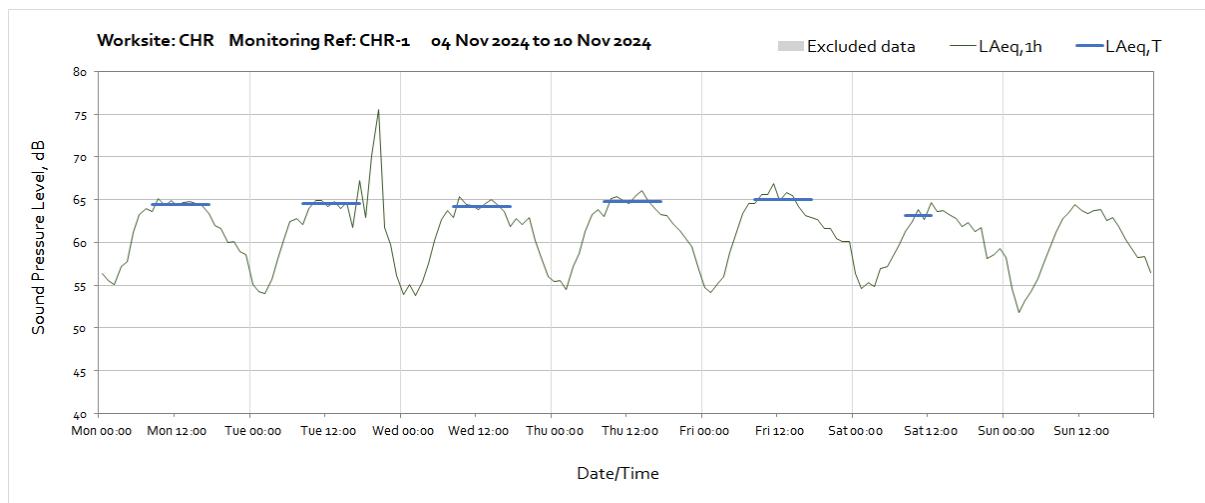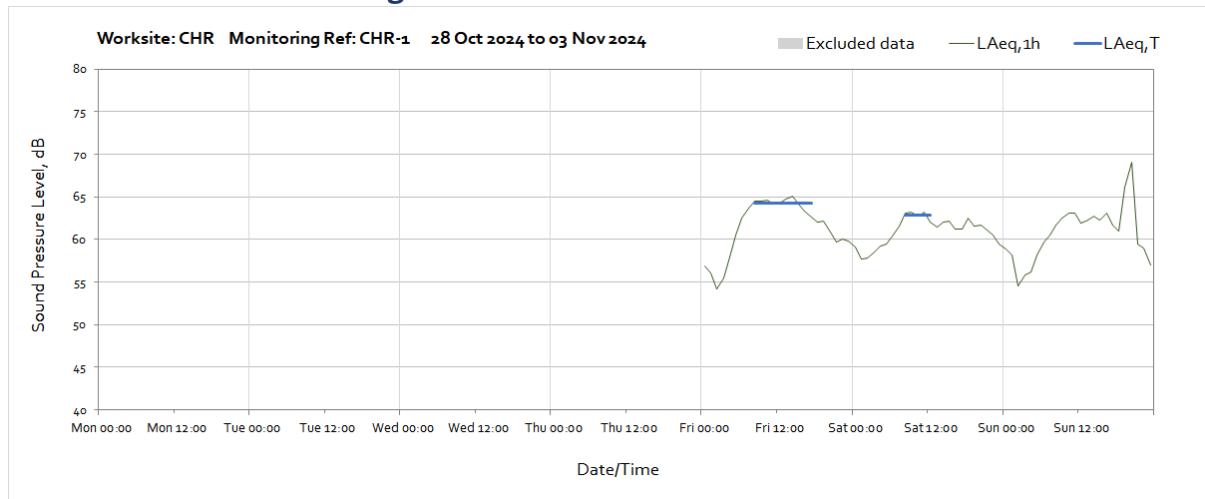




OFFICIAL

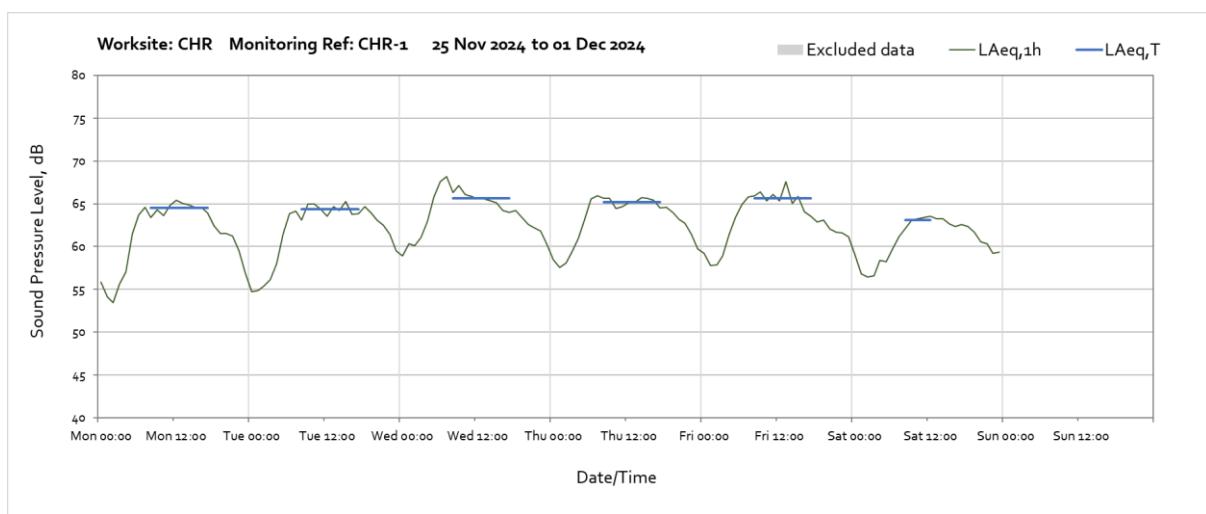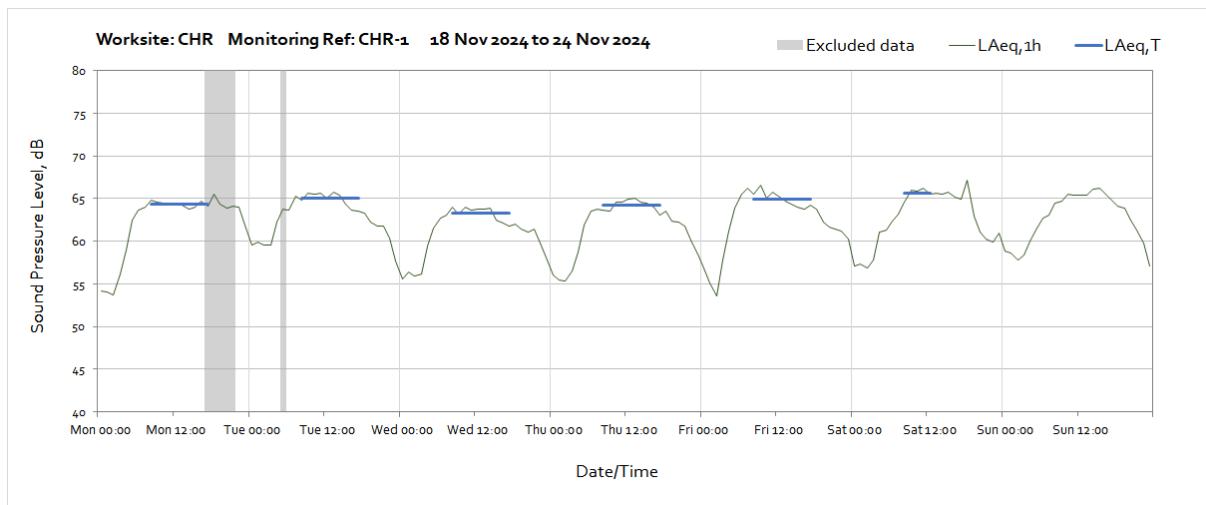


### Worksite: BIC - Monitoring Ref: BIC-1




OFFICIAL

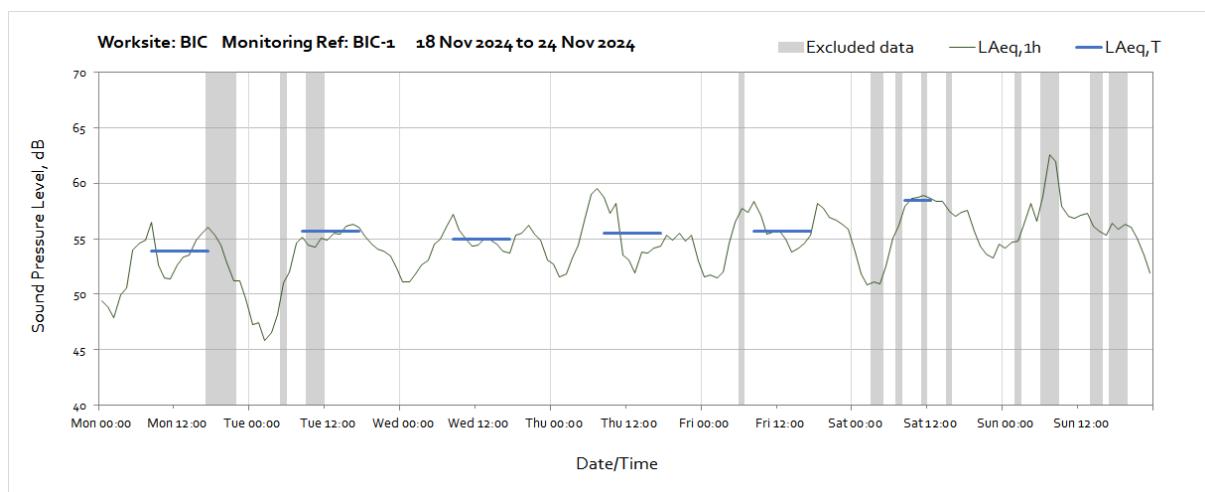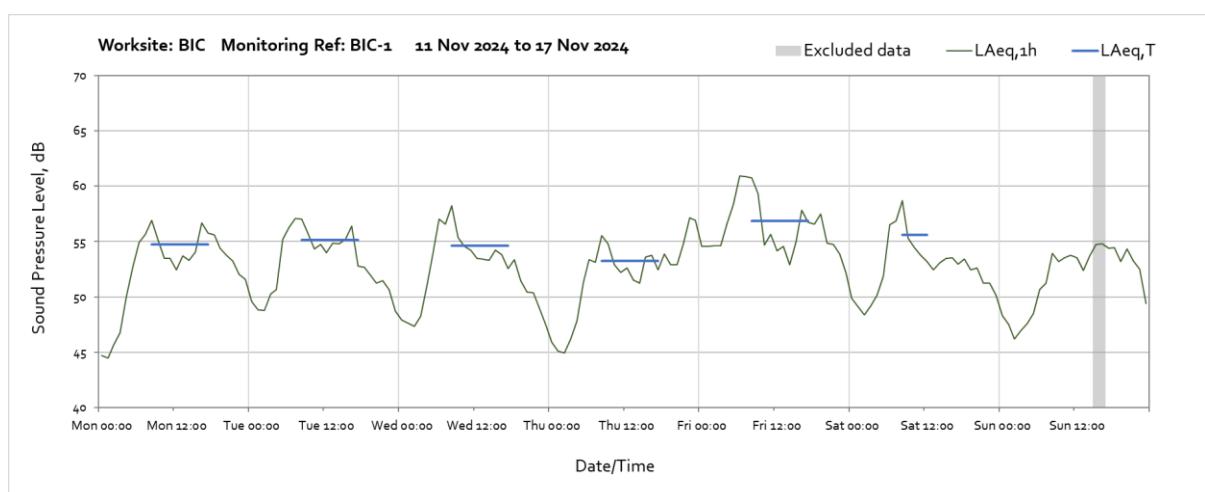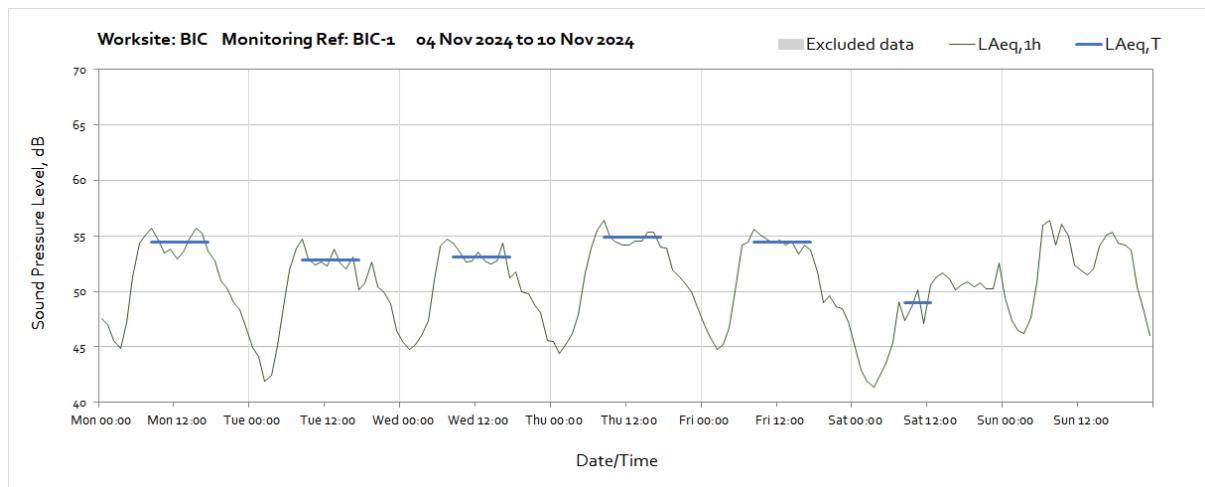


OFFICIAL

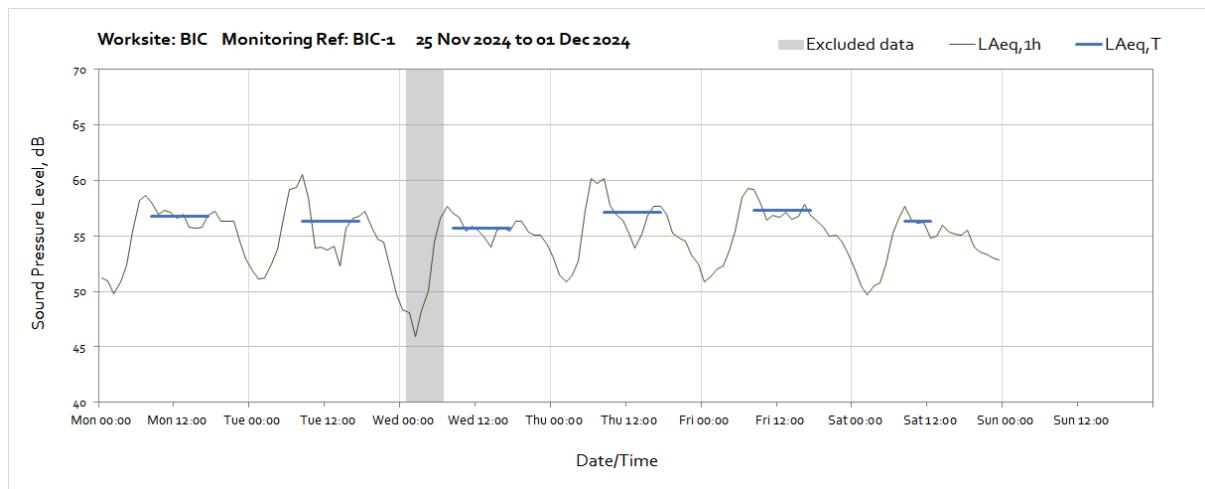


### Worksite: BIS- Monitoring Ref: BIS-1

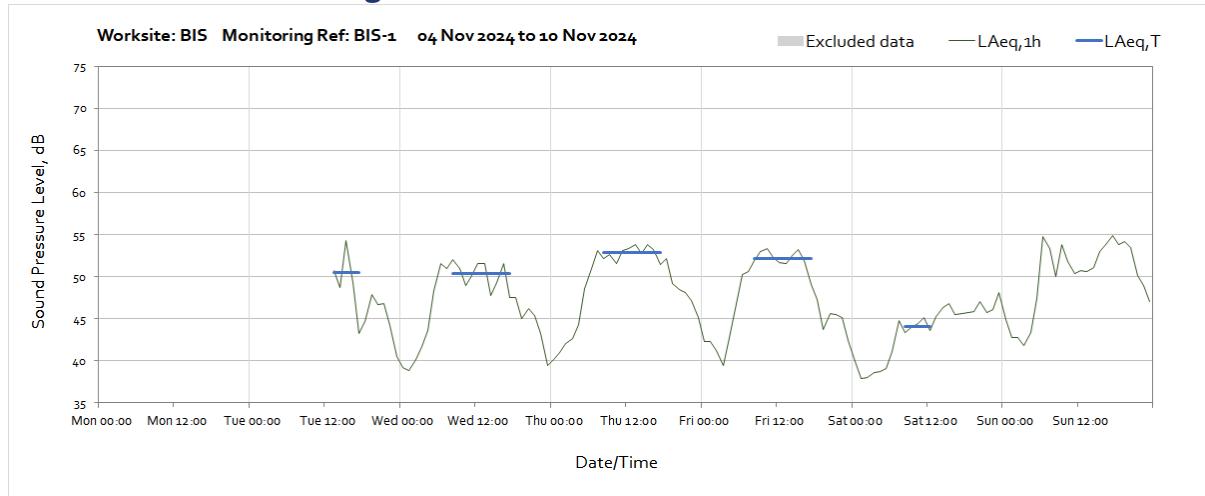

Note: Missing data from the beginning of the month until 13:00 on Tuesday 5<sup>th</sup> November was due to a hardware issue at the monitoring station.

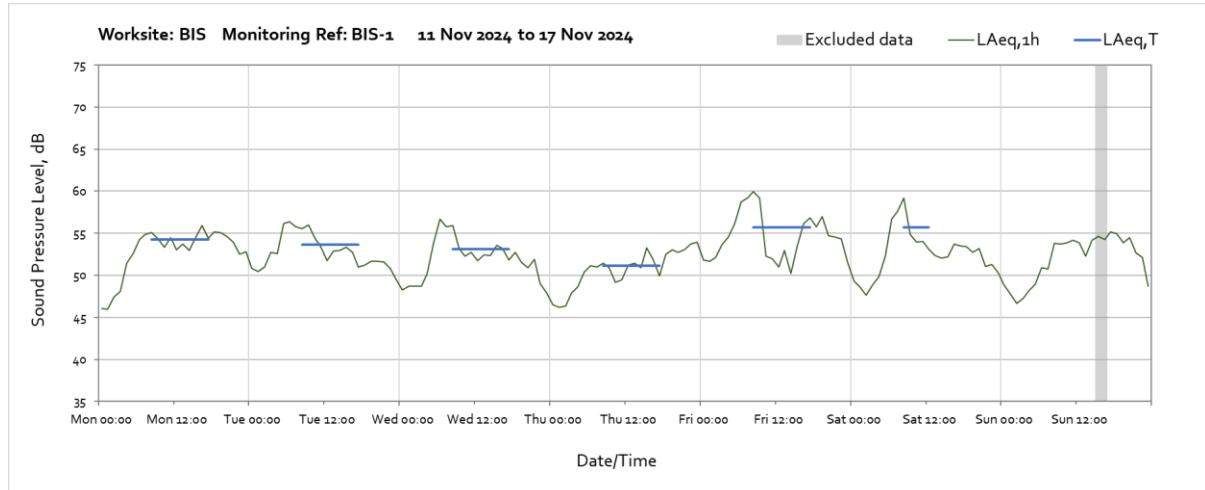


OFFICIAL

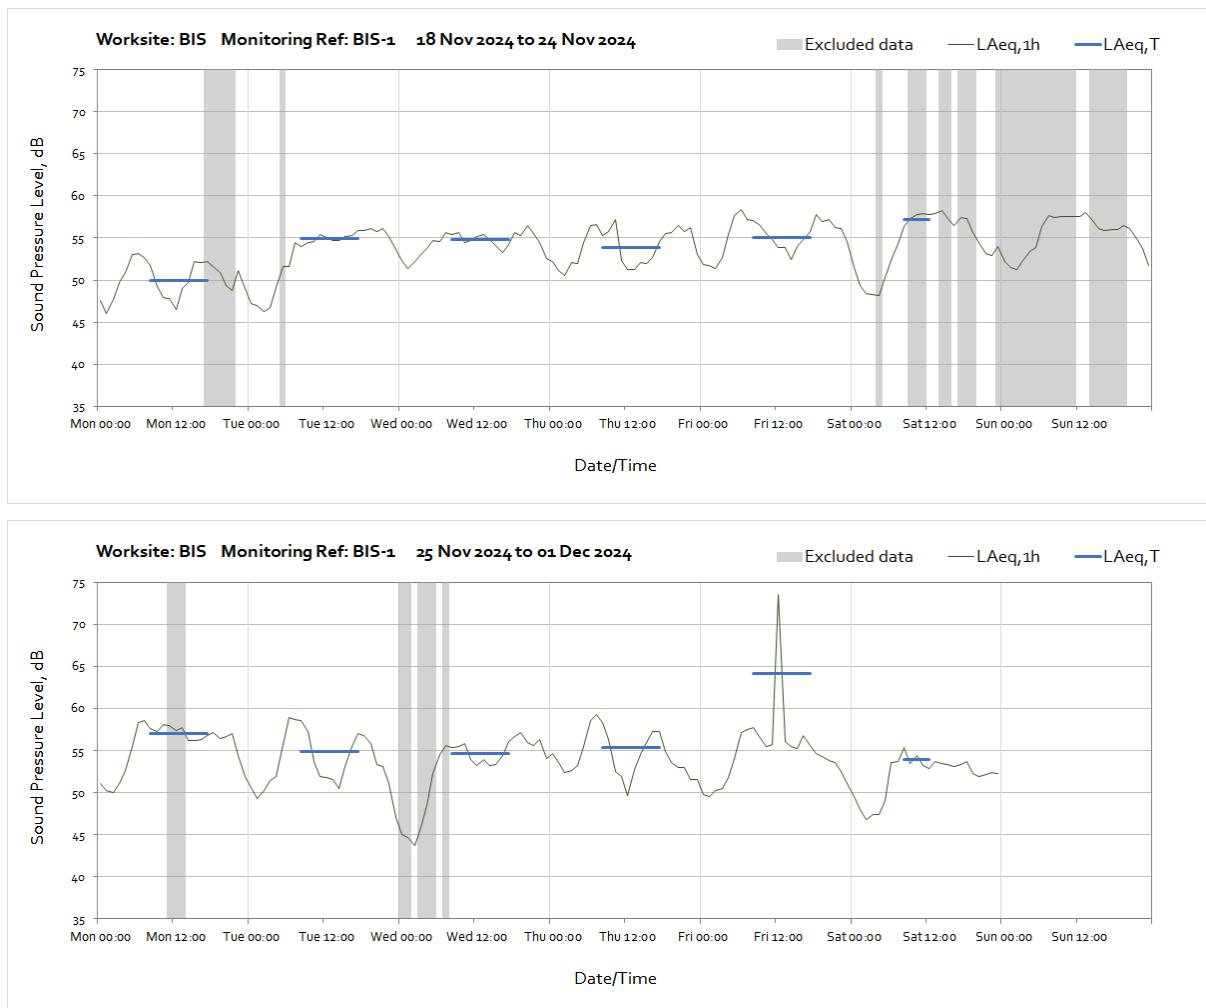


### Worksite: DLE - Monitoring Ref: DLE-1




OFFICIAL

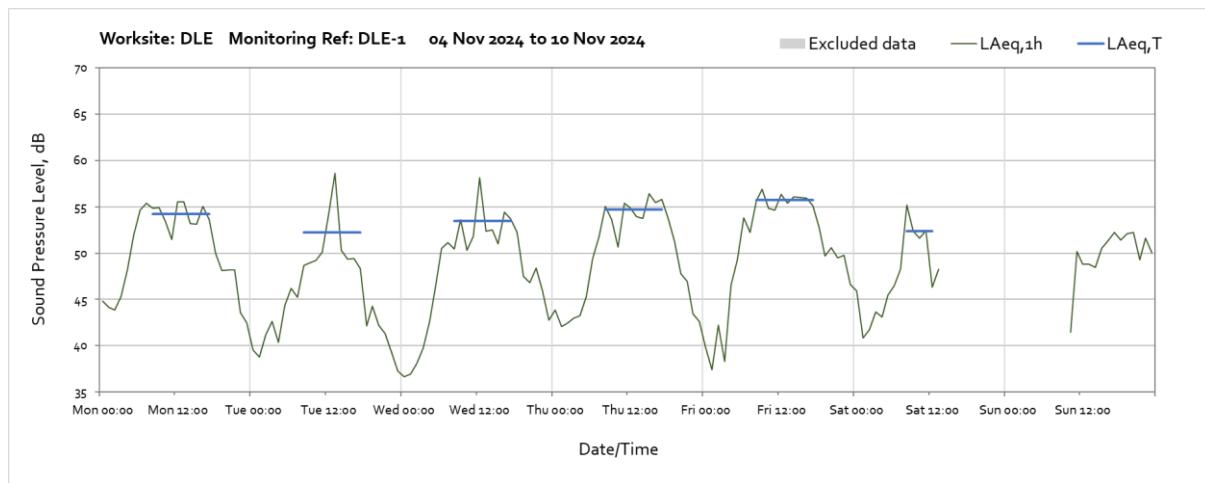

Note: Missing data between 14:00 on Saturday 9<sup>th</sup> and 10:00 on Sunday 10<sup>th</sup> November was due to a system error at the monitoring station.

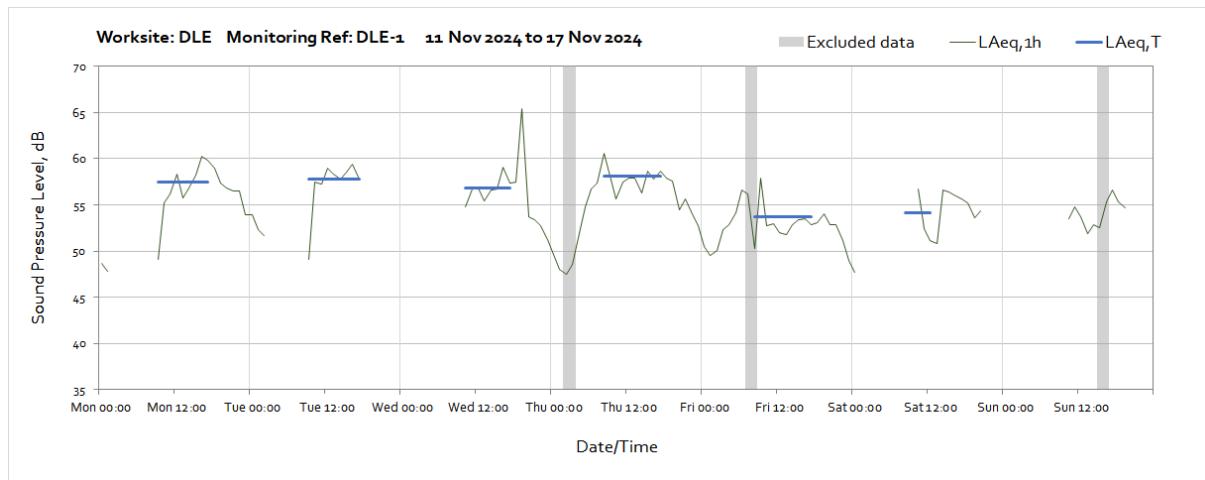


Note: Missing data throughout the week was due to a system error at the monitoring station.

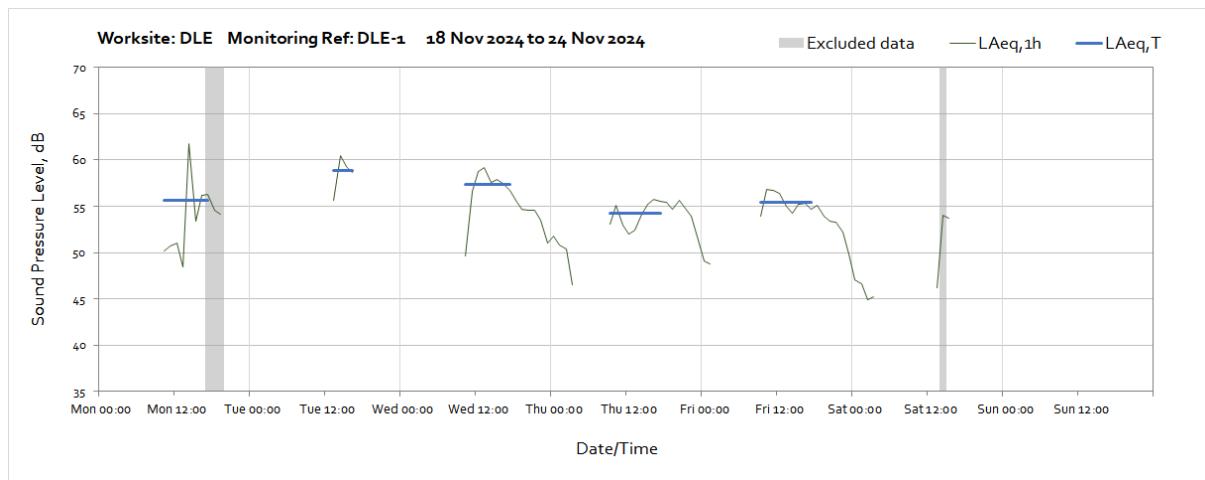


Note: Missing data throughout the week was due to a system error at the monitoring station.

**OFFICIAL**

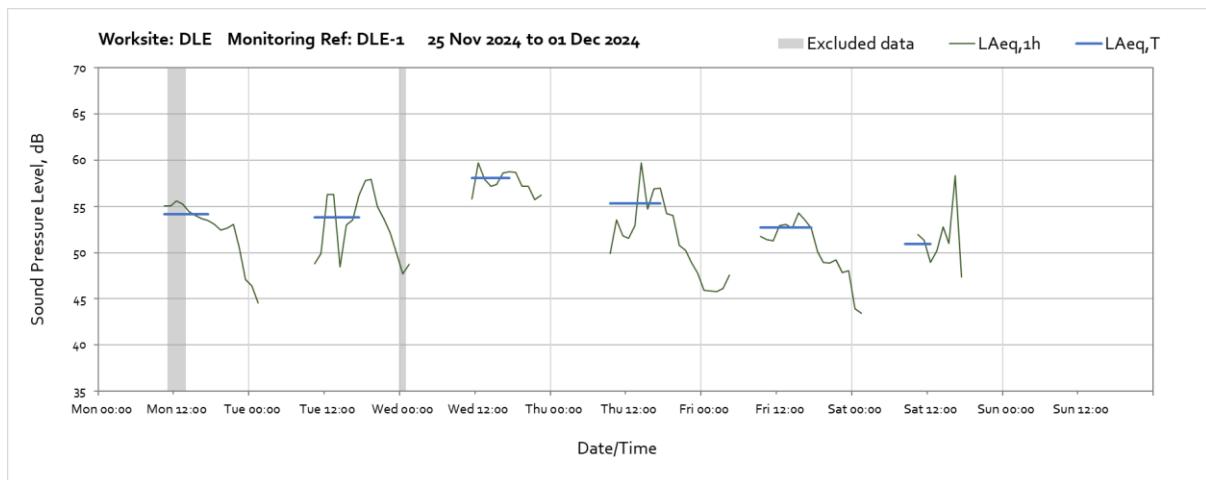

Note: Missing data throughout the week was due to a system error at the monitoring station.




### Worksite: DLE - Monitoring Ref: DLE-2

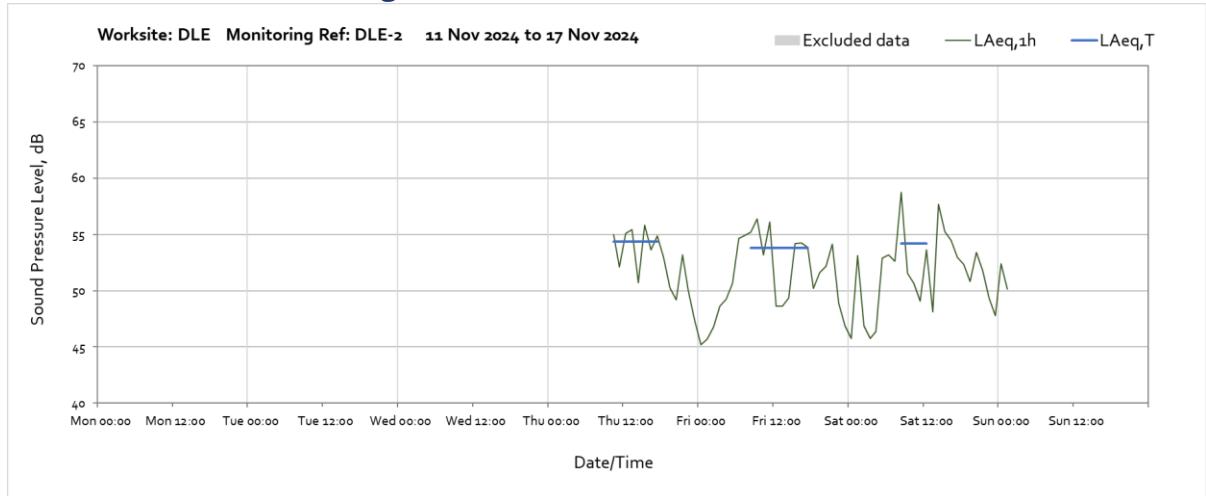



Note: Missing data from the beginning of the month until 10:00 on Thursday 14<sup>th</sup> November and from 02:00 on Sunday 17<sup>th</sup> November until the end of the month was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**


## Worksite: BBE – Monitoring Ref: BBE-1

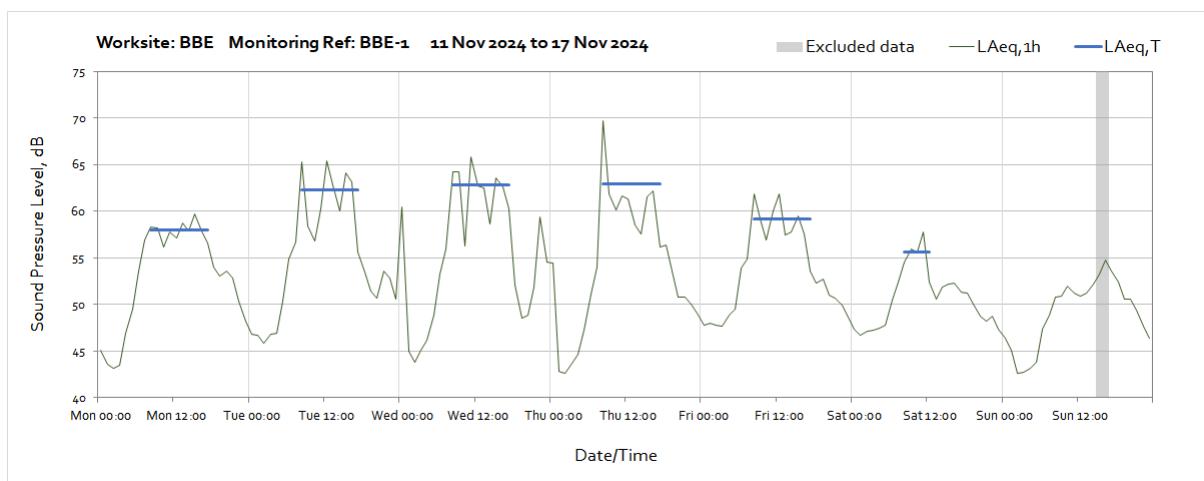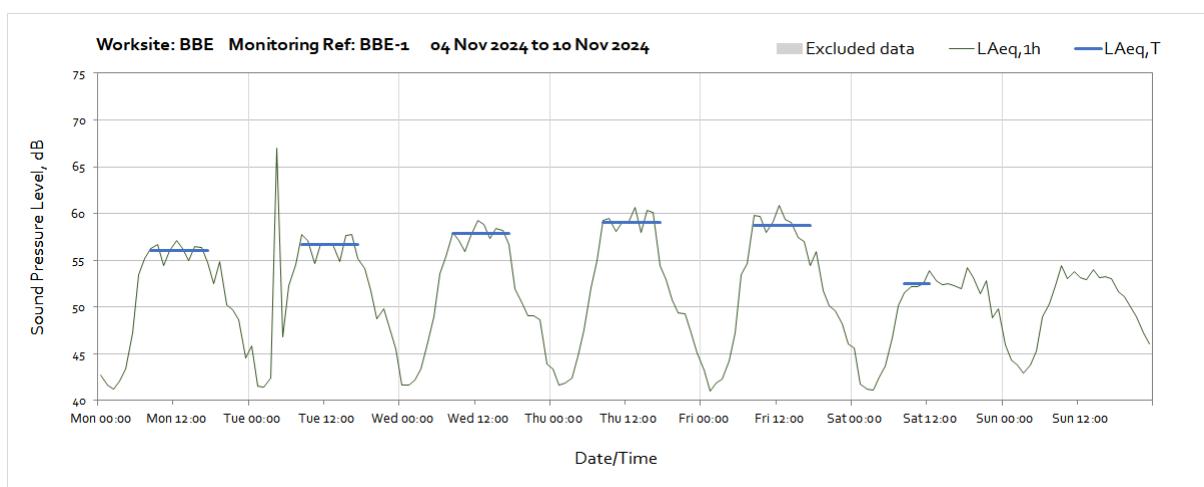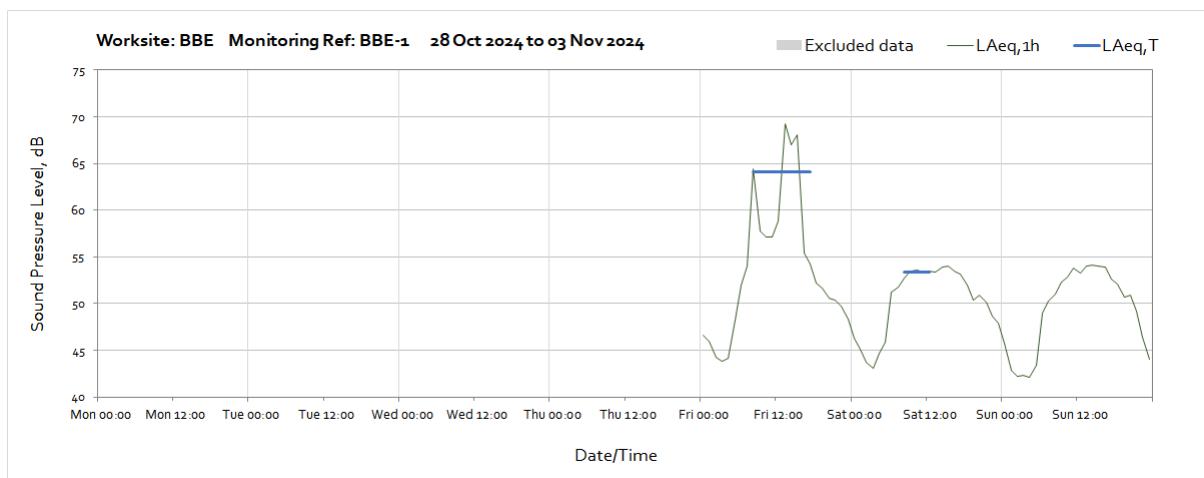




OFFICIAL

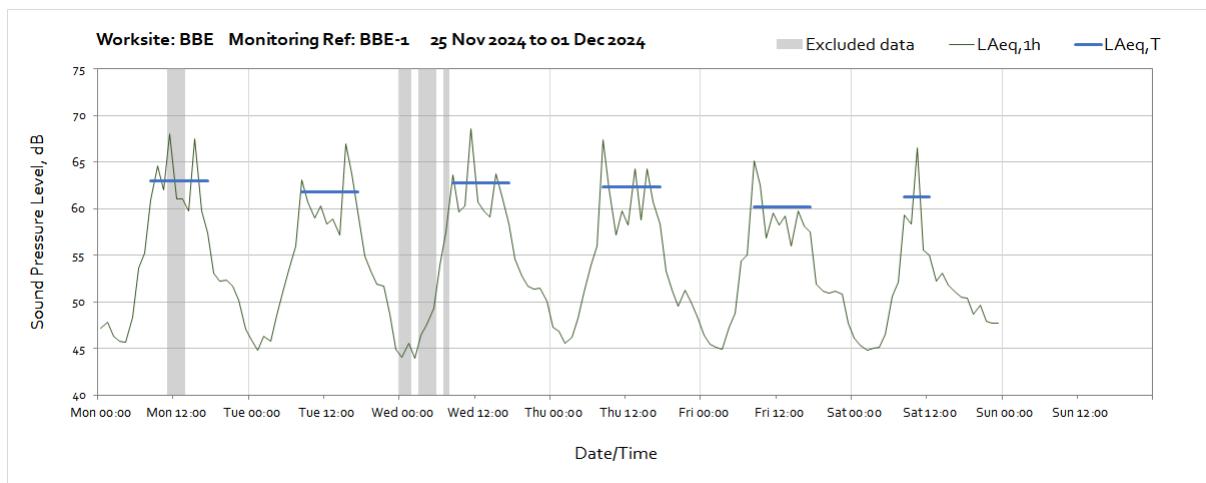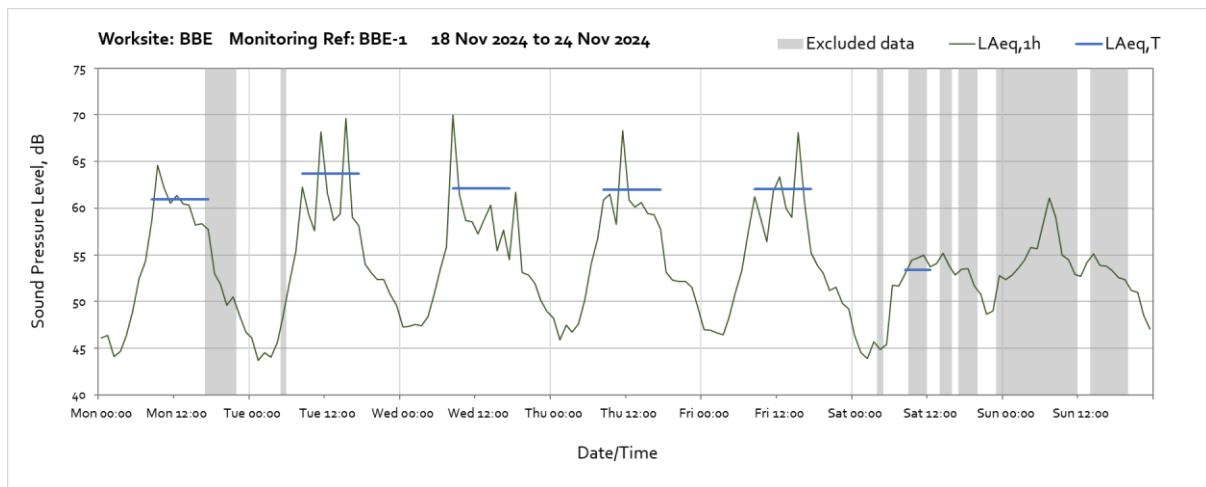


### Worksite: A452 – Monitoring Ref: A452-1

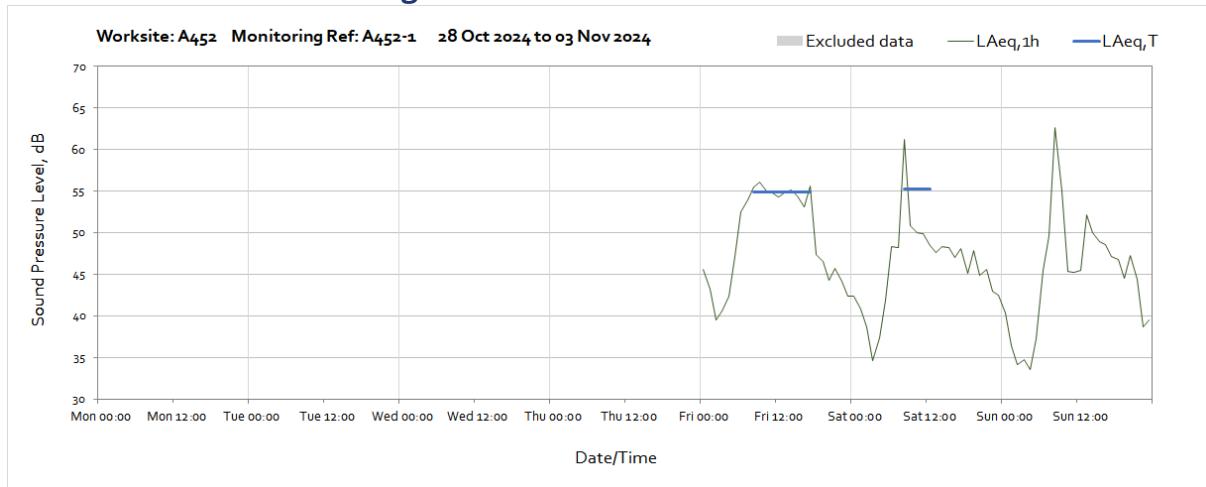



OFFICIAL

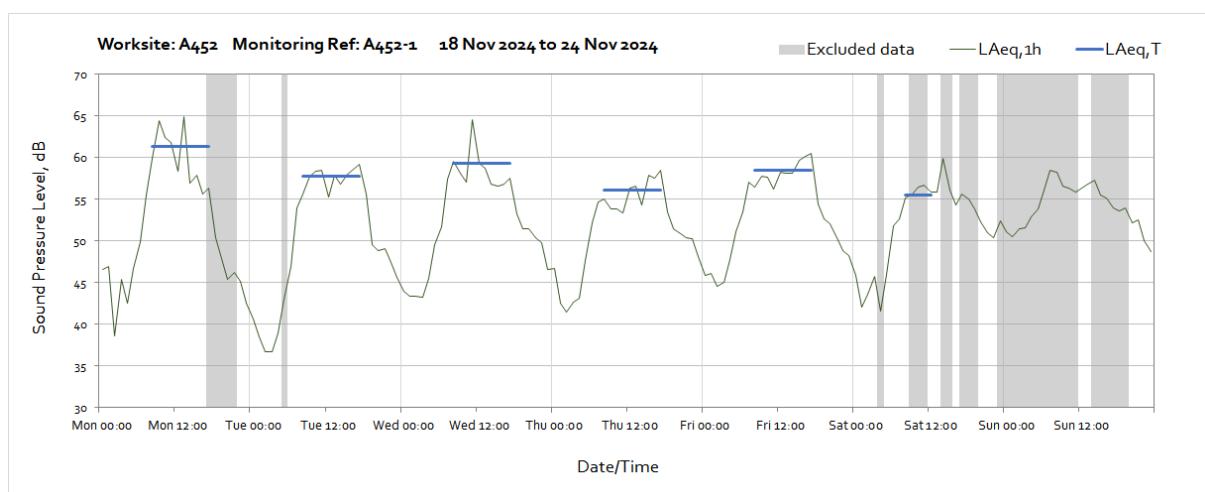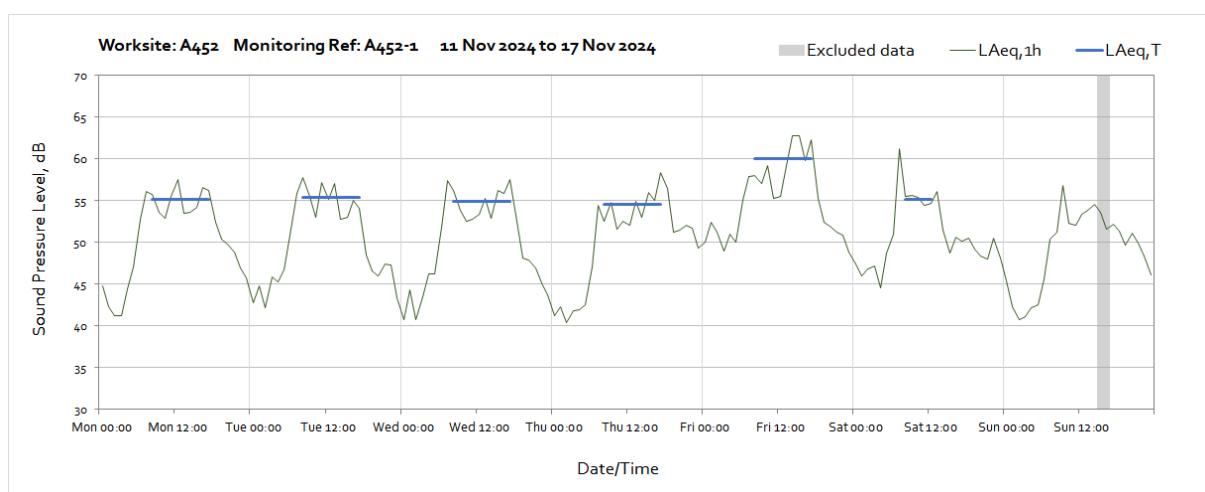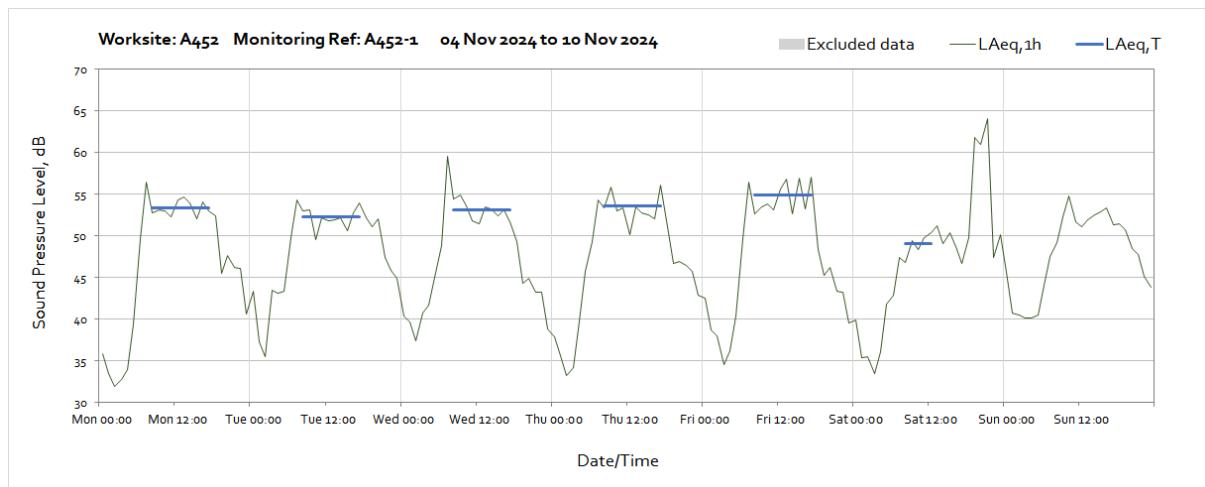




OFFICIAL

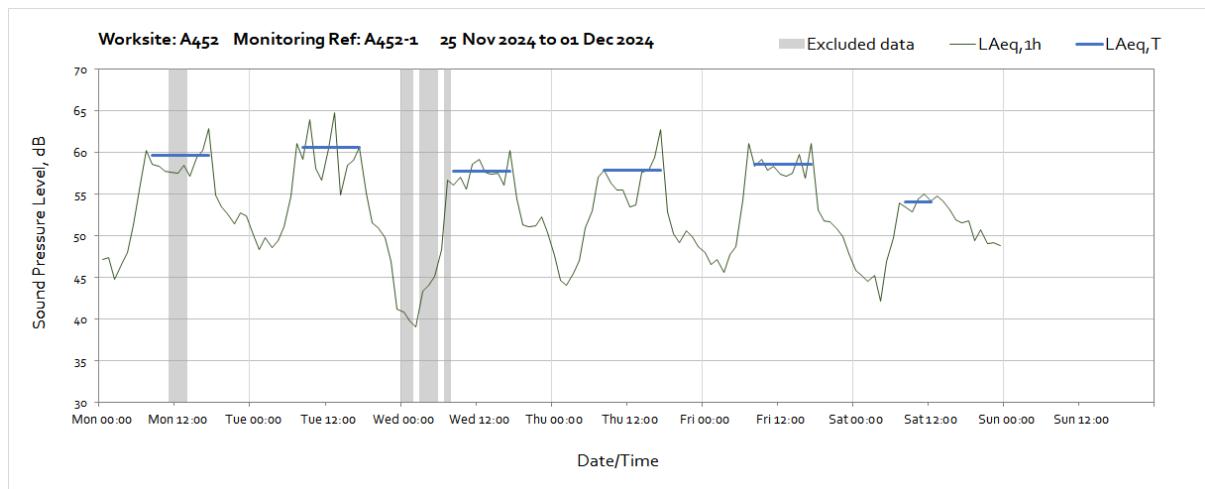

### Worksite: PL – Monitoring Ref: PL-1


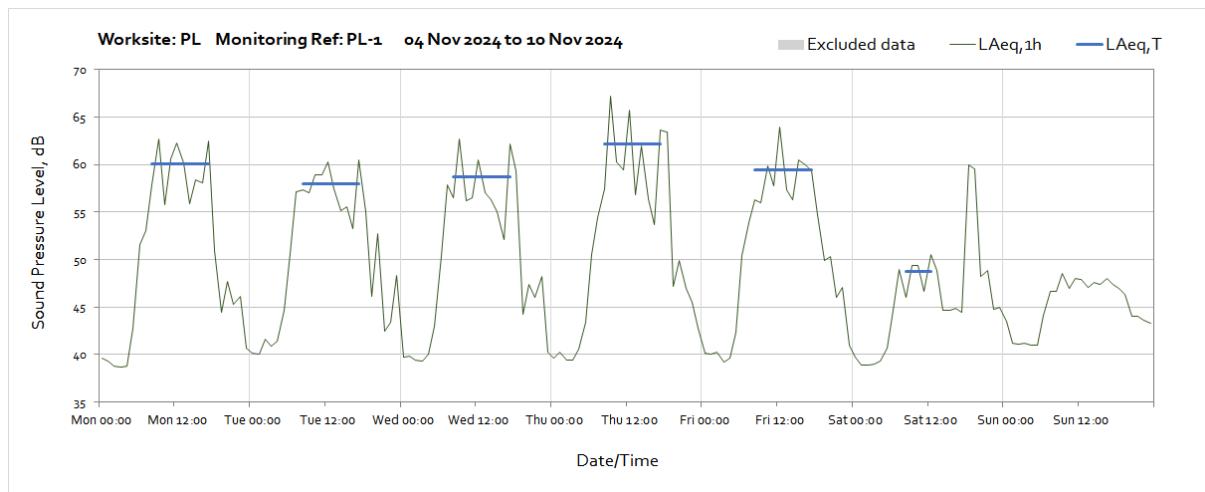
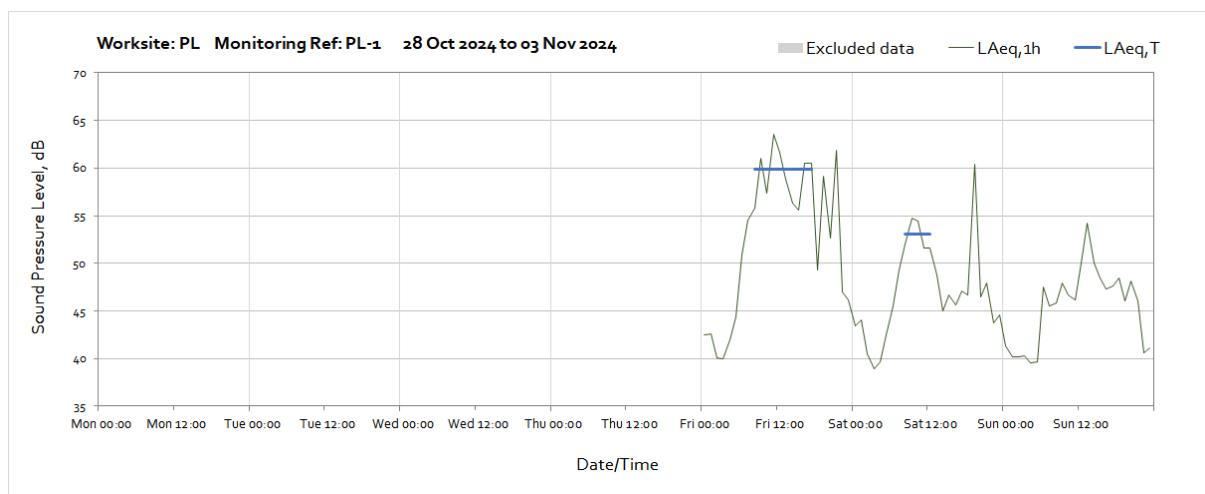


OFFICIAL

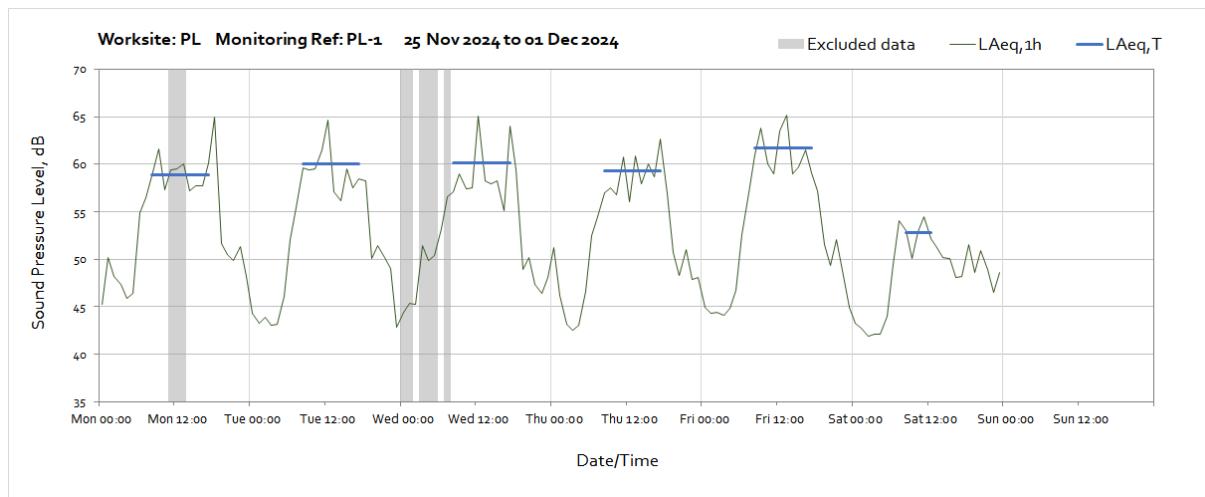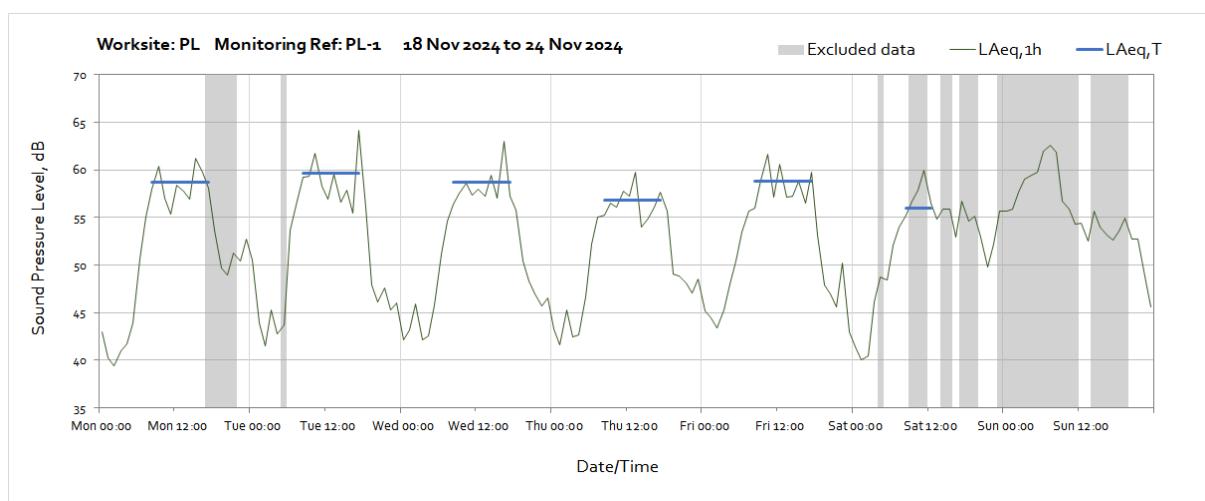
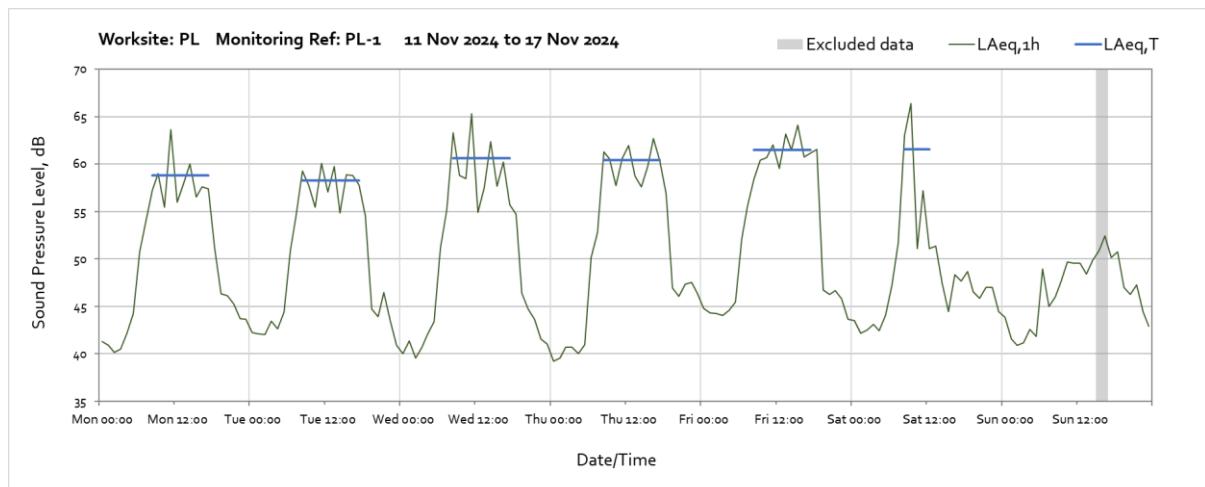


OFFICIAL


## Worksite: PL - Monitoring Ref: PL-2

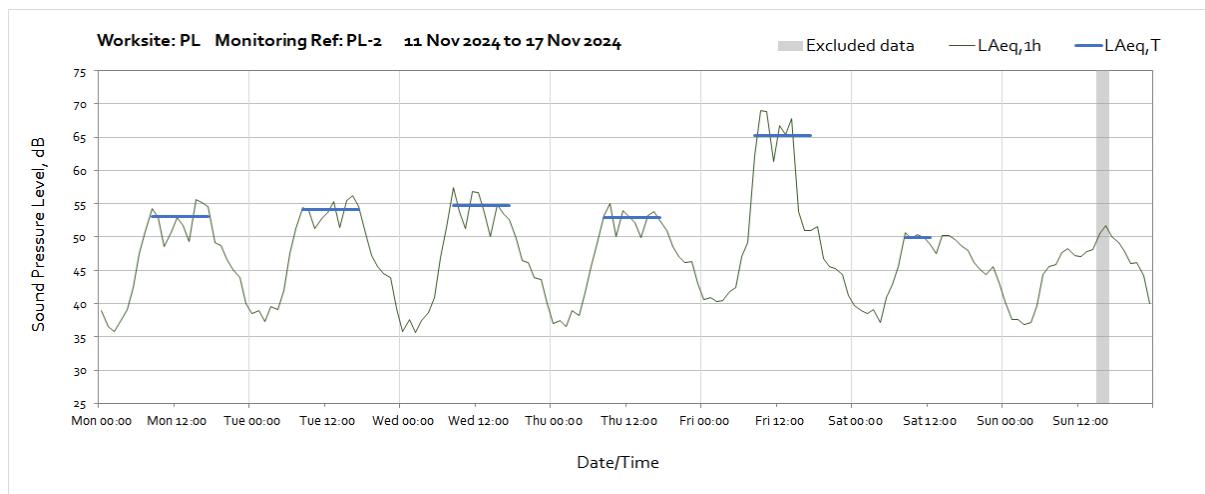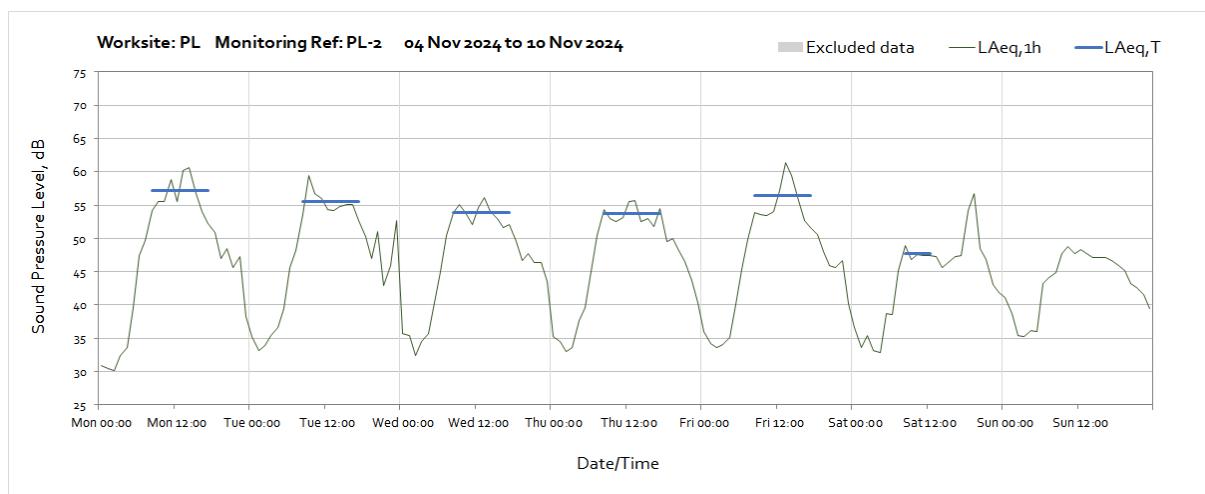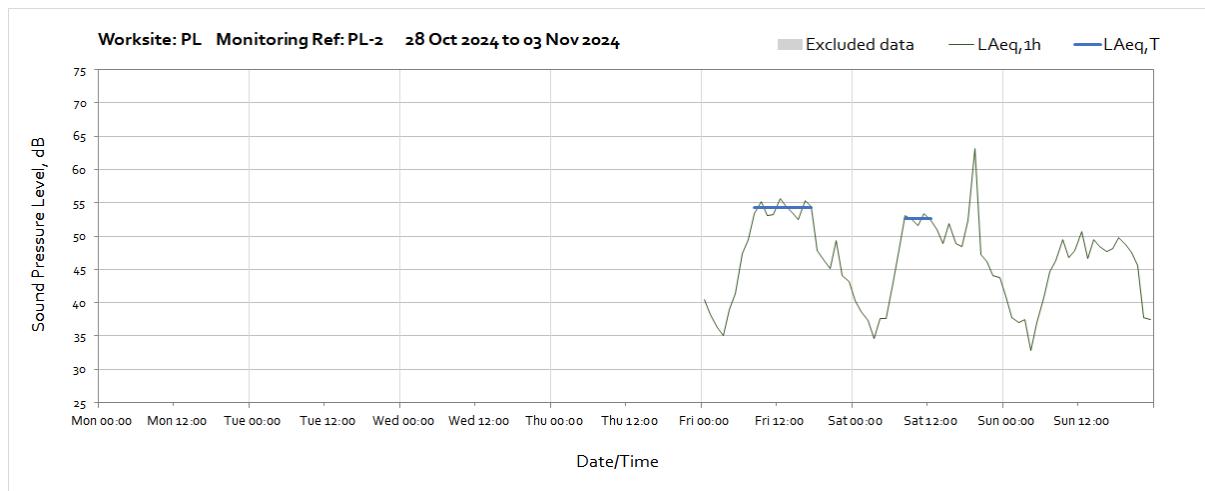


OFFICIAL

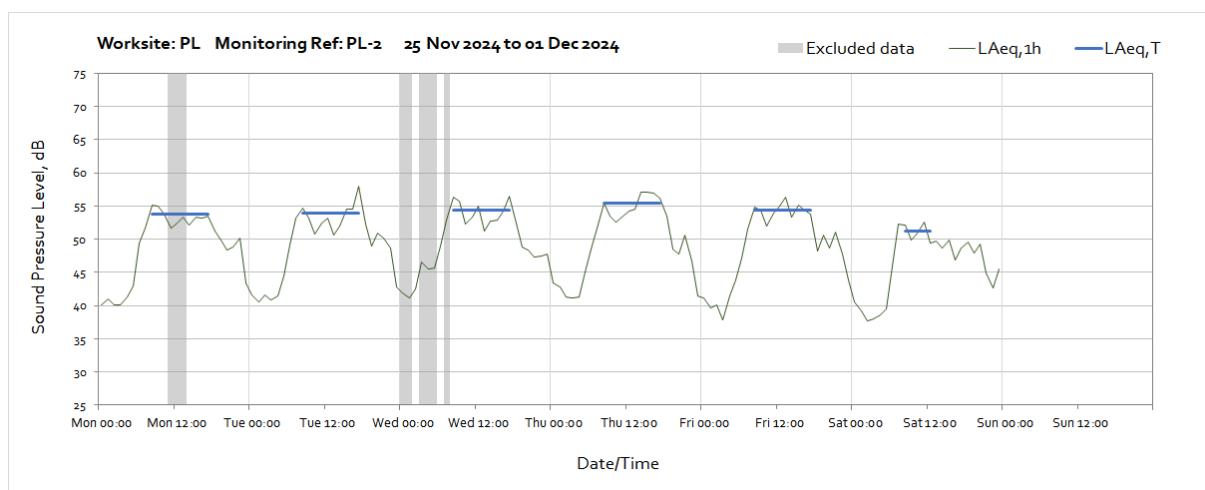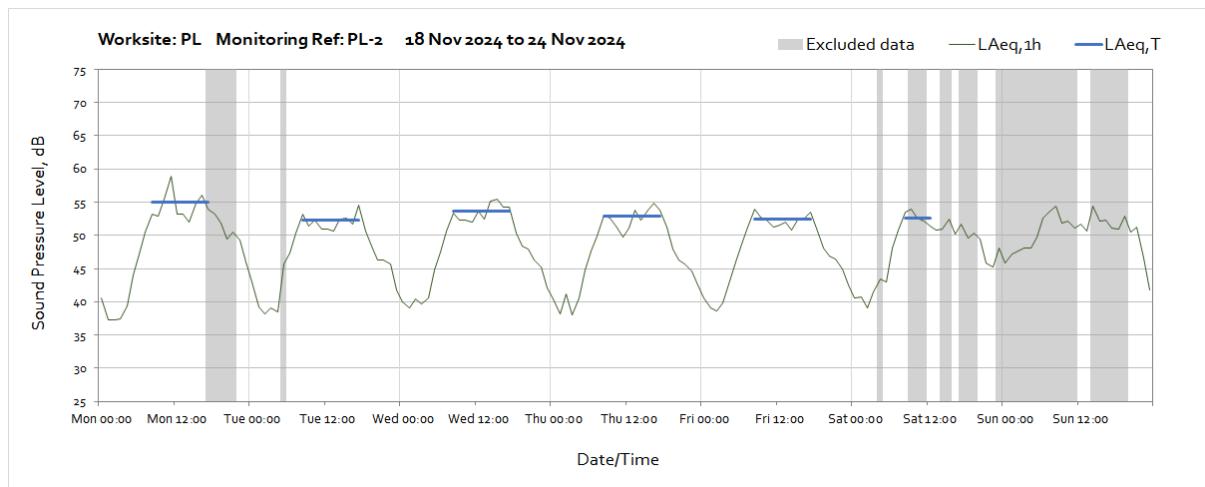


## Worksite: PL - Monitoring Ref: PL-3

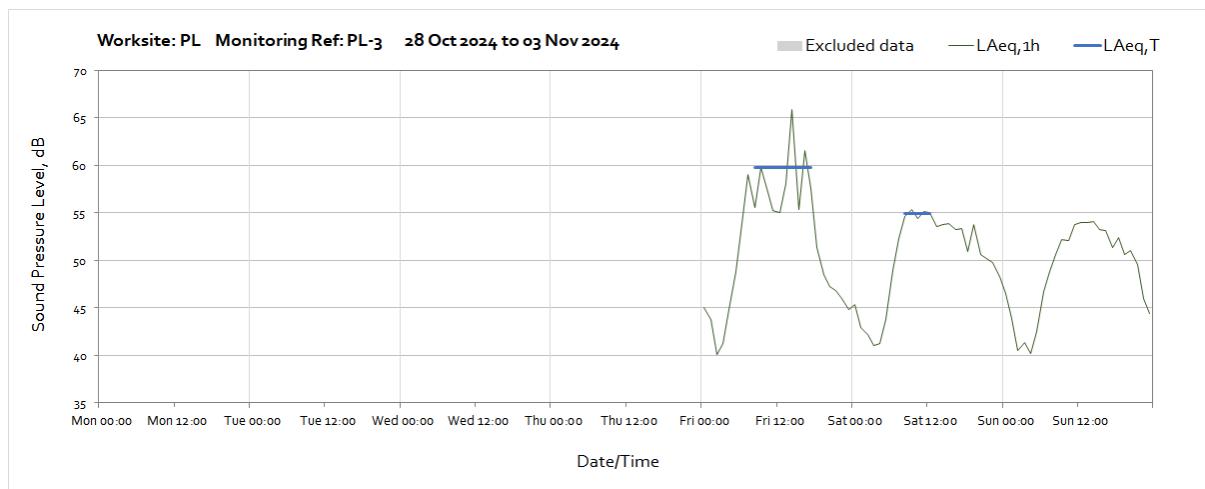

OFFICIAL


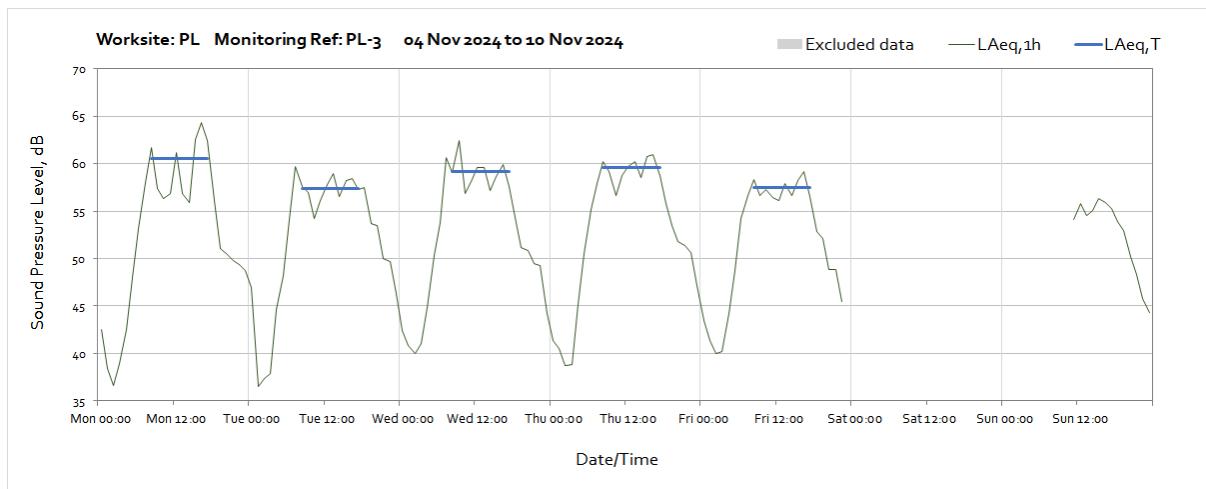


Note: Missing data between 23:00 on Friday 8<sup>th</sup> and 11:00 on Sunday 10<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

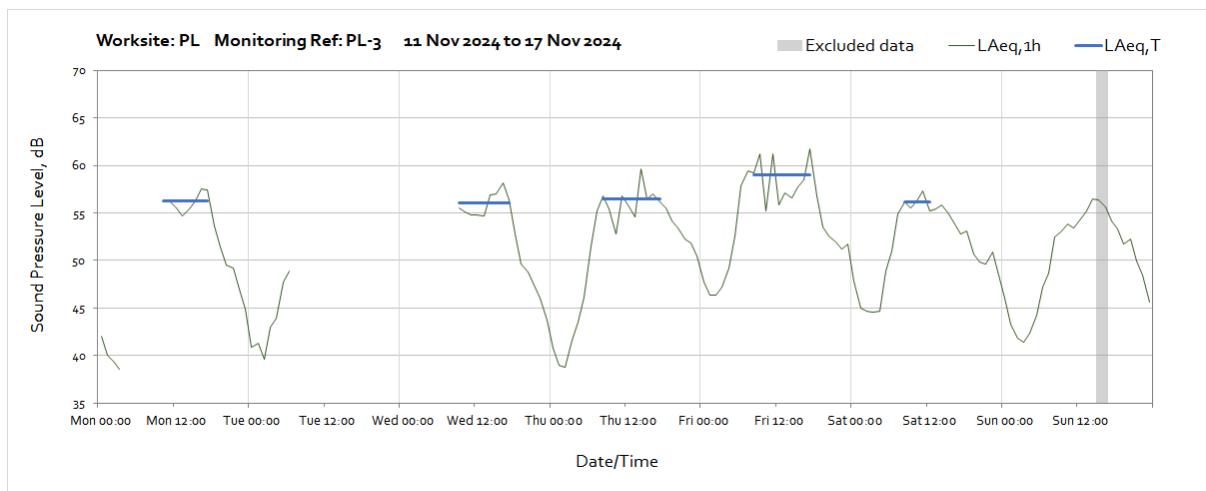


Note: Missing data between 04:00 and 10:00 on Monday 11<sup>th</sup> November and between 07:00 on Tuesday 12<sup>th</sup> and 09:00 on Wednesday 13<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**

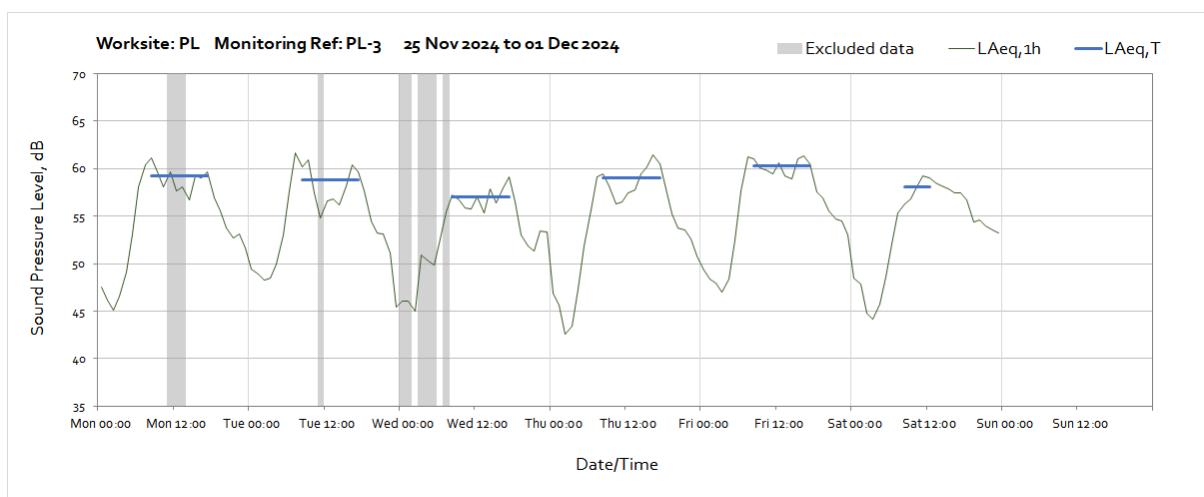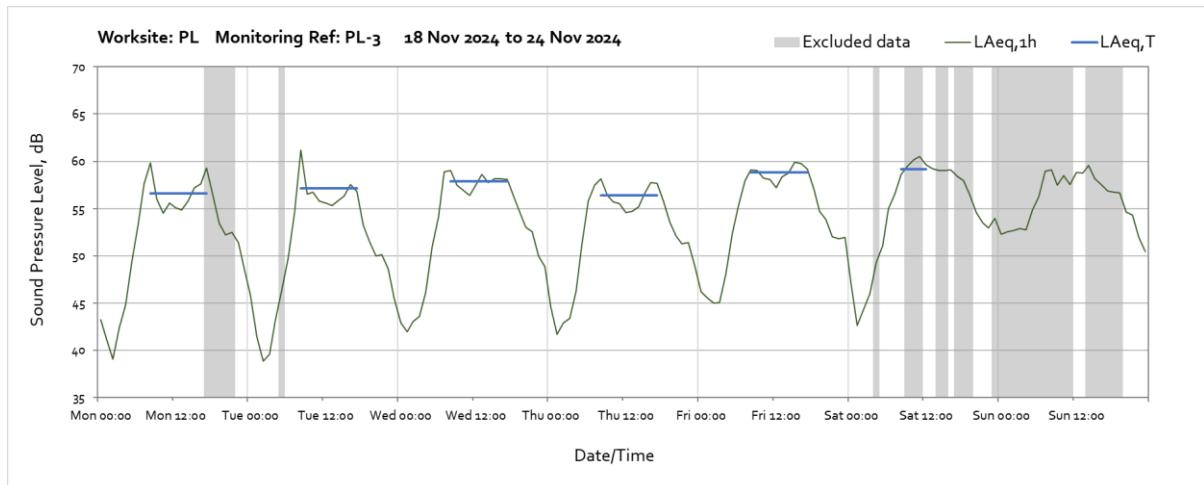


OFFICIAL

## Worksite: PL – Monitoring Ref: PL-5

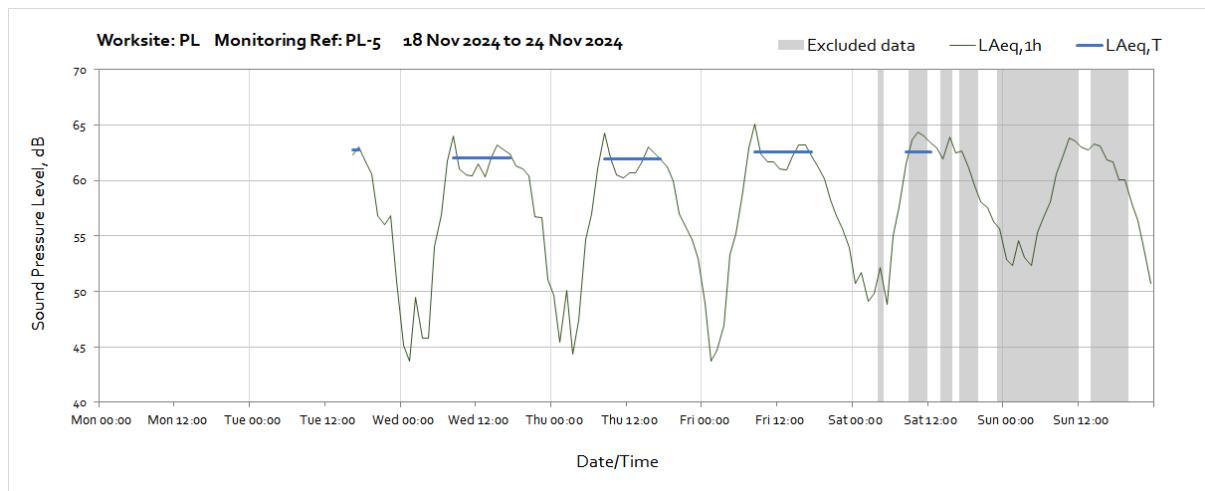


Note: Missing data from the beginning of the month until 16:00 on Tuesday 19<sup>th</sup> November was due to damage to the monitoring system.

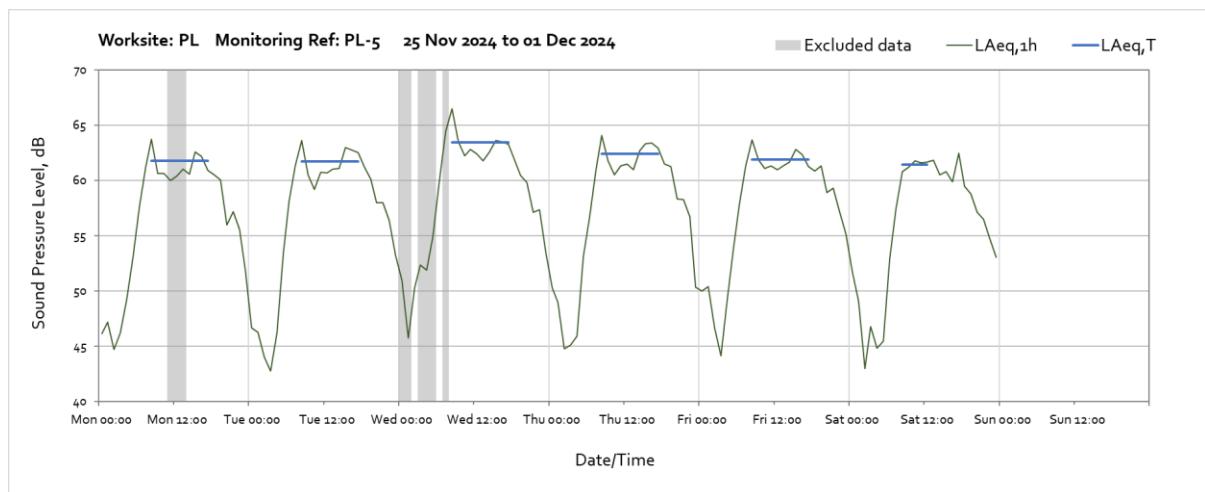


OFFICIAL

## Worksite: BCV – Monitoring Ref: BCV-1


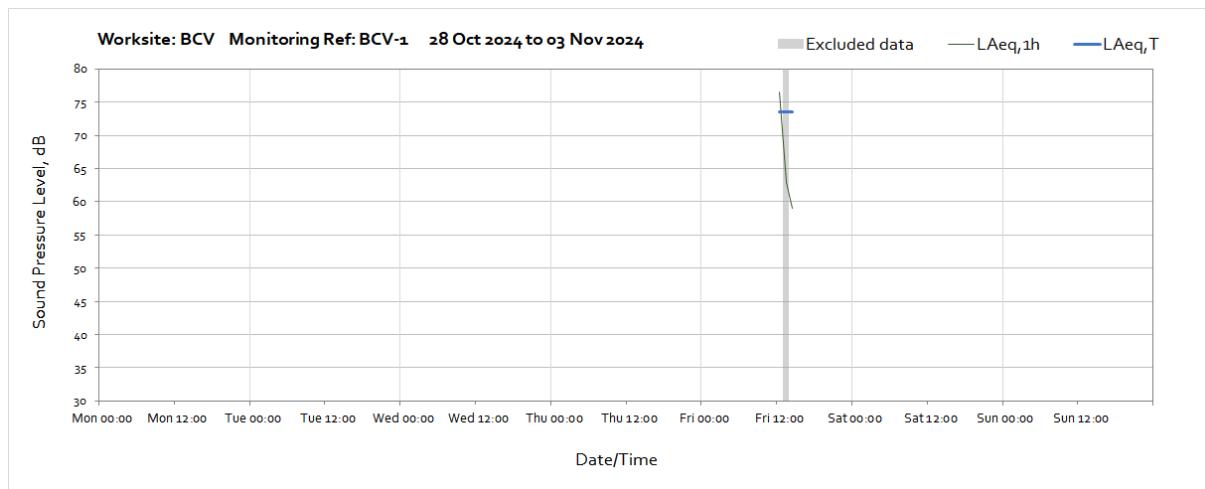


Note: Missing data throughout the week was due to poor solar conditions impacting power supply to the monitoring station.

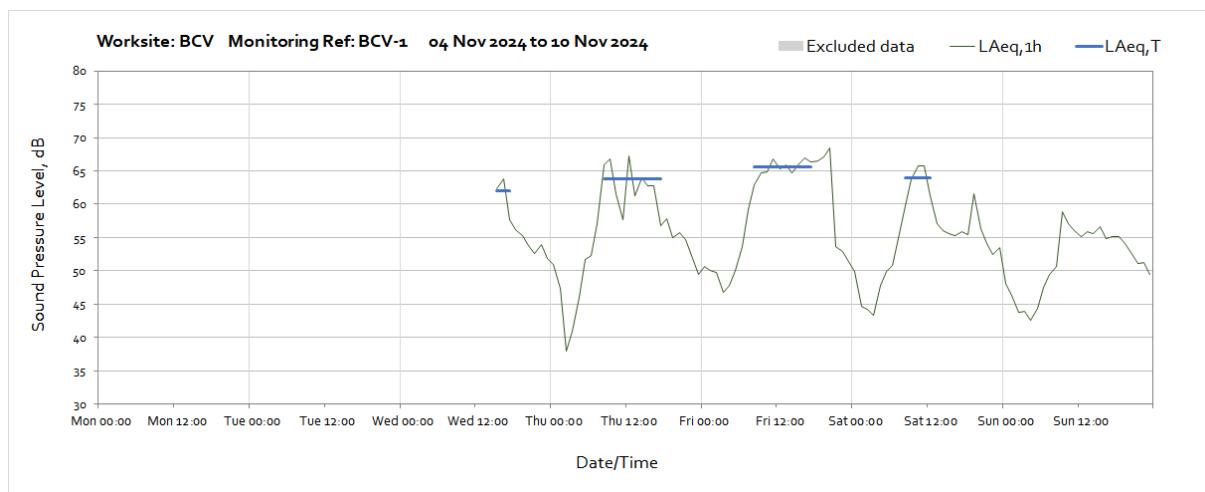

Note: Missing data between 15:00 on Friday 1<sup>st</sup> and 15:00 on Wednesday 6<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.



OFFICIAL

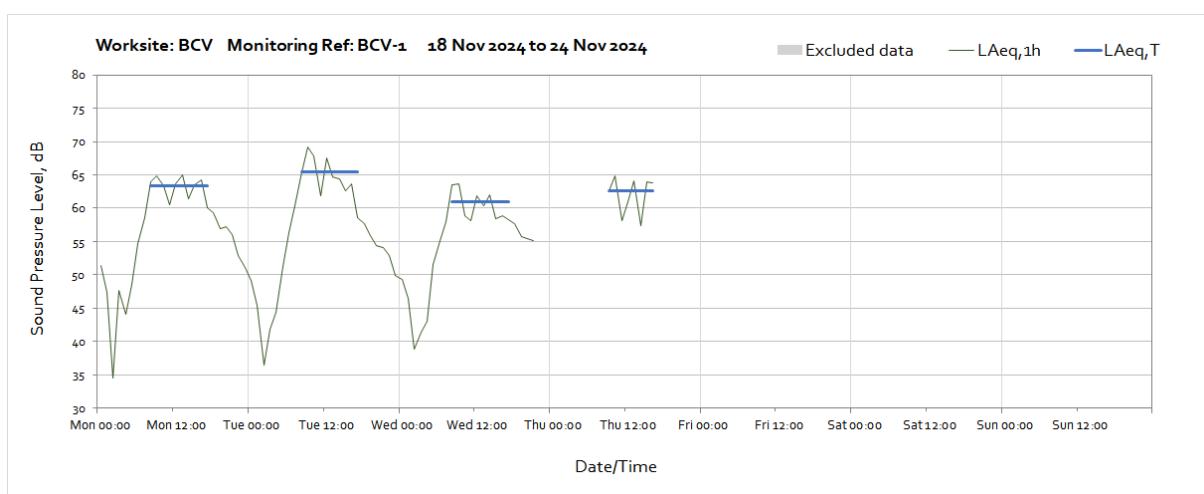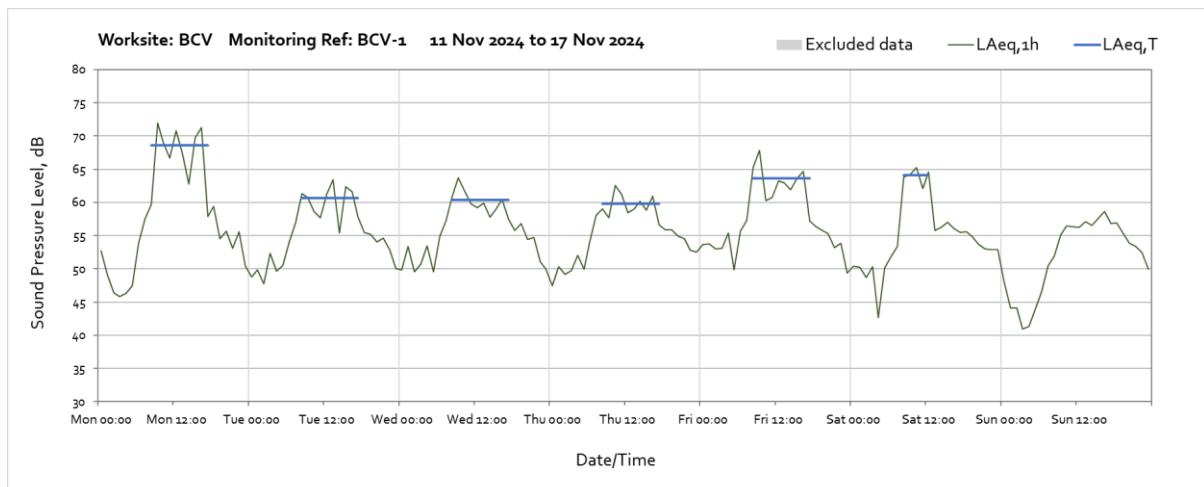


Note: Missing data between 22:00 on Wednesday 20<sup>th</sup> and 09:00 on Thursday 21<sup>st</sup> November and from 17:00 on Thursday 21<sup>st</sup> November until the end of the month was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**

## Worksite: CGRU- Monitoring Ref: CGRU-1

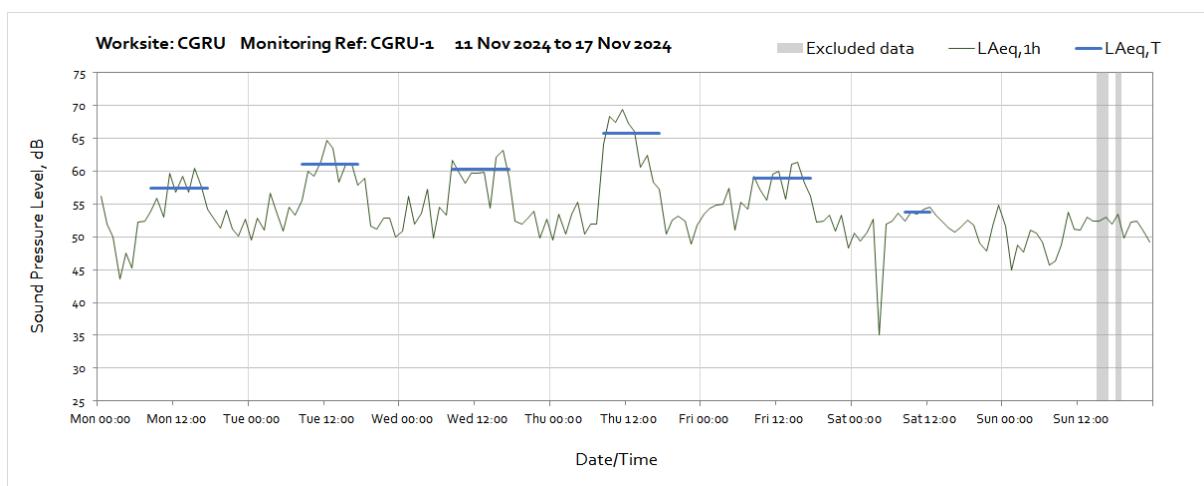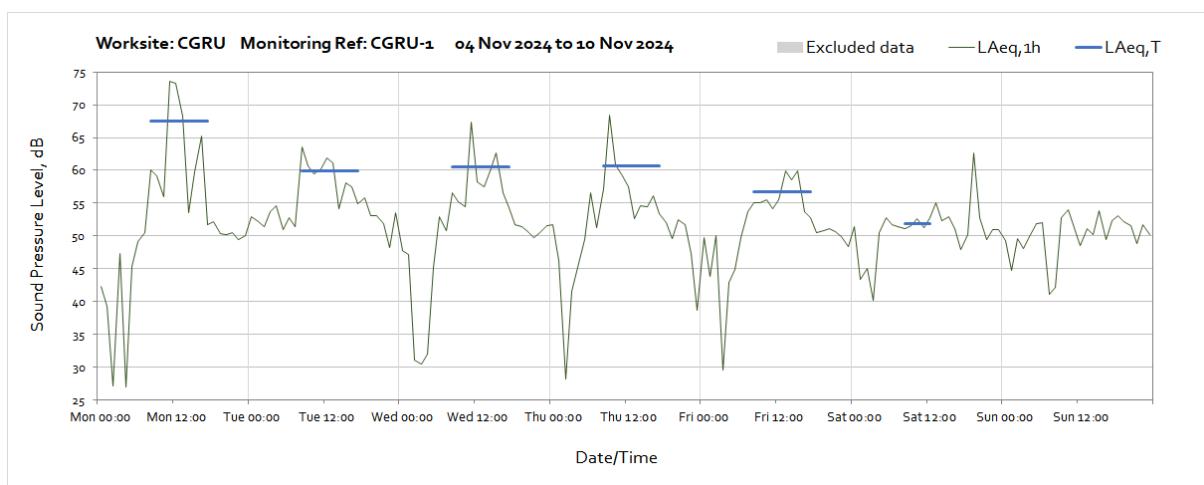

OFFICIAL

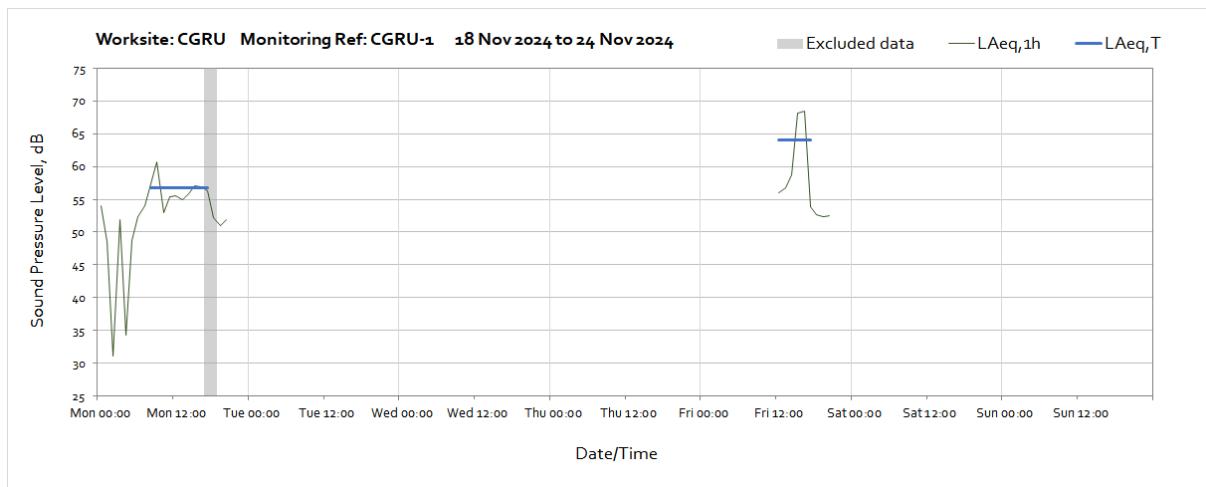




Note: Missing data between 21:00 on Monday 18<sup>th</sup> and 12:00 on Friday 22<sup>nd</sup> November and between 21:00 on Friday 22<sup>nd</sup> and 12:00 on Wednesday 27<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.





Note: Missing data between 21:00 on Friday 22<sup>nd</sup> and 12:00 on Wednesday 27<sup>th</sup> November and from 23:00 on Wednesday 27<sup>th</sup> November until the end of the month was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**

## Worksite: CGRU- Monitoring Ref: CGRU-3

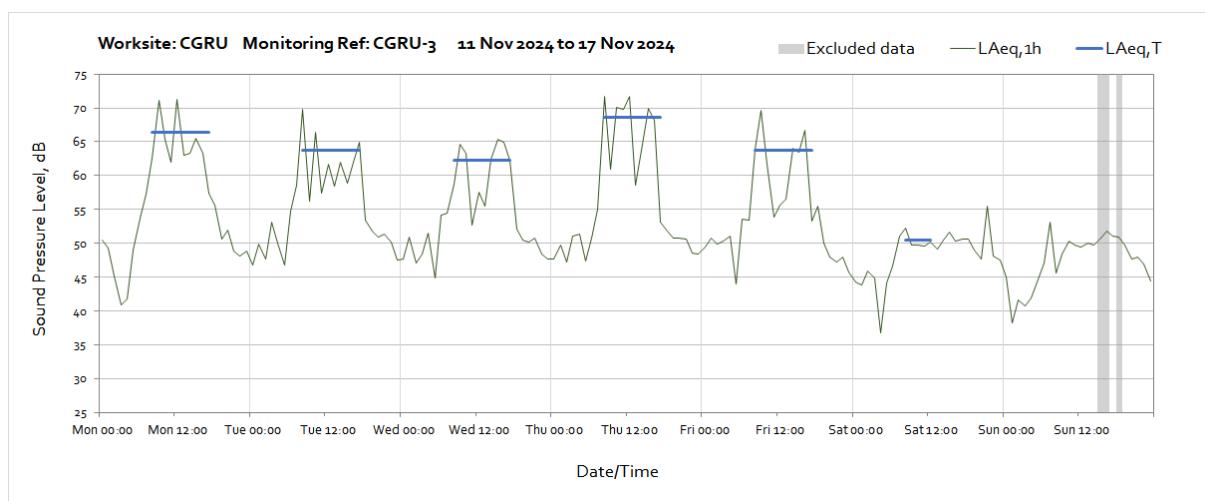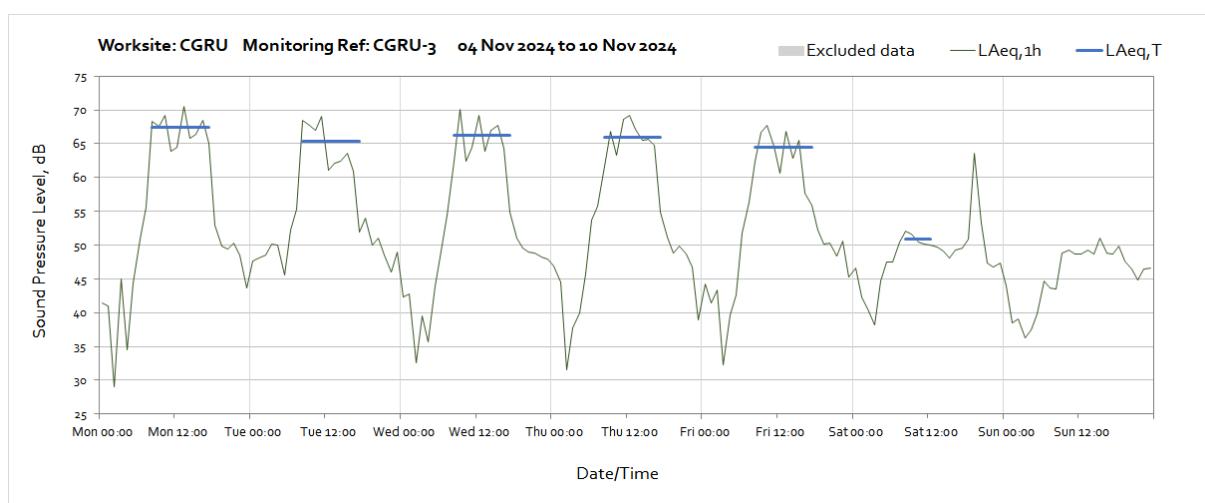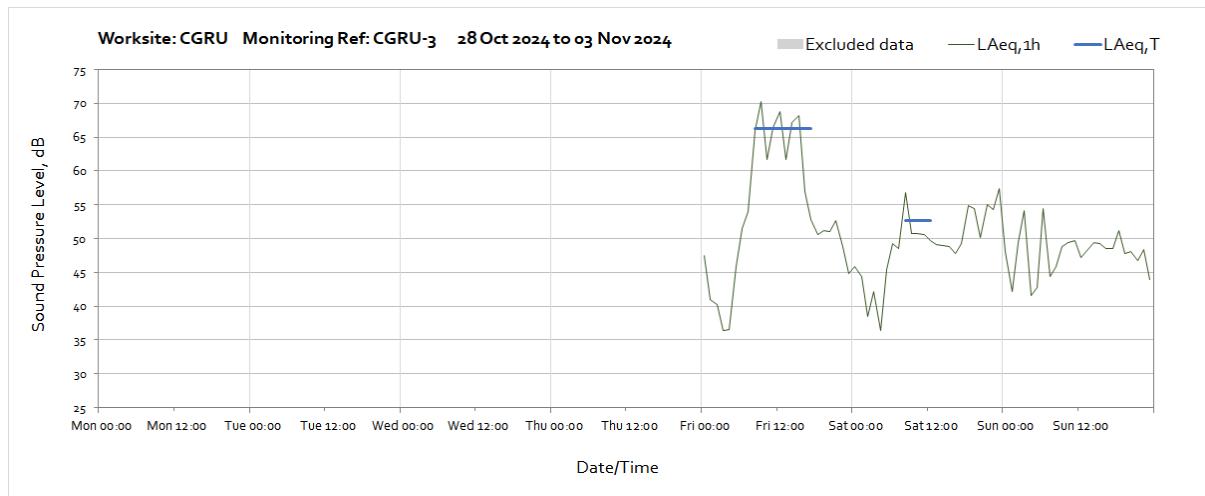


OFFICIAL

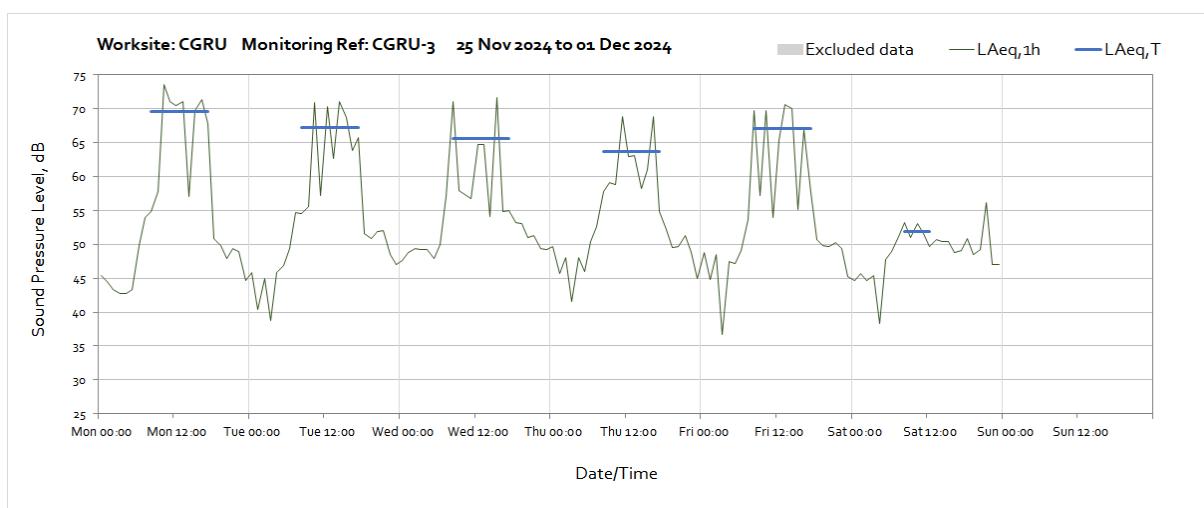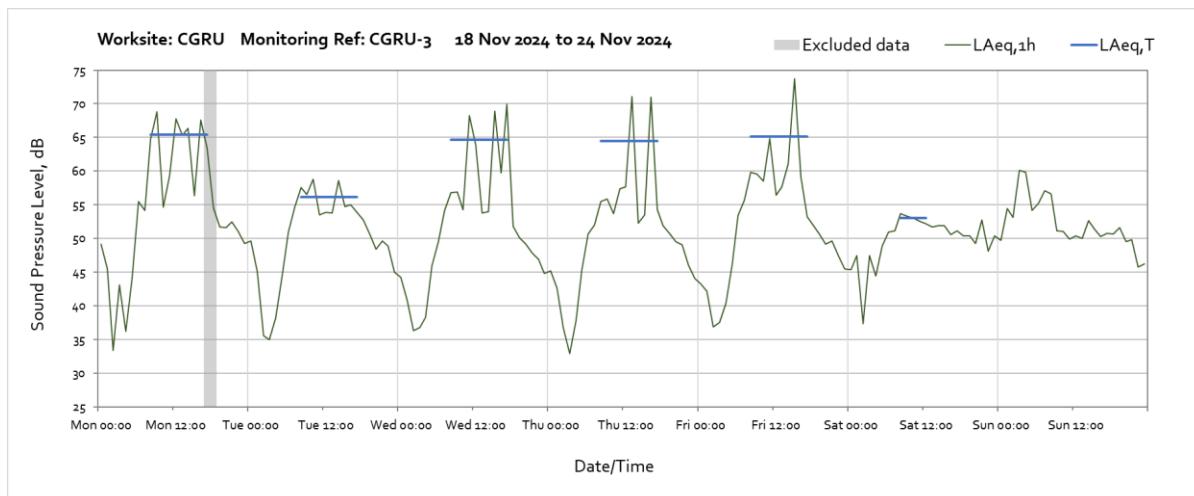


## Worksite: WLOS – Monitoring Ref: WLOS-1



OFFICIAL

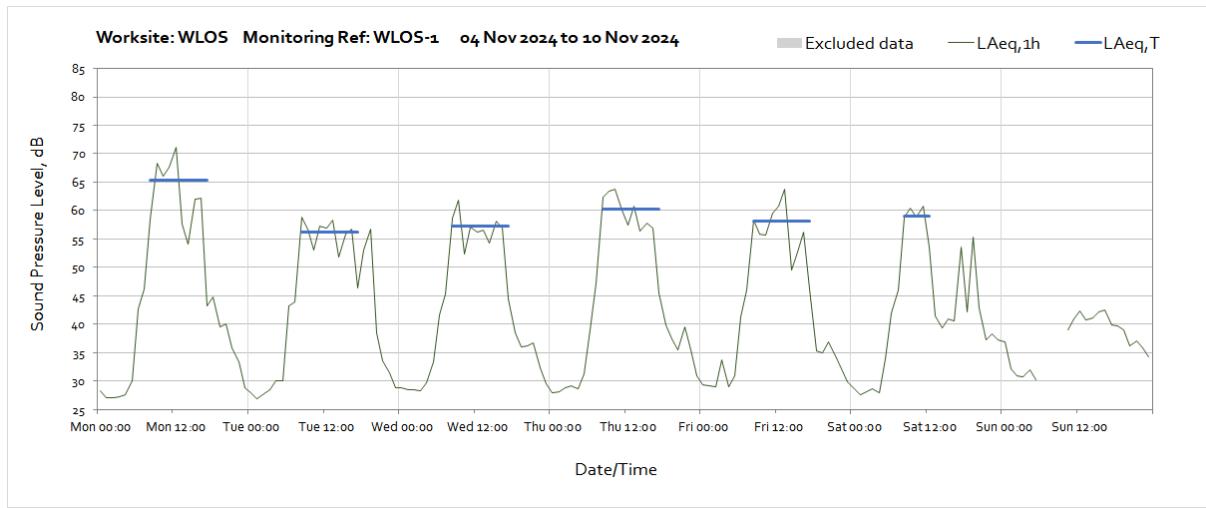


Note: Missing data between 06:00 and 10:00 on Sunday 10<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

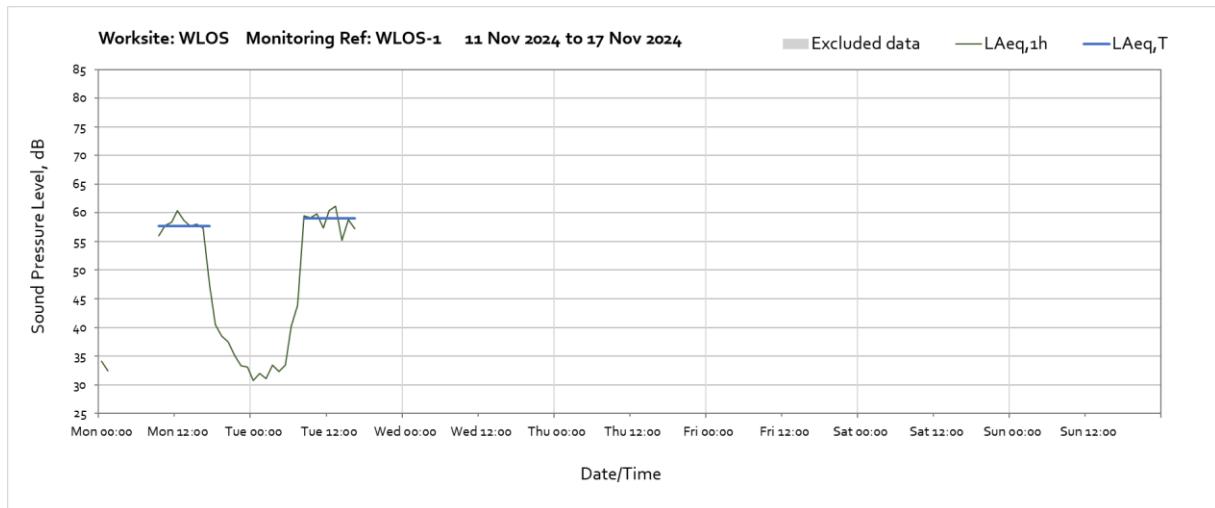

Note: Missing data between 02:00 and 09:00 on Monday 11<sup>th</sup> November and between 17:00 on Tuesday 12<sup>th</sup> and 12:00 on Monday 25<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**


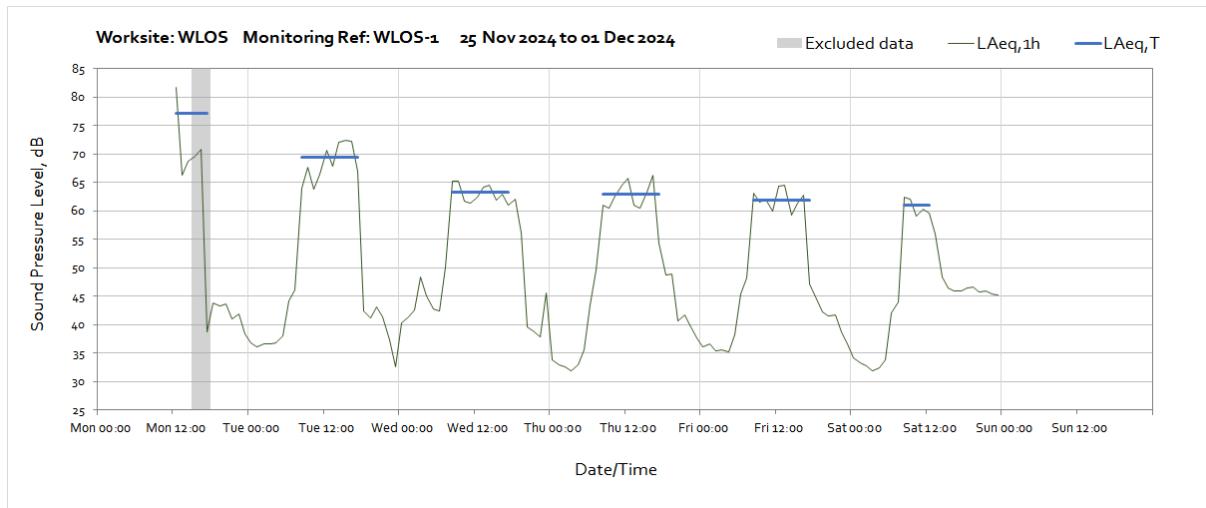


Note: Missing data between 17:00 on Tuesday 12<sup>th</sup> and 12:00 on Monday 25<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.


### **Worksite: WLOS – Monitoring Ref: WLOS-2**




**OFFICIAL**

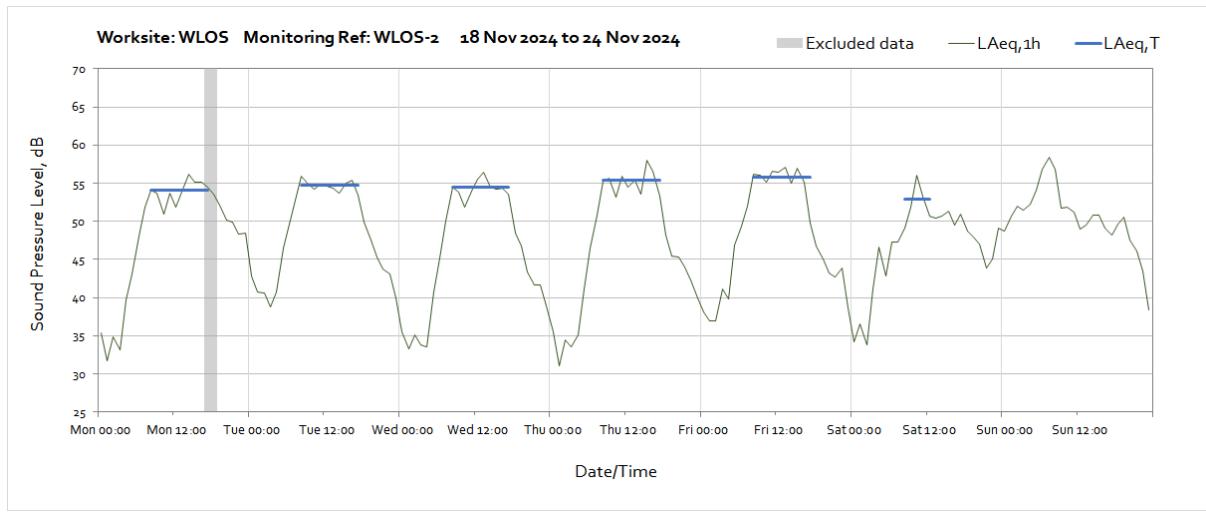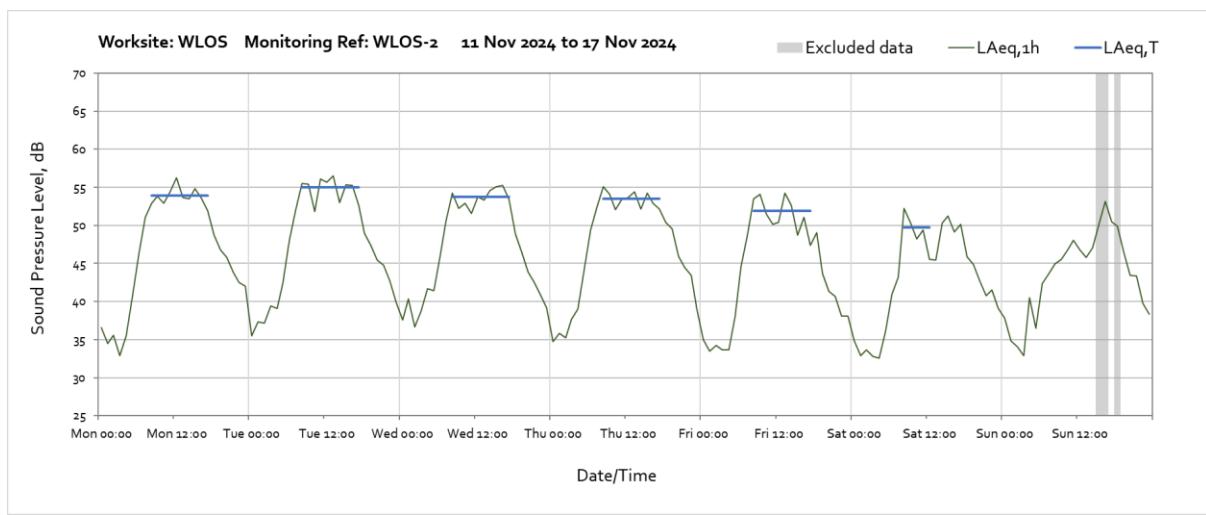


OFFICIAL

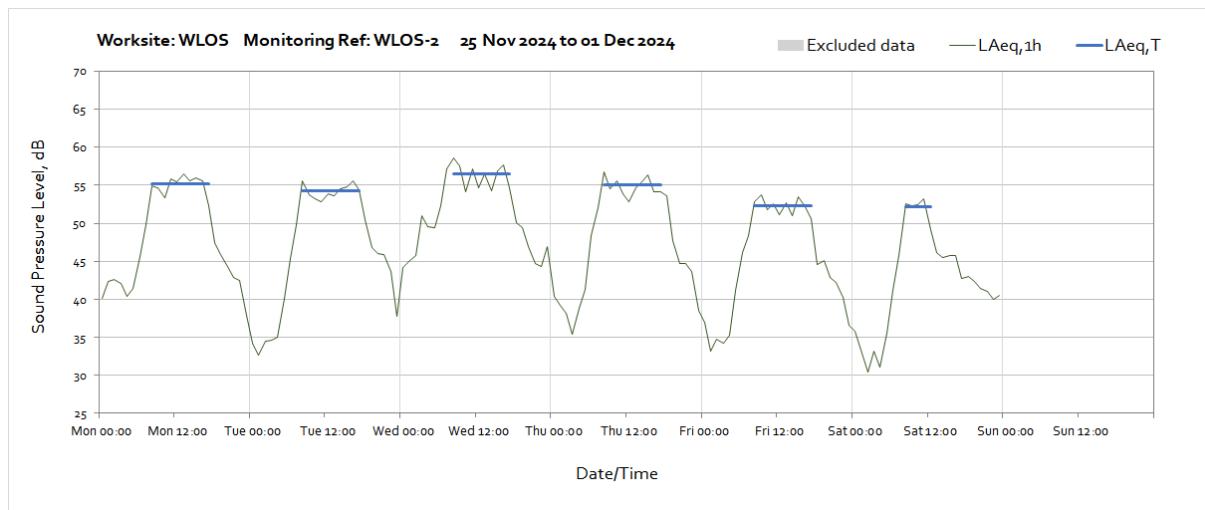

### Worksite: WLOS – Monitoring Ref: WLOS-3

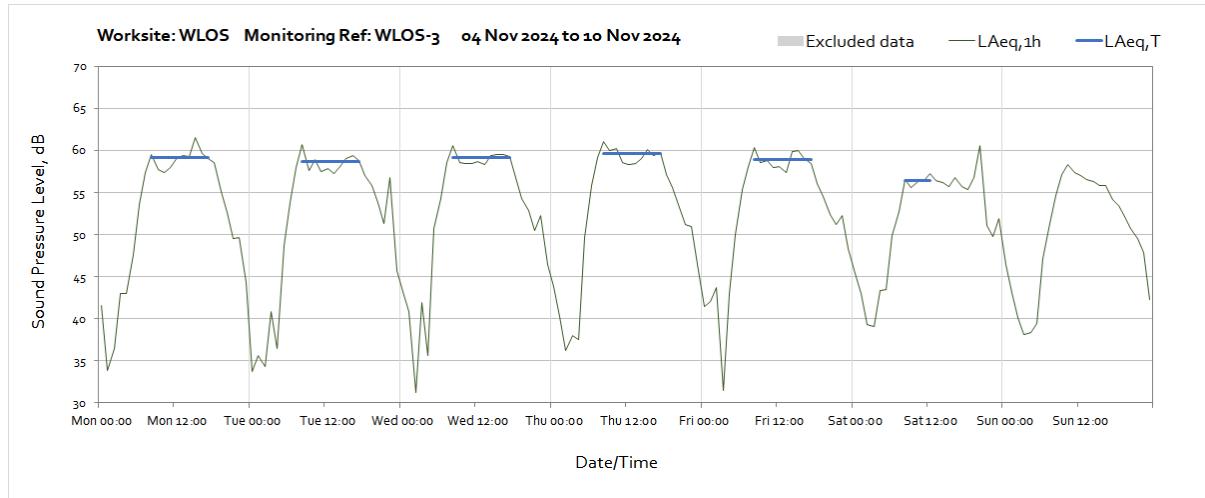


OFFICIAL

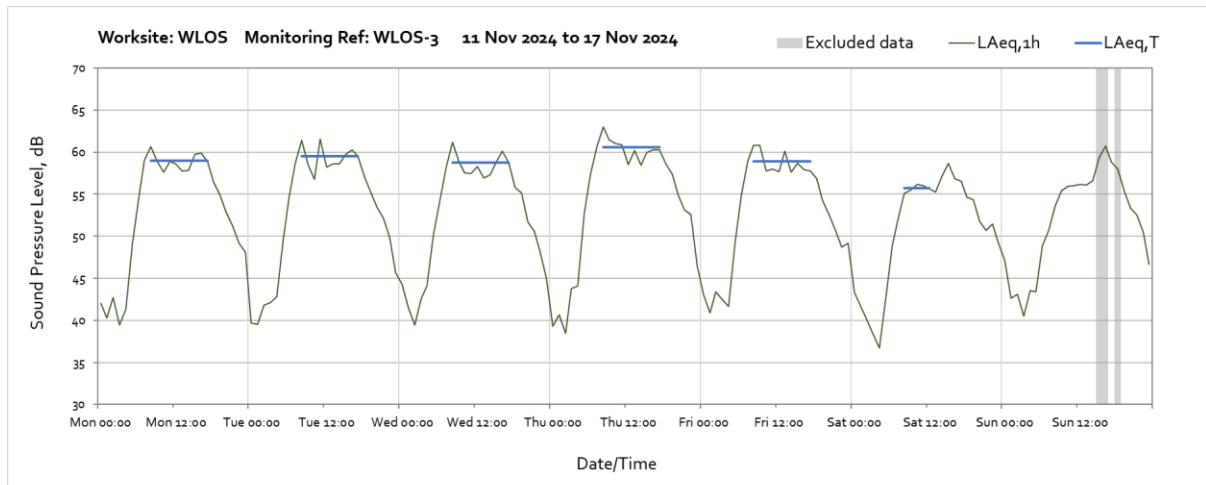

Note: Missing data between 02:00 and 08:00 on Sunday 24<sup>th</sup> November and between 15:00 on Sunday 24<sup>th</sup> and 08:00 on Monday 25<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

OFFICIAL

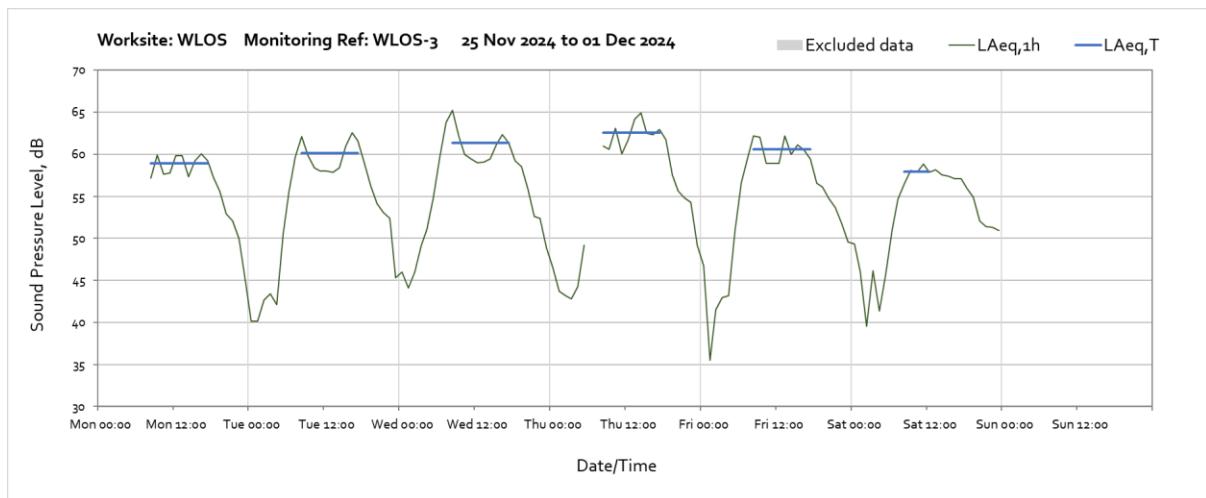



Note: Missing data between 15:00 on Sunday 24<sup>th</sup> and 08:00 on Monday 25<sup>th</sup> November and between 06:00 and 08:00 on Thursday 28<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**




## Vibration

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Periods where PPV values have been affected by local interference with the vibration monitor or only measured for part of the period, which are not representative of HS2 construction works, have been greyed out and excluded when calculating values in of the main report.

### Worksite: CHR – Monitoring Ref: CHRU-V1


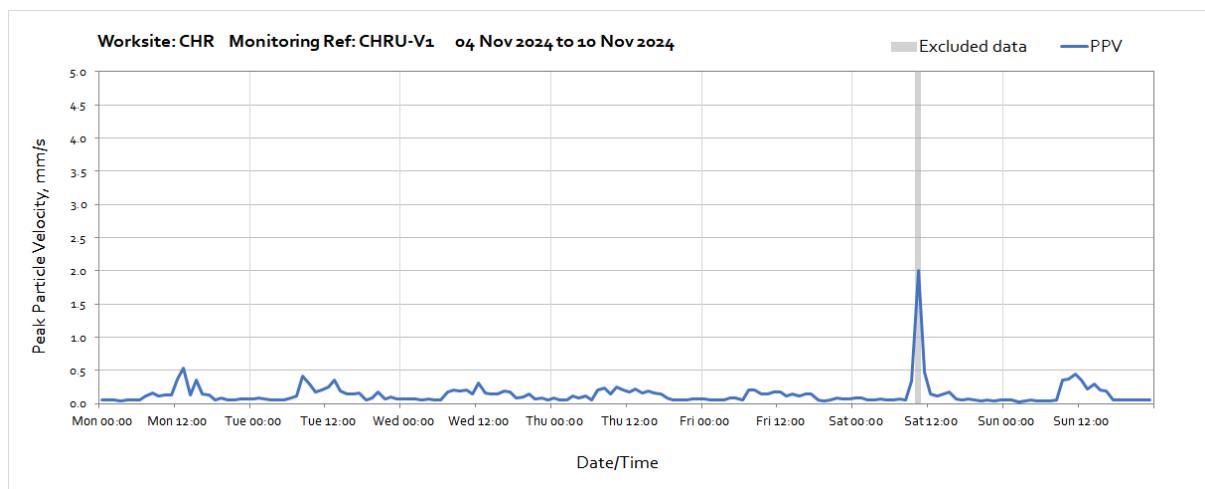
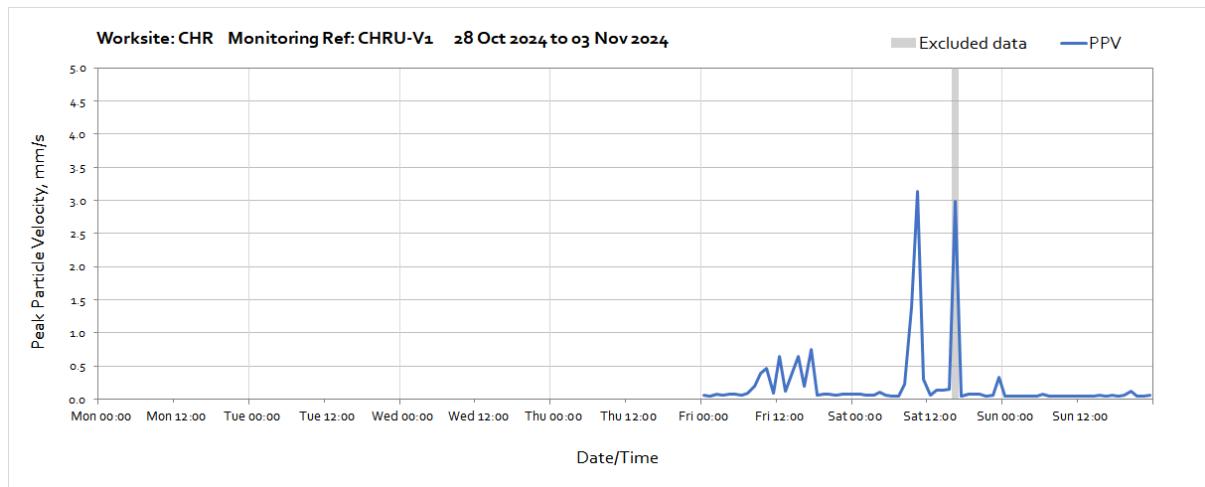


OFFICIAL

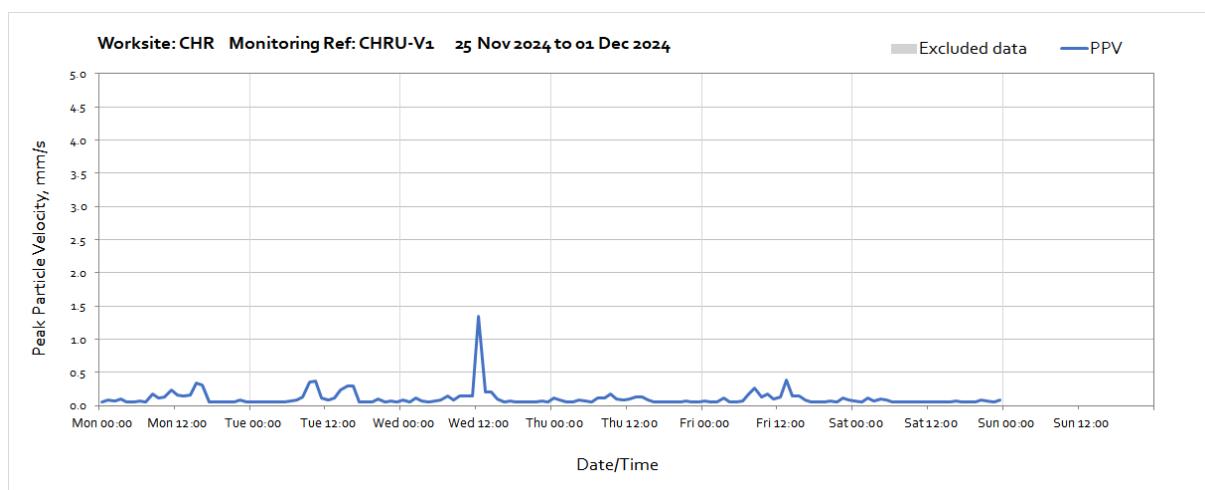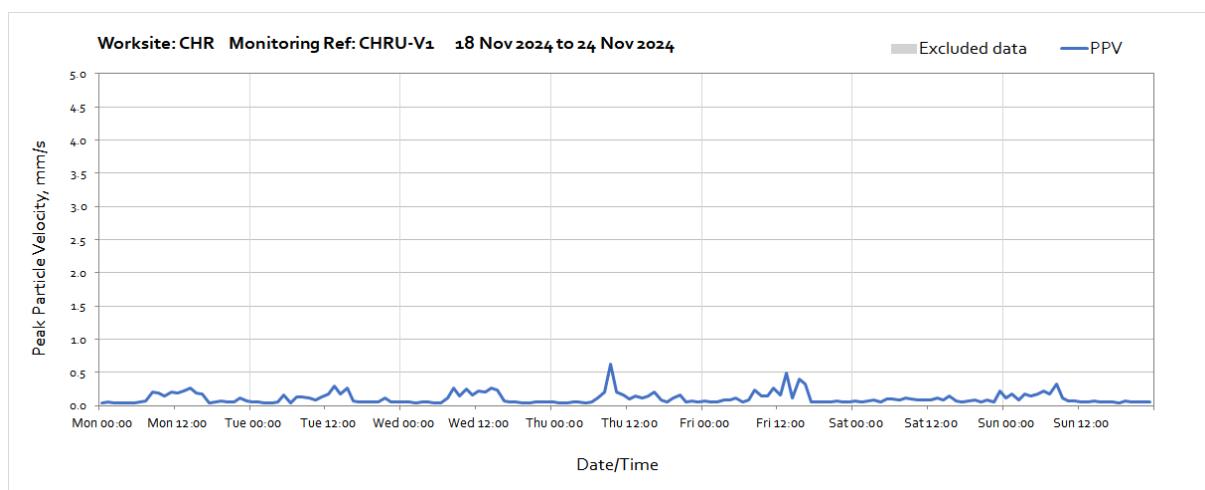
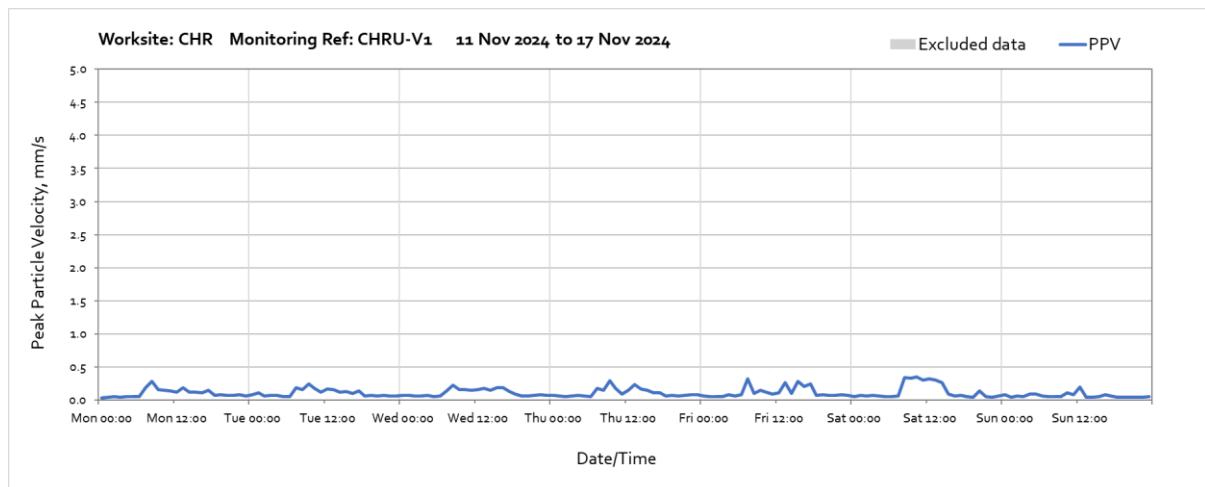


OFFICIAL


## Worksite: DLE – Monitoring Ref: DLE-V1

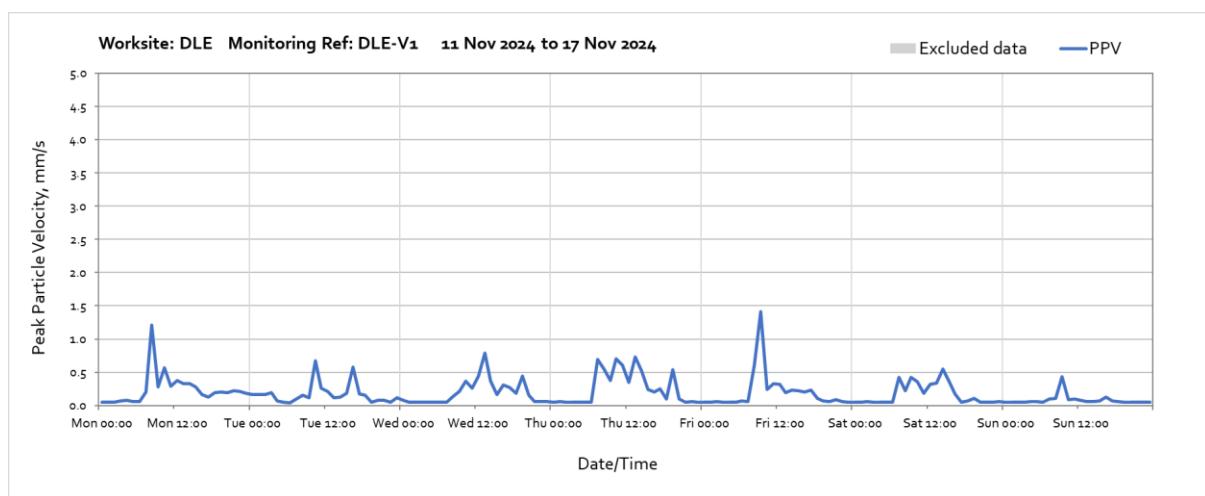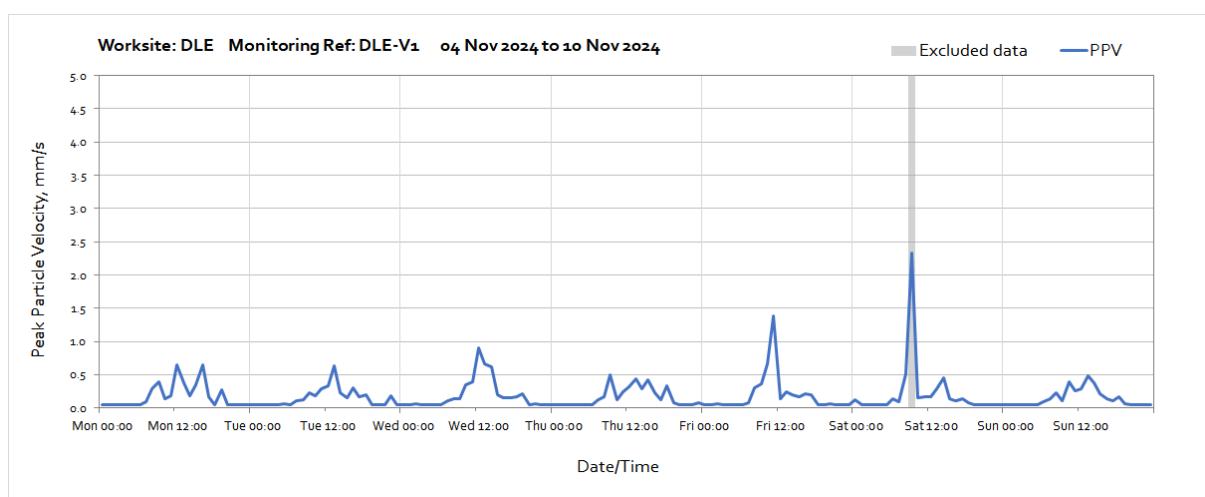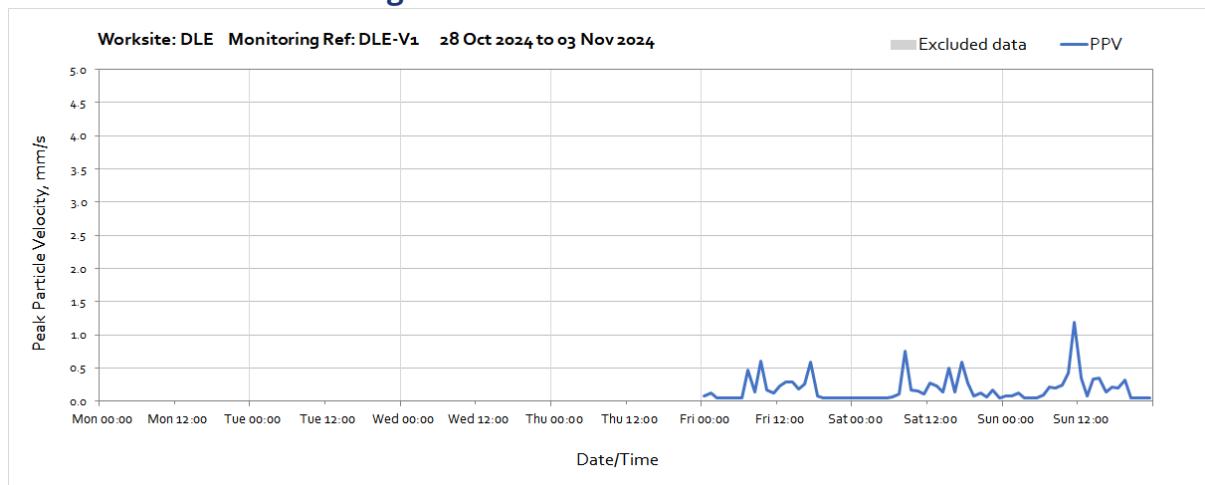




OFFICIAL

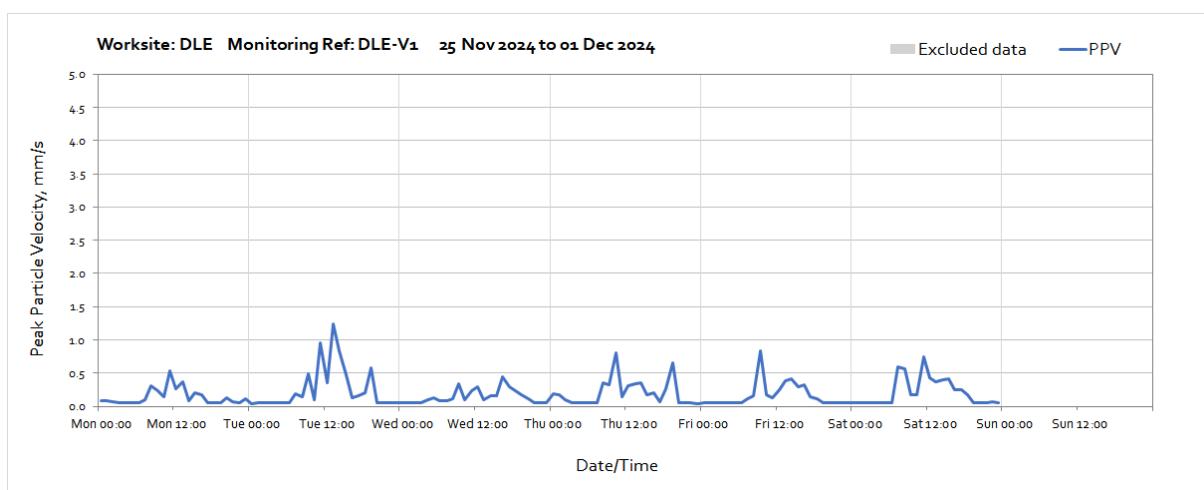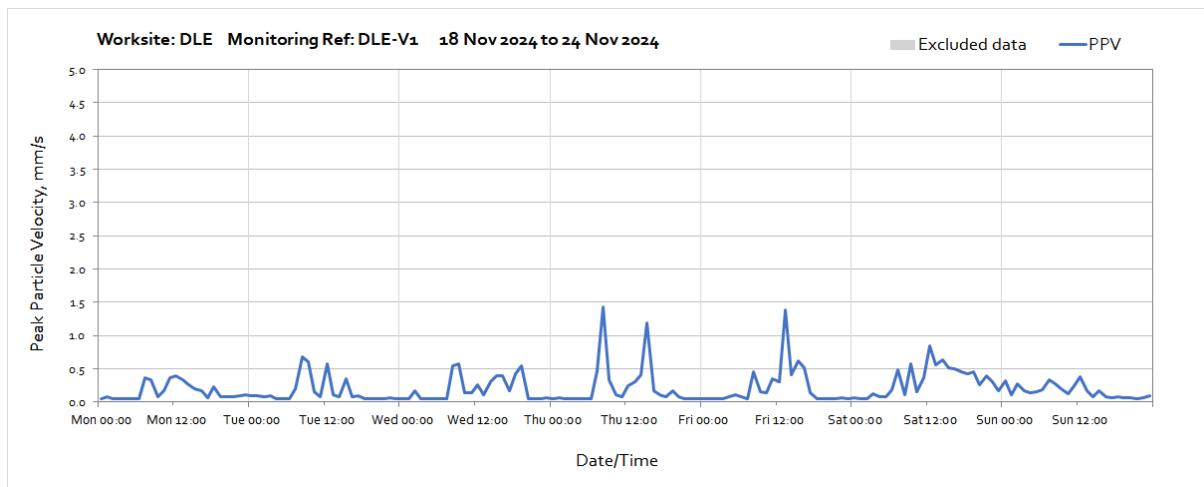


## Worksite: BBE - Monitoring Ref: BBE-V1

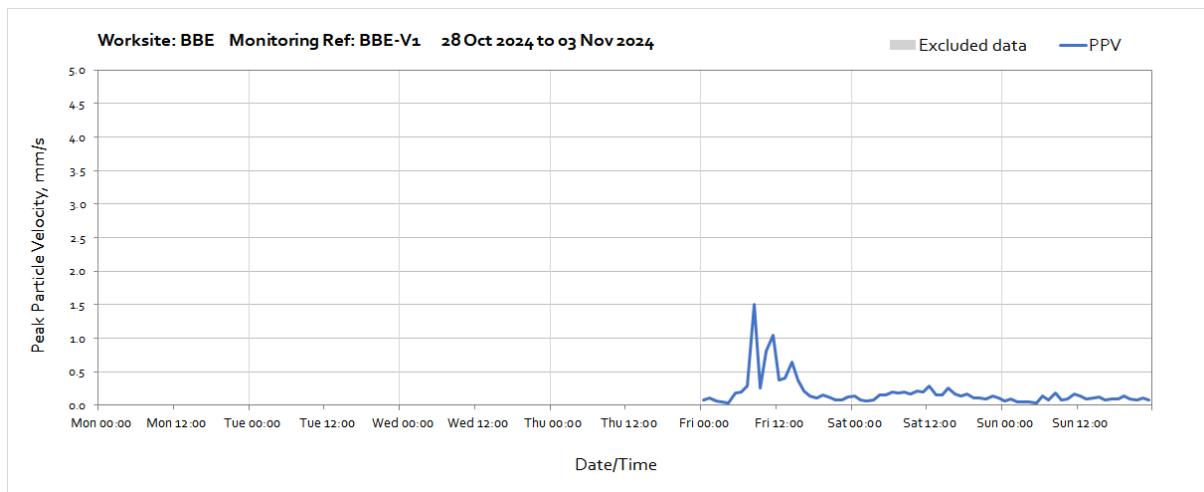



OFFICIAL

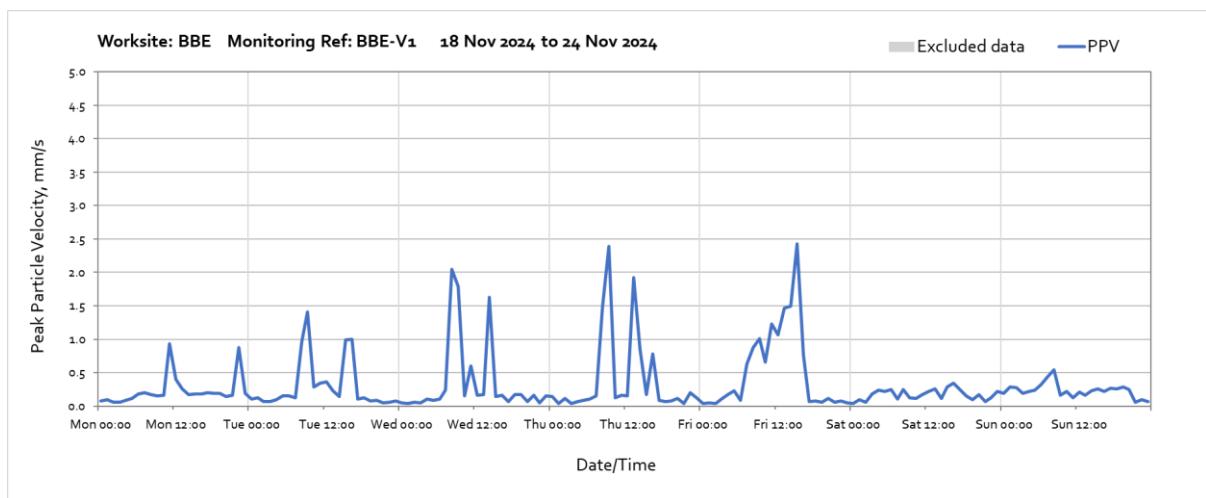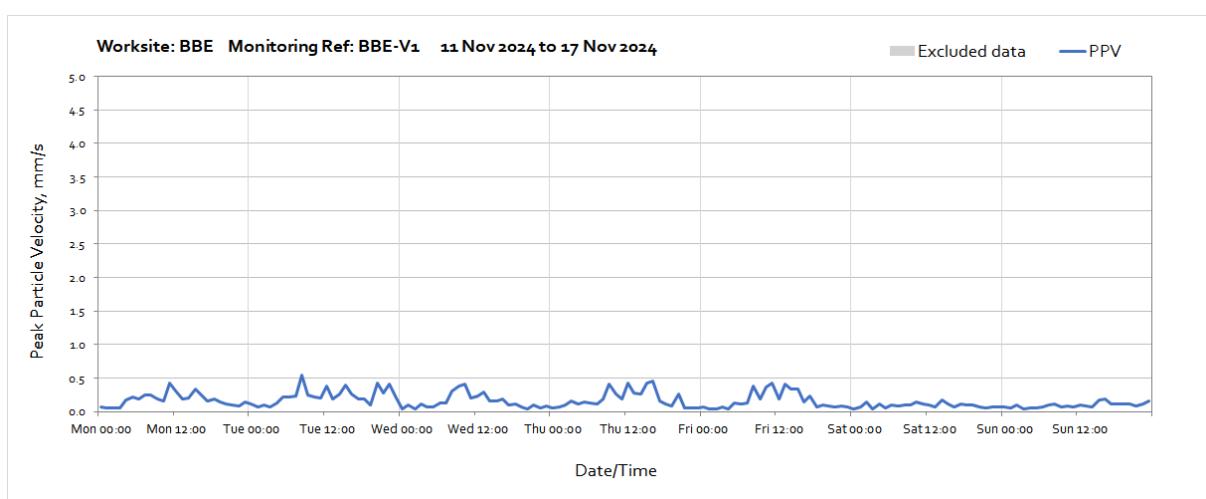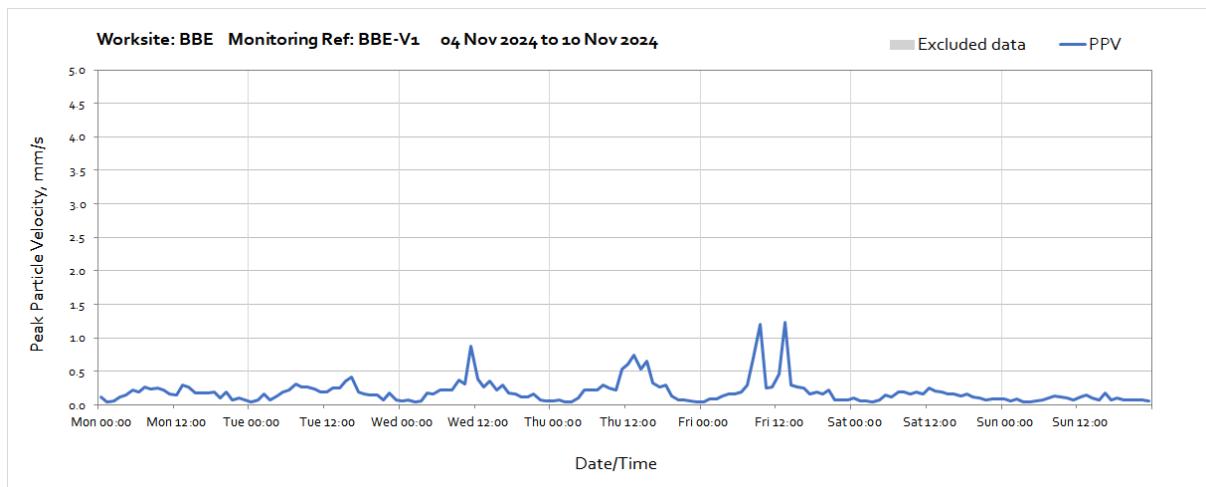




OFFICIAL

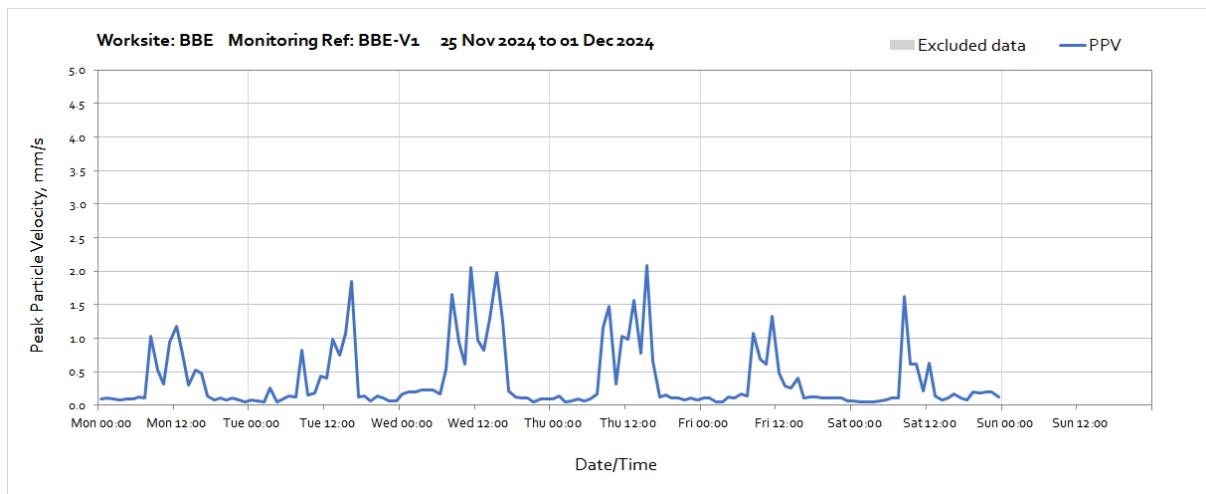

### Worksite: A452 – Monitoring Ref: A452-V1


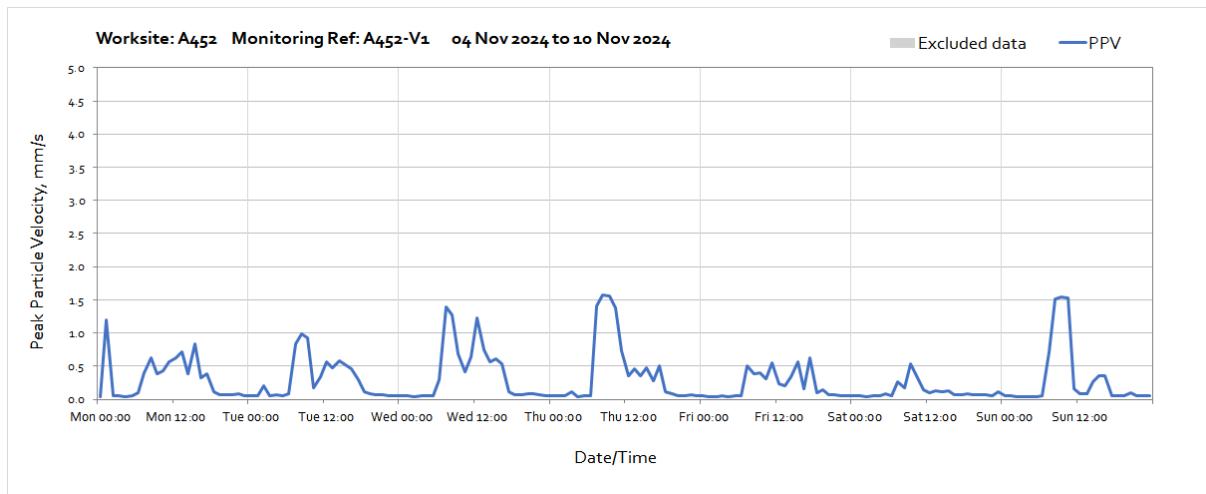
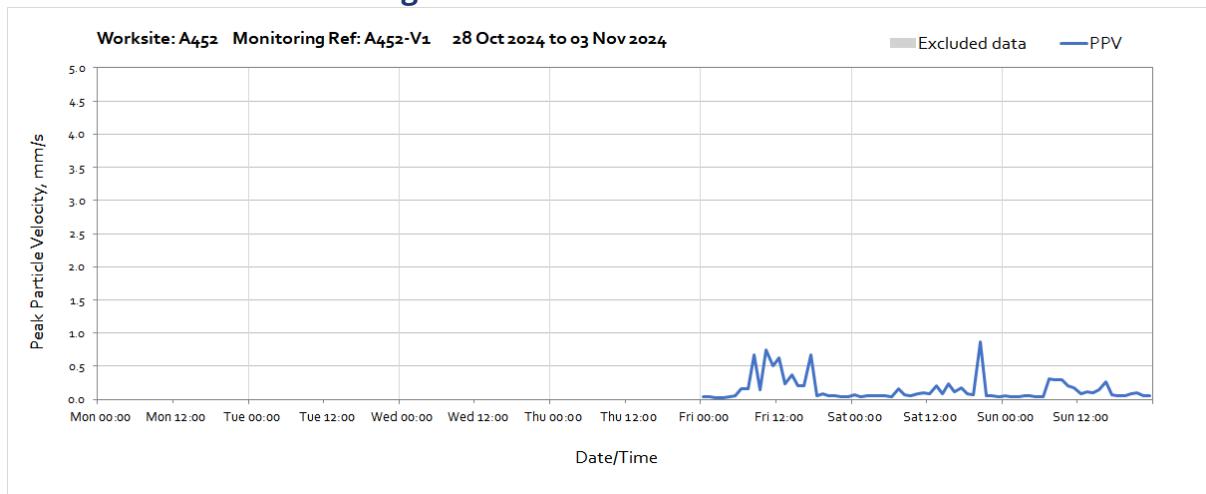


OFFICIAL

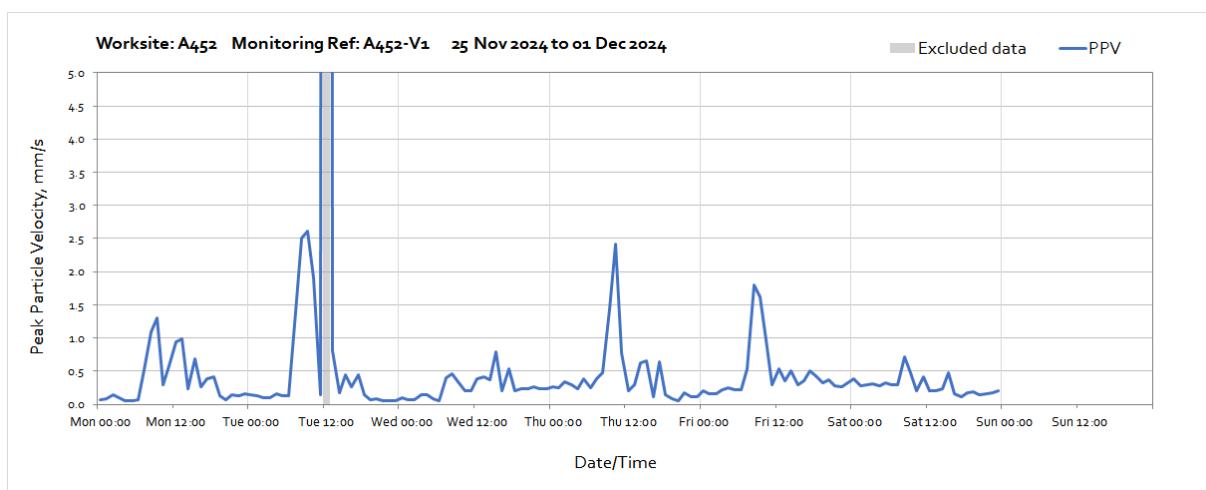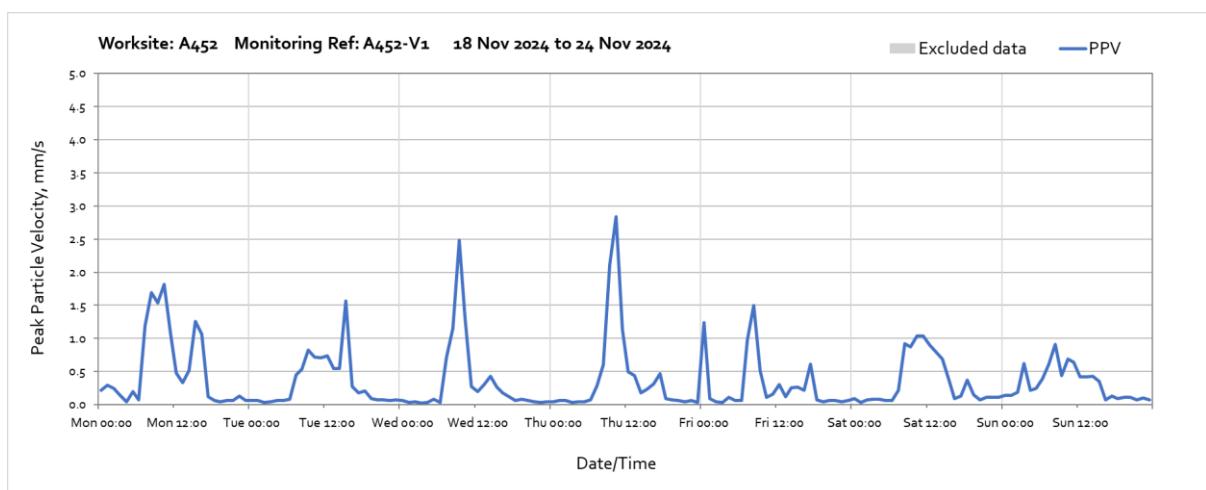
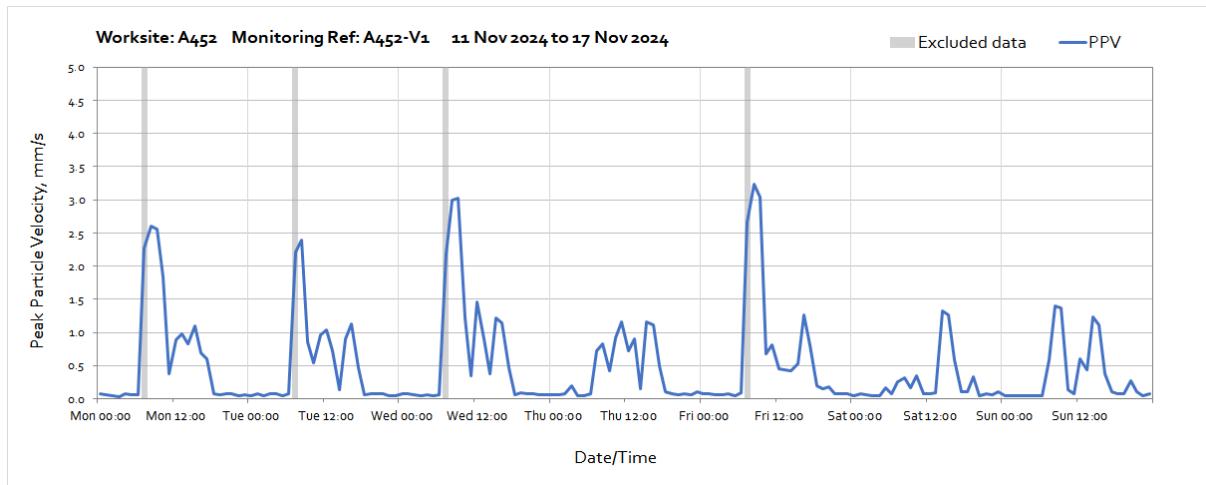


OFFICIAL


## Worksite: PL – Monitoring Ref: PL-V2

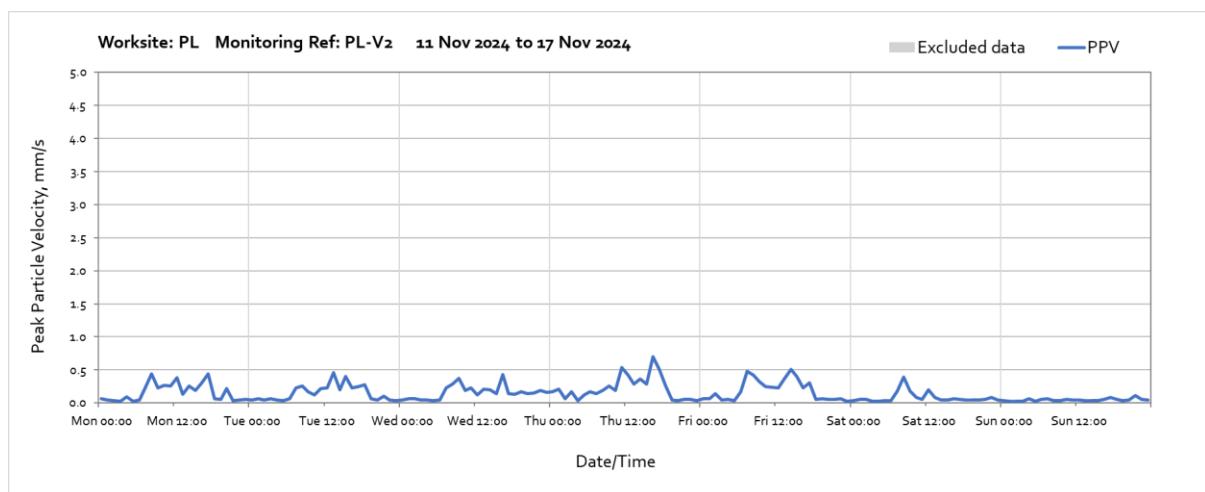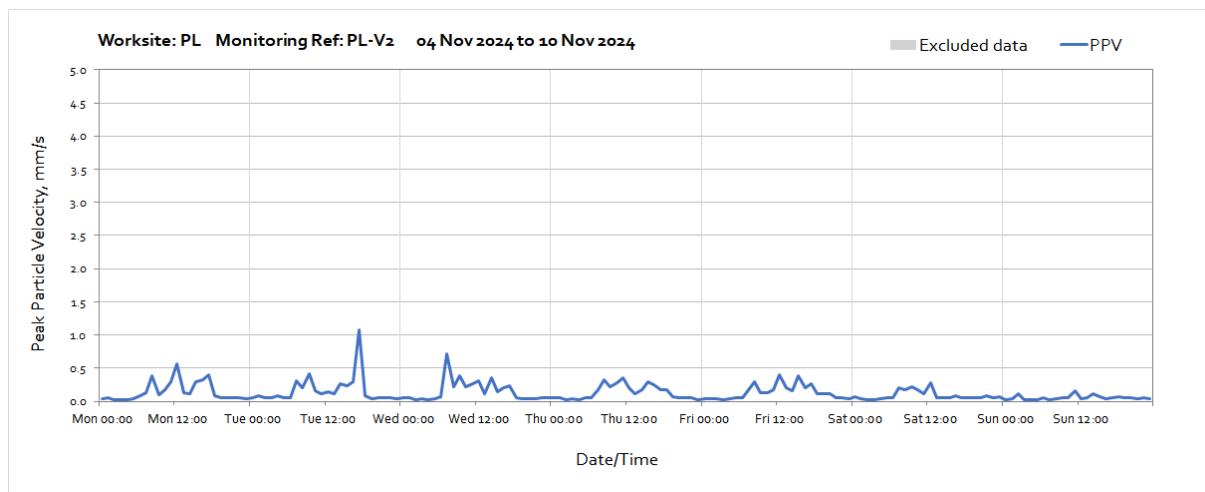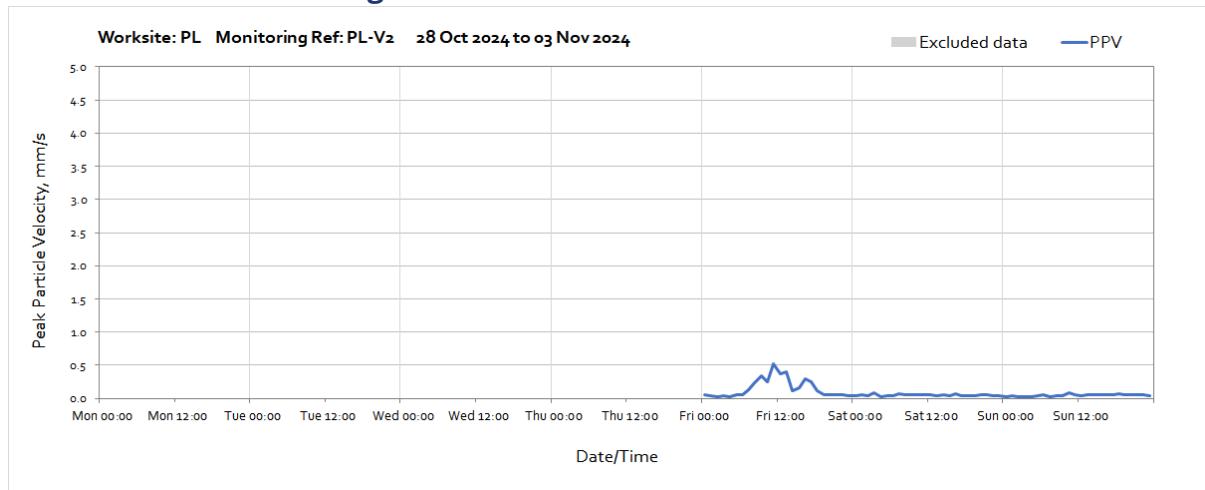




OFFICIAL

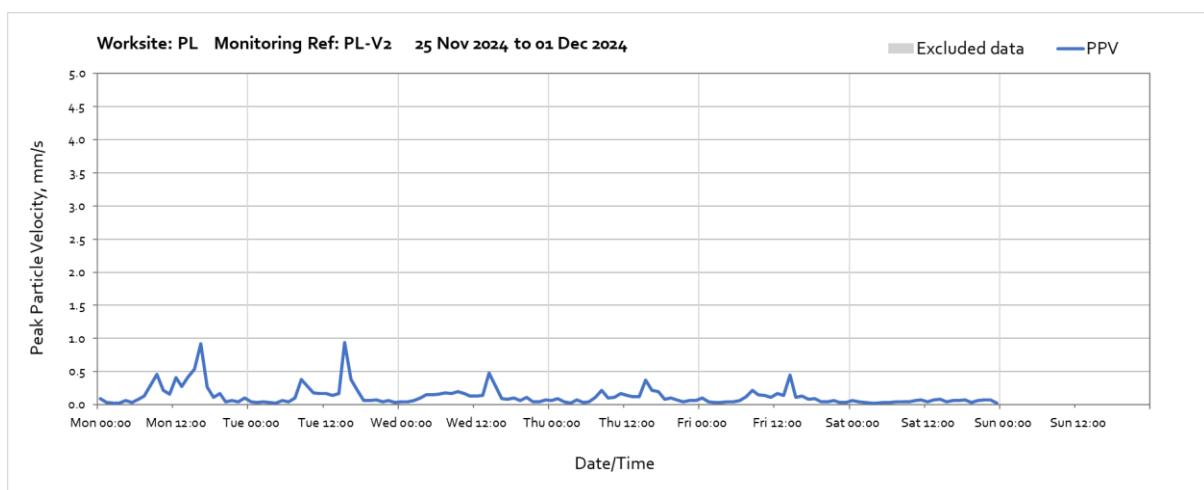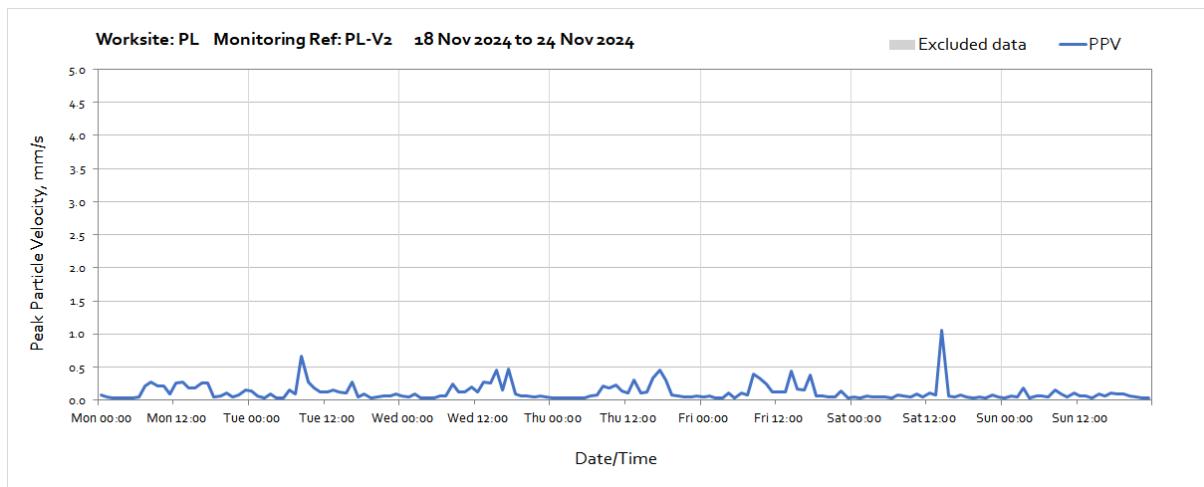


### Worksite: PL – Monitoring Ref: PL-V3

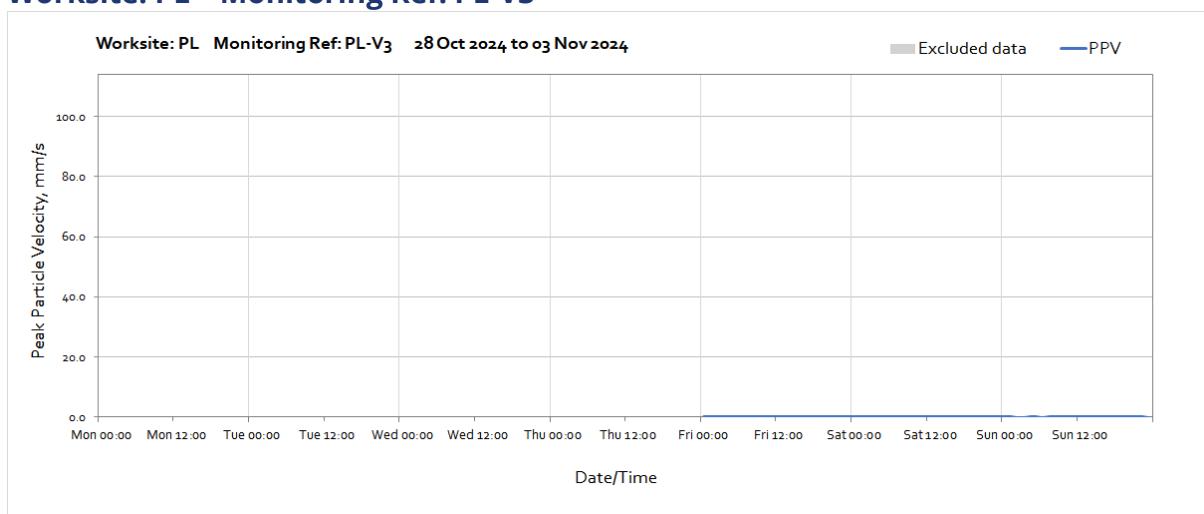



OFFICIAL

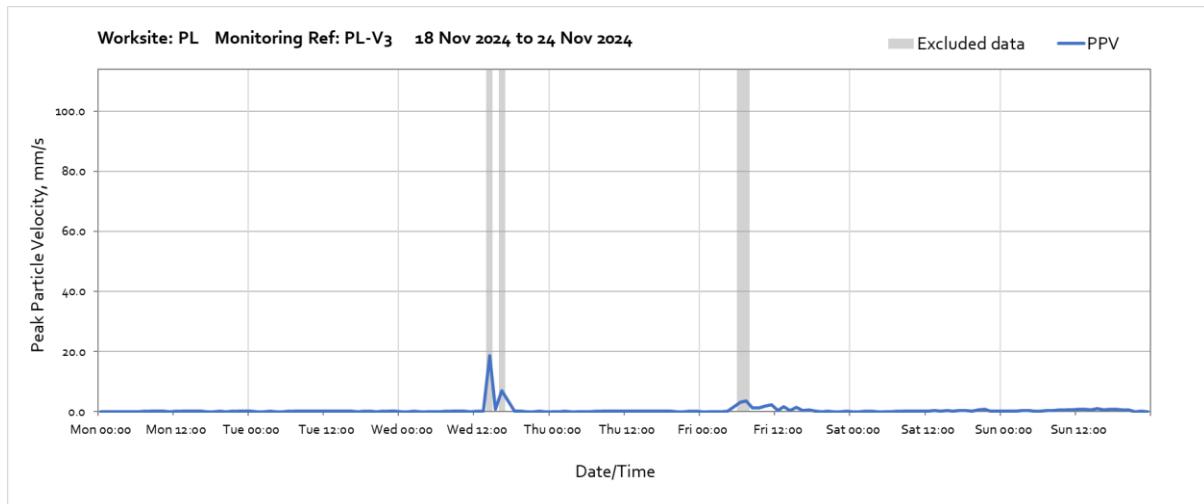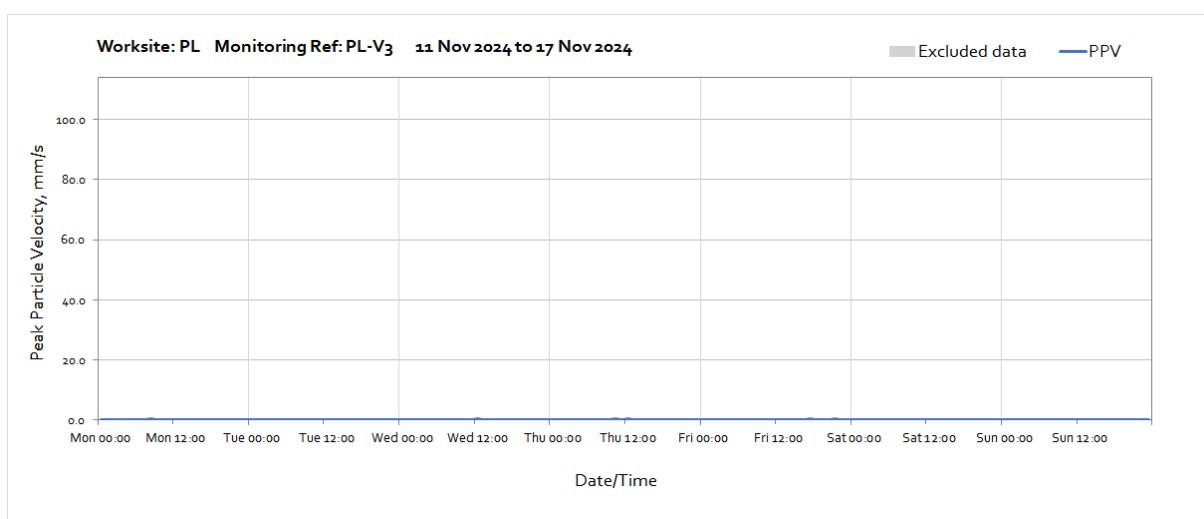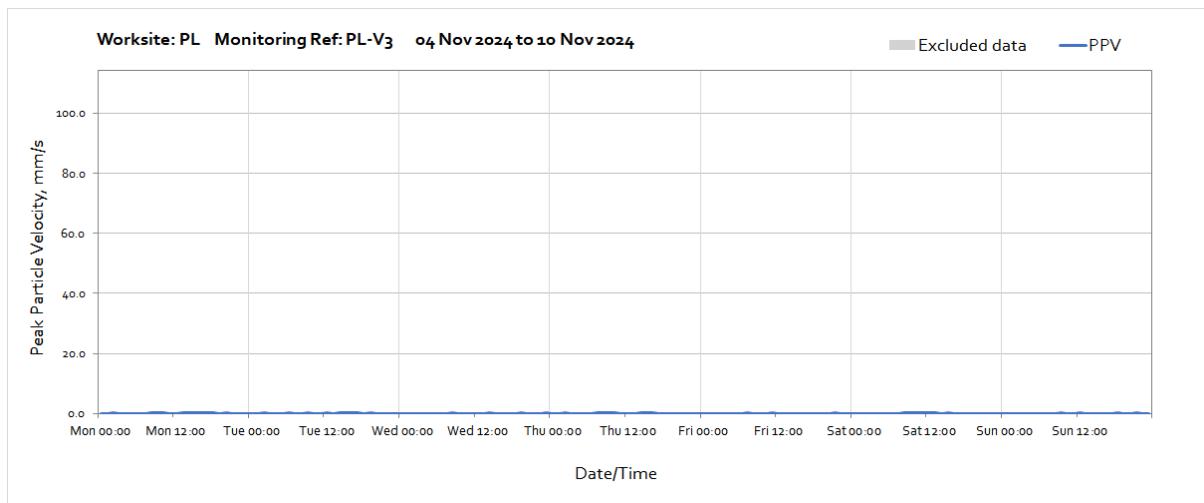




OFFICIAL

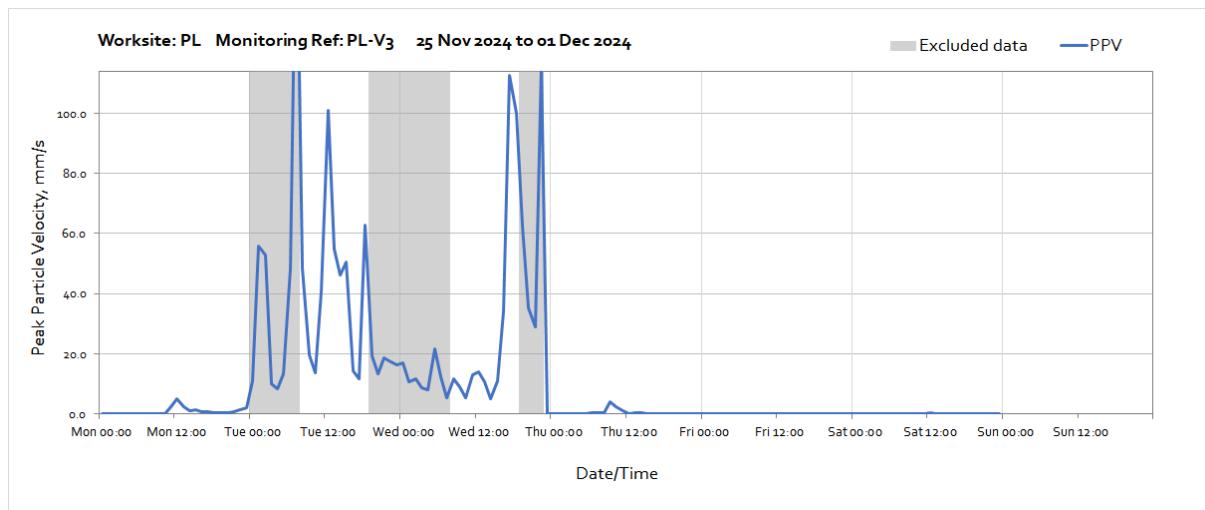

### Worksite: PL – Monitoring Ref: PL-V4

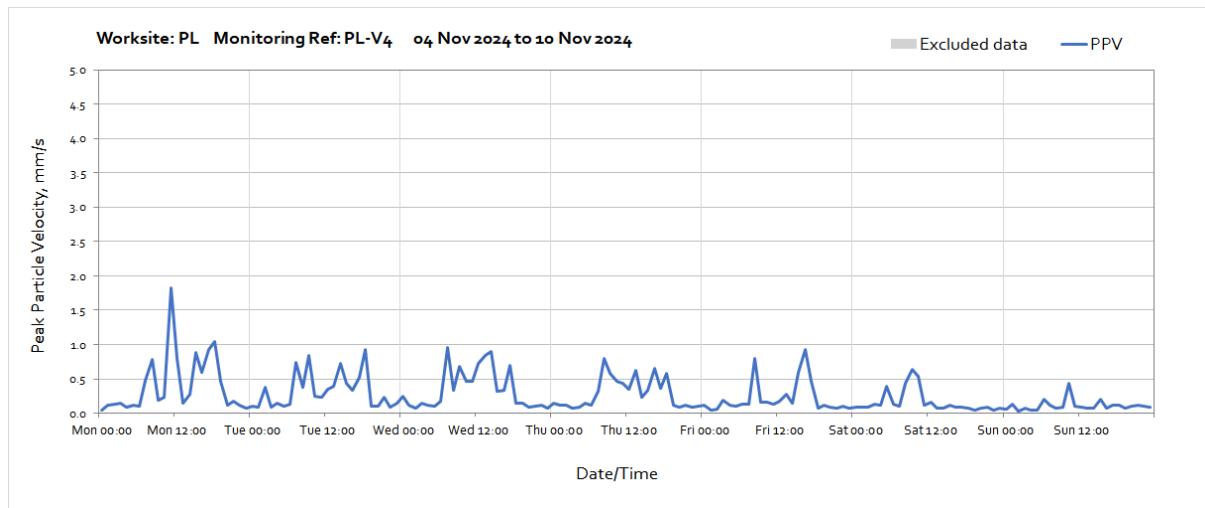
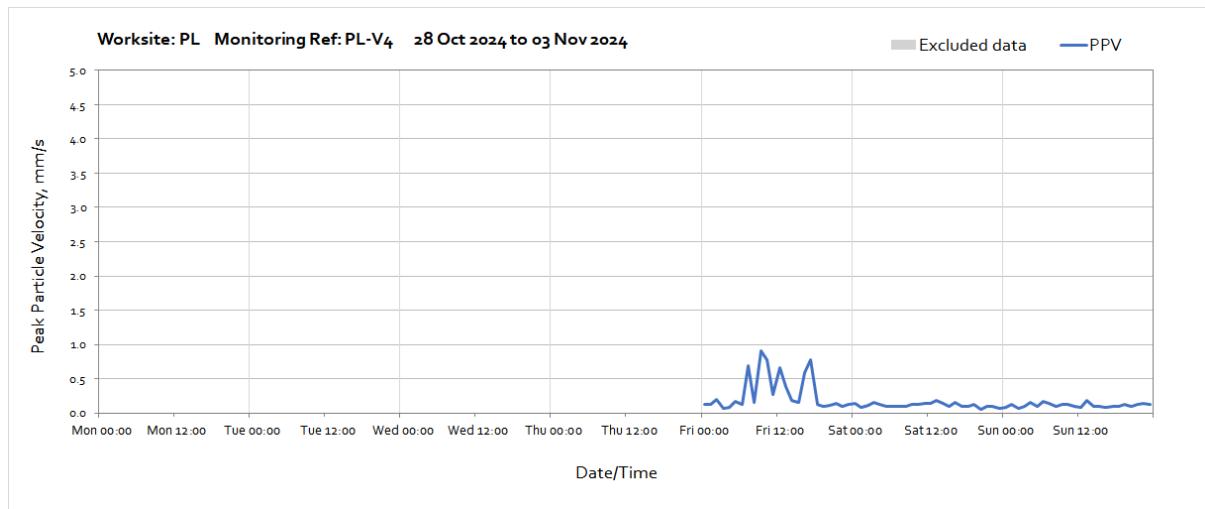


OFFICIAL

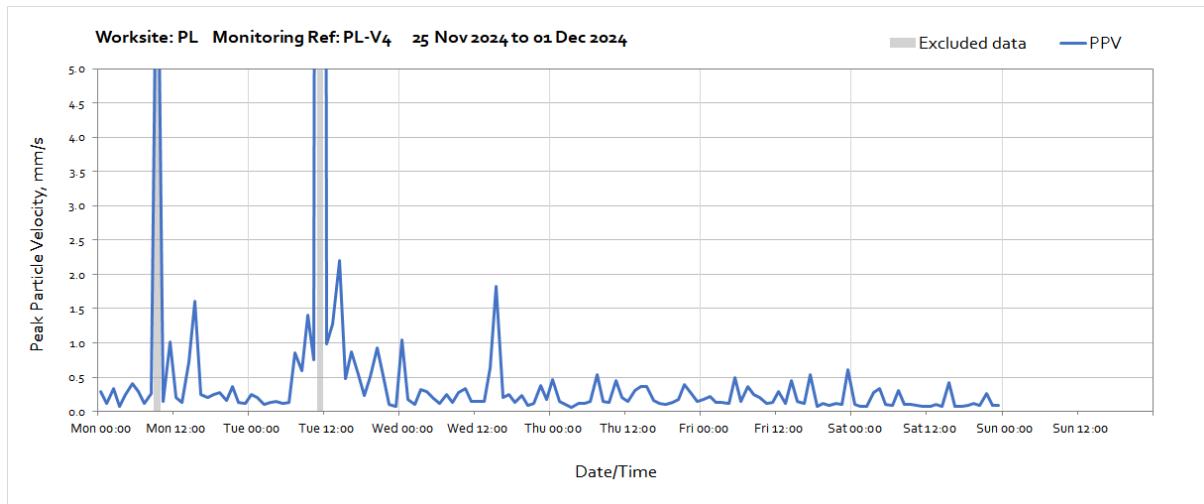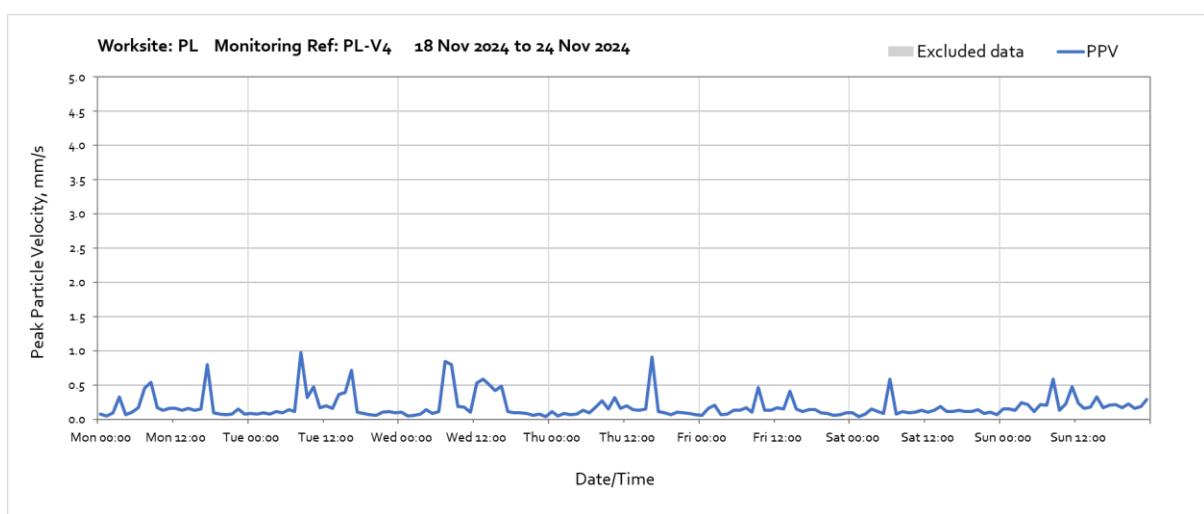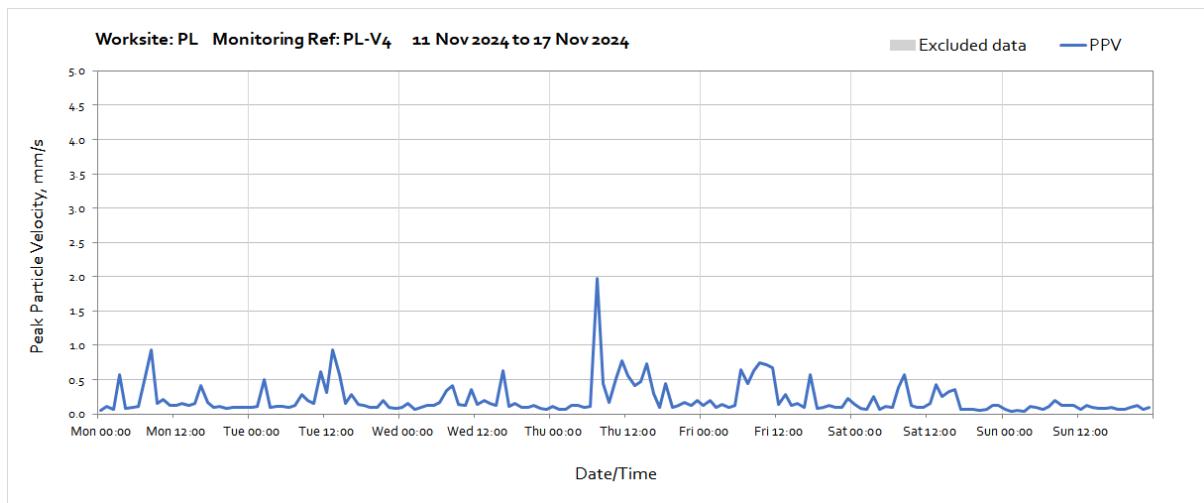


OFFICIAL

## Worksite: BCV – Monitoring Ref: BCV-V6

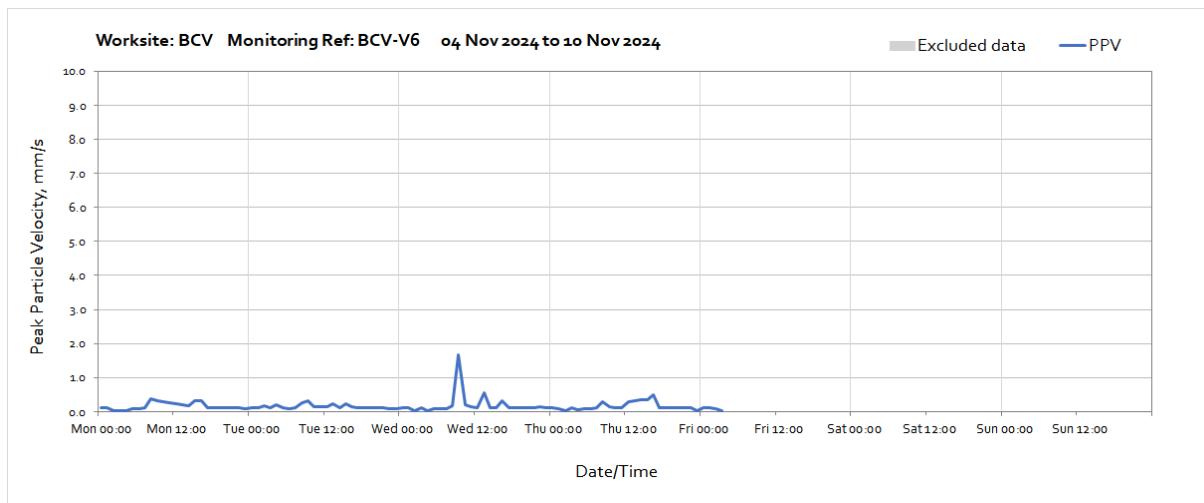
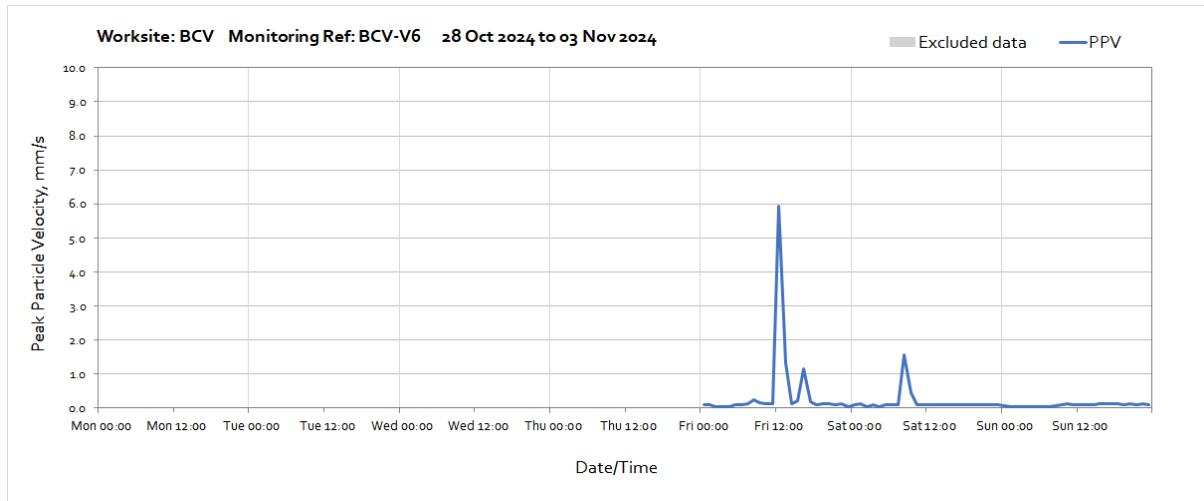


Note: Missing data between 04:00 on Friday 8<sup>th</sup> and 11:00 on Thursday 14<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

OFFICIAL



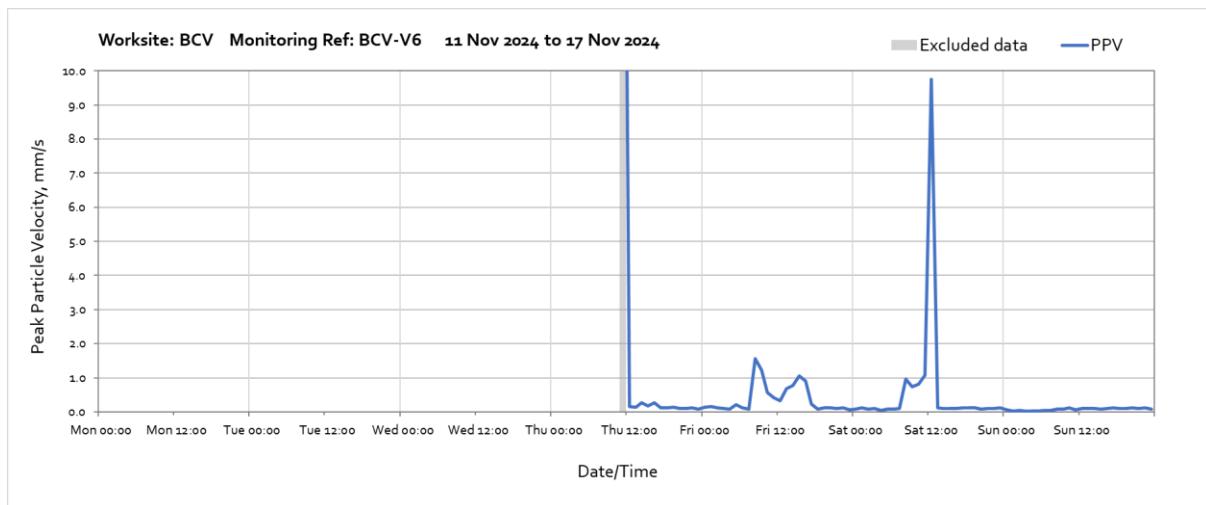


Note: Missing data between 04:00 on Friday 8<sup>th</sup> and 11:00 on Thursday 14<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

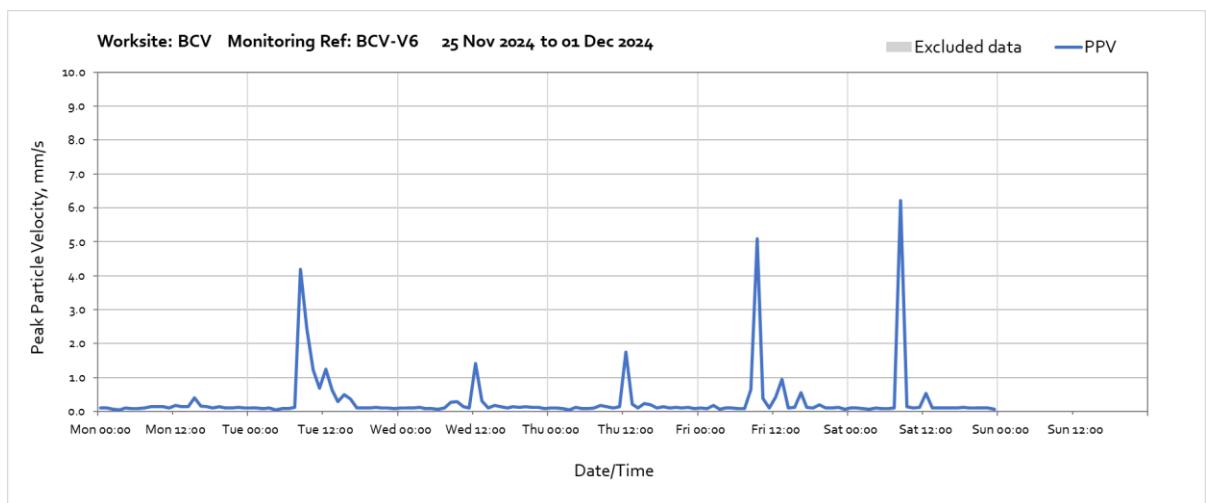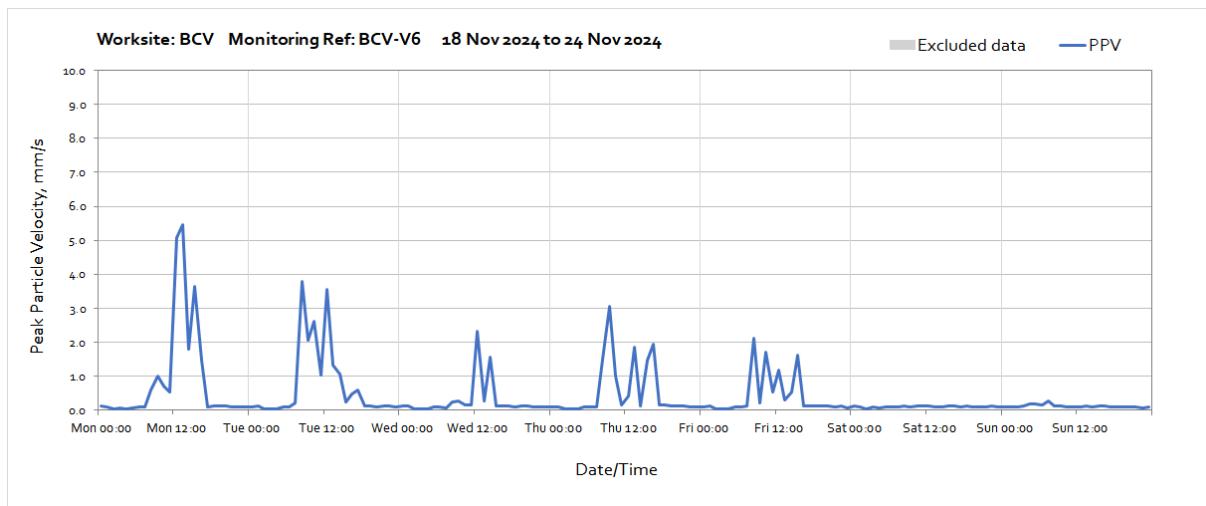


OFFICIAL


## Worksite: WLOS – Monitoring Ref: WLOS-V1

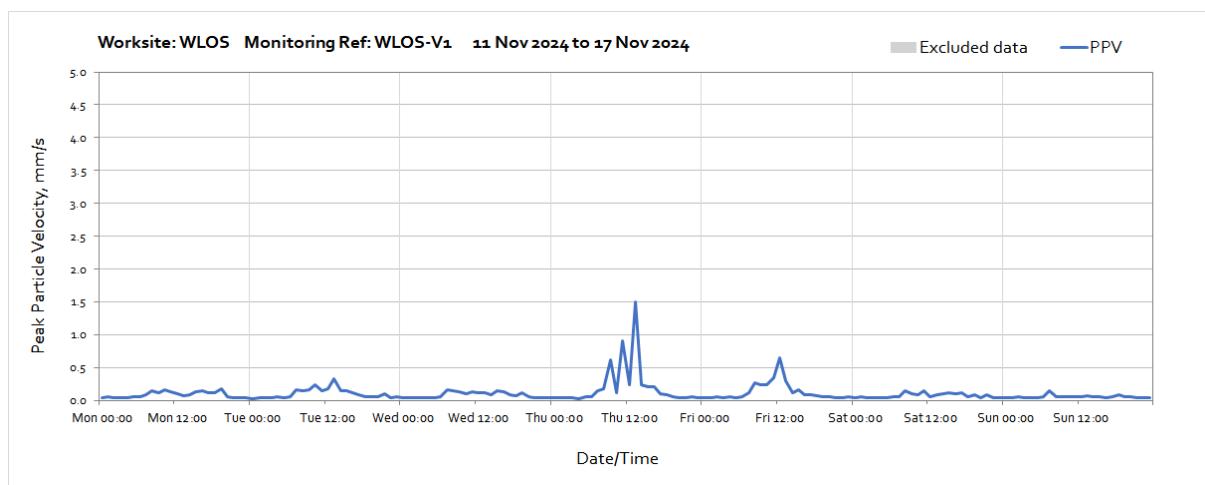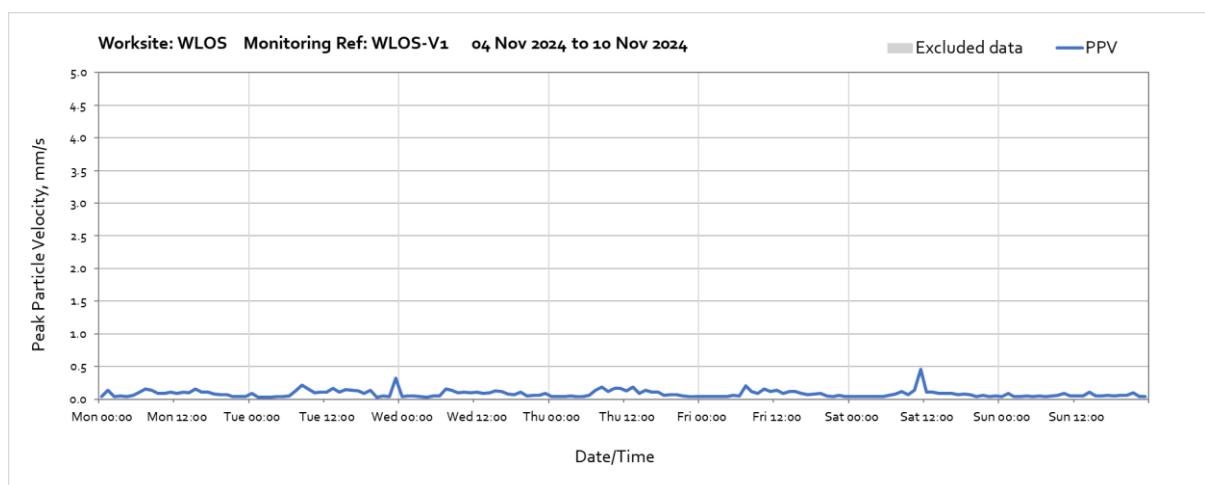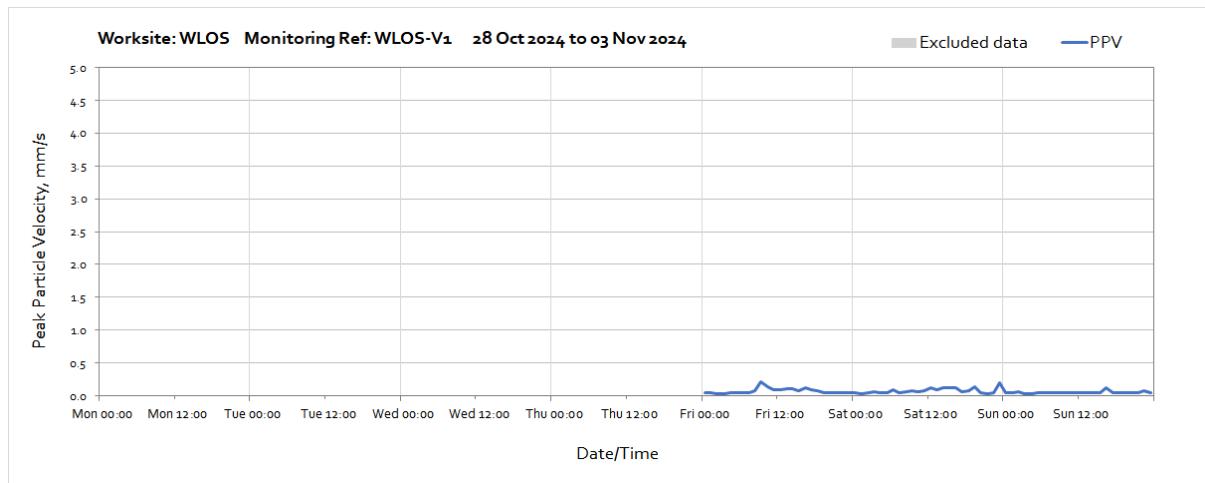

OFFICIAL

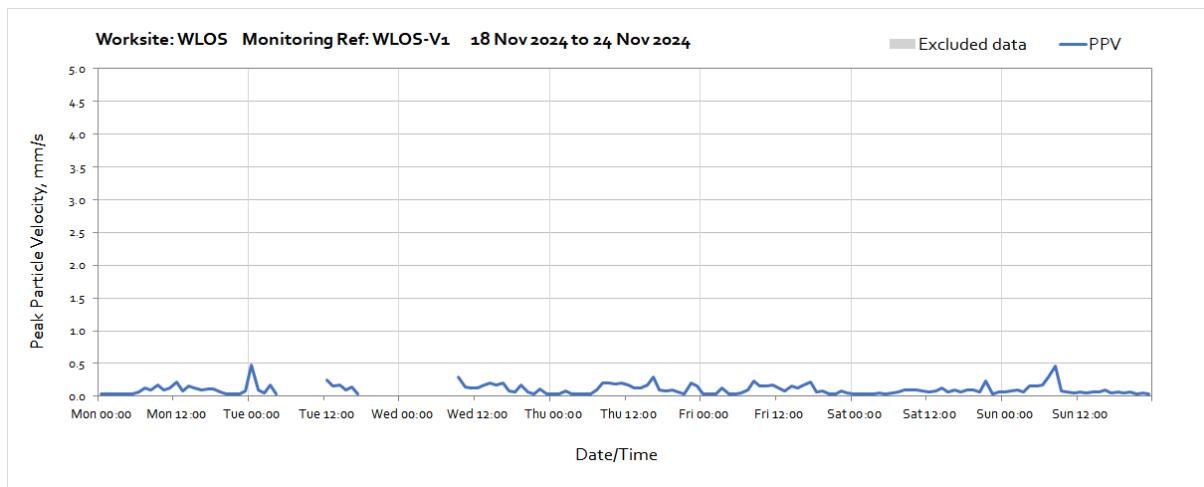




Note: Missing data between 04:00 and 12:00 on Tuesday 19<sup>th</sup> November and between 18:00 on Tuesday 19<sup>th</sup> and 09:00 on Wednesday 20<sup>th</sup> was due to poor solar conditions impacting power supply to the monitoring station.

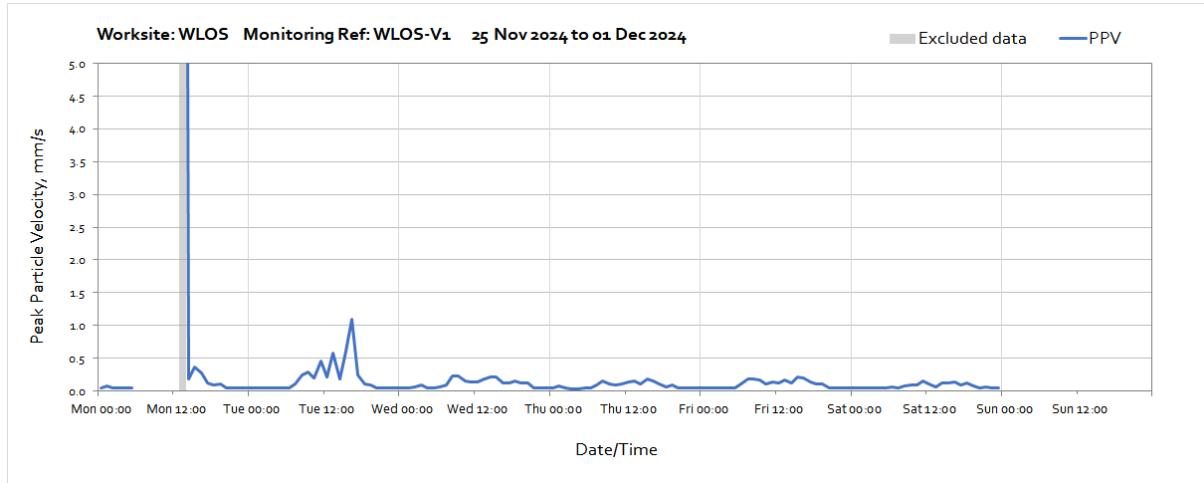



Note: Missing data between 06:00 and 13:00 on Monday 25<sup>th</sup> November was due to poor solar conditions impacting power supply to the monitoring station.

**OFFICIAL**

## Worksite: WLOS – Monitoring Ref: WLOS-V2

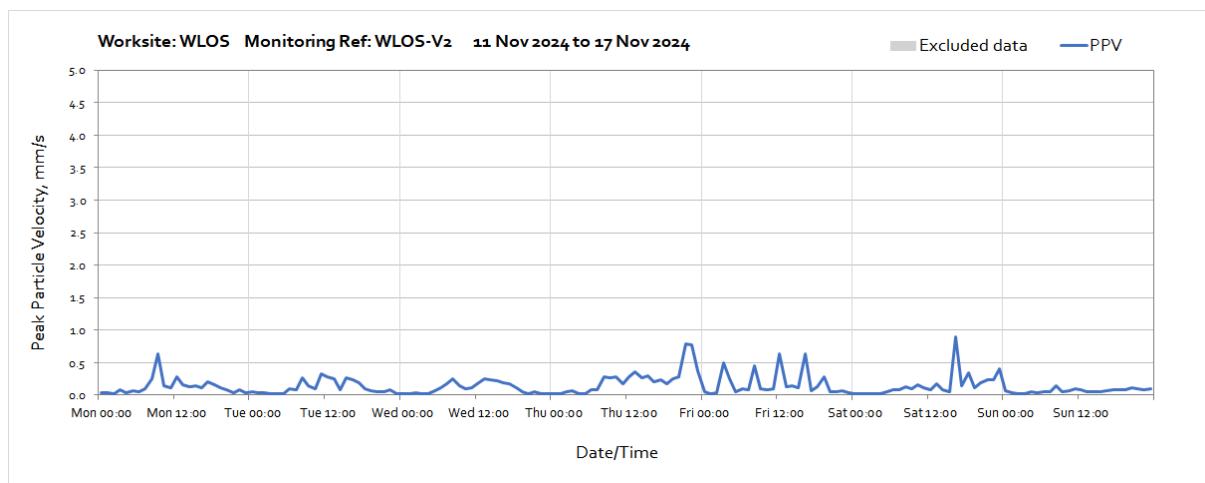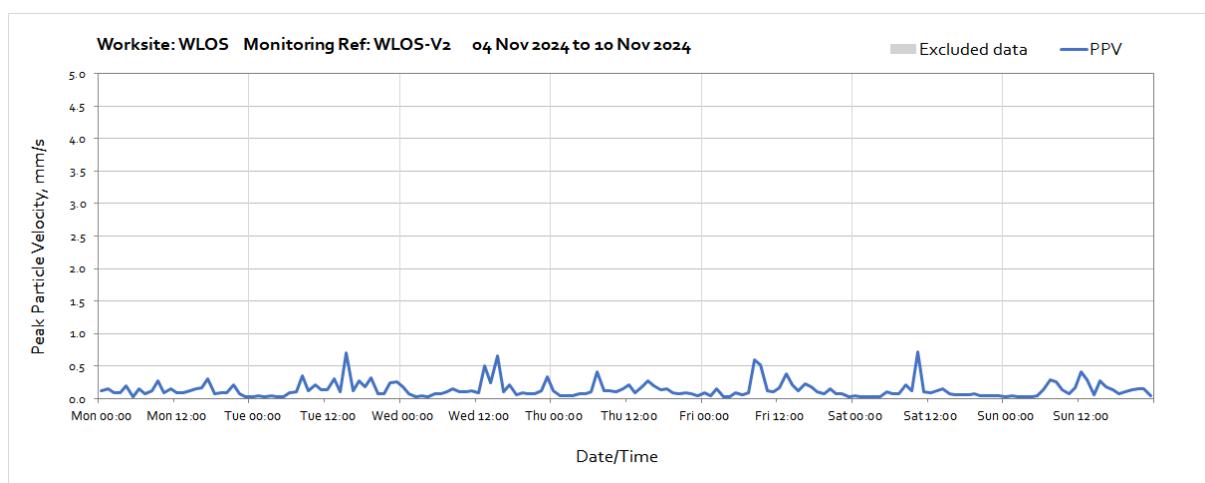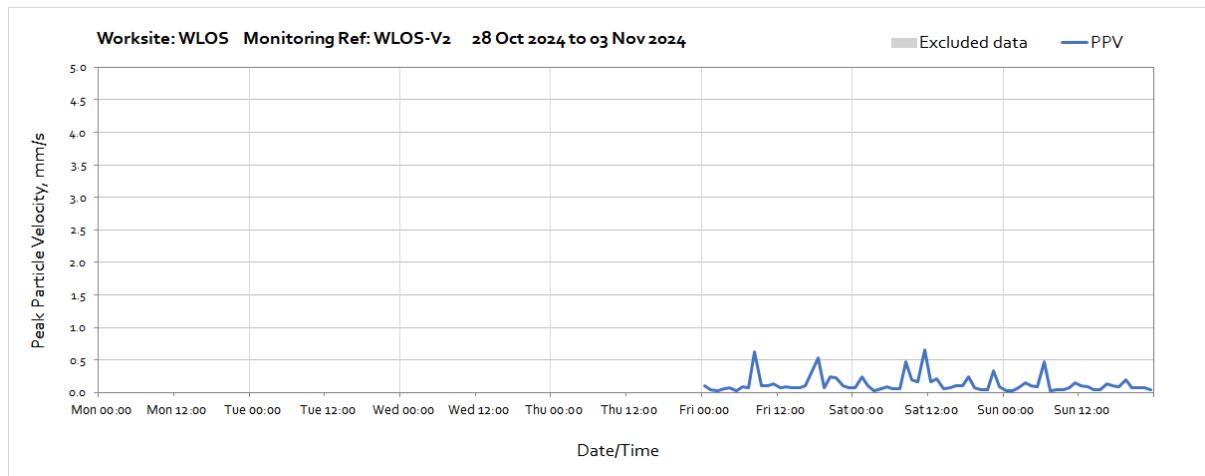

OFFICIAL

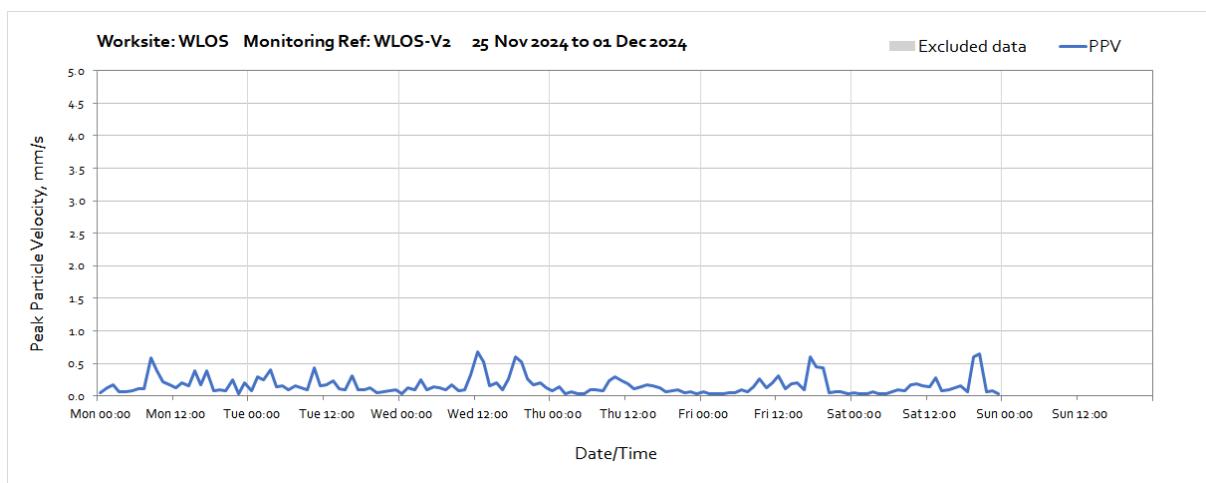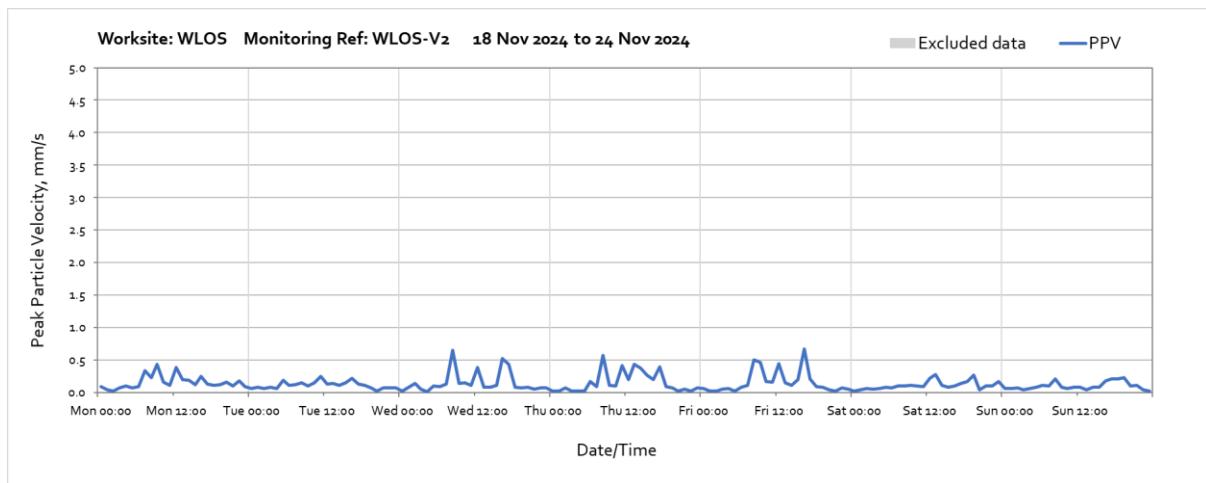

OFFICIAL