

Air Quality and Dust Monitoring Monthly Report – December 2019

London Borough of Ealing



SKANSKA



Department for Transport

High Speed Two (HS2) Limited has been tasked by the Department for Transport (DfT) with managing the delivery of a new national high speed rail network. It is a non-departmental public body wholly owned by the DfT.

High Speed Two (HS2) Limited,
Two Snowhill
Snow Hill Queensway
Birmingham B4 6GA

Telephone: 08081 434 434

General email enquiries: HS2enquiries@hs2.org.uk

Website: www.gov.uk/hs2

A report prepared by Costain Skanska on behalf of HS2 Ltd.

High Speed Two (HS2) Limited has actively considered the needs of blind and partially sighted people in accessing this document. The text will be made available in full on the HS2 website. The text may be freely downloaded and translated by individuals or organisations for conversion into other accessible formats. If you have other needs in this regard please contact High Speed Two (HS2) Limited.

© High Speed Two (HS2) Limited, 2019, except where otherwise stated.

Copyright in the typographical arrangement rests with High Speed Two (HS2) Limited.

This information is licensed under the Open Government Licence v2.0. To view this licence, visit www.nationalarchives.gov.uk/doc/open-government-licence/version/2 **OGI** or write to the Information Policy Team, The National Archives, Kew, London TW9 4DU, or e-mail: psi@nationalarchives.gsi.gov.uk. Where we have identified any third-party copyright information you will need to obtain permission from the copyright holders concerned.



Printed in Great Britain on paper containing at least 75% recycled fibre.

Monthly Summary

- 1.1.1 This Summary Report is published in fulfilment of commitments detailed in the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, Annex 1: Code of Construction Practice, for the nominated undertaker to present the results of air quality and dust monitoring undertaken in the London Borough of Ealing (LBE) during November 2019 and December 2019 respectively.
- 1.1.2 Figure 1 and Figure 2 in Appendix A indicate the current worksites together with air quality and dust monitoring locations.
- 1.1.3 This summary should be read in conjunction with the overview monitoring report available from www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2, which highlights: the applicable standards and guidance, as well as the air quality and dust monitoring methodologies to be implemented by nominated undertakers throughout construction.
- 1.1.4 The current phase of demolition works commenced within the LBE during April 2018 and are expected to be completed by December 2019. The next phase of construction works commenced in October 2019 and is expected to be completed by 2025. The current and completed worksites, as presented in Appendix A, Figure 1 and Figure 2, include:
- Current -
- Demolition and groundworks at Old Oak Common Depot (located in the London Borough of Hammersmith and Fulham), worksite ref. S004-WS01;
 - Victoria Road Crossover Box and Flat Iron Site mobilisation, site set up and groundworks, works site ref: S002-WS01; and
 - Willesden Euro Terminal mobilisation and site set up, works site ref: S001-WS03
- Completed -
- Demolition of buildings on Atlas Road, worksite ref. S001-WS05
 - Demolition of buildings on Victoria Road, worksite ref. S002-WS01.
 - Demolition works at Willesden Euro Terminal, worksite ref. S001-WS03.
 - Demolition of buildings at Mandeville Road Pumping Station, worksite ref. S002-WS02.
- 1.1.5 Nine (9) dust monitors were installed around worksites, where works are underway. These sites returned a medium or high dust risk rating.
- 1.1.6 Dust monitoring locations and results are presented in Appendix B, Table 2, together with line charts of monthly data from each dust monitor. All continuous dust monitoring is undertaken using indicative monitors. Despite being Environment Agency (MCERTS) certified, indicative monitors carry a higher level of uncertainty than reference monitors, and therefore cannot be

strictly compared with Air Quality Standards for human health and the environment. The purpose of the monitoring undertaken is to ensure the effectiveness of the on-site mitigation.

- 1.1.7 The trigger level of 190 µg/m³, over a 1-hour period, in accordance with the updated guidance document 'Guidance on Monitoring in the Vicinity of Demolition and Construction Sites – October 2018)' has been applied.
- 1.1.8 There were no (0) dust trigger alerts recorded during this monitoring period (December 2019). All results were in line with expected ranges.
- 1.1.9 Data capture for AQ037 was below 90% for the month of December 2019 due to the cut in power supply to the area of the site where the monitor is located. No works are currently underway. The site and power supply will be resumed upon mobilisation of the main works late January, early February 2020. Nearby monitors near the site perimeter, AQ025 and AQ026, remain operational.
- 1.1.10 Diffusion tube monitoring of Nitrogen Dioxide (NO₂) was undertaken at six (6) locations in November 2019, around highways within the LBE as part of the management of air quality where significant effects may occur as a result of the scheme.
- 1.1.11 Diffusion tube monitoring results are provided from the laboratory analysis, and therefore still require various analysis and adjustments to be undertaken. Final corrected results will be presented and described in the annual report. However, based on the results to date, no unexpected values were recorded during the monitoring period.
- 1.1.12 NO₂ monitoring locations and results are presented in Appendix C, Table 3, together with the 2019 running mean.
- 1.1.13 Table 1 provides a summary of the complaint information related to dust or air quality received during the reporting period, together with the findings of any related investigations.


Table 1: Summary of complaints received during December 2019 in LBE

Complaint Reference No.	Worksite Reference	Description of complaint	Results of investigation
HS2-19-12398-C	S001 – WS001	A complaint was received on 03/12/2019 with regards to fumes from stationary vehicles idling.	The complainant was provided with a response detailing the key emission requirements set across HS2 works. Contractors have also been reminded about anti-idling to reduce emissions where possible.

Appendix A – Worksites and Monitoring Locations

Figure 1 and 2: Worksites and monitoring locations within the LBE



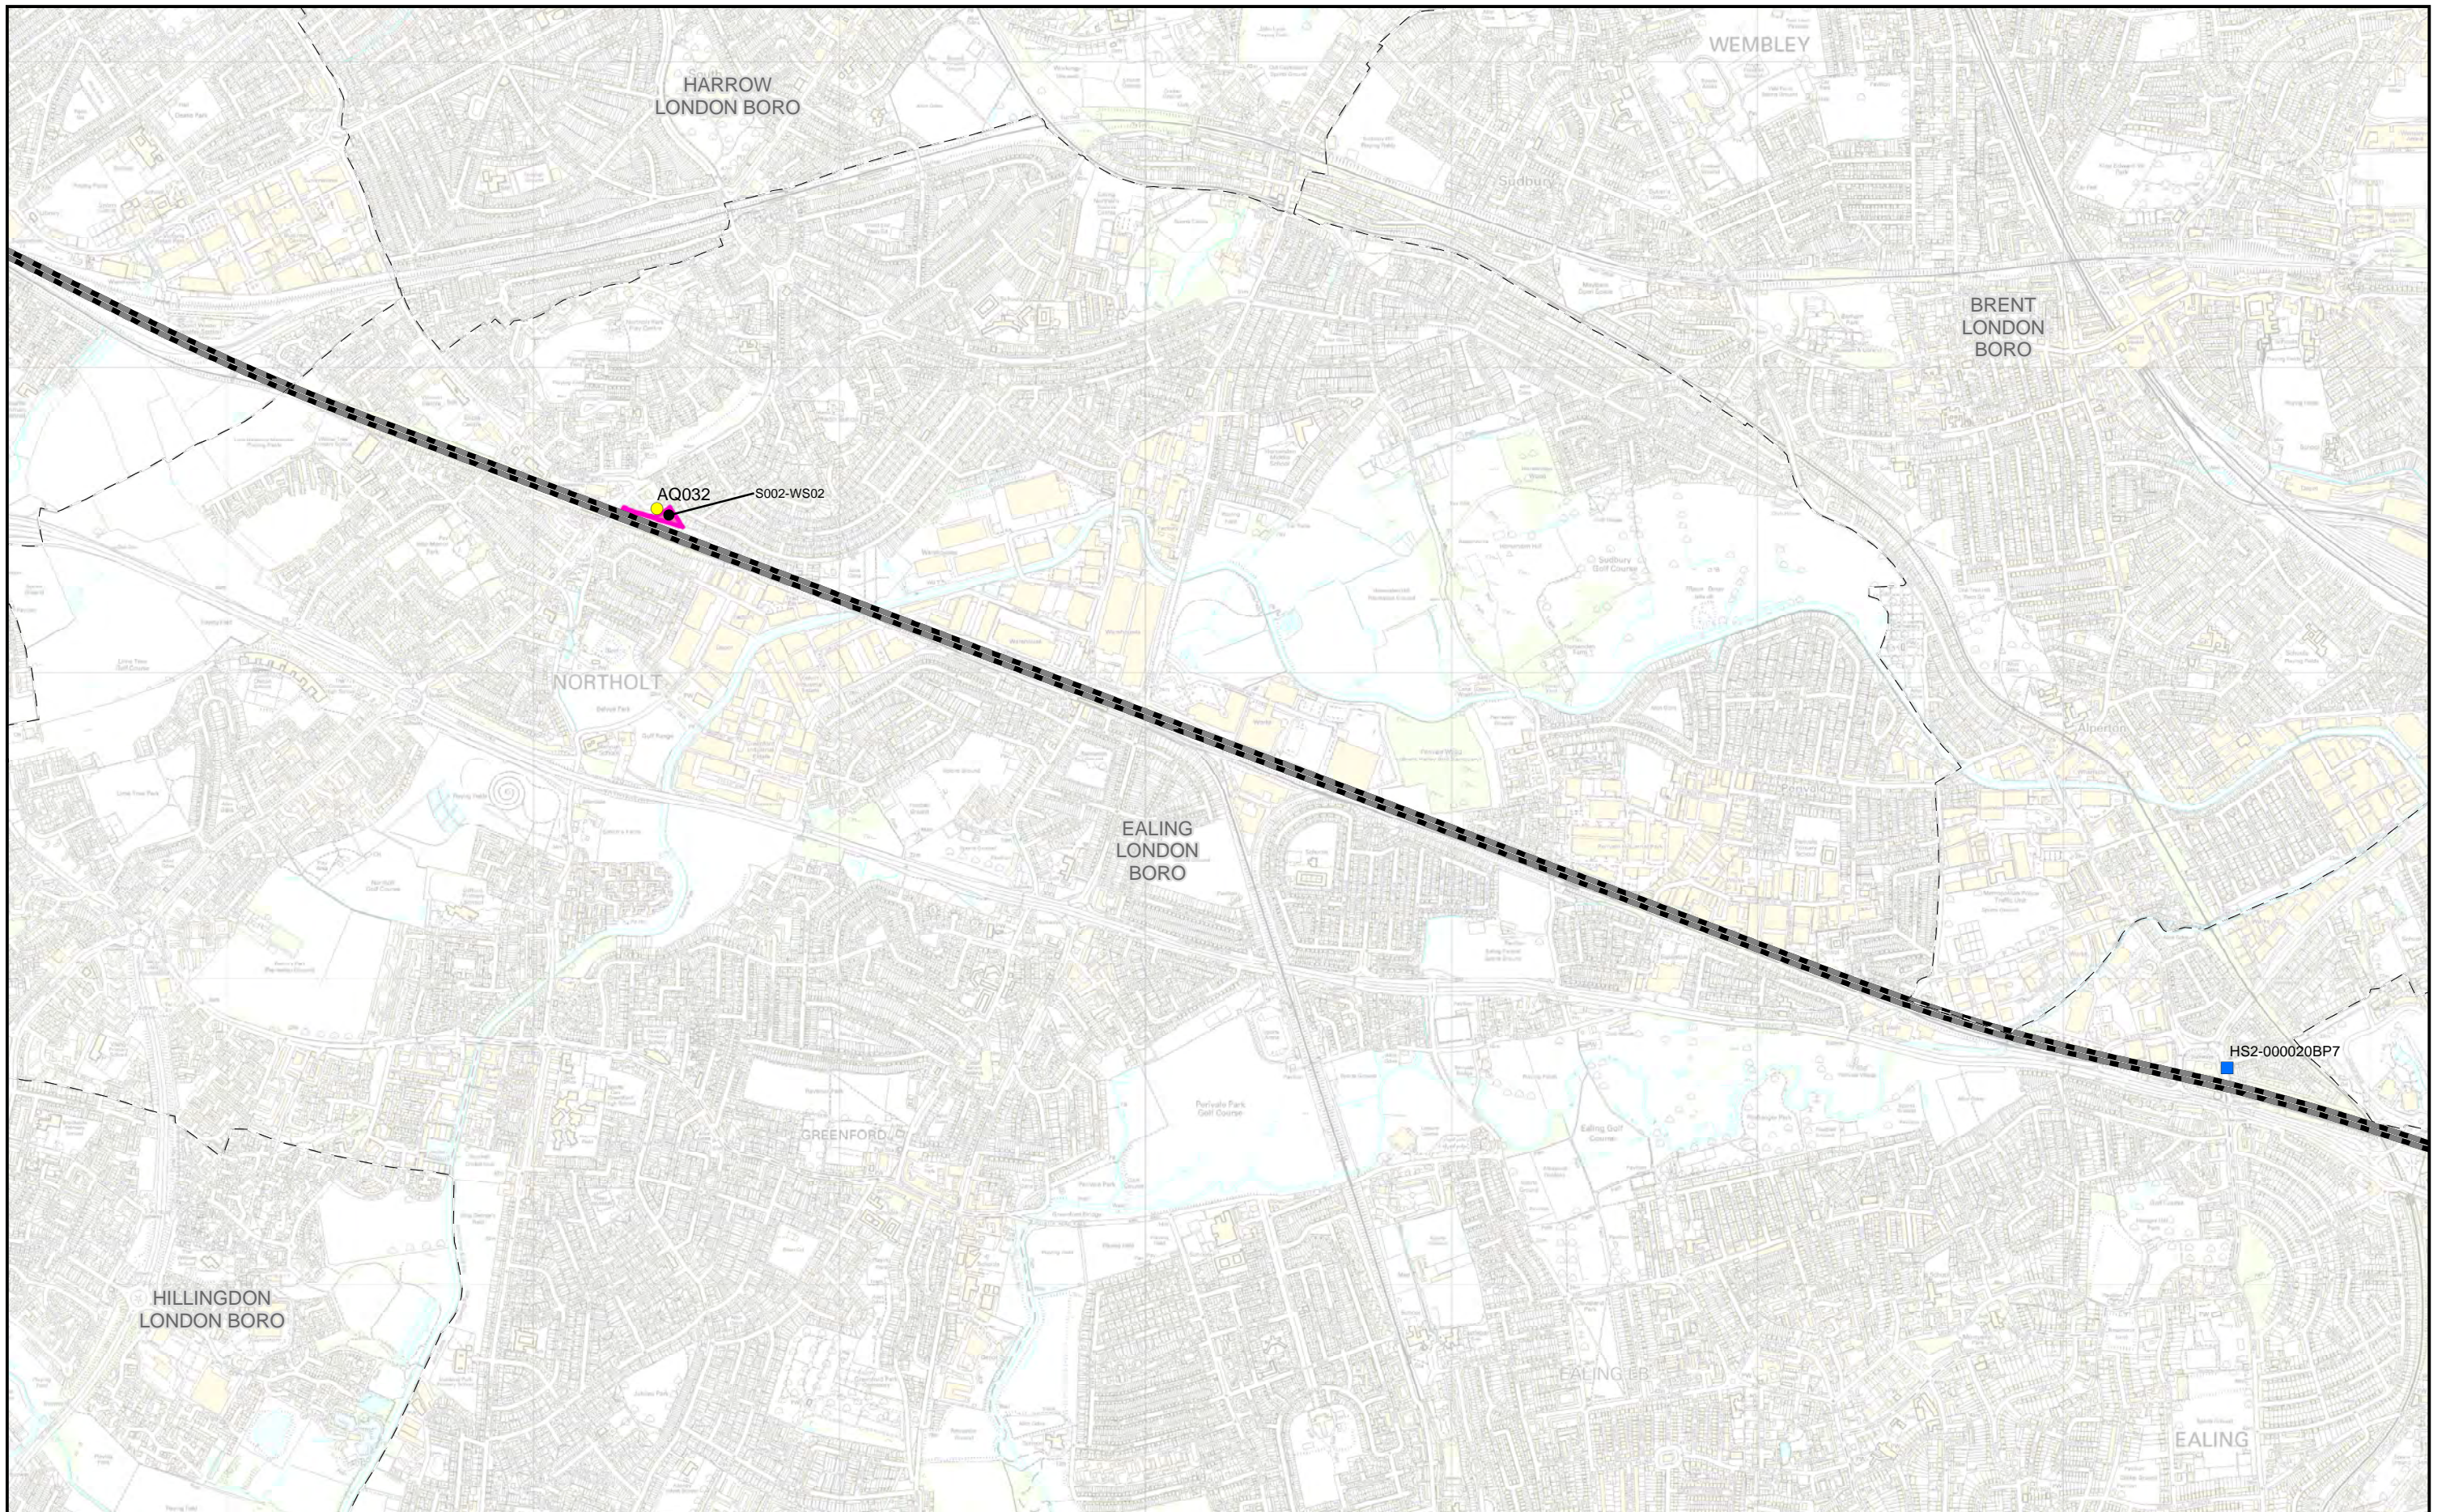

Legend

--- District/Borough boundary

--- Route in tunnel

--- Route on surface

--- HS2 Chainage Markers

■ Diffusion tube monitoring location

■ Mandeville Road Pumping Station

● Dust monitoring location

Figure Number

Figure Name
Worksites and Monitoring locations in LBE (sheet 1)

London Borough of Ealing


hs2

Scale at A3: 20,000

0 200 400 600 800 Metres

© Crown copyright and database rights 2016. Ordnance Survey Licence Number 100049190. Map Number: 1EW02-CSJ-EV-REP-S000-000017_appAFig1.pdf Date: 16/07/18

HS2 Ltd accept no responsibility for any circumstances, which arise from the reproduction of this map after alteration, amendment or abbreviation or if it is issued in part or issued incomplete in any way.

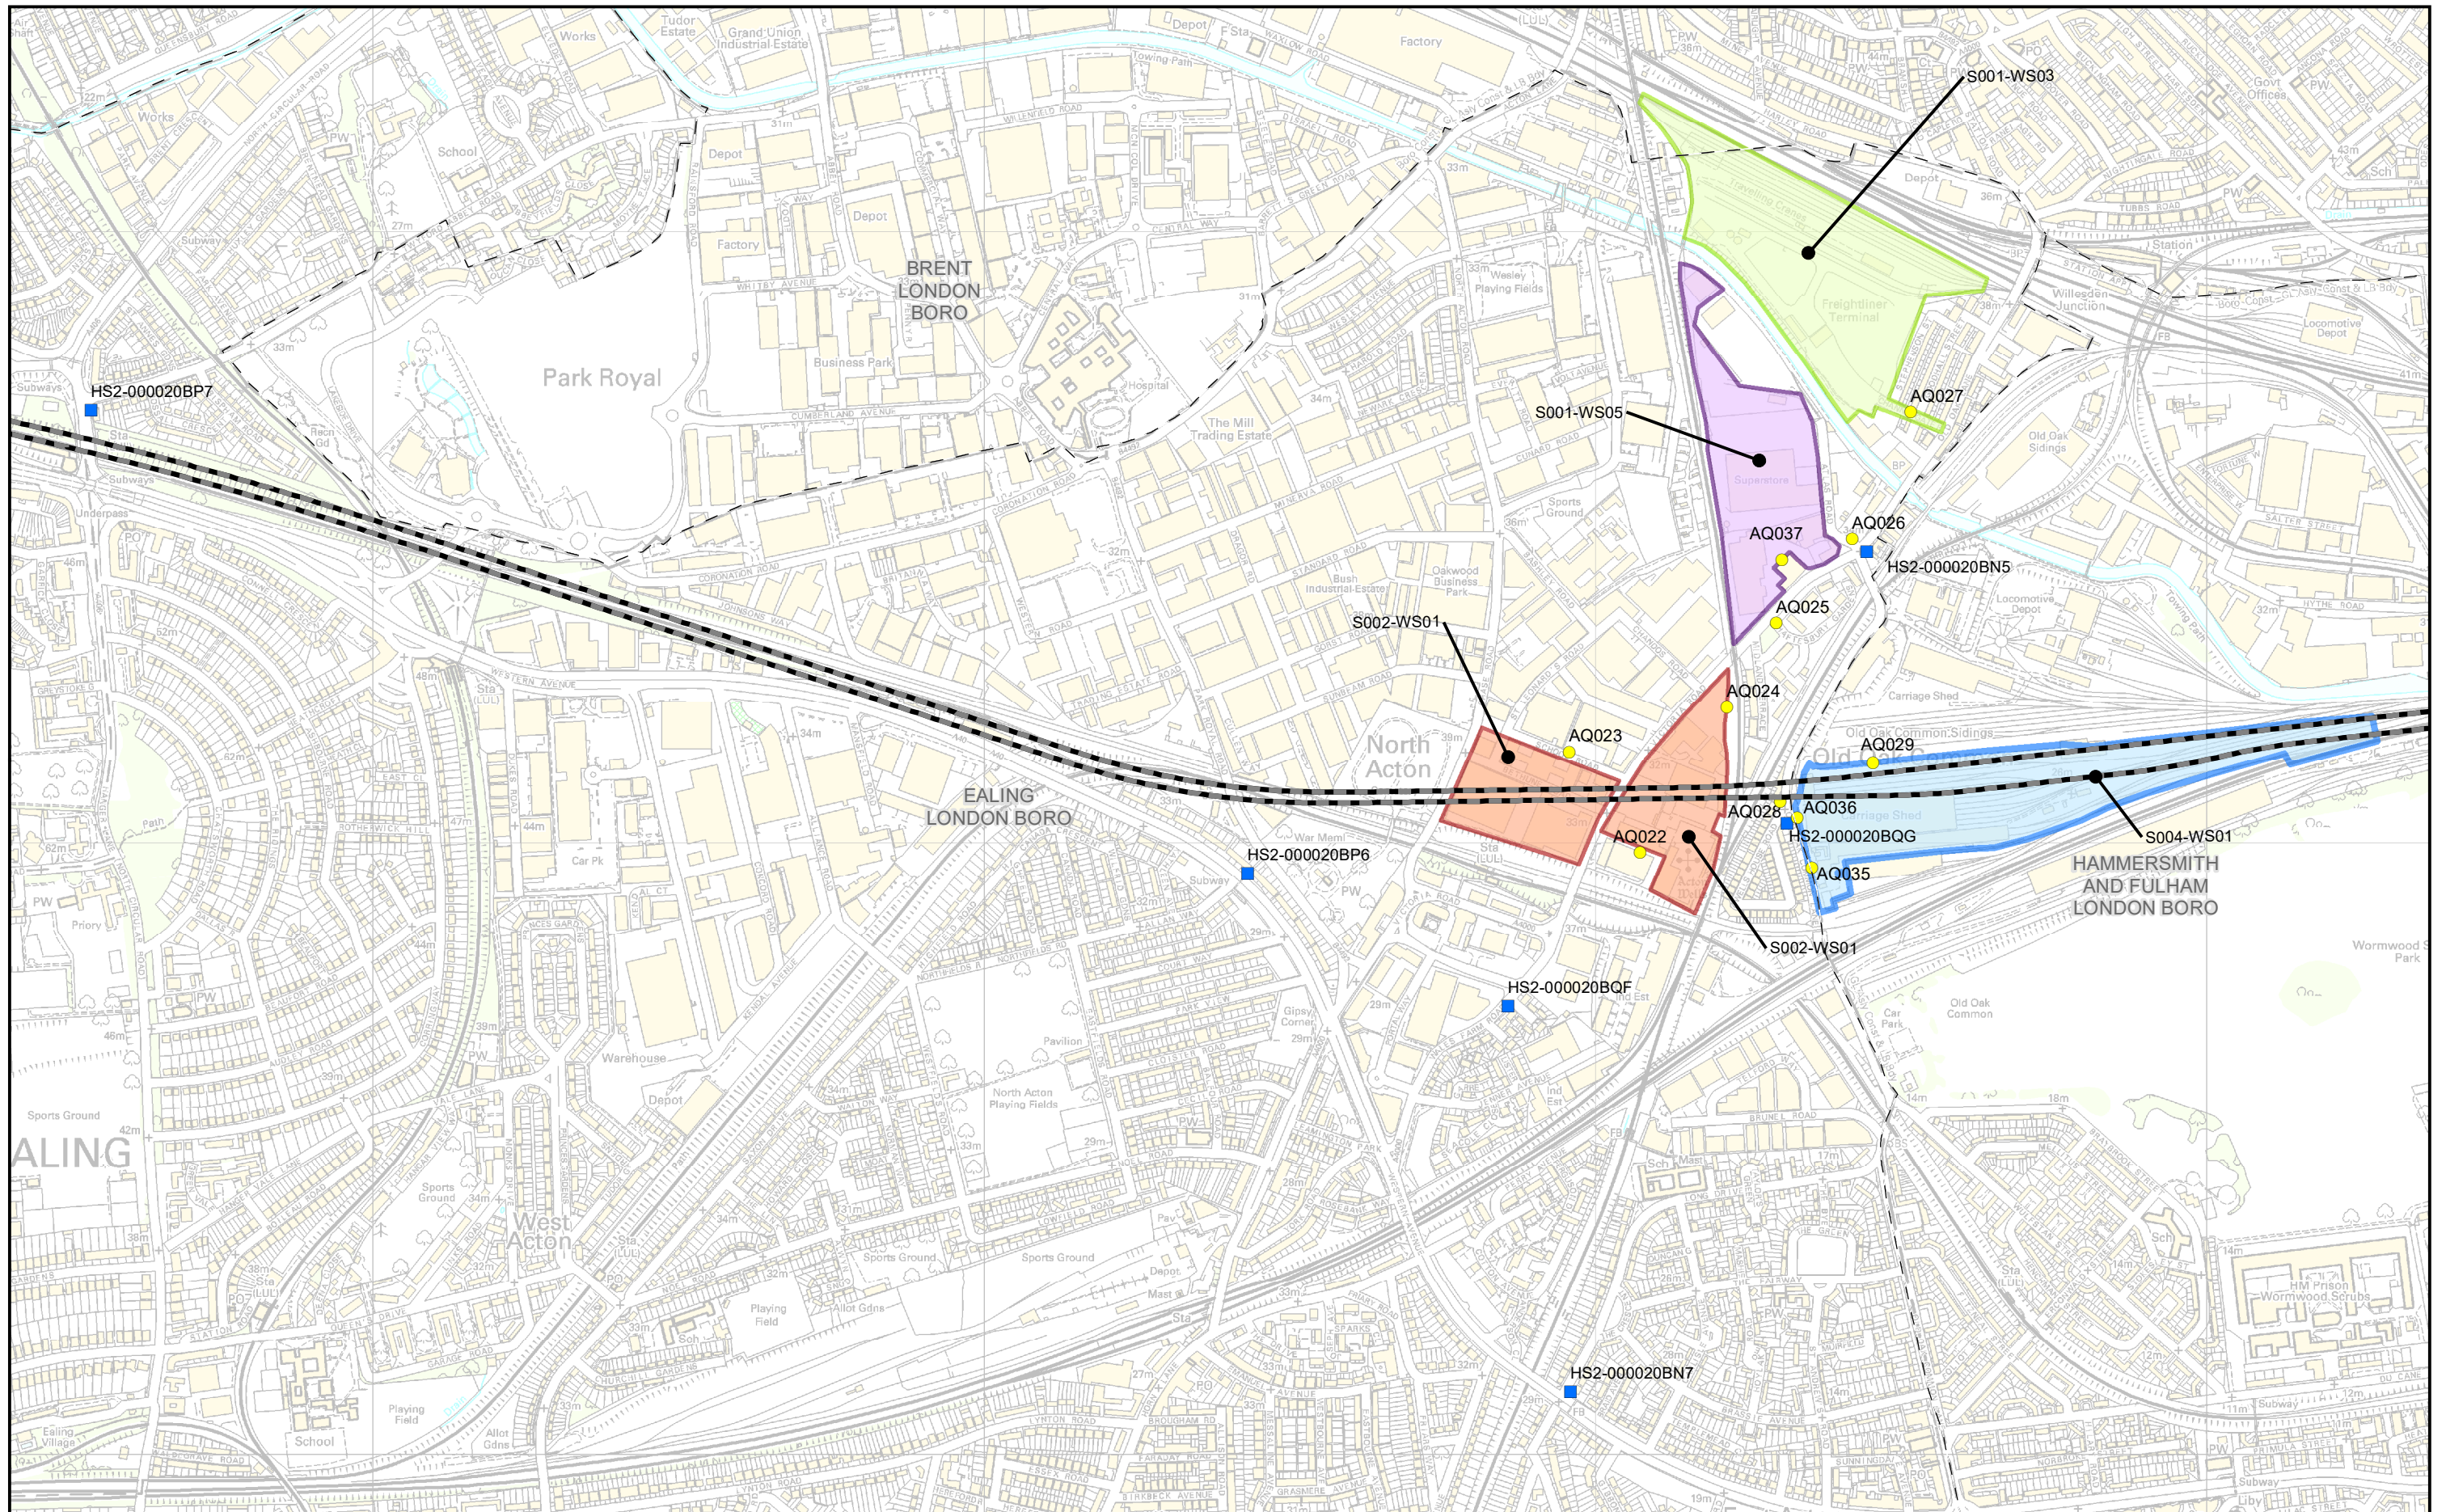

- Legend**
- Route in tunnel
 - Route on surface
 - Diffusion tube monitoring location
 - Dust monitoring location
 - Willesden Euro worksite
 - Victoria Road worksite
 - Old Oak Common worksite
 - Atlas Road worksite

- Willesden Euro worksite
- Victoria Road worksite
- Old Oak Common worksite
- Atlas Road worksite

Figure Number
 Figure Name
Worksites and Monitoring locations in LBE
 (sheet 2)

London Borough of Ealing

HS2 Ltd accept no responsibility for any circumstances, which arise from the reproduction of this map after alteration, amendment or abbreviation or if it is issued in part or issued incomplete in any way.

Scale at A3: 10,000

© Crown copyright and database rights 2016. Ordnance Survey Licence Number 100049190.


Map Number: 1EW02-CSJ-EV-REP-S000-000017_appAFig1.pdf Date: 12/07/19





Appendix B – Dust Monitoring Results

Table 2 Dust monitoring locations and December 2019 Results


Monitoring site ID	Coordinates (X,Y)	Location description	Dust risk rating for site	Monitoring site active during period	Change to site since previous period report	Mean 1-hour PM ₁₀ concentration (µg/m ³)	Minimum 1-hour PM ₁₀ concentration (µg/m ³)	Maximum 1-hour PM ₁₀ concentration (µg/m ³)	Number of 1-hour periods exceeding trigger level of 190 µg/m ³	Data capture (%)
AQ022	521072, 181985	Boden House	H	Yes	N	9.6	0.8	90.5	0	100.0
AQ023	520956, 182149	School Road	H	Yes	N	10.1	0.8	37.0	0	100.0
AQ024	521214, 182223	Braitrim House	H	Yes	N	11.0	0.7	114.3	0	99.7
AQ025	521295, 182360	Victoria Road	H	Yes	N	10.8	0.7	43.2	0	100.0
AQ026	521419, 182497	Old Oak Lane	H	Yes	N	11.1	0.7	61.0	0	100.0
AQ027	521515, 182706	Stephenson Street	H	Yes	N	11.7	0.7	72.7	0	100.0
AQ028	521302, 182067	Wells House Road	H	Yes	N	10.9	0.7	69.0	0	100.0
AQ032	513402, 184536	Badminton Close	M	Yes	N	7.4	0.5	23.4	0	100.0
AQ037	521304, 182464	Atlas Road	H	No	Y	No data	No data	No data	No data	No data

Figure 1: Construction dust 1-hour mean indicative PM₁₀ concentration for dust monitors

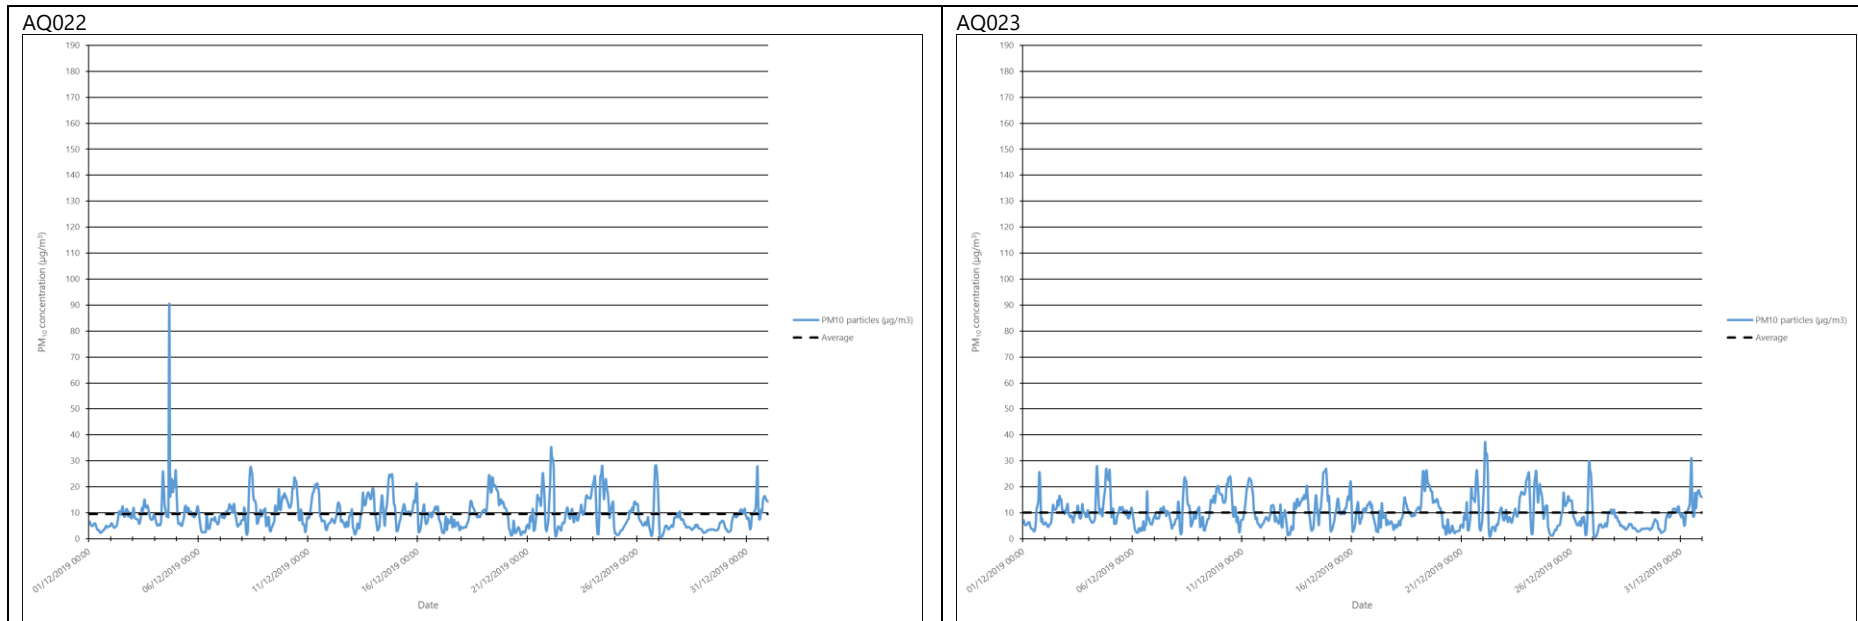


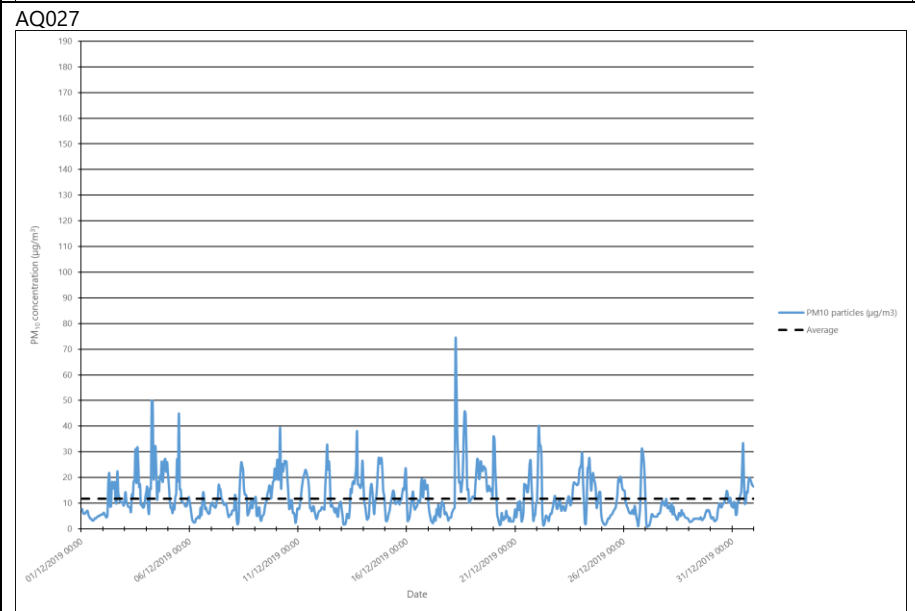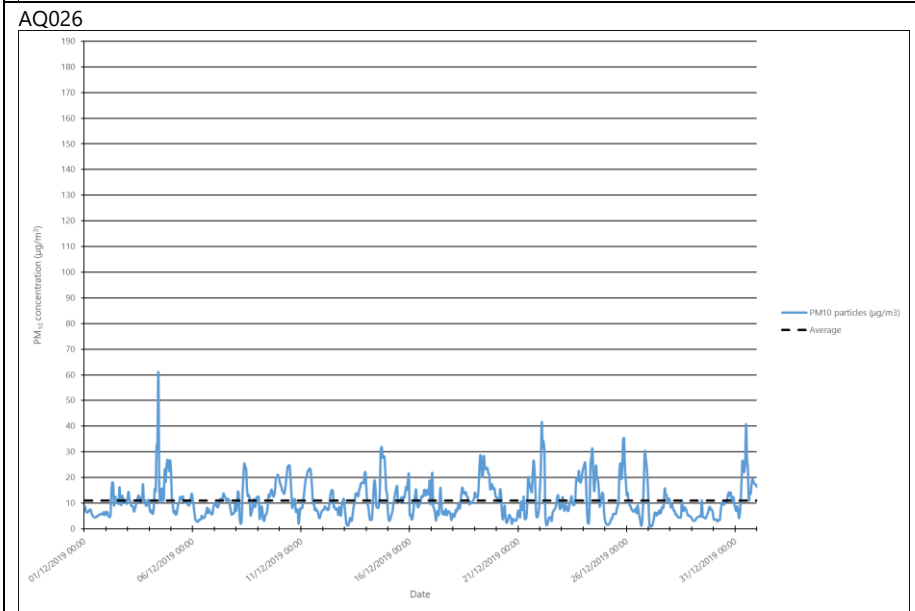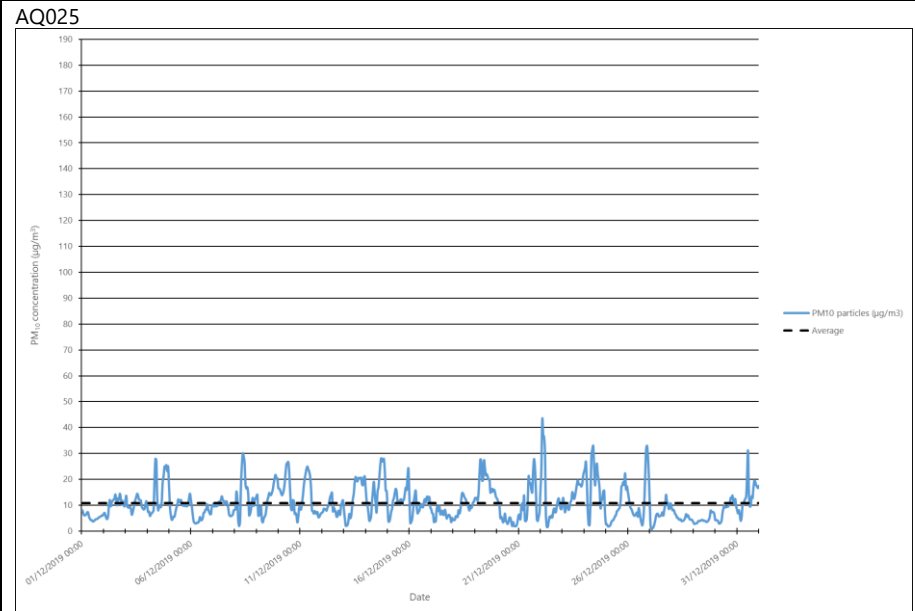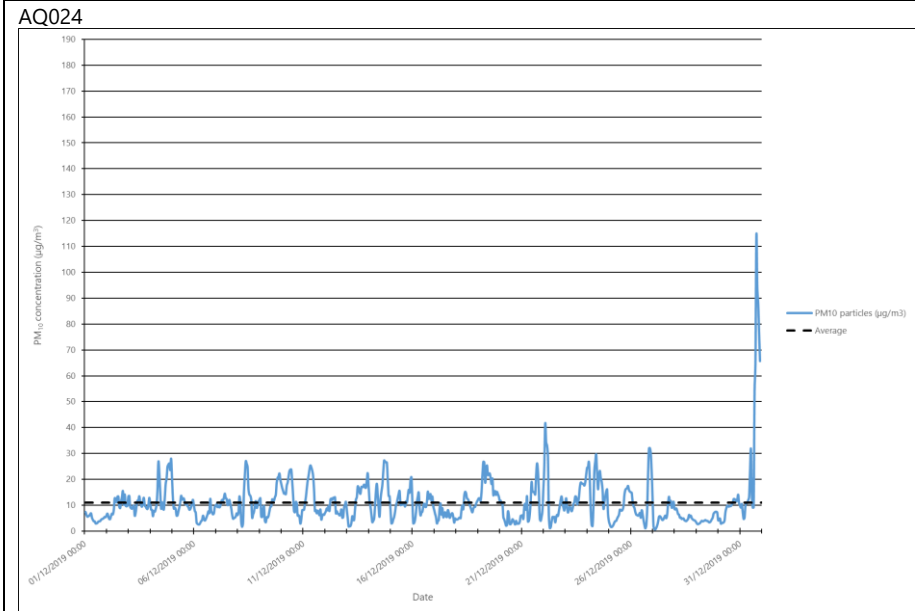

AQ028

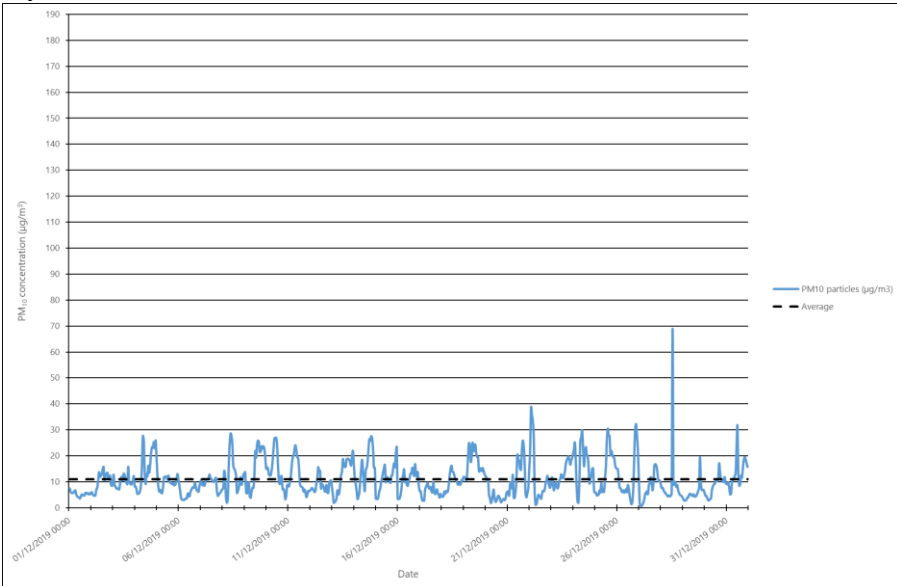

AQ032

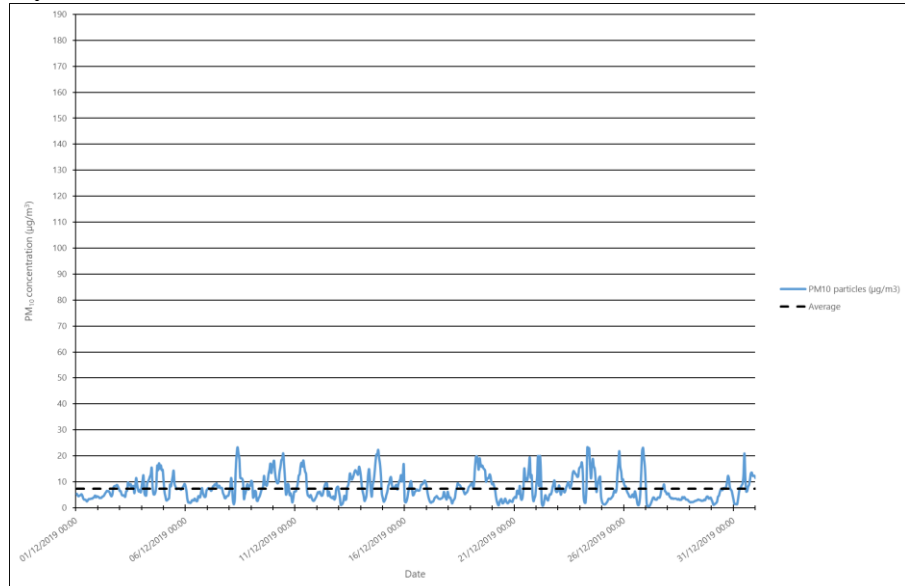

AQ037 – NO DATA

Appendix C – Air Quality Monitoring Results

Table 3 NO₂ monitoring locations around highways, NO₂ concentrations and monthly monitoring results with running mean for 2019 (µg/m³)

Monitoring Site ID	Location description	Coordinates (X, Y)	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Mean ¹
HS2-000020BN5	Sign post on Victoria Road	521443, 182477	63	64	Tube missing	54	38	42	Tube missing	44	48	49	56		51
HS2-000020BN7	The Approach street sign	520959, 181102	75	77	66	47	46	27	49	59	53	53	Tube missing		55
HS2-000020BQF	Conway Drive sign post	520856, 181733	69	68	61	59	50	50	48	49	50	58	59		57
HS2-000020BQG	Lamp post outside No 1. Wells House Road on Old Oak Common Lane	521312, 182033	69	63	60	49	42	50	41	41	47	51	55		52
HS2-000020BP6	Triplicate site next to the Ealing, Western Avenue Acton roadside automatic monitoring station	520430, 181950	68	64	54	45	42	55	45	51	56	53	57		54
HS2-000020BP7	Triplicate site next to the Ealing, Hangar Lane Gyrotory roadside automatic monitoring station	518537, 182708	83	80	74	49	56	68	63	73	67	66	59		67

¹ Note: to aid interpretation and conform with best practice, the monthly measurements in this table are reported rounded to the nearest whole number. The annual mean presented here is calculated based on laboratory data to 4 significant figures, rounded to a whole number, and therefore may differ slightly to a mean derived from averaging the rounded monthly measurements in the table.