

Construction noise and vibration Monthly Report – June 2021

London Borough of Brent

© HS2 Ltd. gov.uk/hs2

| No | n-Techni | cal Summary | 1 | | | | |
|--|------------|---|--------|--|--|--|--|
| Abl | breviatio | ons and Descriptions | 2 | | | | |
| 1 | Intro | duction | 3 | | | | |
| | 1.2 | Measurement Locations | 4 | | | | |
| 2 | Sum | mary of Results | 5 | | | | |
| | 2.1 | Summary of Measured Noise Levels | 5 | | | | |
| | 2.2 | Exceedances of the SOAEL | 7 | | | | |
| | 2.3 | Exceedances of Trigger Level | 8 | | | | |
| | 2.4 | Complaints | 9 | | | | |
| Apı | pendix A | Site Locations | 10 | | | | |
| Apı | pendix B | Monitoring Locations | 12 | | | | |
| Apı | pendix C | Data | 14 | | | | |
| | | | | | | | |
| List | t of table | es | | | | | |
| Tab | ole 1: Tab | le of Abbreviations | 2 | | | | |
| | | nitoring Location | 4 | | | | |
| | | nmary of Measured dB L _{Aeq} Data over the Monitoring Period | 6 | | | | |
| | | nmary of Measured PPV Data over the Monitoring Period | 7 8 | | | | |
| Table 5: Summary of Exceedances of SOAEL | | | | | | | |
| | | nmary of Total Exceedances of SOAEL | 8 | | | | |
| | | nmary of Exceedances of Trigger Levels | 9 | | | | |
| Idl | ne 8. Sult | nmary of Complaints | 9 | | | | |

Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise monitoring carried out within the London Borough of Brent (LBB) area during the month of June 2021.

Noise and vibration monitoring were undertaken in the vicinity of the Canterbury Road Vent Shaft worksite (ref: CRVS), where the following activities were underway:

- construction of ground slab sections and working platforms;
- installation of gullies;
- removal of trees on the east boundary;
- reinstatement works to a garden at northeast site boundary;
- electricity cable installation for existing welfare units;
- installation fixing rails for new welfare units;
- excavations by hand for removal of a fox den;
- removal of sections of concrete slabs and digging of ground to remove obstructions for sheet piling;
- hoarding works;
- installation of additional generators and high voltage transformer;
- preparation works for removal of existing small capacity generators; and
- rendering repairs.

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (https://www.gov.uk/government/publications/hs2-information-papers-environment), were exceeded on two occasions due to HS2 works in the Local Authority Area during June 2021.

There were no exceedances of trigger levels as defined in Section 61 consents during the reporting period at any monitoring position.

Two complaints were received during the monitoring period. A description of complaints, the results of investigations and any actions taken are detailed in Table 8 of this report.

Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

| Acronym/Term | Definition |
|--|--|
| L _{Aeq,T} | See equivalent continuous sound pressure level |
| Ambient sound | A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$ |
| Decibel(s), or dB | Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB. |
| Decibel(s) A- weighted, or dB(A) | The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'. |
| Equivalent continuous sound pressure level, or L _{Aeq,T} | An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level. |
| Exclusion of data | Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded. |
| Façade | A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +2.5 to +3 dB) sound level than it would be if the reflecting surface was not there. |
| Free-field | A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position. |
| LOAEL | Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected. |
| Peak particle velocity, or PPV | Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s. |
| SOAEL | Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur. |
| Sound pressure level | The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud. |
| Vibration dose value, or VDV | An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in m/s ^{1.75} . |

1 Introduction

- 1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:
 - monitoring the impact of construction works;
 - to investigate complaints, incidents and exceedance of trigger levels; or
 - monitoring the effectiveness of noise and vibration control measures.
- 1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the London Borough of Brent (LBB) area for the period 1st to 30th June 2021.
- 1.1.3 There was one active construction site in the local authority area, where monitoring was undertaken, during this period:
 - Canterbury Road Vent Shaft worksite ref.: CRVS (see plan 1 in Appendix A), where work activities included:
 - construction of ground slab sections and working platform;
 - installation of gullies;
 - removal of trees at east boundary;
 - reinstatement works to a garden at northeast boundary;
 - electricity cable installation for existing welfare units;
 - installation fixing rails for new welfare units;
 - excavations by hand for removal of a fox den;
 - removal of sections of concrete slabs and digging of ground along a section of the eastern boundary to remove obstructions for sheet piling;
 - hoarding works;

- installation of additional generators and high voltage transformer;
- preparation works for removal of existing small capacity generators; and
- rendering repairs within the south-eastern part of the site.
- 1.1.4 The applicable standards, guidance, and monitoring methodology are outlined in the construction noise and vibration monitoring methodology report which can be found at the following location https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2. Noise and vibration monitoring reports for previous months can also be found at this location.

1.2 Measurement Locations

- 1.2.1 Three noise and one vibration monitoring installations were active in June in the LBB area. Table 2 summarises the positions of the noise monitoring installations within the LBB area in June 2021.
- 1.2.2 A map showing the positions of the noise monitoring installations is presented in Appendix B.

Table 2: Monitoring Location

| Worksite Reference | Measurement Reference | Address |
|-----------------------|--------------------------|--|
| CRVS | N053 | St Mary's Catholic Primary School, Canterbury Road, London NW6 5ST |
| | N054 | Canterbury House, Canterbury Road, London NW6 5ST |
| | N055 | Carlton House, Canterbury Terrace, London NW6 5DY |
| | V061 | St Mary's Catholic Primary School, Canterbury Road, London NW6 5ST |

2 Summary of Results

2.1 Summary of Measured Noise Levels

2.1.1 Table 3 presents a summary of the measured noise levels at the monitoring location over the reporting period. The $L_{Aeq,T}$ is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period $L_{Aeq,T}$ that was found to occur within the month.

Table 3: Summary of Measured dB L_{Aeq} Data over the Monitoring Period

| Worksite Reference | Measurement Reference | Site Address | Free-field or Façade measurement | | | y Avera est day | | , | | Saturda (high | y Avera est day | | | Pul Holi Averag | day / blic iday ge L _{Aeq,T} est day |
|-----------------------|--------------------------|---|--|----------------|----------------|--------------------|----------------|----------------|----------------|------------------|--------------------|----------------|----------------|-----------------------|---|
| | | | | 0700 - 0800 | 0800 - 1800 | 1800 - 1900 | 1900 - 2200 | 2200 - 0700 | 0700 - 0800 | 0800 - 1300 | 1300 - 1400 | 1400 - 2200 | 2200 - 0700 | 0700 - 2200 | 2200 - 0700 |
| CRVS | N053 | St Mary's Catholic Primary School, Canterbury Road, London | Free-field | 56.7 (57.9) | 70.1 (77.6) | 56.9 (70.9) | 56.4 (60.6) | 52.9 (57.6) | 56.8 (58.6) | 62.2 (70.3) | 55.6 (57.8) | 54.7 (58.3) | 49.5 (57.5) | 54.4 (62.4) | 53.0 (56.9) |
| | N054 | Canterbury House, Canterbury Road, London | Free-field | 60.2 (62.9) | 63.6 (66.6) | 56.8 (60.1) | 55.5 (59.2) | 56.3 (62.4) | 60.3 (61.3) | 60.9 (62.4) | 59.3 (60.1) | 57.2 (59.8) | 56.6 (61.0) | 58.4 (64.3) | 57.4 (61.9) |
| | N055 | Carlton House, Canterbury Terrace, London | Free-field | 58.7 (60.5) | 61.0 (70.6) | 59.6 (61.0) | 59.5 (61.6) | 54.5 (59.7) | 58.4 (59.6) | 58.4 (59.5) | 57.5 (59.2) | 57.0 (59.7) | 48.0 (57.7) | 55.9 (62.2) | 53.5 (57.3) |

2.1.2 Table 4: Summary of Measured PPV Data over the Monitoring Period presents a summary of the measured vibration levels at each monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

| Worksite Reference | Measurement Reference | Monitor Address | Highest PPV measured in any axis, mm/s |
|-----------------------|--------------------------|---|--|
| CRVS | V061 | St Mary's Catholic Primary School, Canterbury Road, | 5.46 (Z-axis) |
| | | London | |

Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly L_{Aeq} values and, where relevant, the L_{Aeq,T} values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location: https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data.

2.2 Exceedances of the SOAEL

- 2.2.1 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."
- 2.2.2 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.
- 2.2.3 Where reported construction noise levels exceed the SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.4 Table 5 presents a summary of recorded exceedances of the SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of SOAEL

| Worksite Reference | Measurement Site Address Reference | | Day (Weekday, Saturday, Sunday, Night) | Time period | Number of exceedances of SOAEL |
|-----------------------|------------------------------------|---|--|-------------|--------------------------------|
| CRVS | N053 | St Mary's Catholic Primary School, Canterbury Road, London | Weekday | 8:00-18:00 | 2 |
| | N054 | Canterbury House, Canterbury Road, London | All days | All periods | No exceedance |
| | N055 | Carlton House, Canterbury Terrace, London | All days | All periods | No exceedance |

2.2.5 For the purpose of assessing eligibility for noise insulation or temporary rehousing, multiple exceedances of the SOAEL in a 24-hour period would be counted as a single exceedance during that day. Over the reporting period, the overall number of SOAEL exceedances at each measurement location is shown in Table 6 and may be lower than the total sum of individual exceedances reported in Table 5 for each location.

Table 6: Summary of Total Exceedances of SOAEL

| Worksite Reference | Measurement Reference | Monitor Address | Total of SOAEL exceedances in the month |
|-----------------------|--------------------------|---|---|
| CRVS | N053 | St Mary's Catholic Primary School, Canterbury Road, London | 2 |

2.2.6 Two exceedances of the SOAEL were recorded due to HS2 construction works during June 2021 at monitoring location N053 during weekday periods as a result of felling trees on the site boundary near the monitor.

2.3 Exceedances of Trigger Level

2.3.1 Table 7 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 7: Summary of Exceedances of Trigger Levels

| Complaint Reference Number (if applicable) | Worksite Reference | Date and Time Period | Identified Source | Results of Investigation (including noise monitoring results) | Actions Taken |
|---|-----------------------|----------------------------|----------------------|--|---------------|
| - | - | - | - | - | - |

2.4 Complaints

2.4.1 Table 8 provides a summary of complaint information related to noise received during the reporting period, along with the findings of any investigation.

Table 8: Summary of Complaints

| Complaint Reference Number | Worksite Reference | Description of Complaint | Results of Investigation | Actions Taken |
|----------------------------------|-----------------------|--|---|--|
| HS2-21-42067-C | CRVS | Complaint due to construction noise on a Saturday morning | Due to permitted ongoing works. | Contractor spoke to stakeholder and advised would follow up. Since then stakeholder has been contacted twice and advises situation has improved. |
| HS2-21-42078-C | CRVS | Complaint due to construction noise early in the morning from around 5am | The contractor was not working in the area at the date and time of the complaint. | The contractor has also verified with Network Rail that they were not working in the area. Results of the investigation confirmed back to stakeholder. |

Appendix A Site Locations

OFFICIAL

HS2

Worksite identification plan - 1



OFFICIAL

Appendix B Monitoring Locations



Noise monitoring plan - 1




OFFICIAL


Appendix C Data


Noise


The following graphs show the hourly measured ambient noise level $L_{Aeq,1h}$ and, where relevant, the averaged noise level $L_{Aeq,T}$ values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the $L_{Aeq,T}$ values in Table 3 of the main report.


Worksite: CRVS - Monitoring Ref: N053

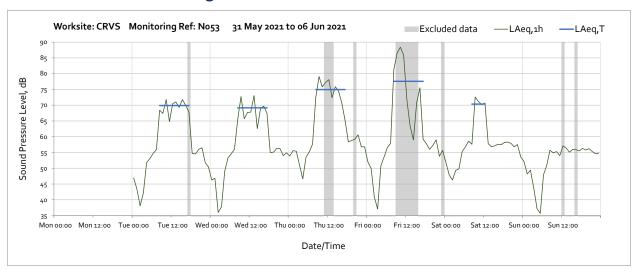

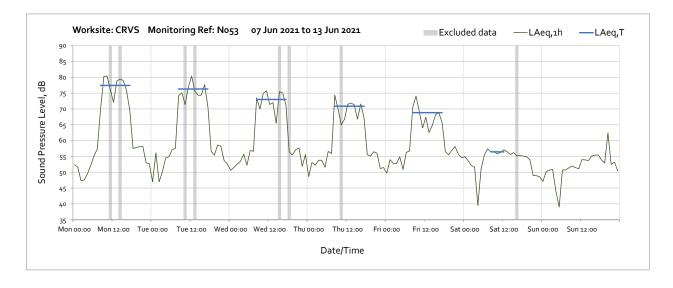


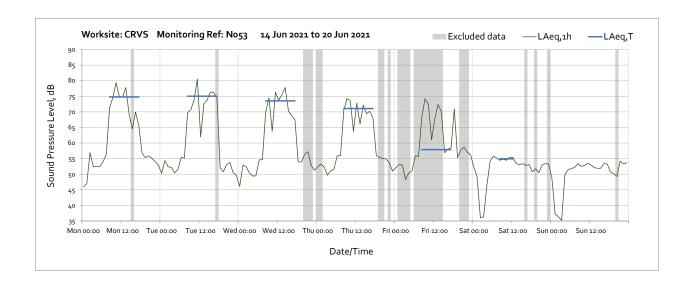


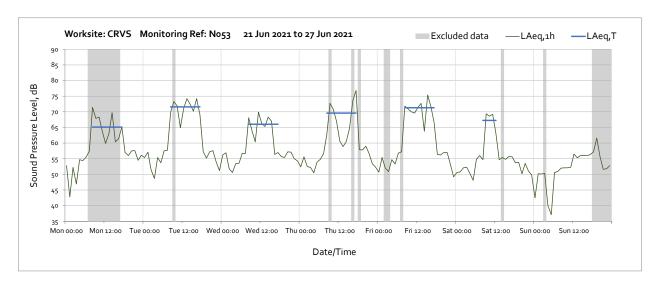


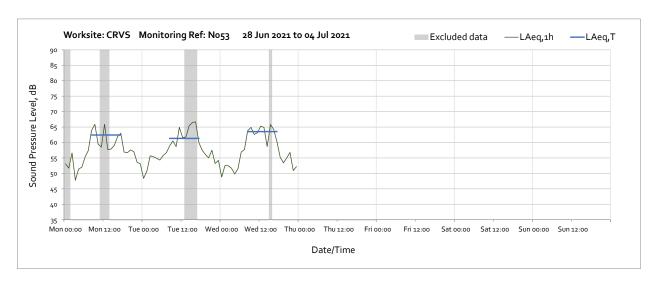



Worksite: CRVS - Monitoring Ref: N054

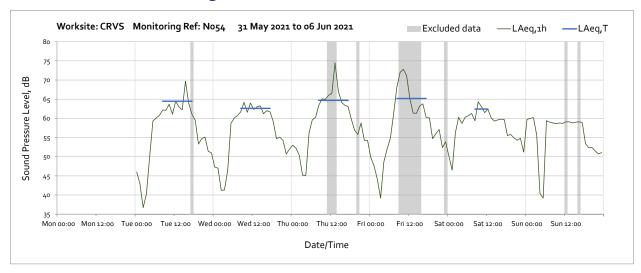

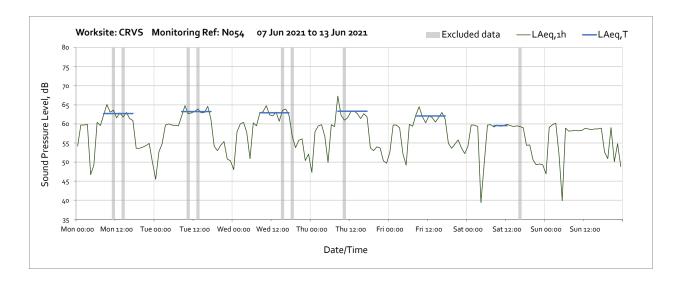


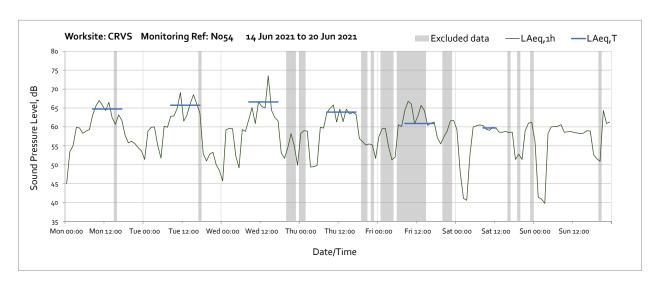


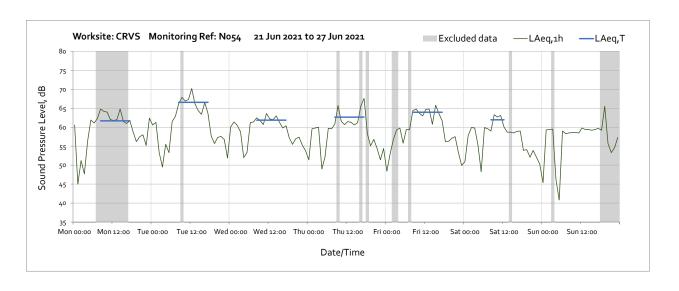


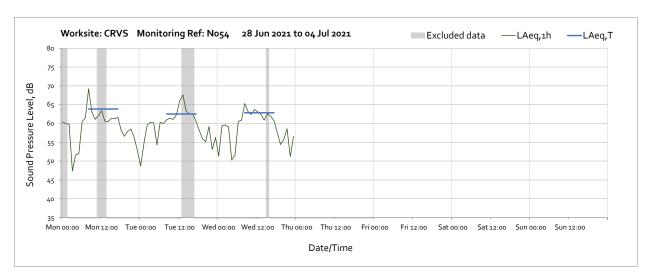



Worksite: CRVS - Monitoring Ref: N055

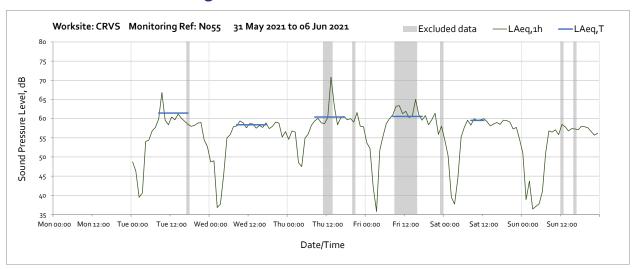

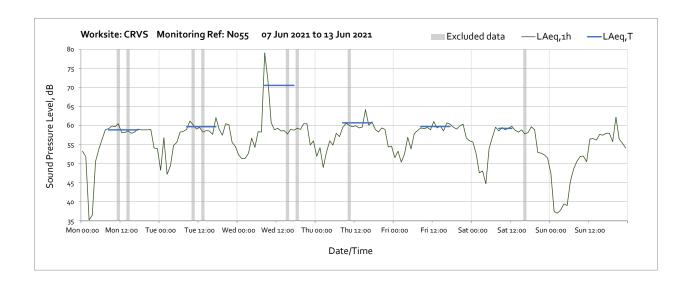

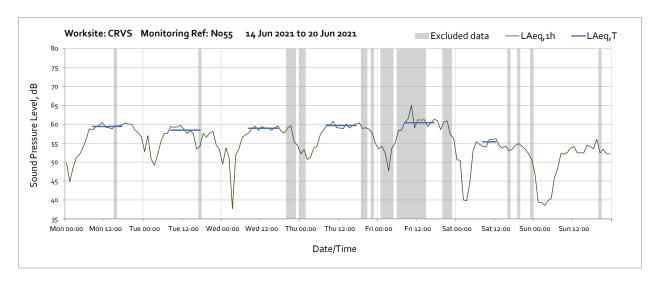

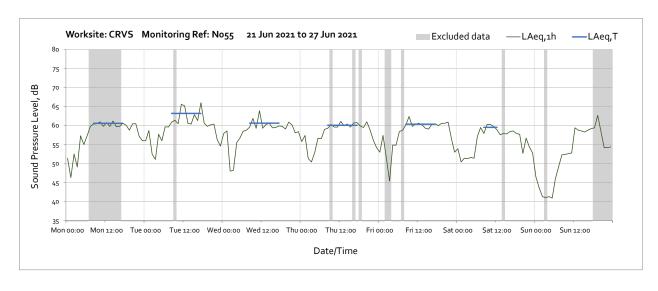

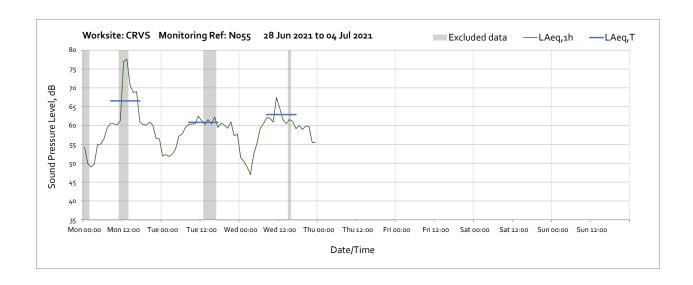

Vibration

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axis x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.

