

# **Construction Noise and Vibration Monthly Report – June 2022**

**Solihull Metropolitan Borough Council** 

© HS2 Ltd. gov.uk/hs2

| Non-Techni    | cai Summary   | 1  |
|---------------|---|----|
| Abbreviation  | ons and Descriptions  | 2  |
| 1 Intro       | oduction  | 3  |
| 1.2           | Measurement Locations   | 4  |
| 2 Sum         | mary of Results   | 6  |
| 2.1           | Summary of Measured Noise Levels                                      | 6  |
| 2.2           | Exceedances of the LOAEL and SOAEL                                    | 9  |
| 2.3           | Exceedances of Trigger Level  | 11 |
| 2.4           | Complaints  | 12 |
| Appendix A    | Site Locations  | 13 |
| Appendix B    | Monitoring Locations  | 20 |
| Appendix C    | Data  | 26 |
|               |   |    |
|               |   |    |
| List of table | es ·  |    |
| Table 1: Tab  | le of Abbreviations   | 2  |
| Table 2: Moi  | nitoring Locations  | 5  |
|               | nmary of Measured dB L <sub>Aeq</sub> Data over the Monitoring Period | 7  |
| Table 4: Sun  | nmary of Measured PPV Data over the Monitoring Period                 | 9  |
|               | nmary of Exceedances of LOAEL and SOAEL                               | 10 |
| Table 6: Sun  | nmary of Total Exceedances of SOAEL                                   | 11 |
| Table 7: Sun  | nmary of Exceedances of Trigger Levels                                | 11 |
| Table 8: Sun  | nmary of Complaints   | 12 |

### **Non-Technical Summary**

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within the Solihull Metropolitan Borough Council (SMBC) during the month of June 2022.

Within this period monitoring was undertaken at the following worksites:

- Noise monitoring was undertaken in the vicinity of the Blythe Bypass Embankment Worksite (ref.: BBE), where no works to place during the monitoring period.
- Noise monitoring was undertaken in the vicinity of the A452 compound (ref.: A452),
   where pond installation and drainage works were underway.
- Noise monitoring was undertaken in the vicinity of the Park Lane Worksite (ref.: PL)
  where earthworks, stockpiling, drainage and ditch works, and fencing were
  underway.
- Noise and Vibration monitoring was undertaken in the vicinity of the Balsall Common Viaduct Worksite (ref.: BCV) where piling was underway.
- Noise monitoring was undertaken in the vicinity of the Carol Green Rail Underbridge Worksite (ref.: CGRU), where excavation, soil stabilisation working platform constrction, drainage installation, topsoil stripping, and stone laying were underway.
- Noise and vibration monitoring were undertaken in the vicinity of the Waste Lane Overbridge and Satellite Worksite (ref.: WLOS), where installation of cables and anchors, utility surveys, drilling of boreholes, excavation works, piling works, concrete pouring and waste removal from site were underway.

There was one (1) exceedance of the HS2 threshold levels for significant noise impacts during the reporting period at any monitoring position.

There were no exceedances of trigger levels as defined in Section 61 consents during the reporting period at any monitoring position.

No complaints were received during the monitoring period. A description of complaints, the results of investigations and any actions taken are detailed in Table 8 of this report.

# **Abbreviations and Descriptions**

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

| Acronym/Term   | Definition   |
|--|--|
| L <sub>Aeq,T</sub>   | See equivalent continuous sound pressure level   |
| Ambient sound  | A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$   |
| Decibel(s), or dB  | Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.  |
| Decibel(s) A-<br>weighted, or<br>dB(A)                                     | The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.   |
| Equivalent<br>continuous<br>sound pressure<br>level, or L <sub>Aeq,T</sub> | An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.   |
| Exclusion of data  | Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded. |
| Façade   | A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.   |
| Free-field   | A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.   |
| LOAEL  | Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.  |
| Peak particle<br>velocity, or PPV  | Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.   |
| SOAEL  | Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.   |
| Sound pressure<br>level  | The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.  |
| Vibration dose<br>value, or VDV  | An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in m/s <sup>1.75</sup> .         |

### 1 Introduction

- 1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:
  - monitoring the impact of construction works;
  - to investigate complaints, incidents and exceedance of trigger levels; or
  - monitoring the effectiveness of noise and vibration control measures.
- 1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the Solihull Metropolitan District (SMBC) for the period 1<sup>st</sup> to 30<sup>th</sup> June 2022.
- 1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:
  - Blythe Bypass Embankment worksite, reference BBE (see plan 1 in Appendix A), where no works took place during the monitoring period.
  - A452 worksite, reference A452 (see plan 2 in Appendix A), where work activities included:
    - pond installation; and
    - drainage works.
  - Park Lane worksite, reference PL (see plan 3 in Appendix A), where work activities included:
    - earthworks;
    - stockpiling;
    - drainage and ditch works; and
    - fencing.

- Balsall Common Viaduct worksite, reference BCV (see plan 4 in Appendix A), where work activities included piling works.
- Carol Green Rail Underbridge worksite, reference CGRU (see plan 4 in Appendix A), where work activities included:
  - excavation;
  - soil stabilisation;
  - working platform construction;
  - drainage installation;
  - topsoil stripping; and
  - stone laying.
- Waste Lane Overbridge and Satellite worksite, reference WLOS (see plan 5 in Appendix A), where work activities included:
  - installation of cables and anchors;
  - utility survey by digging trial holes and reinstating tarmac;
  - borehole drilling;
  - excavation for water pipe installation and temporary stone ramp;
  - secant piling;
  - concrete pouring; and
  - waste removal from platforms.
- 1.1.4 Applicable standards, guidance, and monitoring methodology are outlined in the construction noise and vibration monitoring methodology report which can be found at the following location

  <a href="https://www.gov.uk/government/collections/monitoring-the-environmental-effects-">https://www.gov.uk/government/collections/monitoring-the-environmental-effects-</a>

of-hs2. Noise and vibration monitoring reports for previous months can also be found at this location.

#### 1.2 Measurement Locations

- 1.2.1 Eleven (11) noise and two (2) vibration monitoring installations were active in June in the SMBC area. Table 2 summarises the position of noise and vibration monitoring installations within the SMBC area in June 2022.
- 1.2.2 An additional noise monitor, ref.: BBE-1, was installed in proximity of Blythe Bypass Embankment worksite (worksite ref.: BBE) on the 21<sup>st</sup> of June.

- 1.2.3 Construction works at WP062 worksite were completed in the month of May. The noise monitors WP062-1 and WP062-2 were therefore removed on 31<sup>st</sup> May 2022.
- 1.2.4 Maps showing the position of noise monitoring installations are presented in Appendix B.

Table 2: Monitoring Locations

| Worksite Reference                | Measurement<br>Reference | Address  |  |  |  |
|-----------------------------------|--------------------------|--|--|--|--|
| Blythe Bypass<br>Embankment (BBE) | BBE-1                    | Patrick Farm House, Meriden Road, Hampton in Arden           |  |  |  |
| A452 compound                     | A452-1                   | Marsh House Farm, Brandocks Marsh, Solihull                  |  |  |  |
| Park Lane                         | PL-1                     | Park Lane, Balsall Common, Solihull                          |  |  |  |
|                                   | PL-2                     | The Laurel, Lavender Hall Lane, Balsall Common, Solihull     |  |  |  |
|                                   | PL-3                     | Holly Acre Lodge, Kenilworth Road, Solihull                  |  |  |  |
|                                   | PL-4                     | Top Lodge, Kenilworth Road, Solihull                         |  |  |  |
| Balsall Common Viaduct            | BCV-1                    | Cherry Tree Cottage, Truggist Lane, Balsall Common, Solihull |  |  |  |
| Carol Green Rail<br>Underbridge   | CGRU-1                   | The Stables, Truggist Lane, Balsall Common, Solihull         |  |  |  |
| Waste Lane Overbridge             | WLOS-1                   | 19 Hodgetts Lane, Burton Green, Warwickshire                 |  |  |  |
| and Satellite                     | WLOS-2                   | Little Beanitt Farm, Waste Lane, Balsall Common, Solihull    |  |  |  |
|                                   | WLOS-3                   | Dragonflies, Waste Lane, Balsall Common, Solihull            |  |  |  |
|                                   | WLOS-V1                  | 19 Hodgetts Lane, Burton Green, Warwickshire                 |  |  |  |
|                                   | WLOS-V2                  | Little Beanitt Farm, Waste Lane, Balsall Common, Solihull    |  |  |  |

### 2 Summary of Results

#### 2.1 Summary of Measured Noise Levels

2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The  $L_{Aeq,T}$  is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period  $L_{Aeq,T}$  that was found to occur within the month.

Table 3: Summary of Measured dB L<sub>Aeq</sub> Data over the Monitoring Period

| Worksite<br>Reference       | Measurement<br>Reference | Site Address          | Free-Field or<br>Façade<br>Measurement | Weekday Average L <sub>Aeq,Т</sub><br>(Highest Day L <sub>Aeq,Т</sub> ) |                | Saturday Average L <sub>Aeq,T</sub><br>(Highest Day L <sub>Aeq,T</sub> ) |                |                |                | Sunday / Public Holiday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> ) |                |                |                |                |                |
|-----------------------------|--------------------------|-----------------------|--|---|----------------|--|----------------|----------------|----------------|--|----------------|----------------|----------------|----------------|----------------|
|                             |                          |                       |  | 0700 -<br>0800  | 0800 -<br>1800 | 1800 -<br>1900   | 1900 -<br>2200 | 2200 -<br>0700 | 0700 -<br>0800 | 0800 -<br>1300   | 1300 -<br>1400 | 1400 -<br>2200 | 2200 -<br>0700 | 0700 -<br>2200 | 2200 -<br>0700 |
| Blythe Bypass<br>Embankment | BBE-1                    | Patrick Farm<br>House | Free-field                             | 54.5  | 55.8           | 53.6   | 51.1           | 48.6           | 53.1           | 53.2   | 52.9           | 53.3           | 47.3           | 53.6           | 48.0           |
|                             |                          |                       |  | (55.7)  | (60.5)         | (54.6)   | (53.4)         | (55.3)         | (53.1)         | (53.2)   | (52.9)         | (55.1)         | (53.6)         | (57.0)         | (53.5)         |
| A452                        | A452-1 Marsh House       |                       | Free-field                             | 49.7  | 55.4           | 52.0   | 48.3           | 46.2           | 50.1           | 50.2   | 49.4           | 49.6           | 44.5           | 49.2           | 46.5           |
| Compound                    |                          | Farm                  |  | (53.5)  | (60.0)         | (67.2)   | (52.3)         | (52.4)         | (52.7)         | (52.5)   | (51.9)         | (52.7)         | (52.3)         | (55.2)         | (54.3)         |
| Park Lane                   | PL-1                     | Park Lane             | Free-field                             | 55.0  | 61.3           | 50.2   | 48.0           | 46.0           | 55.2           | 55.3   | 51.8           | 51.6           | 44.6           | 48.4           | 45.4           |
|                             |                          |                       |  | (60.6)  | (65.5)         | (56.8)   | (56.4)         | (63.0)         | (61.6)         | (60.2)   | (54.3)         | (58.3)         | (50.6)         | (56.1)         | (54.2)         |
|                             | PL-2                     | The Laurel            | Free-field                             | 47.0  | 48.2           | 46.5   | 45.9           | 43.1           | 48.0           | 48.9   | 47.7           | 47.8           | 43.3           | 45.9           | 42.7           |
|                             |                          |                       |  | (49.2)  | (53.4)         | (55.0)   | (52.9)         | (51.4)         | (50.6)         | (50.8)   | (49.3)         | (52.5)         | (51.2)         | (49.6)         | (49.9)         |
|                             | PL-3                     | Holly Acre Lodge      | Free-field                             | 52.5  | 57.8           | 55.6   | 50.2           | 47.1           | 51.7           | 52.8   | 52.0           | 51.9           | 46.0           | 50.4           | 46.5           |
|                             |                          |                       |  | (56.6)  | (60.0)         | (62.4)   | (54.2)         | (53.9)         | (53.7)         | (56.1)   | (53.7)         | (56.5)         | (52.0)         | (55.7)         | (53.1)         |
|                             | PL-4                     | Top Lodge             | Free-field                             | 60.0  | 61.8           | 57.6   | 55.6           | 53.3           | 56.1           | 61.8   | 59.3           | 57.5           | 52.6           | 57.3           | 52.6           |
|                             |                          |                       |  | (62.4)  | (65.8)         | (59.3)   | (64.5)         | (74.0)         | (58.0)         | (71.0)   | (61.1)         | (60.1)         | (59.9)         | (60.9)         | (57.9)         |
| Balsall                     | BCV-1                    | Cherry Tree           | Free-field                             | 51.5  | 56.5           | 51.1   | 50.8           | 48.3           | 51.7           | 53.7   | 49.8           | 50.3           | 44.9           | 51.1           | 47.4           |
| Common<br>Viaduct           |                          | Cottage               |  | (54.7)  | (65.5)         | (53.9)   | (59.2)         | (55.2)         | (55.4)         | (55.5)   | (51.3)         | (54.5)         | (50.7)         | (62.7)         | (52.6)         |
|                             | CGRU-1                   | The Stables           | Free-field                             | 48.6  | 54.5           | 48.7   | 48.3           | 46.6           | 48.0           | 52.0   | 50.4           | 49.4           | 43.2           | 48.5           | 45.2           |

| Worksite<br>Reference                     | Measurement<br>Reference | Site Address         | Free-Field or<br>Façade<br>Measurement | Weekday Average L <sub>Aeq,T</sub> Saturday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> ) (Highest Day L <sub>Aeq,T</sub> ) |                | г              | Pul<br>Holi<br>Averag<br>(Highe | day /<br>blic<br>iday<br>ge L <sub>Aeq,T</sub><br>est Day |                |                |                |                |                |                |                |
|---|--------------------------|----------------------|--|--|----------------|----------------|---------------------------------|---|----------------|----------------|----------------|----------------|----------------|----------------|----------------|
|   |                          |                      |  | 0700 -<br>0800   | 0800 -<br>1800 | 1800 -<br>1900 | 1900 -<br>2200                  | 2200 -<br>0700  | 0700 -<br>0800 | 0800 -<br>1300 | 1300 -<br>1400 | 1400 -<br>2200 | 2200 -<br>0700 | 0700 -<br>2200 | 2200 -<br>0700 |
| Carol Green<br>Rail<br>Underbridge        |                          |                      |  | (52.7)   | (58.0)         | (52.6)         | (53.7)                          | (55.8)  | (51.9)         | (53.9)         | (53.2)         | (55.3)         | (56.4)         | (58.2)         | (51.5)         |
| Waste Lane<br>Overbridge<br>and Satellite | WLOS-1                   | 19 Hodgetts<br>Lane  | Façade                                 | 51.2<br>(53.9)   | 67.3<br>(77.0) | 47.8<br>(67.6) | 49.2<br>(56.8)                  | 47.8<br>(56.9)  | 55.8<br>(59.6) | 63.5<br>(75.5) | 45.9<br>(48.2) | 47.8<br>(50.9) | 47.8<br>(53.6) | 47.4<br>(52.4) | 48.9<br>(56.8) |
| WP062                                     | WLOS-2                   | Waste Lane<br>(East) | Façade                                 | 51.5<br>(56.7)   | 55.0<br>(60.0) | 49.5<br>(53.6) | 49.0<br>(53.7)                  | 47.1<br>(56.9)  | 49.2<br>(50.5) | 52.0<br>(52.7) | 49.9<br>(51.7) | 50.0<br>(54.9) | 45.6<br>(53.7) | 49.2<br>(55.8) | 47.8<br>(55.7) |
|   | WLOS-3                   | Waste Lane<br>(West) | Free-field                             | 58.7<br>(60.3)   | 59.2<br>(60.4) | 57.7<br>(59.6) | 54.9<br>(61.5)                  | 49.5<br>(57.0)  | 54.6<br>(55.5) | 58.5<br>(59.3) | 58.8<br>(59.7) | 57.3<br>(62.4) | 48.9<br>(55.0) | 56.1<br>(59.4) | 49.3<br>(55.9) |

2.1.2 Table 4 presents a summary of the measured vibration levels at the monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

| Worksite<br>Reference | Measurement<br>Reference | Monitor Address   | Highest PPV measured in any axis, mm/s |
|-----------------------|--------------------------|---|--|
| WLOS                  | WLOS-V1                  | 19 Hodgetts Lane, Burton Green,<br>Warwickshire, CV8 1PH                            | 3.20 (X-axis)                          |
|                       | WLOS-V2                  | Little Beanitt Farm, Waste Lane,<br>Berkswell, Balsall Common, Solihull,<br>CV7 7GH | 1.06 (X-axis)                          |

2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly L<sub>Aeq</sub> values and, where relevant, the L<sub>Aeq,T</sub> values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location: <a href="https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data">https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data</a>.

#### 2.2 Exceedances of the LOAEL and SOAEL

- 2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".
- 2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."

- 2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.
- 2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

| Worksite<br>Reference                     | Measure<br>ment<br>Reference | Site<br>Address           | Day<br>(Weekday<br>,<br>Saturday,<br>Sunday,<br>Night) | Time period                         | Number of exceedances of LOAEL | Number of exceedances of SOAEL      |
|---|------------------------------|---------------------------|--|-------------------------------------|--------------------------------|-------------------------------------|
| Blythe Bypass<br>Embankment               | BBE-1*                       | Patrick<br>Farm<br>House  | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
| A452 Compound                             | A452-1*                      | Marsh<br>House<br>Farm    | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
| Park Lane                                 | PL-1*                        | Park Lane                 | Weekday  | 0800-1800                           | 6                              | No exceedance                       |
|   | PL-2*                        | The Laurel                | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
|   | PL-3*                        | Holly Acre<br>Lodge       | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
|   | PL-4                         | Top Lodge                 | Weekday<br>Saturday<br>Night                           | 0800-1800<br>0800-1300<br>2200-0700 | 2<br>1<br>7                    | No exceedance<br>No exceedance<br>5 |
| Balsall Common<br>Viaduct                 | BCV-1*                       | Cherry<br>Tree<br>Cottage | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
| Carol Green Rail<br>Underbridge           | CGRU-1*                      | The<br>Stables            | All Days   | All Periods                         | No exceedance                  | No exceedance                       |
| Waste Lane<br>Overbridge and<br>Satellite | WLOS-1*                      | 19<br>Hodgetts<br>Lane    | Weekday  | 0800-1800                           | 2                              | No exceedance                       |
|   | WLOS-2                       | Waste<br>Lane (East)      | All Days   | All Periods                         | No exceedance                  | No exceedance                       |

| Worksite<br>Reference | Measure<br>ment<br>Reference | Site<br>Address         | Day<br>(Weekday<br>,<br>Saturday,<br>Sunday,<br>Night) | Time period | Number of exceedances of LOAEL | Number of exceedances of SOAEL |
|-----------------------|------------------------------|-------------------------|--|-------------|--------------------------------|--------------------------------|
|                       | WLOS-3                       | Waste<br>Lane<br>(West) | All Days   | All Periods | No exceedance                  | No exceedance                  |

<sup>\*</sup>A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

- 2.2.6 Exceedances of the LOAEL were recorded at Three (3) monitoring locations, where a total of Eighteen (18) LOAEL exceedances were measured during June 2022. LOAEL exceedances were recorded during weekdays, Saturdays and during night-time.
- 2.2.7 For the purpose of assessing eligibility for noise insulation or temporary rehousing, multiple exceedances of the SOAEL in a 24-hour period would be counted as a single exceedance during that day. Over the reporting period, the overall number of SOAEL exceedances at each measurement location is shown in Table 6 and may be lower than the total sum of individual exceedances reported in Table 5 for each location.

Table 6: Summary of Total Exceedances of SOAEL

| Worksite<br>Reference | Measurement<br>Reference | Monitor Address | Total of SOAEL exceedances in the month |
|-----------------------|--------------------------|-----------------|---|
| Park Lane             | PL-4                     | Top Lodge       | 1                                       |

2.2.8 One (1) SOAEL exceedances were recorded due to HS2 construction works during June 2022. The exceedance occurred at monitoring location PL-4 during a night.

#### 2.3 Exceedances of Trigger Level

2.3.1 Table 7 provides a summary of exceedances of the S61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 7: Summary of Exceedances of Trigger Levels

| Complaint<br>Reference<br>Number (if<br>applicable) | Worksite<br>Reference | Date and<br>Time Period | Identified<br>Source | Results of<br>Investigation<br>(including noise<br>monitoring results) | Actions<br>Taken |
|---|-----------------------|-------------------------|----------------------|--|------------------|
| -   | -                     | -                       | -                    | -  | -                |

#### 2.4 Complaints

2.4.1 Table 8 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.


Table 8: Summary of Complaints


| Complaint<br>Reference Number |   | _ | Results of Investigation | Actions Taken |
|-------------------------------|---|---|--------------------------|---------------|
| -                             | - | - | -                        | -             |

# **Appendix A Site Locations**


### **HS2** Worksite Identification Plan - Overview



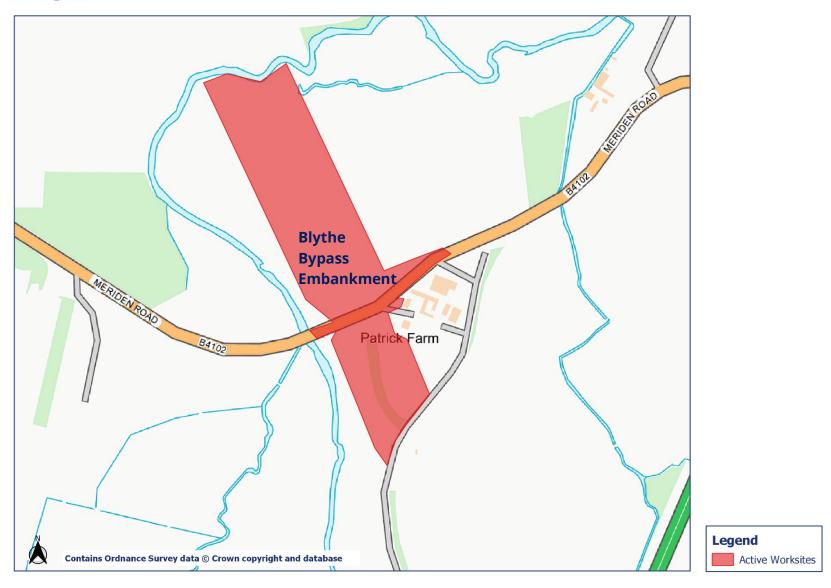

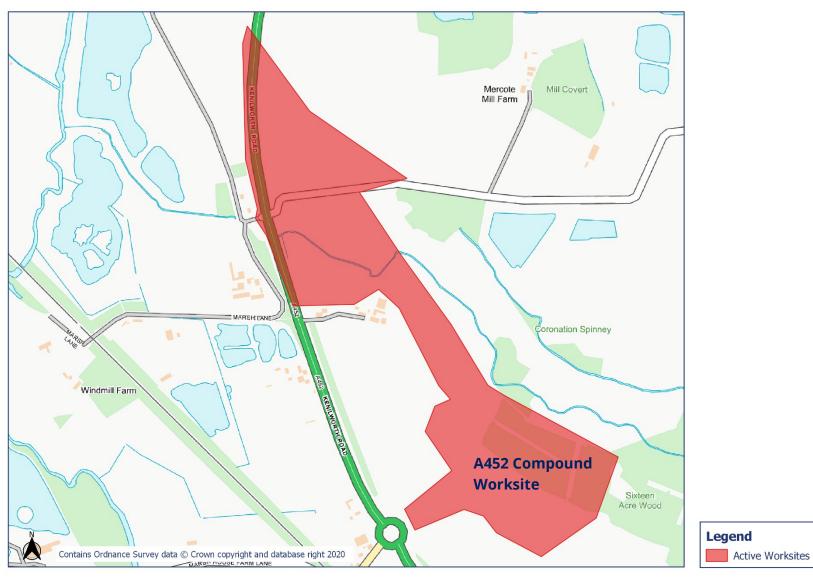



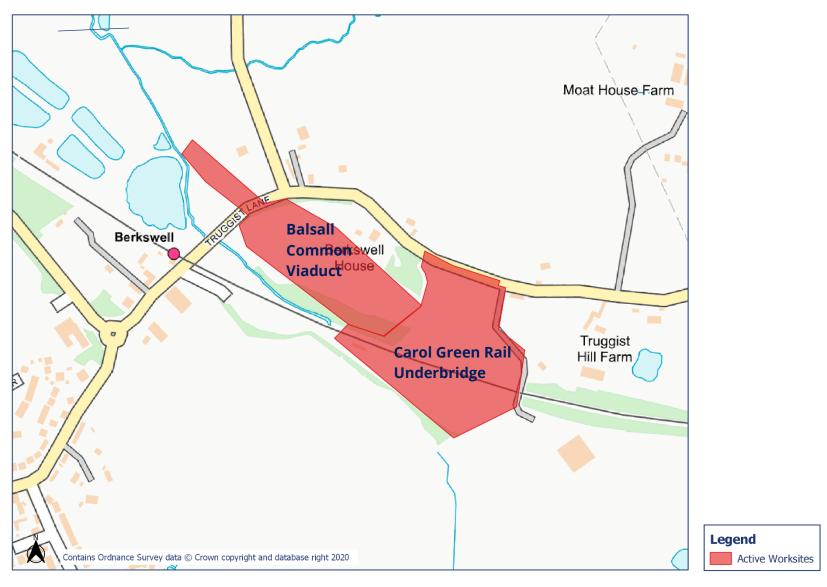



# **Appendix B Monitoring Locations**

### **Noise Monitoring Plan - 1**




### **Noise Monitoring Plan - 2**



### **Noise Monitoring Plan - 3**



#### **Noise Monitoring Plan - 4**

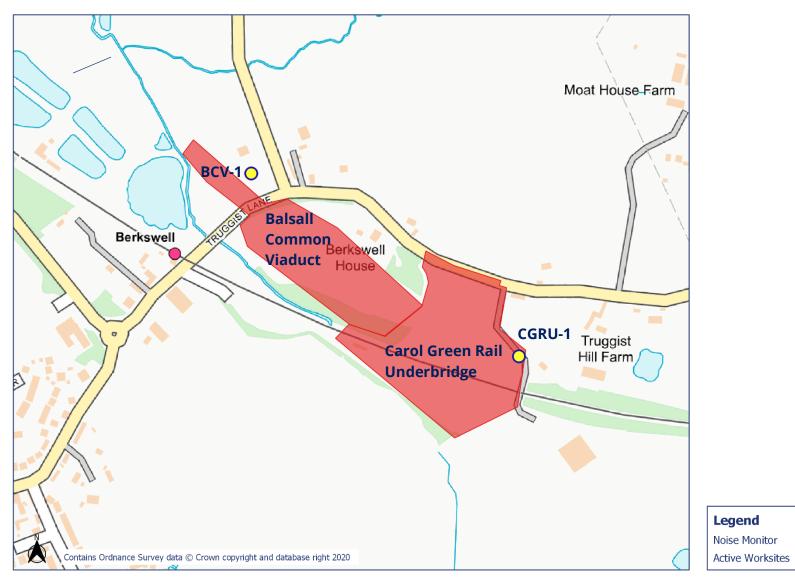

#### **Noise Monitoring Plan - 5**




# **Appendix C Data**

#### **Noise**

The following graphs show the hourly measured ambient noise level  $L_{Aeq,1h}$  and, where relevant, the averaged noise level  $L_{Aeq,T}$  values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the  $L_{Aeq,T}$  values in Table 3 of the main report.


#### **Worksite: BBE - Monitoring Ref: BBE-1**

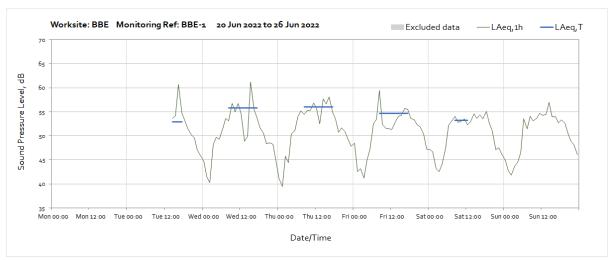



Note: The noise monitor was installed on the 21st of June 2022.





#### Worksite: A452 Compound - Monitoring Ref: A452-1

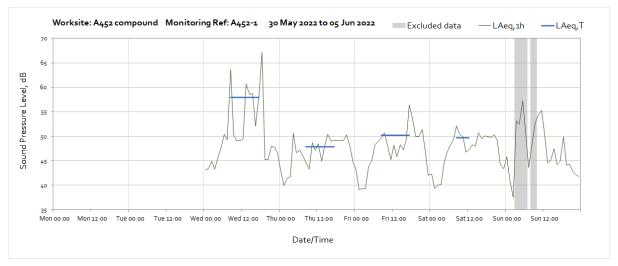


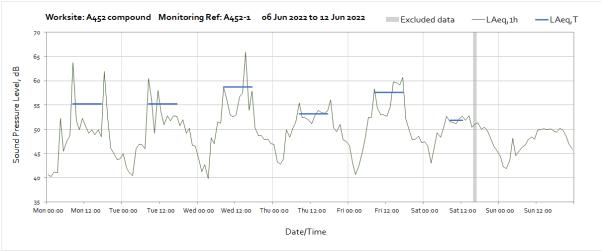


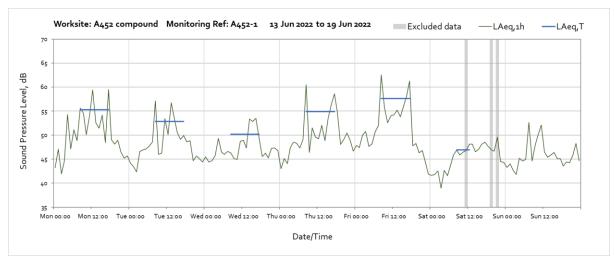


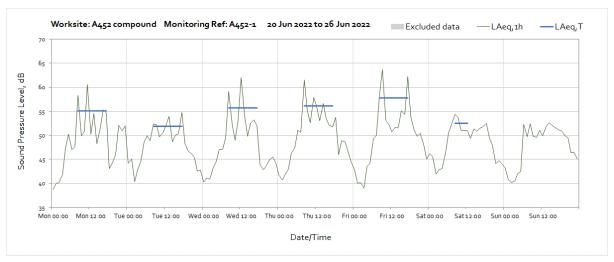


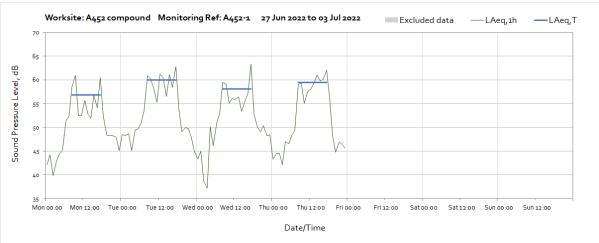

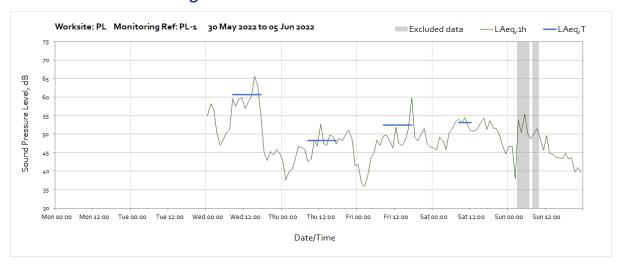


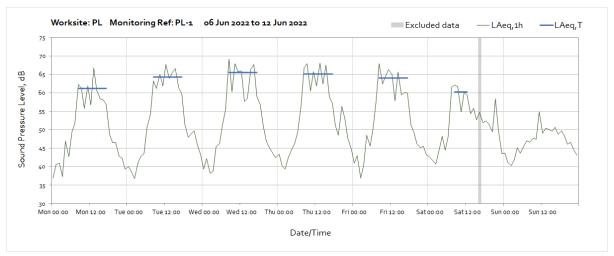


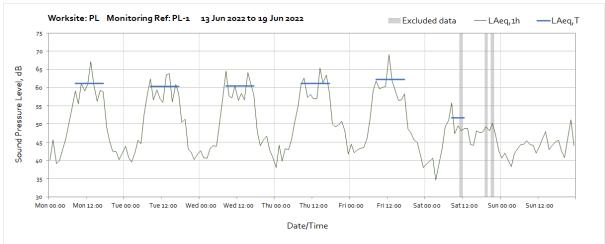


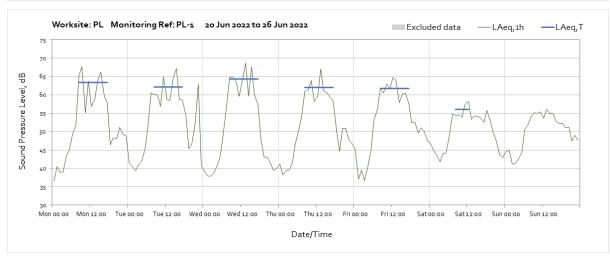




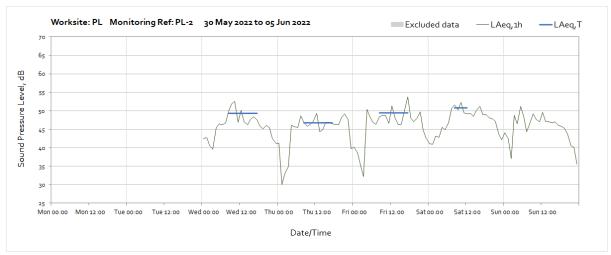


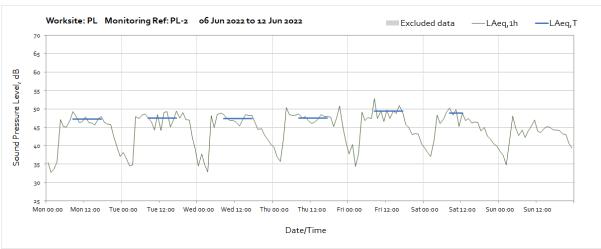


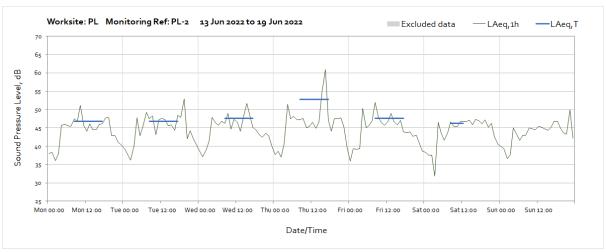


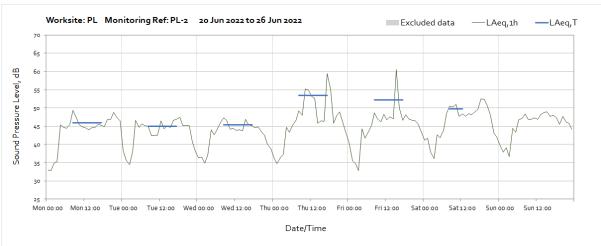




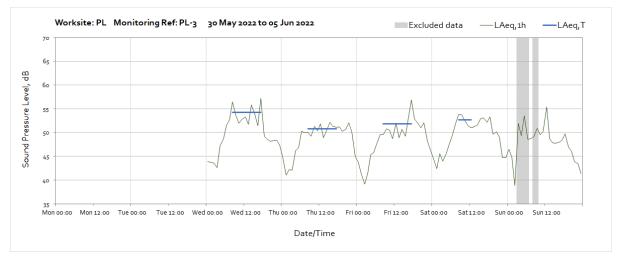


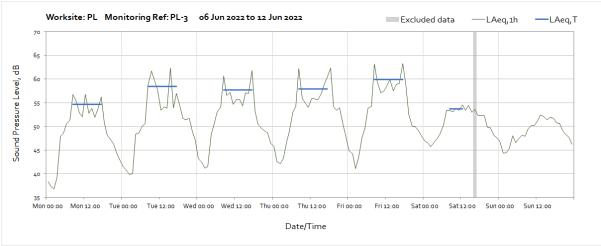


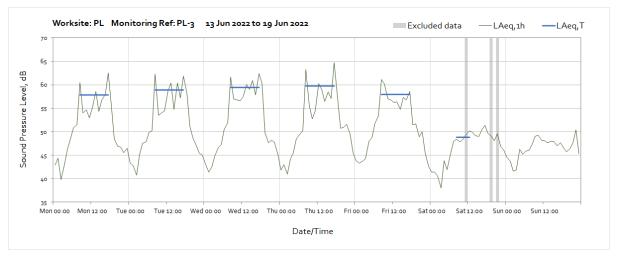


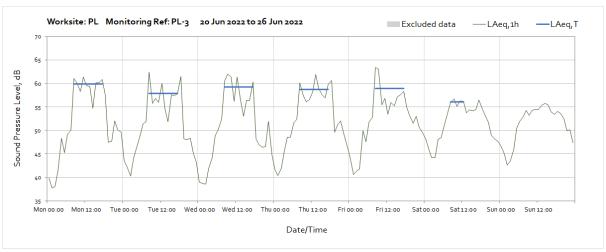





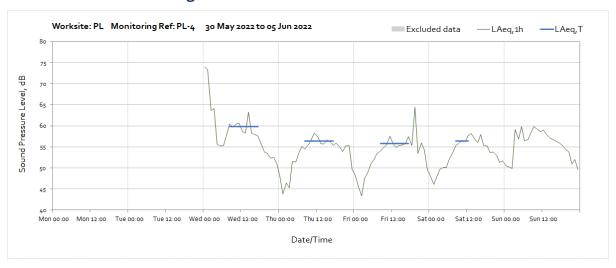

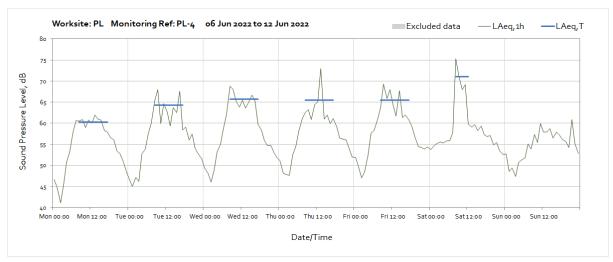


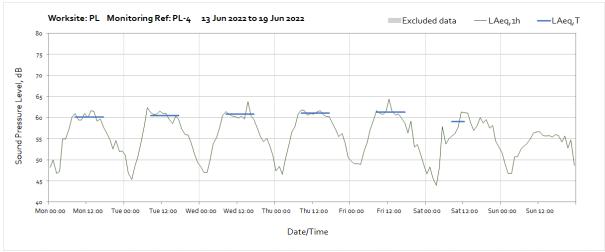

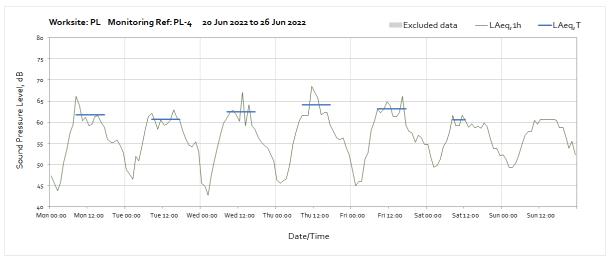


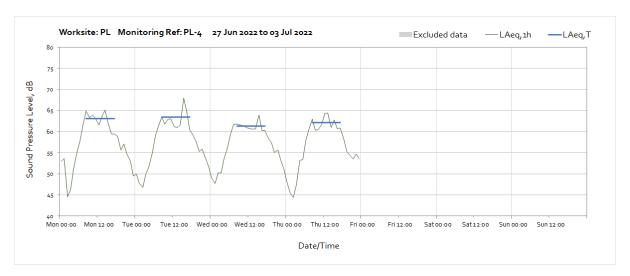



# **Worksite: BCV - Monitoring Ref: BCV-1**

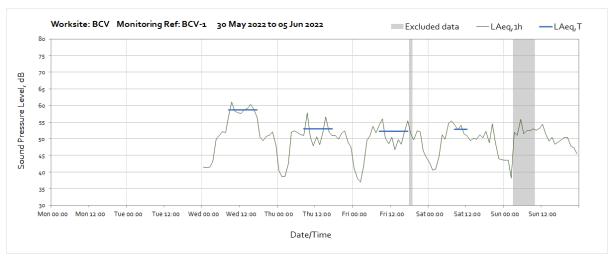




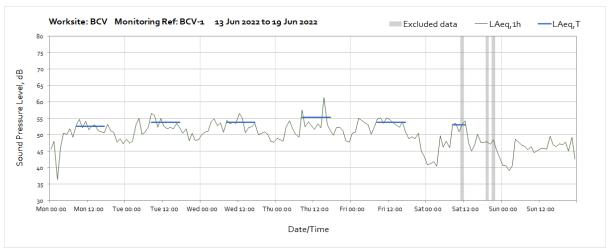


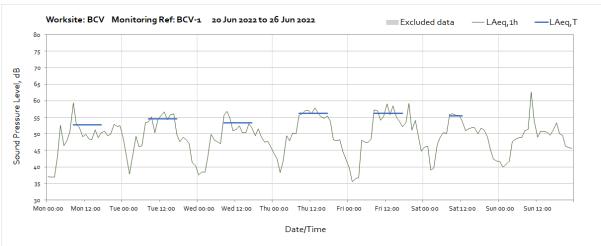

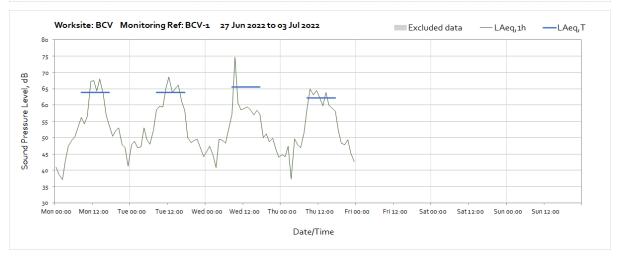



# **Worksite: CGRU- Monitoring Ref: CGRU-1**

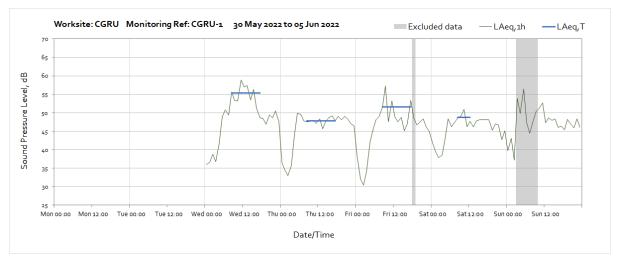

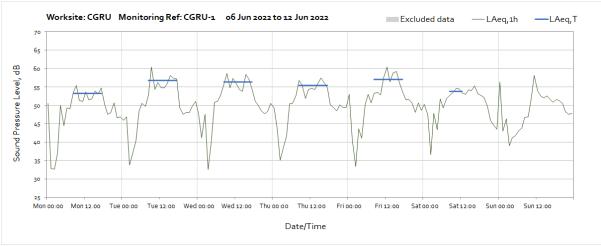




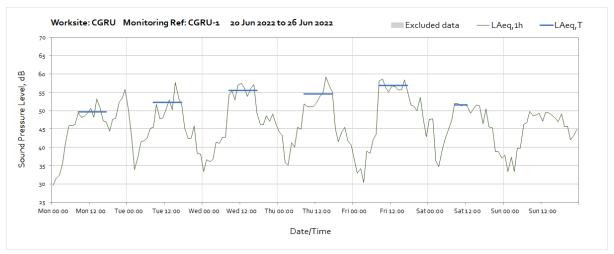


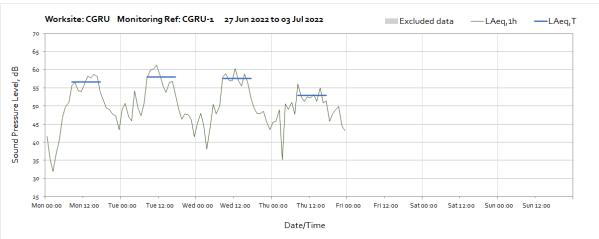

#### Worksite: WLOS - Monitoring Ref: WLOS-1

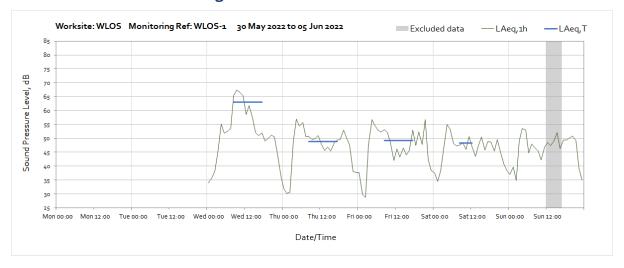



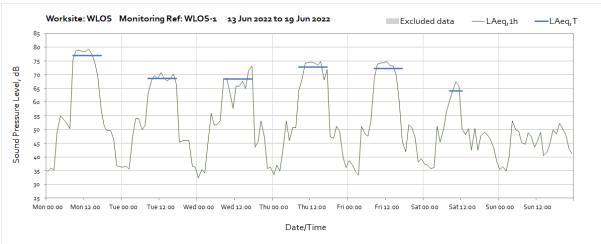







# **Worksite: WLOS - Monitoring Ref: WLOS-2**



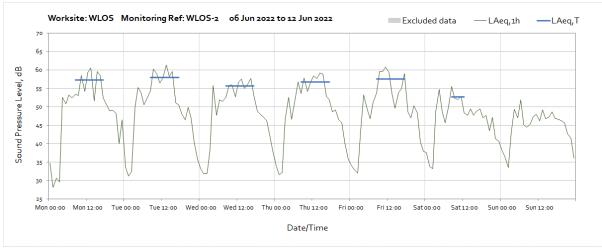



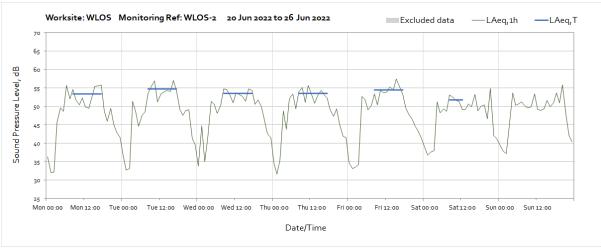




# **Worksite: WLOS - Monitoring Ref: WLOS-3**







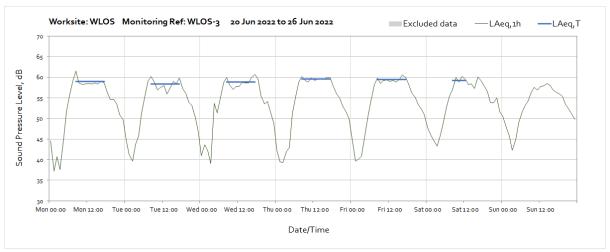






#### **Vibration**

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.


#### Worksite: WLOS - Monitoring Ref: WLOS-V1

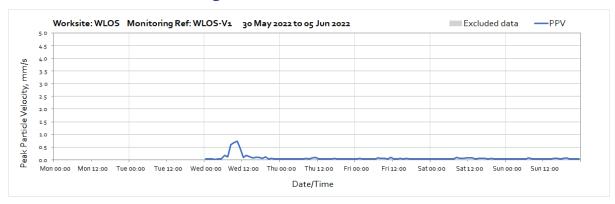

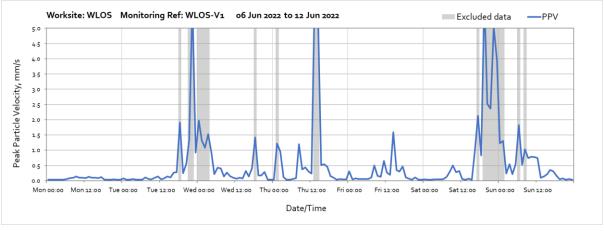

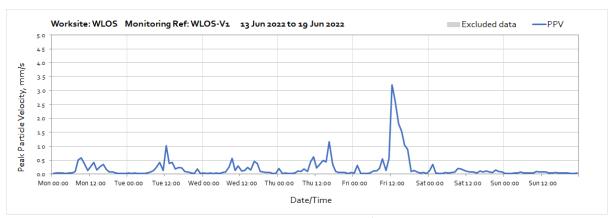

Note: High vibration levels between 12:00 and 17:00 on Friday 17<sup>th</sup> of June was due diaphragm walling and hydrofraise works undertaken in the vicinity of the vibration monitor.

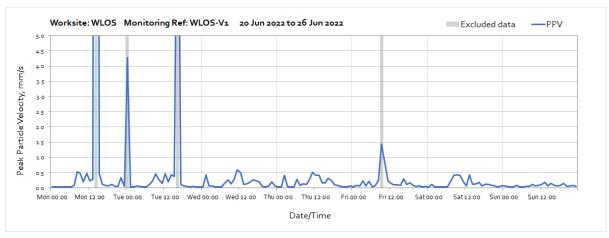



#### **Worksite: WLOS - Monitoring Ref: WLOS-V2**

