



Ministry
of Defence

Defence Equipment and Support
Secretariat
#2043 Maple 0a
Ministry of Defence
Abbey Wood
Bristol BS34 8JH



Email: DES SEC-PolSec LE-JSC-WPNS@mod.uk



Our Reference:
FOI2022/09448
Date:
5th September 2022

Dear ,

I am writing about your email of 10 August 2022, requesting the following information:

'I have recently purchased an ex military defender 110. I have checked the release MERLIN data base and the vehicle service history is not contained in the available published MERLIN extract (the vehicle has recently just come out of service).

Therefore I submit a FOI request for the following information;

- 1) Vehicle military service history (units served etc as contained in the MERLIN/James).**
- 2) Any maintenance records / work objects related to this vehicle.**

**Vehicle registration: HS 58 AA
VIN number: SALLDBA67VA104416'**

Your request has been handled in accordance with the Freedom of Information (FOI) Act 2000.

A search has been carried out of Ministry of Defence (MOD) records and it is confirmed that some information is held on your vehicle that can be released. This is enclosed, as follows:

Annex A – HS58AA Vehicle History (TFR)
Annex B – Fault History (Redacted)
Annex C – Inspection History
Annex D – Modification History (Redacted)
Annex E – Service History

It has proved necessary to withhold some information related to your request. This is commercially sensitive information in the Fault History (Annex B) and Modification History (Annex D) relating to contractor repair times, which has been withheld under qualified exemption Section 43(2) (Commercial Interests). Section 43 concerns information which if disclosed would or would likely prejudice the commercial interests of any person (including defence contractors and the public authority holding it).

As this exemption is qualified, it was necessary to undertake a Public Interest Test to determine whether the balance for withholding the information outweighs that for disclosure. General arguments in favour of release were that full disclosure would demonstrate the MOD's commitment

to openness and transparency; and make the UK Government more accountable to the electorate. The FOI Act also contains a presumption for release.

The Fault and Modifications Histories provide details of the time taken by MOD contractors to rectify fault reports on HS58AA. This data, along with previously published information, could be used to make reasonable assumptions about hourly labour rates. As market sensitive information, this could then be exploited by commercial competitors to undercut the contractor when bidding for similar work.

Given the arguments described above, on balance, it was determined that the information should be withheld. The level of prejudice against release of this exempted information has been set at the higher level of “would” rather than “would be likely to”.

If you have any queries regarding the content of this letter, please contact this office in the first instance. If you wish to complain about the handling of your request, or the content of this response, you can request an independent internal review by contacting the Information Rights Compliance team, Ground Floor, MOD Main Building, Whitehall, SW1A 2HB (e-mail CIO-FOI-IR@mod.gov.uk). Please note that any request for an internal review should be made within 40 working days of the date of this response.

If you remain dissatisfied following an internal review, you may raise your complaint directly to the Information Commissioner under the provisions of Section 50 of the Freedom of Information Act. Please note that the Information Commissioner will not normally investigate your case until the MOD internal review process has been completed. The Information Commissioner can be contacted at: Information Commissioner’s Office, Wycliffe House, Water Lane, Wilmslow, Cheshire, SK9 5AF. Further details of the role and powers of the Information Commissioner can be found on the Commissioner's website at <https://ico.org.uk/>.

Yours sincerely,

DE&S Secretariat

VEHICLE DETAILS

ERM	NATO Stock Number	Asset Code	Contract Number	Description	Colour
(a)	(b)	(c)	(d)	(e)	(f)
HS58AA	2320998939745	NB50313100	LV2A/088DUM	TRUCK UTY MED (TUM) (HS) FFR SOFT TOP LAND ROVER 2.5 LTR TURBO DSL (WITH EEGR)	Army/NATO Green IRR

Date In Service	Chassis Number	Engine No.	Cast	Cast Date
(g)	(h)	(i)	(j)	(k)
10/02/1997	SALLDBA67VA104416	N/A		

VEHICLE HISTORY

ERM	Key No.	RIV Date	UIN	Unit Title	RIV No.	RCP No.	RCP Date	Batch
(a)	(b)	(c)	(d)	(e)	(f)	(g)	(h)	(i)
HS58AA	3	09/02/1997	CA005A	JSCS ASHCHURCH	CAPITA	23546AA	10/02/1997	
HS58AA	4	07/05/1997	A0306A	9 PARA SQN RE	29923A	841	16/05/1997	
HS58AA	4	18/05/2000	A5857A	36 ENGR – 70 SQN	83	452	12/06/2000	R40
HS58AA	4	09/08/2000	A9038A	UK ENGR REGT LOG SQN	58	1254	26/08/2000	B27
HS58AA	4	05/02/2001	A5857A	36 ENGR – 70 SQN	371	764	21/02/2001	
HS58AA	4	24/01/2003	A5857B	OP TELIC 70 GURKHA FD SP SQN	85	97	29/03/2003	T71
HS58AA	4	21/06/2003	A9106A	INF BG 1	36	221	23/07/2003	T99
HS58AA	4	20/10/2003	A9106C	BN BG	176	778	05/11/2003	U25
HS58AA	4	15/03/2004	A9113A	TASK FORCE MUTHANNA - BG4	266	676	23/03/2004	MCR
HS58AA	4	04/10/2004	A9106B	M2T BG	877	8113	08/10/2004	V42
HS58AA	4	16/04/2005	A9105A	ARTY BG	31	2331	13/05/2005	W08

HS58AA	4	25/12/2005	A9106B	M2T BG	2080	3323	28/12/2005	W99
HS58AA	4	24/06/2006	A9008A	BCBG(S)	825	918	28/06/2006	X39
HS58AA	4	23/02/2007	A0211A	16 REGT RA	999	999	02/11/2007	Y79
HS58AA	4	15/11/2007	A2798B	HQ 25 ENGR REGT	28941	72	24/01/2008	Y98
HS58AA	3	04/07/2011	A5969A	TFSU (UK)	87402	5137DD	18/10/2011	
HS58AA	4	15/11/2012	CB997C	ABRO CATTERICK PLANNED REPAIR	4983D	7155	20/11/2012	
HS58AA	2	12/03/2013	A6205G	DSG VEHICLES LONGMOOR	L0002	013/13	11/04/2013	
HS58AA		30/10/2014		RY			30/10/2014	
HS58AA		26/03/2018		TUF HQ			29/03/2018	
HS58AA		08/10/2018		DSG BOVINGTON			15/10/2018	
HS58AA		15/10/2018		TUF HQ			15/10/2018	
HS58AA		24/01/2019		TUF LULWORTH			24/01/2019	
HS58AA		04/02/2021		OSVP CVS HOLDINGS			16/02/2021	

Work Objects

Serial Number: HS58AA
NSN: 2320998939744


Criteria:
Repair Level: ALL
Work Object Status: Closed
Mission Impact: ALL
Fault State: ALL
Escalate Work: ALL
Work Request ID:
Assigned Work Status: ALL
Working Organisation:
Repair Section:

Fault ID	Work Request ID	Fault Description	Work Status	Fault State	Escalate Work	Repair Level	Batch Fault Group ID Number	Fault Occurrence Date	Mission Impact	Reason For Work	Level 3 Description	Working Organisation	Repair Section	Estimated Repair Time
000000-00C55B59	000000-0035A81A	PT Reclamation Task	Closed	Fully Fit	No	Level 2		26 Oct 2021	N/A	Reclamation	TUM HS FFR HARD TOP	14 REGT RA, WKSP	RSAPRECLAMATION	000:00
000000-00B411D2		WORK CARRIED OUT AS PER CUSTOMER REQUEST - SALES ORDER 8T0012213	Closed	Fully Fit	No	Level 1		04 Jun 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B41168		IN INSP - 0002 - OUT INSPECT FUNCTIONAL	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B410E9		IN INSP - 7160 AND 7191 - WING ASSY	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B410E4		IN INSP - 6642 AND 6665 - REMUS BARS AND MATS	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B410D8		IN INSP - 6151 AND 9632 - ENGINE AND GEARBOX	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B4108A		IN INSP - 5217 AND 5224 - JERRY CAN STOWAGE	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B41085		IN INSP - 5189 - R&R HARD TOP ASSY	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B41083		IN INSP - 4614 AND 4616 - LHF AND RHF SIDE REPEATER	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B41045		IN INSP - 4543 & 4548 - INDICATOR	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40FF5		IN INSP - 3626 - C&A WHEEL ALIGNMENT	Closed	Non-Taskworthy	No	Level 2		24 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40FF1		IN INSP - 3576 - RENEW RH TRACK ROD END	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40FEB		IN INSP - 3473 & 3546 - STEERING	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40F87		IN INSP - 2589, 2601, 2831 & SOP ADD - BRAKES	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40F81		IN INSP - 1090 - BLEED CLUTCH HYDRAULIC SYSTEM	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40F6D		IN INSP - 0866 AND 0867 - COOLANT	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40F69		IN INSP - 0557 - BLEED FUEL SYSTEM AFTER REPAIRS	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40FOA		IN INSP - 0013, 4536, 4531, 4600, 4602 AND 4573 - HEADLIGHTS AND LIGHTS	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40EBC		IN INSP - 0010 - STEAM CLEAN ENGINE/TRANS	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B40EB9		IN INSP - 0004 & 0009 - ROAD AND RBT	Closed	Non-Taskworthy	No	Level 2		23 Apr 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB812F		MEI 933 ADVISORY -45- VEHICLE JACK NOT PRESENTED - to travel in convoy with another vehicle holding serviceable jack	Closed	Limited Role	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B1FEF3		SNVE 377 - SWIVEL HOUSING	Closed	Fully Fit	No	Level 1	000000-0000697A	29 Mar 2019	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00B14E7E		WORK CARRIED OUT AS PER CUSTOMER REQUEST - SALES ORDER 8T0012031 AND 8B0158033	Closed	Fully Fit	No	Level 2		04 Mar 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B14E4E		REPAIRS BAAN CARDS	Closed	Non-Taskworthy	No	Level 2		04 Mar 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B0C3FA		WORK CARRIED OUT AS PER CUSTOMER REQUEST - SALES ORDER 8T0011540 AND 8B0155674	Closed	Fully Fit	No	Level 2		06 Feb 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB8162		MEI 932 ADVISORY -7.2- FUEL SPILL PIPE WEEPING	Closed	Fully Fit	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00B0C3F8		INSPECTION BAAN CARDS	Closed	Non-Taskworthy	No	Level 2		06 Feb 2019	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB8172		MEI 933 ADVISORY -13- FFR BATTERIES BUZ TEST INOP	Closed	Fully Fit	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB84E2		C/A HOSE CLIPS	Closed	Non-Taskworthy	No	Level 2		04 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB84E0		PRESSURE TEST COOLANT SYSTEM	Closed	Non-Taskworthy	No	Level 2		04 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB84DF		RENEW FUSES TO FUSE BOX	Closed	Non-Taskworthy	No	Level 2		04 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB84DE		REPLACE FFR ADJUSTER PULLEY AND IDLER	Closed	Non-Taskworthy	No	Level 2		04 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB827F		IN INSP-0010 STEAM CLEAN ENG/TRANS	Closed	Non-Taskworthy	No	Level 2		01 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB827E		IN INSP-0004-ROAD TEST	Closed	Non-Taskworthy	No	Level 2		01 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00A9C95D		CARRY OUT (ANNUAL FMT 933 INSPECTION)	Closed	Limited Role	No	Level 2		12 Mar 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00A9C956		CARRY OUT (ANNUAL FMT 932 W 1 INSPECTION)	Closed	Fully Fit	No	Level 2		12 Mar 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00AB8125		MEI 933 DEFECT -42- MOD 46 WHEEL NUT INDICATORS NOT FITTED	Closed	Non-Taskworthy	No	Level 1		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB8161		MEI 932 DEFECT -1.8- UNABLE TO CARRY OUT HEADLIGHT BEAM CHECK DUE TO INOP N/S DIP BEAM	Closed	Non-Taskworthy	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB8123		AF B6534 -ADVISORY- 11 - OBS - O/S BRAKE PIPE CLIP MISSING	Closed	Fully Fit	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB80FD		AF B6534 DEFECT -3- FUEL SPILL PIPE LEAKING	Closed	Non-Taskworthy	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00AB811B		MEI 932 DEFECT -1.7- N/S HEADLIGHT DIP BEAM INOP	Closed	Non-Taskworthy	No	Level 2		16 May 2018	N/A	Inspection	TUM HS FFR HARD TOP			000:00
000000-00A41F66		Wiring Loom Fire - Land Rover TUM (HS) all variants, TUL (HS) all variants and Battle Field Ambulance (BFA) post embodiment	Closed	Limited Role	No	Level 2	000000-0000451D	28 Jul 2017	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00A9C97B		Instruction Mod 41 - Battery Isolation Switch.	Closed	Fully Fit	No	Level 2		12 Mar 2018	N/A	Servicing	TUM HS FFR HARD TOP			
000000-00A9C96D		CARRY OUT 1 YRLY (L 2 VM TASKS 2320-D-128-601 T 7 COLM B)	Closed	Fully Fit	No	Level 1		12 Mar 2018	N/A	Servicing	TUM HS FFR HARD TOP			
000000-00A9C967		CARRY OUT 1 YRLY SERVICE (L1 TASK'S 2320-D-128-601 T 7 COLM B)	Closed	Fully Fit	No	Level 2		12 Mar 2018	N/A	Servicing	TUM HS FFR HARD TOP			
000000-00A9C997		CARRY OUT O.O.P.M. T 5 SERIAL 3 (RENEW COOLANT 5 YRLY)	Closed	Fully Fit	No	Level 2		12 Mar 2018	N/A	Servicing	TUM HS FFR HARD TOP			
000000-00A9C988		CARRY OUT O.O.P.M. T 5 SERIAL 2 (RENEW GEAR-BOX OIL)	Closed	Fully Fit	No	Level 2		12 Mar 2018	N/A	Servicing	TUM HS FFR HARD TOP			
000000-00AB7F4E		BAAN 10 - WORKSHOP PREP	Closed	Fully Fit	No	Level 2		01 Jun 2018	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00A3F33F		STEAM CLEAN VEHICLE (EX LOAN F.T.U.)	Closed	Limited Role	No	Level 1		25 Jul 2017	N/A	Inspection	TUM HS FFR HARD TOP			
000000-00A3F34B		RECTIFY POOR STARTING-RUNNING (POSSIBLE AIR IN SYSTEM)	Closed	Limited Role	No	Level 2		25 Jul 2017	N/A	Failure	TUM HS FFR HARD TOP			
000000-009E049A		CARRY OUT ANNUAL (FMT 932 W 1 INSPECTION TO RE-ALIGN)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009E04A6		CARRY OUT (ANNUAL FMT 933 INSPECTION)	Closed	Limited Role	No	Level 2		14 Nov 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009E04C0		CARRY OUT 2 YRLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM C)	Closed	Fully Fit	No	Level 1		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009E04CC		CARRY OUT 2 YEARLY (L2 VM TASKS 2320-D-128-601 T 7 COLM C)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009E04DD		CARRY OUT O.O.P.M. T5 SERIAL 1 (RENEW ENGINE OIL & FILTER)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009E04EB		CARRY OUT O.O.P.M. T5 SERIAL 4 (RENEW AIR CLEANER)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009E04FE		RENEW BRAKE FLUID (2 YRLY VMS TASK)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009E0506		REPACK FRONT & REAR HUB BEARINGS (2 YRLY VM TASKS)	Closed	Fully Fit	No	Level 2		14 Nov 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009BBA29		CARRY OUT AF 6534 INSPECTION	Closed	Fully Fit	No	Level 2		15 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BBA2C		CARRY OUT 6 MTHLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM A)	Closed	Fully Fit	No	Level 1		15 Aug 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009BBA2D		CARRY OUT 6 MTHLY (L2 VM TASKS 2320-D-128-601 T7 COLM A)	Closed	Fully Fit	No	Level 2		15 Aug 2016	N/A	Servicing	TUM HS FFR HARD TOP			
000000-009BC8FD		REPLACE BONNET ASSY (RUSTY) INTERCHANGE ALL PARTS	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC03		REPLACE L/H DOOR SURROUND SEAL	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC06		REPLACE REAR DOOR SURROUND SEAL	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC0C		RESECURE LOWER AIR INTAKES ON DASH	Closed	Fully Fit	No	Level 1		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC13		RE RIVET L/H REAR FLAGPOOL BRACKET	Closed	Limited Role	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC19		REPLACE R/H SEAT ASSY	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC1D		REPLACE L/H SEAT ASSY	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC23		REPLACE BOTH FRONT DOOR WINDOWS FELTS	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC26		REPLACE SLAVE SOCKET COVER LEAD	Closed	Fully Fit	No	Level 1		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC2B		REPLACE REAR TOWING PINTLE	Closed	Limited Role	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC35		REPLACE WIPER ARM ADAPTOR ASSY	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC3A		REPLACE REAR AXLE HALFSHAFTS AND DRIVE FLANGES	Closed	Fully Fit	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			
000000-009BCC45		REPLACE DASH BINACLE BACKING PLATE AND LOWER METAL PANEL	Closed	Non-Taskworthy	No	Level 2		18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP			


000000-009BCC4D	HEATER MOTOR NOISY AND ONLY WORKS NO TOP SPEED	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC53	REPLACE HEATER CONTROL PANEL (BENT)	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC59	REPLACE TRACK ROD ASSY	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC5D	RECTIFY POWER STEERING LEAK FROM PIPE REV TO PUMP	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC61	TRANSFER BOX OIL LEAK	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC65	REPLACE EXHAUST TAIL AND MIDDLE PIPES	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC66	REPLACE REAR PORTHOLE (DAMAGED)	Closed	Limited Role	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC67	REPLACE HANDBRAKE LEVER (BENT)	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC68	REPLACE STEERING DAMPER	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC6B	REPLACE FRONT ANTI-ROLL BAR BALLJOINTS AND RUBBERS	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC71	REPLACE REAR ANTI-ROLL BAR BALLJOINTS AND RUBBERS	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC74	REPLACE OIL COOLER PIPES (LEAKING)	Closed	Non-Taskworthy	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC79	STEAM CLEAN CHASSIS AND TRANSMISSION	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC7C	REPLACE WATER PUMP TO THERMOSTAT HOSE	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCC80	RESECURE MIRROR ARMS	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BCD1B	BLEED AND ADJUST CLUTCH FREEPLAY	Closed	Fully Fit	No	Level 2	18 Aug 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009BC56E	CARRY OUT FMT932(W1) RE-CERTIFICATION	Closed	Non-Taskworthy	No	Level 2	27 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-009BC571	CARRY OUT FMT933 INSPECTION	Closed	Non-Taskworthy	No	Level 2	27 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E35	CARRY OUT RBT AFTER ALL BRAKE REPAIRS COMPLETED	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982E80	CARRY OUT FULL UNDER BODY STEAM CLEAN	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097FAA4	CARRY OUT 1 YRLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM B)	Closed	Limited Role	No	Level 1	22 Mar 2016	N/A	Servicing	TUM HS FFR HARD TOP		
000000-0097FAA9	CARRY OUT 1 YRLY (L2 VM TASKS 2320-D-128-601 T7 COLM B N.R.)	Closed	Limited Role	No	Level 2	22 Mar 2016	N/A	Servicing	TUM HS FFR HARD TOP		
000000-00982E7E	REPLACE SCRATCHED O/S MIRROR GLASS	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Damage	TUM HS FFR HARD TOP		
000000-00982E54	RE-FIT FUEL PIPE HOSE CLIP & BRKT (LEFT IN CAB)	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E71	REPLACE TOW PINTLE R CLIP	Closed	Limited Role	No	Level 2	01 Apr 2016	N/A	Damage	TUM HS FFR HARD TOP		
000000-00982E4C	INV/RECTIFY DIESEL LEAK AROUND FUEL TANK AREA	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E50	REPLACE PERISHING FUEL TANK MOUNTS	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982DF9	INV/REC DIFF LOCK NOT RELEASING ONCE SELECTED	Closed	Limited Role	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982DFE	RECTIFY OIL LEAKS AT T/BOX	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E21	ADJUST HAND BRAKE CABLE	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982E2F	REPLACE REAR BRAKE PADS (GETTING LOW)	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982DB1	REPLACE CORRODING N/S & O/S FRONT SUSPENSION TURRETS	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982DB5	N/S/F SUSPENSION DAMPER WEEPING	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982DC1	O/S/F DAMPER MTG WASHERS INCORRECTLY FITTED	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982DF4	RECTIFY INOP HAZARD SWITCH ILLUMINATION	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E0B	RECTIFY INOP O/S MAIN BEAM LIGHT	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E0F	RECTIFY INOP NUMBER PLATE LAMP WHEN TAPPED	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E14	SECURE NUMBER PLATE LAMP COVER	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982DAD	REMOVE PAINT FROM STEERING CHALICE BALL ENDS	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982DC2	O/S/F BRAKE HOSE & PIPE FOULING R/SPRING ON R/H STEER LOCK	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D8C	TGN STEER BOX MTG BOLTS & REPLACE LOCK TABS	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D98	RE-CLIP POWER STEERING PIPES TO FRONT CROSS MEMBER	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982D40	RECTIFY FAILED EMISSIONS TEST	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D47	INV/REC OIL LEAK TURBO AREA	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D77	REPLACE WORN STEERING DAMPER BUSHES (BOTH ENDS)	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D80	REPLACE WORN PANHARD ARM BUSHES	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E02	SECURE N/S & O/S SUN VISORS	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D6D	INV/REC VERY STIFF STEERING	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E5F	FREE OFF CONVOY LAMP SHIELD	Closed	Limited Role	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D5E	SECURE STEERING COLUMN COWLING	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D68	SECURE CTR DASH TRIM (IND)	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E7C	SECURE X2 BREATHERS IN ENG BAY, BEHIND CYL HEAD	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982D4B	REPLACE DAMAGED DRIVERS SEAT BELT	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Damage	TUM HS FFR HARD TOP		
000000-00982D54	SECURE N/S WIPER ARM SPINDLE ADAPTER	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982D59	REPLACE DAMAGED STEERING WHEEL	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Damage	TUM HS FFR HARD TOP		
000000-00982E64	ROUTE HEADER TANK HOSE CORRECTLY	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982E2A	REPLACE MISSING X1 EXHAUST DOWNPIPE MTG NUT	Closed	Fully Fit	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00982E62	RECTIFY INOP LOW BRAKE FLUID WARNING LIGHT	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-0097F7B4	STEAM CLEAN ALL STEERING OIL PIPES & CHECK FOR LEAKS	Closed	Fully Fit	No	Level 2	21 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097F7C6	REPLACE MISSING BOLT AT STEERING BOX TO FRONT PANEL	Closed	Fully Fit	No	Level 2	21 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-009705AC	Power steering in-op (Steering box & pump renewed)	Closed	Limited Role	No	Level 2	17 Feb 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-0097F79F	RECTIFY FLUID LEAK AT BRAKE MASTER CYLINDER	Closed	Non-Taskworthy	No	Level 2	21 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097F7A8	CHECK FOR LOSS OF CLUTCH FLUID	Closed	Fully Fit	No	Level 2	21 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097F7B1	CHECK POSSIBLE LEAK FROM WATER BOTTLE	Closed	Fully Fit	No	Level 2	21 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097F260	CHECK STEERING STIFF & DIFFICULT TO DRIVE (EX LOAN)	Closed	Non-Taskworthy	No	Level 2	21 Mar 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-0097FA9B	CARRY OUT ANNUAL (FMT 932 W 1 INSPECTION NO REPORTS)	Closed	Fully Fit	No	Level 2	22 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-0097FA9E	CARRY OUT ANNUAL (FMT 933 INSPECTION NO REPORTS)	Closed	Limited Role	No	Level 2	22 Mar 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00982E09	BEAMSET HEAD LIGHTS (AIM U/S)	Closed	Non-Taskworthy	No	Level 2	01 Apr 2016	N/A	Failure	TUM HS FFR HARD TOP		
000000-00954F0E	CLUTCH PEDAL GRIP MISSING	Closed	Fully Fit	No	Level 1	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-008718A1	NO BRIDGE CLASSIFICATION SIGNS FITTED	Closed	Fully Fit	No	Level 1	09 Feb 2015	N/A	Closed No Action	TUM HS FFR HARD TOP		
000000-00954ECD	000000-00311531 EXHAUST BLOWING AT CENTRE BOX	Closed	Fully Fit	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP	LD LAD	HQ SQN LAD
000000-007E5DF4	NO INSPECTION CERTIFICATE FOR FFR SYSTEM	Closed	Limited Role	No	Level 1	06 Feb 2014	N/A	Closed No Action	TUM HS FFR HARD TOP		
000000-00954FC1	000000-00311531 PRESENT FOR RE-CERTIFICATION BY 31/01/15	Closed	Non-Taskworthy	No	Level 2	05 Jan 2016	N/A	Closed No Action	TUM HS FFR HARD TOP	LD LAD	HQ SQN LAD
000000-00954FEC	000000-00311531 RHS FRONT LOWER DAMPER BUSH EXCESSIVE PLAY	Closed	Non-Taskworthy	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP	LD LAD	HQ SQN LAD
000000-00962A1C	Check No2 ball joint torque tightness as per safety notice LE 5NvE 00063	Closed	Non-Taskworthy	No	Level 2	20 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00954E9E	000000-00311531 NO 4 STEERING BALLJOINT GAITOR TORN	Closed	Non-Taskworthy	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP	LD LAD	HQ SQN LAD
000000-00954EC9	INVESTIGATE FAULTY STEERING BOX	Closed	Non-Taskworthy	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00954F1C	OIL SEEPAGE AT TRANSFER BOX	Closed	Fully Fit	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-00954F13	OIL SEEPAGE AT SUMP	Closed	Fully Fit	No	Level 2	05 Jan 2016	N/A	Inspection	TUM HS FFR HARD TOP		
000000-008E49AB	000000-00310ACF Carry out yearly service & MEI	Closed	Fully Fit	No	Level 2	10 Dec 2015	N/A	Servicing	TUM HS FFR HARD TOP	LD LAD	HQ SQN LAD
000000-008B05BC	000000-0030FCCB replace windscreen	Closed	Limited Role	No	Level 2	25 Jul 2015	N/A	Damage	TUM HS FFR HARD TOP		
000000-00882DB7	DE-MISTER LEVER SNAPPED OFF	Closed	Limited Role	No	Level 1	24 Mar 2015	N/A	Damage	TUM HS FFR HARD TOP		
000000-0087189B	000000-003027D4 UNIT TO INSPECT CES BEFORE NEXT USE	Closed	Limited Role	No	Level 1	09 Feb 2015	N/A	Closed No Action	TUM HS FFR HARD TOP		
000000-00871896	000000-003027D4 VEHICL JACK AND FIRE EXTINGUISHER TO BE INSPECTED BEFORE NEXT USE	Closed	Non-Taskworthy	No	Level 2	09 Feb 2015	N/A	Closed No Action	TUM HS FFR HARD TOP		
000000-0084D18F	CLEAR ALL FAULTS FROM DSG CATTERICK JOB No 8B0094778	Closed	Fully Fit	No	Level 4	09 Feb 2015	N/A	Inspection	TUM HS FFR HARD TOP		B LINE
000000-0084D18D	PAS PUMP BOLTS SHEARED	Closed	Fully Fit	No	Level 4	20 Oct 2014	N/A	Failure	TUM HS FFR HARD TOP		B LINE
000000-0084D190	INVESTIGATE EXCESSIVE NOISE FROM FFR GENERATOR	Closed	Fully Fit	No	Level 4	20 Oct 2014	N/A	Failure	TUM HS FFR HARD TOP		B LINE
000000-0084D18D	CLUTCH MASTER CYLINDER LEAKING	Closed	Fully Fit	No	Level 4	20 Oct 2014	N/A	Failure	TUM HS FFR HARD TOP		B LINE
000000-0084D18B	CLUTCH	Closed	Fully Fit	No	Level 4	20 Oct 2014	N/A	Failure	TUM HS FFR HARD TOP		B LINE
000000-00842CB0	Towing Pintle Assembly	Closed	Fully Fit	No	Level 2	09 Oct 2014	Degraded	Inspection	TUM HS FFR HARD TOP		
000000-0082909B	CARRY OUT AF 6534 INSPECTION	Closed	Non-Taskworthy	No	Level 2	30 Jul 2014	N/A	Inspection	TUM HS FFR HARD TOP		

000:00

000000-008290AD	CARRY OUT 6 MTHLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM A)	Closed	Non-Taskworthy	No	Level 1	30 Jul 2014	N/A	Servicing	TUM HS FFR HARD TOP	
000000-008290B8	CARRY OUT 6 MTHLY (L2 VMS TASKS 2320-D-128-601 T7 COLM A)	Closed	Non-Taskworthy	No	Level 2	30 Jul 2014	N/A	Servicing	TUM HS FFR HARD TOP	
000000-0082C2C6	TORQUE WHEEL NUTS	Closed	Fully Fit	No	Level 1	08 Aug 2014	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007D31FD	RENEW L/H/F WING (EYE BROW)	Closed	Fully Fit	No	Level 2	05 Dec 2013	N/A	Damage	TUM HS FFR HARD TOP	
000000-007D3209	RECTIFY L/H HEADLAMP INOP ON DIPPED BEAM	Closed	Non-Taskworthy	No	Level 2	05 Dec 2013	N/A	Failure	TUM HS FFR HARD TOP	
000000-007D3220	CARRY OUT 12 MTHLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM B)	Closed	Fully Fit	No	Level 1	05 Dec 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007D3228	CARRY OUT 12 MTHLY (L2 VMS TASKS 2320-D-128-601 T7 COLM B)	Closed	Fully Fit	No	Level 2	05 Dec 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007D3210	CARRY OUT ANNUAL FMT 932 (W2 INSPECTION)	Closed	Non-Taskworthy	No	Level 2	05 Dec 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-007D3217	CARRY OUT ANNUAL FMT 933 (INSPECTION)	Closed	Fully Fit	No	Level 2	05 Dec 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-007B1BDB	Update JAMES systems maintenance forecasting	Closed	Fully Fit	No	Level 2	05 Sep 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-007AA453	CARRY OUT 6 MTHLY SERVICE (L1 TASKS 2320-D-128-601 T7 COLM A)	Closed	Fully Fit	No	Level 1	08 Aug 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007AA45B	CARRY OUT 6 MTHLY (L2 VMS TASKS 2320-D-128-601 T7 COLM A)	Closed	Fully Fit	No	Level 2	08 Aug 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007AA462	REPLACE R/H/F TYRE U/S	Closed	Non-Taskworthy	No	Level 1	08 Aug 2013	N/A	Failure	TUM HS FFR HARD TOP	
000000-007AA44D	CARRY OUT AF 6534 INSPECTION	Closed	Fully Fit	No	Level 2	08 Aug 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-0079A699	Inspect tyres for damage	Closed	Fully Fit	No	Level 2	25 Jun 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-00797634	GOODYEAR G90 tyres manufactured in South Africa cracking File Ref OSVP/64/40/04/09	Closed	Non-Taskworthy	No	Level 1	24 Jun 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-0077F1FE	REPLACE MISSING REAR SEAT (MOUNTING BRACKETS)	Closed	Fully Fit	No	Level 2	16 Apr 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-0077F206	REPLACE MISSING REAR SEAT BELTS	Closed	Fully Fit	No	Level 2	16 Apr 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-0077F24F	UP-DATING VEHICLE INFORMATION	Closed	Fully Fit	No	Level 2	16 Apr 2013	N/A	Inspection	TUM HS FFR HARD TOP	
000000-0078012C	mirror arms loose and mirror loose on arm	Closed	Fully Fit	No	Level 2	17 Apr 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-00780141	fuel pipe not clipped in	Closed	Fully Fit	No	Level 1	17 Apr 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-00780156	webbing straps missing from bonnet	Closed	Fully Fit	No	Level 1	17 Apr 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-00780163	rear bottom door seal missing	Closed	Fully Fit	No	Level 2	17 Apr 2013	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007545D7	CARRY OUT 24 MTH SERVICE IAW 2320-D-128-601 TAB 7 COL C	Closed	Fully Fit	No	Level 2	03 Dec 2012	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007545D9	CARRY OUT OOPM TAB 5 SER's 1,2,3,4,6	Closed	Fully Fit	No	Level 2	03 Dec 2012	N/A	Servicing	TUM HS FFR HARD TOP	
000000-007545DB	CARRY OUT 932W & 933 INSPECTION	Closed	Fully Fit	No	Level 2	03 Dec 2012	N/A	Inspection	TUM HS FFR HARD TOP	
000000-007545DC	CARRY OUT FULL RE-SPRAY IF REQUIRED	Closed	Fully Fit	No	Level 2	03 Dec 2012	N/A	Refurbishment	TUM HS FFR HARD TOP	
000000-007545DE	CLEAR ALL FAULTS FROM DSG JOB CARD 8B0048121	Closed	Fully Fit	No	Level 2	03 Dec 2012	N/A	Failure	TUM HS FFR HARD TOP	
000000-006D2E20	CARRY OUT MEI / DISP INSPECTION	Closed	Fully Fit	No	Level 2	03 Oct 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-006D28CF	CARRY OUT OOPM GEAR BOX OIL CHANGE	Closed	Fully Fit	No	Level 1	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-006D28CA	CARRY OUT OOPM COOLANT CHANGE	Closed	Fully Fit	No	Level 2	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-006D28C5	CARRY OUT BRAKE FLUID CHANGE	Closed	Fully Fit	No	Level 2	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-006D28C1	CARRY OUT FUEL AND OIL FILTER WITH OIL CHANGE	Closed	Fully Fit	No	Level 1	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-006D28BB	CARRY OUT 24 MONTH L2 TASKS	Closed	Fully Fit	No	Level 2	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-006D28B8	CARRY OUT 24 MONTH L1 TASKS	Closed	Fully Fit	No	Level 1	03 Oct 2011	N/A	Servicing	TUM HS FFR HARD TOP	
000000-005BA70C	COMPLETE L1 MAINT IAW AESP 2320-D-128, TABLE 7, COLUMN C	Closed	Fully Fit	No	Level 1	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-005BA709	COMPLETE L1 MAINT IAW AESP 2320-D-128, TABLE 5, SER 4	Closed	Fully Fit	No	Level 1	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-005BA66E	COMPLETE L1 MAINT IAW AESP 2320-D-128, TABLE 5, SER 1	Closed	Fully Fit	No	Level 1	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-005D180C	CARRY OUT SPARE WHEEL TYRE VALVE MOD	Closed	Fully Fit	No	Level 1	15 Jan 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-005D180B	RENEW CLIP ON BONNET STAY BAR	Closed	Fully Fit	No	Level 1	15 Jan 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-00487BB6	FIT MISSING BATTERY TERMINAL COVERS	Closed	Fully Fit	No	Level 1	14 Oct 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-00487BB3	RENEW FIRE EXT BRACKET	Closed	Fully Fit	No	Level 1	14 Oct 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-00487BB0	OBSERVE R/H/F TYRE CLOSE TO WEAR LIMITS	Closed	Fully Fit	No	Level 1	14 Oct 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-004754D5	COVER MISSING OF RAD TERMINAL BOX	Closed	Fully Fit	No	Level 1	08 Sep 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-00458EF1	FIT FUEL STICKER TO JERRY CAN COMPARTMENT	Closed	Fully Fit	No	Level 1	20 Jul 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-006BAD44	CARRY OUT 6534 INSPECTION	Closed	Fully Fit	No	Level 1	14 Jul 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-006BAD42	CARRY OUT L1 MAINT IAW 2320-D-128-601 TABLE 7 COL A	Closed	Fully Fit	No	Level 1	14 Jul 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-006BAD3F	CARRY OUT L2 MAINT IAW 2320-D-128-601 TABLE 7 COL A	Closed	Non-Taskworthy	No	Level 2	14 Jul 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-006AE7C7	Insp Steering Drop Arm Tab Washer	Closed	Non-Taskworthy	No	Level 2	22 Jun 2011	N/A	Inspection	TUM HS FFR HARD TOP	
000000-00487B7D	RECTIFY HEATER SPEED CONTROL LEVER INTERMITTANT	Closed	Fully Fit	No	Level 2	14 Oct 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-005BA71C	COMPLETE MEI IAW AESP 2300-A-050-013	Closed	Fully Fit	No	Level 2	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-00487B91	INVESTIGATE ENGINE RUNNING ROUGH AT LOW RPM AND UNDER LOAD	Closed	Fully Fit	No	Level 2	14 Oct 2009	N/A	Failure	TUM HS FFR HARD TOP	
000000-005BA70D	COMPLETE L2 MAINT IAW AESP 2320-D-128, TABLE 7, COLUMN C	Closed	Fully Fit	No	Level 2	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-005BA831	COMPLETE L2 MAINT IAW AESP 2320-D-128-601, TABLE 7, SER 52	Closed	Fully Fit	No	Level 2	16 Nov 2010	N/A	Failure	TUM HS FFR HARD TOP	
000000-005991F0	L/STORAGE BIN LATCH, REQ RE-RIVETING	Closed	Non-Taskworthy	No	Level 2	04 Oct 2010			TUM HS FFR HARD TOP	
000000-0050D37D	COMPLETE L2 MAINT IAW AESP 2320-D-128-601, TABLE 7, COLUMN A	Closed	Non-Taskworthy	No	Level 2	24 May 2010			TUM HS FFR HARD TOP	
000000-0050D386	COMPLETE AFB 6534 IAW IAW AESP 2300-A-050-013	Closed	Non-Taskworthy	No	Level 1	24 May 2010			TUM HS FFR HARD TOP	
000000-0050D37A	COMPLETE L1 MAINT IAW AESP 2320-D-128-601, TABLE 7, COLUMN A	Closed	Non-Taskworthy	No	Level 1	24 May 2010			TUM HS FFR HARD TOP	
000000-00487BBE	REMOVE PAINT FROM CONVOY LIGHT LENS	Closed	Fully Fit	No	Level 1	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BBD	RECTIFY POWER STEERING FLUID OVERFILLED	Closed	Fully Fit	No	Level 1	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BB8	RENEW BONNET STAY BAR CLIP	Closed	Fully Fit	No	Level 1	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BB4	CLEAN OUT INTERIOR OF NO. PLATE LIGHT	Closed	Fully Fit	No	Level 1	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00458EEF	FIT FUEL CAP CHAIN	Closed	Fully Fit	No	Level 1	20 Jul 2009			TUM HS FFR HARD TOP	
000000-0049E958	COMPLETE L2 MAINT IAW AESP 2320-D-128-601, TABLE7, COLUMN B	Closed	Fully Fit	No	Level 2	19 Nov 2009			TUM HS FFR HARD TOP	
000000-0049E956	COMPLETE L1 MAINT IAW AESP 2320-D-128-601, TABLE7, COLUMN B	Closed	Fully Fit	No	Level 1	19 Nov 2009			TUM HS FFR HARD TOP	
000000-0048B3B3	VEH HORN INOP	Closed	Non-Taskworthy	No	Level 2	18 Jan 2010			TUM HS FFR HARD TOP	
000000-00487BD4	COMPLETE MEI IAW AESP 2300-A-050-013	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-004867C7	COMPLETE MEI IAW AESP 2300-A-050-013	Closed	Non-Taskworthy	No	Level 2	12 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BAB	RECTIFY REAR PROPSHAFT BOLTS LOOSE @ DIFF	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BA7	RENEW L/H/F ANTI ROLL BAR BALL JOINT	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BA4	RENEW FRONT RADIUS ARM REAR BUSHES	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487BA1	RECTIFY PLAY @ PANHARD ROD BUSHES	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B9F	INVESTIGATE POWER STRG FLUID LEAK	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B99	RECTIFY DAMAGE TO BONNET (DENTED AND HOLED)	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B95	RECTIFY COOLANT SEEPAGE AT TOP HOSE	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B8D	RECTIFY BATTERIES INSECURE (CLAMP BOLTS SNAPPED AND MISSING)	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B88	FIT HIGH LEVEL AIR INTAKE MOD CORRECTLY, OR REMOVE	Closed	Non-Taskworthy	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B7F	SECURE DASH	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B78	RECTIFY HEATER CONTROL LEVERS STIFF TO OPERATE (BECOMING BENT)	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B74	RENEW STRG COLUMN SHROUD	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B68	TIGHTEN DVRS AND PASS BTM DOOR HINGES	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-00487B67	RENEW R/H HEADLIGHT (BEAM DIFFUSE)	Closed	Fully Fit	No	Level 2	14 Oct 2009			TUM HS FFR HARD TOP	
000000-0042EE11	CARRY OUT 6 YEARLY OUT OF PHASE MAINTENANCE IAW AESP 2320-D-128-601 TABLE 5 INSTRUCTION 6	Closed	Fully Fit	No	Level 2	09 Jun 2009			TUM HS FFR HARD TOP	
000000-0042DE61	CARRY OUT INSPECTION IAW AF6534	Closed	Non-Taskworthy	No	Level 1	08 Jun 2009			TUM HS FFR HARD TOP	
000000-0042DE5F	CARRY OUT 6 MONTHLY QT TASKS IAW AESP 2320-D-128-601 TABLE 7 COLUMN A	Closed	Non-Taskworthy	No	Level 2	08 Jun 2009			TUM HS FFR HARD TOP	
000000-0042DE5E	CARRY OUT 6 MONTHLY SERVICE IAW AESP 2320-D-128-601 TABLE 7 COLUMN A	Closed	Non-Taskworthy	No	Level 1	08 Jun 2009			TUM HS FFR HARD TOP	
000000-003E3285	BOWMAN PLATFORM WILL NOT POWER UP, ON INSPECTION THE BACK OF THE 24V GENERATORIS INSECURE	Closed	Limited Role	No	Level 2	17 Mar 2009			TUM HS FFR HARD TOP	
000000-002C0BB8	BATTERY CABLES BROKEN (RADIO BATT5)	Closed	Fully Fit	No	Level 1	16 Oct 2008			TUM HS FFR HARD TOP	
000000-0034C424	ADJUST WASHER JETS	Closed	Fully Fit	No	Level 1	04 Dec 2008			TUM HS FFR HARD TOP	
000000-0034C439	FIT COVER AT INSTRUMENT PANEL	Closed	Fully Fit	No	Level 1	04 Dec 2008			TUM HS FFR HARD TOP	
000000-00310D34	CARRY OUT L1 MAINT IAW AESP2320-D-122-601 TABLE 7 COLUMN D	Closed	Non-Taskworthy	No	Level 2	13 Nov 2008			TUM HS FFR HARD TOP	

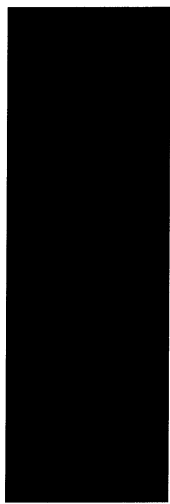

000:00
0000:00
0000:00
0000:00
0000:00

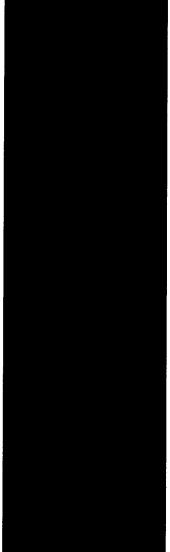

000000-00310D36	000000-00284920	CARRY OUT L1 MAINT IAW AESP2320-D-122-601 TABLE 7 COLUMN D	Closed	Non-Taskworthy	No	Level 2	13 Nov 2008	TUM HS FFR HARD TOP
000000-003043A4	000000-00284638	CARRY OUT 2 YEARLY SERVICE	Closed	Non-Taskworthy	No	Level 1	11 Nov 2008	TUM HS FFR HARD TOP
000000-003043A6	000000-0028463B	CARRY OUT 2 YEARLY QT TASKS	Closed	Non-Taskworthy	No	Level 2	11 Nov 2008	TUM HS FFR HARD TOP
000000-00289ADC	000000-00282910	ADJUST WASHER JETS	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289ADE	000000-00282910	FIT COVER AT INSTRUMENT PANEL	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE0	000000-00282910	FIT MISSING HANDLE AT DVRS SEAT ADJUSTER	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE3	000000-00282910	FIT MISSING HANDLE AT DVRS SEAT ADJUSTER	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE4	000000-00282910	FIT RIFLE CLIP PADS	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE6	000000-00282910	FIT MISSING SPARE WHEEL VALVE EXTENSION	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE7	000000-00282910	FIT COVER AT R/H SPARE WHEEL MOUNT	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE9	000000-00282910	FREE OFF RECOVERY SHACKLES	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289ABC	000000-00281DDE	FIT SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00283845	000000-002816CE	CARRY OUT 5 YEARLY OOP MAINT	Closed	Non-Taskworthy	No	Level 1	18 Sep 2008	TUM HS FFR HARD TOP
000000-00283847	000000-002813C4	CARRY OUT 1 YEARLY QT TASKS	Closed	Non-Taskworthy	No	Level 2	18 Sep 2008	TUM HS FFR HARD TOP
000000-00283859	000000-002813C4	CARRY OUT MEI	Closed	Non-Taskworthy	No	Level 2	18 Sep 2008	TUM HS FFR HARD TOP
000000-00289ABE	000000-0028163D	FIT SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AC2	000000-0028163D	FIT SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AC7	000000-0028163D	FIT SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AD0	000000-0028163D	FIR SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AD1	000000-0028163D	FIR SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AE5	000000-00281641	FIT MISSING SPARE WHEEL	Closed	Fully Fit	No	Level 1	22 Sep 2008	TUM HS FFR HARD TOP
000000-00289AEC	000000-0028163D	FIT SEAT BELT PROTECTOR MOD	Closed	Fully Fit	No	Level 2	22 Sep 2008	TUM HS FFR HARD TOP
000000-00283830	000000-00281646	CARRY OUT 1 YEARLY SERVICE	Closed	Non-Taskworthy	No	Level 1	18 Sep 2008	TUM HS FFR HARD TOP
000000-0008FB34		Initial Usage	Closed	Fully Fit	No	Level 1	25 Jan 2008	TUM HS FFR HARD TOP
000000-0008FC4C		Initial Usage	Closed	Fully Fit	No	Level 1	25 Jan 2008	TUM HS FFR HARD TOP
000000-0008FD4E		Initial Maintenance	Closed	Fully Fit	No	Level 1	25 Jan 2008	TUM HS FFR HARD TOP

Work Objects

Serial Number: HS58AA
 NSN: 2320998939744

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Maintenance Event ID	Work Request ID	Escalate Work	Maintenance Event Name	Next Due Date	Repair Level	Fault State	Work Status	Estimated Repair Time	Working Organisation	Repair Section
000000-0018FE6C		No	MEI (2)		Level 2			000:00		
000000-001127CF		No	MEI (2)		Level 2			000:00		
000000-00A87A46		No	6 Monthly 6534 Insp		Level 1	Non-Taskworthy	CL	000:00		
000000-003643F6		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-002D4A3A		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-007597E5		No	MEI (2)		Level 2			000:00		
000000-004D18B5		No	MEI (2)		Level 2	Fully Fit	CL	000:00		INSPECTION
000000-00B0CB45		No	MEI (2)		Level 2	Non-Taskworthy	CL	000:00		
000000-00436706		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-003643C3		No	MEI (2)		Level 2			000:00		
000000-009873EC		No	MEI (2)		Level 2			000:00		
000000-0081DE16		No	6 Monthly 6534 Insp		Level 1	Non-Taskworthy	CL	000:00		
000000-00987520		No	MEI (2)		Level 2			000:00		
000000-0060FE50		No	MEI (2)		Level 2	Non-Taskworthy	CL	000:00		
000000-0057BFA2		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-0098733A		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00683A83		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00987521		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-007597E6		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-000A240A		No	MEI (2)		Level 2		CL	000:00		
000000-000C5B48		No	MEI (2)		Level 2		CL	000:00		
000000-000A267B		No	MEI (2)		Level 2		CL	000:00		
000000-000257AB		No	MEI (2)		Level 2		CL	000:00		
000000-0002DDA7		No	MEI (2)		Level 2		CL	000:00		
000000-0003017C		No	First Parade Insp (AR)(1)		Level 1		CL	000:00		
000000-0004E236		No	First Parade Insp (AR)(1)		Level 1		CL	000:00		
000000-00167F8E		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-0018FF97		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00B0CB46		No	6 Monthly 6534 Insp		Level 1	Non-Taskworthy	CL	000:00		
000000-002513D9		No	MEI (2)		Level 2			000:00		
000000-0070F1F2		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-001718E5		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-002513DA		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-004D18C4		No	6 Monthly 6534 Insp		Level 1	Fully Fit	CL	000:00		INSPECTION
000000-0060FE58		No	6 Monthly 6534 Insp		Level 1			000:00		
000000-00683A82		No	MEI (2)		Level 2			000:00		

Work Objects

Serial Number: HS58AA
 NSN: 232098939744

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Modification Event ID	Modification Number	Modification Description	Work Request ID	Escalate Work	Production Classification/In Service Classification	Modification Type	Apply When Usage Equals	Embody by Target Date	Usage Counter Units	Fault State	Work Status	Repair Level	Working Organisation	Repair Section	Estimated Repair Time
000000-00693E83	00046	FITTING OF WHEEL NUT INDICATORS TO LAND ROVER HS PLATFORMS		No	1/A	Mod				Non-Taskworthy	CL	Level 2			000:00
000000-00025EBF	00020	8 Metre Mast Mount Installation Kit		No	-/-	UTI				Fully Fit	CL				
000000-0000921E	00003	Heli-lift Vehicle Modification (Hard Top Only)		No	-/	RTI				Fully Fit	CL				
		This instruction details the removal of the existing six way lighting switch and the fitting of a seven way lighting switch to all variants including winter water vehicles.		No	3/A	Mod				Fully Fit					
000000-00643925	00044			No	-/	RTI				Fully Fit	CL	Level 1			
000000-00018294	00006	Fitting of Spare Wheel Tyre Inflation Valve Extensior		No	-/-	RTI				Fully Fit	CL	Level 2			
000000-00643921	00039	TUM (HS) REMUS 1- SAFETY AND COMPLIANCE PROGRAMME		No	-/-	UTI				Fully Fit	CL	Level 2			
000000-00643922	00024	Fitting of Trailer Breakaway Attachment Plate		No	-/	UTI				Fully Fit	CL				
000000-0000D089	00016	Radio Battery Isolation Switch and Power Import / Export System		No	-/	RTI				Fully Fit	CL				
000000-000102D4	00032	Project SHOEHORN Revised Weight Data Plate		No	-/	UTI				Fully Fit	CL				
000000-0000B8A6	00008	Input / Output Porthole for Comms / Power Cable Installatior		No	-/	RTI				Fully Fit	CL				
000000-00011C05	00027	Input/Output Porthole for Communication Cables, Cover Modificatior		No	-/	UTI				Fully Fit	CL				
000000-0001339B	00019	Blackout Cover for Warning Light Panel		No	-/-	UTI				Fully Fit	CL				
000000-00020A32	00029	Spare Wheel Adaptor Plates; Left and Right Hand Installatior		No	-/-	UTI				Fully Fit	CL				
000000-00024F3F	00038	Fitting of a New Import/Export Box Mount Bracket		No	-/-	UTI				Fully Fit	CL				
000000-0000FAE1	00033	Rear Door Blackout Blind (FFR Variants) Only		No	-/-	UTI				Fully Fit	CL				
000000-000204CE	00012	Fitting Radio Frequency Radiated Hazard (RADHAZ) Protection Kit		No	1/A	RTI				Fully Fit	CL				
000000-00022621	00001	Radio Rack Fixings		No	-/	RTI				Fully Fit	CL				
000000-0000B01D	00007	TUAAM Earth Bonding Improvements		No	1/A	UTI				Fully Fit	CL				
000000-0000D995	00035	Fitting of Emergency Hammer		No	1/A	UTI				Fully Fit	CL				
000000-0001907E	00017	Introduction of Battery Retention		No	1/A	UTI				Fully Fit	CL				
000000-000225C7	00037	Fitting Glow Plug Timer Interface Harness		No	-/	UTI				Fully Fit	CL				
000000-00010FD9	00030	Front Belt Protection Sleeves		No	1/A	UTI				Fully Fit	CL				
000000-00018279	00002	Roof Mounted Communication Installation (Blanking Plate Only)		No	-/	RTI				Fully Fit	CL				
000000-000243CE	00025	Fitting of Spare Wheel Lifting Aid Harness		No	1/A	UTI				Fully Fit	CL				

Work Objects

Serial Number: HS58AA
 NSN: 2320998939744

Criteria:
 Repair Level: ALL
 Work Object Status: Closed
 Mission Impact: ALL
 Fault State: ALL
 Escalate Work: ALL
 Work Request ID:
 Assigned Work Status: ALL
 Working Organisation:
 Repair Section:

Maintenance Event ID	Work Request ID	Escalate Work	Maintenance Event Name	Next Due Date	Repair Level	Fault State	Work Status	Estimated Repair Time	Working Organisation	Repair Section
000000-004D18FE		No	2 Yearly/40000 Kms	30 Oct 2020	Level 1	Fully Fit	CL	000:00		B LINE
000000-00A87A93		No	2 Yearly/40000 Kms	30 Oct 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-002513CF		No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	30 Oct 2020	Level 1			000:00		
000000-0057BFA3		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-00A87ACD		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1	Non-Taskworthy	CL	000:00		
000000-0018FF89		No	2 Yearly/40000 Kms	30 Oct 2020	Level 1			000:00		
000000-002513CD		No	OOPS 6 Yearly/120000 Kms Camshaft Timing Belt (2)	19 Feb 2025	Level 2			000:00		
000000-002513CE		No	OOPS 5 Yearly/155000 Kms Drain And Replen Gearbox Oil (2)	16 May 2023	Level 2			000:00		
000000-002513E5		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-00A87ACC		No	Yearly/20000 Kms	22 Apr 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-007597F4		No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00		
000000-002D4AB9		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-001127C2		No	2 Yearly/40000 Kms	30 Oct 2020	Level 1			000:00		
000000-007597F3		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-001127C4		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-00B0CAD4		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1	Non-Taskworthy	CL	000:00		
000000-0081DDB8		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1	Non-Taskworthy	CL	000:00		
000000-00364402		No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00		
000000-00AA46D8		No	OOPS 6 Yearly/120000 Kms Camshaft Timing Belt (2)	19 Feb 2025	Level 2	Non-Taskworthy	CL	000:00		
000000-004D18C9		No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	30 Oct 2020	Level 1	Fully Fit	CL	000:00		B LINE
000000-0018FF8A		No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00		
000000-0018FF9D		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-00B0CA9F		No	Yearly/20000 Kms	22 Apr 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-0060EADB		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1	Fully Fit	CL	000:00		
000000-00683A79		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-002513CC		No	2 Yearly/40000 Kms	30 Oct 2020	Level 1			000:00		
000000-002513E7		No	OOPS 5 Yearly Drain/Flush And Replen Cooling System	16 May 2023	Level 1			000:00		
000000-00A87A5E		No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	30 Oct 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-001718C5		No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00		
000000-00A87A55		No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	30 Oct 2020	Level 1	Non-Taskworthy	CL	000:00		
000000-004D1900		No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	30 Oct 2020	Level 1	Fully Fit	CL	000:00		B LINE

000000-00436732	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00
000000-00986BDD	No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00
000000-000A254F	No	5 Yearly/100000 Kms (1)		Level 1		CL	000:00
000000-000A2513	No	Yearly/20000 Kms	22 Apr 2020	Level 1		CL	000:00
000000-000CF28F	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-000F6DC9	No	Weekly (AR)(1)		Level 1		CL	000:00
000000-000A5C57	No	Weekly (AR)(1)		Level 1		CL	000:00
000000-001002FF	No	2 Yearly/40000 Kms	30 Oct 2020	Level 1		CL	000:00
000000-000D70D9	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-000E74D0	No	Yearly/20000 Kms	22 Apr 2020	Level 1		CL	000:00
000000-000AD7DA	No	2 Yearly/40000 Kms	30 Oct 2020	Level 1		CL	000:00
000000-000AD7DB	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-000AD7DC	No	Yearly/20000 Kms	22 Apr 2020	Level 1		CL	000:00
000000-000AD7DD	No	Weekly (AR)(1)		Level 1		CL	000:00
000000-0001130C	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-0001860A	No	6 Yearly/120000 Kms (2)		Level 2		CL	000:00
000000-000FA2DC	No	Yearly/20000 Kms	22 Apr 2020	Level 1		CL	000:00
000000-0002FD32	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-000F16AD	No	Weekly (AR)(1)		Level 1		CL	000:00
000000-00052797	No	Weekly (AR)(1)		Level 1		CL	000:00
000000-00052796	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1		CL	000:00
000000-00683A78	No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00
000000-004D1901	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1	Fully Fit	CL	000:00
000000-004D18FF	No	Yearly/20000 Kms	22 Apr 2020	Level 1	Fully Fit	CL	000:00
							B LINE
							B LINE
000000-002513E4	No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	30 Oct 2020	Level 1			000:00
000000-007597F0	No	2 Yearly/40000 Kms	30 Oct 2020	Level 1			000:00
000000-0070F1F0	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00
000000-00986BDE	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00
000000-0018FE7B	No	5 Yearly/100000 Kms (1)		Level 1			000:00
000000-0060E29E	No	Yearly/20000 Kms	22 Apr 2020	Level 1	Fully Fit	CL	000:00
000000-00364403	No	6 Monthly/10000 Kms	22 Oct 2019	Level 1			000:00
000000-007597F1	No	OOPS 2 Yearly/40000 Kms Replace Air Cleaner Element (1)	30 Oct 2020	Level 1			000:00
000000-007597F2	No	OOPS 2 Yearly/20000 Kms Drain Engine Oil And Filter Change (1)	30 Oct 2020	Level 1			000:00
000000-00986BCB	No	OOPS 5 Yearly Drain/Flush And Replen Cooling System	16 May 2023	Level 1			000:00
000000-001127C3	No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00
000000-00986BF2	No	OOPS 5 Yearly/155000 Kms Drain And Replen Gearbox Oil (2)	16 May 2023	Level 2			000:00
000000-002513E6	No	Yearly/20000 Kms	22 Apr 2020	Level 1			000:00