

HS2

November 2023

Construction Noise and Vibration Monthly Report – September 2023

North Warwickshire Borough Council

Non-Technical Summary	1
Abbreviations and Descriptions	3
1 Introduction	4
1.2 Measurement Locations	6
2 Summary of Results	8
2.1 Summary of Measured Noise and Vibration Levels	8
2.2 Exceedances of the LOAEL and SOAEL	12
2.3 Exceedances of Trigger Level	15
2.4 Complaints	15
Appendix A Site Locations	17
Appendix B Monitoring Locations	22
Appendix C Data	28

List of tables

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	6
Table 3: Summary of Measured dB L _{Aeq} Data over the Monitoring Period	9
Table 4: Summary of Measured PPV Data over the Monitoring Period	12
Table 5: Summary of Exceedances of LOAEL and SOAEL	13
Table 7: Summary of Exceedances of Trigger Levels	15
Table 8: Summary of Complaints	16

OFFICIAL

Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within North Warwickshire Borough Council (NWBC) area during the month of September 2023.

Within this period monitoring was undertaken at the following worksites:

- Noise monitoring was undertaken at the Church Lane Embankment worksite (ref.: CLE), where fencing installation was underway.
- Noise monitoring was undertaken at the Kingsbury Main Compound worksite (ref.: KMC), where works activities included de-vegetation, material deliveries and Compound operation.
- Noise monitoring was undertaken at the Birmingham & Fazeley Canal Viaduct worksite (ref.: BFCV), where bridge installation works were underway.
- Noise and vibration monitoring was undertaken at the Marston Box/Marston Lane worksite (ref.: MB), where activities included stockpiling, separation of rebar, material movements, concrete breaking and piling platform construction.
- Noise monitoring was undertaken at the Faraday Avenue Embankment and Underbridge worksite (ref.: FAEU), where embankment construction works were underway.
- Noise monitoring was undertaken at the Water Orton South Compound worksite (ref.: WOSC), where installation of cofferdams was underway.
- Noise monitoring was undertaken at the Chattle Hill Box Structure worksite (ref.: CHBS), where activities included pile cropping, concrete pours and material removal works.
- Noise monitoring was undertaken at the Attleboro Lane Overbridge worksite (ref.: ALO), where work activities included topsoil stripping and embankment filling.
- Noise monitoring was undertaken at the Gilson Embankment worksite (ref.: GE), where work activities included foundation works and technical backfill.
- Noise monitoring was undertaken at the Gilson Drive worksite (ref.: GLD), where activities included temporary bridge installation, viaduct works, embankment construction works, technical backfilling, culvert works and vehicle movements.
- Noise monitoring was undertaken at the Birmingham Road worksite (ref.: BRD), where cofferdam installation was underway.

OFFICIAL

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<https://www.gov.uk/government/publications/hs2-information-papers-environment>) were exceeded on one (1) occasion due to HS2 works during September 2023.

There were no exceedances of trigger levels, as defined in Section 61 consents during the reporting period.

Eight (8) complaints were received within the North Warwickshire area during the monitoring period. A description of the complaint, the results of investigations and any actions taken are detailed in Table 7 of this report.

Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
$L_{Aeq,T}$	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A-weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or $L_{Aeq,T}$	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in m/s ^{1.75} .

OFFICIAL

1 Introduction

- 1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:
- monitoring the impact of construction works;
 - to investigate complaints, incidents and exceedance of trigger levels; or
 - monitoring the effectiveness of noise and vibration control measures.
- 1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the North Warwickshire Borough Council (NWBC) area for the period 1st to 31st September 2023.
- 1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:
- Church Lane Embankment worksite, ref.: CLE (see Plan 1 in Appendix A), where work activities included:
 - Fencing installation, including post and wire installation.
 - Kingsbury Main Compound worksite, ref.: KMC (see Plan 2 in Appendix A), where work activities included:
 - De-vegetation, including strimming.
 - Material deliveries.
 - Compound operation.
 - Birmingham & Fazeley Canal Viaduct worksite, ref.: BFCV (see Plan 2 in Appendix A), where works activities included:
 - Bridge installation, including installation of rebar, concrete pours and bridge lifting.
 - Marston Box/Marston Lane worksite (ref.: MB), where work activities included:

- Stockpiling.
 - Separation of rebar.
 - Material movements.
 - Concrete breaking out.
 - Piling platform construction.
- Faraday Avenue Embankment and Underbridge worksite, ref.: FAEU (see Plan 3 in Appendix A), work activities included:
 - Embankment construction.
- Water Orton South Compound worksite, ref.: WOSC (see Plan 4 in Appendix A), work activities included:
 - Installation of cofferdams.
- Chatte Hill Box Structure worksite, ref.: CHBS (see Plan 4 in Appendix A), where work activities included:
 - Pile cropping.
 - Concrete pours.
 - Material removal.
- Attleboro Lane Overbridge worksite, ref.: ALO (see Plan 4 in Appendix A), where work activities included:
 - Topsoil stripping.
 - Embankment filling.
- Gilson Embankment worksite, ref.: GE (see Plan 4 in Appendix A)
 - Foundation works.
 - Technical backfill.
- Gilson Drive worksite, ref.: GLD (see Plan 4 in Appendix A), works activities included:
 - Temporary bridge installation.
 - Viaduct works including installation of welfare unit.
 - Embankment construction, including filling.
 - Material deliveries.
 - Technical backfilling.

- Vehicle movements.
- Culvert works including Excavation, dig and replace.
- Birmingham Road worksite, ref.: BRD (see Plan 4 in Appendix A), work activities included:
 - Installation of cofferdam.

1.1.4 The applicable standards, guidance, and monitoring methodology is outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2>. Noise and vibration monitoring reports for previous months can also be found at this location.

1.2 Measurement Locations

- 1.2.1 Seventeen (17) noise monitoring installations and nine (9) vibration monitoring installations were active in September in the NWBC area. Table 2 summarises the position of noise and vibration monitoring installations within the NWBC area in September 2023.
- 1.2.2 Monitor WOSC-N1 was decommissioned on the 21st of September.
- 1.2.3 Maps showing the position of noise and vibration monitoring installations are presented in Appendix B.

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
Church Lane Embankment (CLE)	CLE-N1	Highfields Cottage, Middleton, North Warwickshire
Kingsbury Main Compound (KMC)	KMC-N1	Kingsbury Road, Curdworth CP, Marston, Warwick, West Midlands
	KMC-N2	Kingsbury Road, Curdworth CP, Marston, Warwick, West Midlands
Birmingham Fazeley Canal Viaduct (BFCV)	BFCV-N2	North of Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire
	BFCV-V4	North of Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire
Marston Box (MB)	MB-N1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
	MB-V1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
Faraday Avenue Embankment and Underbridge (FAEU)	FAEU-N1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire
	FAEU-V1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire

Worksite Reference	Measurement Reference	Address
Water Orton South Compound (WOSC)	WOSC-N1	53 Watton Lane, Water Orton CP, Warwickshire
	WOSC-V1	53 Watton Lane, Water Orton CP, Warwickshire
Chattle Hill Box Structure (CHBS)	CHBS-N1	6 Gorsey Way, Coleshill, Warwickshire, Birmingham
Attleboro Lane Overbridge (ALO)	ALO-N1	West of 47 Attleboro Lane, Water Orton, Birmingham
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD
	AFE-N1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD
	ALO-V1	West of 47 Attleboro Lane, Water Orton, Birmingham
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD
Gilson Embankment (GE)	GE-N1	The Cottage, Gilson Road, Coleshill, Warwickshire
	GE-N2	Lovelock Cottage, Gilson Road, Warwickshire
	GE-V1	The Cottage, Gilson Road, Coleshill, Warwickshire
Gilson Drive (GLD)	GLD-N1	10 Gilson Dr, Coleshill, Birmingham
	GLD-V1	10 Gilson Dr, Coleshill, Birmingham
	CM-N1	Coleshill Manor Office Campus, Birmingham
Birmingham Road (BRD)	BRD-N2	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-N3	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-V1	1 New Cottages, Birmingham Road, Coleshill, Birmingham

2 Summary of Results

2.1 Summary of Measured Noise and Vibration Levels

2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The $L_{Aeq,T}$ is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period $L_{Aeq,T}$ that was found to occur within the month.

Table 3: Summary of Measured dB L_{Aeq} Data over the Monitoring Period

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Saturday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Sunday / Public Holiday Average L _{Aeq,T} (Highest Day L _{Aeq,T})	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
CLE	CLE-N1	Highfields Cottage, Middleton	Free-field	48.8 (52.5)	48.1 (67.7)	45.0 (51.5)	43.9 (51.9)	42.1 (53.6)	45.4 (53.5)	44.2 (45.9)	44.7 (48.4)	45.8 (65.1)	40.8 (48.5)	46.0 (54.1)	42.0 (50.3)
KMC	KMC-N1	Kingsbury Road, Curdworth CP, Marston	Free-field	56.8 (61.6)	61.4 (75.1)	56.2 (70.6)	54.6 (59.6)	53.6 (59.7)	55.5 (57.8)	53.9 (55.3)	53.1 (55.1)	53.2 (55.4)	52.0 (55.8)	53.0 (55.9)	53.1 (57.4)
	KMC-N2	Kingsbury Road, Curdworth CP, Marston		57.2 (60.1)	57.3 (68.8)	55.0 (58.6)	54.3 (58.3)	53.5 (58.6)	55.1 (57.7)	53.9 (55.3)	53.4 (54.9)	53.3 (55.4)	52.3 (55.3)	53.3 (57.2)	53.3 (57.6)
BFCV	BFCV-N2	(North of) Lock Cottage, Marston Lane, Curdworth CP	Free-field	68.7 (69.9)	67.9 (70.7)	67.7 (71.7)	66.8 (70.0)	65.0 (70.5)	66.2 (67.0)	67.4 (69.1)	67.5 (69.6)	67.0 (69.8)	63.7 (66.6)	67.5 (71.4)	64.7 (69.2)
MB	MB-N1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield	Free-field	56.2 (60.2)	56.1 (68.0)	55.7 (59.3)	54.7 (59.1)	52.7 (60.1)	56.0 (58.1)	54.6 (56.1)	52.8 (56.3)	53.8 (59.5)	51.1 (55.8)	52.7 (55.6)	51.9 (58.4)
FAEU	FAEU-N1	South of Orchard Cottage, Newlands Lane, Curdworth	Free-field	56.2 (63.2)	56.4 (63.0)	53.9 (60.6)	53.4 (62.3)	52.2 (64.9)	55.0 (59.6)	53.2 (56.1)	50.3 (55.0)	51.0 (55.1)	51.0 (55.8)	51.6 (61.4)	52.8 (59.2)
WOSC	WOSC-N1	53 Watton Lane, Water Orton CP	Free-field	67.0 (68.6)	67.5 (80.1)	65.2 (68.2)	63.5 (69.7)	60.9 (67.3)	64.0 (65.0)	65.6 (66.3)	65.1 (66.0)	64.4 (67.2)	59.0 (62.3)	64.4 (67.6)	60.5 (66.6)

OFFICIAL

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Saturday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Sunday / Public Holiday Average L _{Aeq,T} (Highest Day L _{Aeq,T})	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
CHBS	CHBS-N1	6 Gorsey Way, Coleshill	Free-field	64.7 (66.4)	64.7 (66.1)	63.5 (67.2)	61.8 (64.8)	59.8 (65.5)	61.2 (64.3)	62.6 (62.9)	62.9 (65.1)	61.8 (65.0)	56.8 (61.8)	61.8 (66.1)	59.0 (64.5)
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton	Free-field	58.1 (63.7)	60.8 (67.0)	55.4 (62.3)	55.1 (62.8)	53.8 (63.4)	55.0 (60.1)	54.1 (56.7)	52.8 (58.5)	54.3 (60.1)	52.6 (60.1)	54.8 (62.7)	55.8 (62.2)
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD	Free field	58.2 (63.7)	59.9 (66.4)	55.6 (62.3)	55.5 (62.3)	54.1 (63.6)	55.1 (60.5)	54.3 (57.1)	52.8 (58.0)	54.3 (60.4)	52.9 (60.3)	54.8 (62.4)	55.9 (62.1)
	AFE-N1	Attleboro Farm, Attleboro Lane, B46 1SD	Free field	65.2 (67.7)	70.2 (72.3)	61.2 (66.3)	60.5 (65.7)	58.9 (67.0)	58.6 (64.2)	58.4 (61.5)	58.5 (62.3)	59.7 (64.8)	57.4 (63.8)	60.3 (66.2)	60.0 (65.7)
GE	GE-N1	The Cottage, Gilson Road, Coleshill	Free-field	61.0 (64.6)	61.2 (64.9)	60.1 (64.1)	58.2 (63.5)	55.9 (63.0)	57.5 (60.3)	58.6 (60.0)	59.2 (61.4)	58.2 (61.8)	53.7 (57.8)	57.9 (62.8)	56.5 (62.8)
	GE-N2	Lovelock Cottage, Gilson Road	Free-field	60.4 (63.7)	60.2 (63.7)	58.3 (62.3)	56.8 (61.1)	55.0 (63.2)	57.2 (60.8)	59.5 (70.0)	55.7 (59.2)	55.8 (59.5)	52.6 (58.4)	59.5 (80.0)	56.7 (63.0)
GLD	GLD-N1	10 Gilson Dr, Coleshill	Free-field	59.1 (62.3)	58.9 (63.7)	57.5 (63.6)	56.5 (62.2)	55.3 (61.9)	57.1 (58.5)	55.8 (58.3)	56.2 (64.1)	56.3 (61.4)	53.5 (58.0)	58.1 (63.1)	54.9 (61.6)

OFFICIAL

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Saturday Average L _{Aeq,T} (Highest Day L _{Aeq,T})					Sunday / Public Holiday Average L _{Aeq,T} (Highest Day L _{Aeq,T})	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
	CM-N1	Coleshill Manor Office Campus, Birmingham	Free-field	58.5 (62.3)	58.5 (69.5)	56.7 (60.6)	56.2 (60.9)	55.1 (61.3)	57.8 (59.0)	56.9 (65.4)	54.9 (61.1)	55.8 (63.3)	53.7 (56.7)	56.5 (60.4)	54.8 (62.0)
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill	Free-field	63.5 (65.6)	63.4 (66.3)	62.1 (65.4)	61.1 (63.9)	58.7 (64.8)	61.0 (62.3)	61.3 (63.2)	60.6 (63.2)	60.9 (64.3)	57.5 (61.0)	61.7 (64.7)	59.3 (64.7)
	BRD-N3		Free-field	70.2 (72.0)	70.5 (72.4)	68.7 (71.5)	66.8 (71.2)	64.0 (70.8)	68.0 (68.8)	69.2 (71.0)	69.4 (70.7)	67.6 (70.5)	63.2 (67.0)	68.1 (70.2)	64.3 (70.1)

OFFICIAL

- 2.1.2 Table 4 presents a summary of the measured vibration levels at the monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
BFCV	BFCV-V4	(North of) Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire	1.70 (Z-axis)
MB	MB-V1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midland	0.28 (X-axis)
FAEU	FAEU-V1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire	3.27 (X-axis)*
WOSC	WOSC-V1	53 Watton Lane, Water Orton CP, Warwickshire	2.16 (X-axis)
ALO/AFE	ALO-V1	West of 47 Attleboro Lane, Water Orton, Birmingham	1.45 (X-axis)
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD	1.12 (Z-axis)
GE	GE-V1	The Cottage, Gilson Road, Coleshill, Warwickshire	0.94 (X-axis)
GLD	GLD-V1	10 Gilson Dr, Coleshill, Birmingham	0.94 (X-axis)
BRD	BRD-V1	1, New Cottages, Birmingham Road, Coleshill, Birmingham	4.13 (Z-axis)*

- 2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly L_{Aeq} values and, where relevant, the $L_{Aeq,T}$ values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location:
<https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data>.

2.2 Exceedances of the LOAEL and SOAEL

- 2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects

OFFICIAL

the acoustic character of the area such that there is a perceived change in the quality of life".

- 2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."
- 2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAEls and SOAEls for construction noise.
- 2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
CLE	CLE-N1*	Highfields Cottage, Middleton	Weekday	0800-1800	1	No exceedances
KMC	KMC-N1*	Kingsbury Road, Sutton Coldfield	All days	All periods	No exceedances	No exceedances
	KMC-N2	Kingsbury Road, Sutton Coldfield	Weekday	0800-1800	1	No exceedances
BFCV	BFCV-N2	North of Lock Cottage, Marston Lane, Curdworth	All days	All periods	No exceedances	No exceedances
MB	MB-N1*	Elford House, Kingsbury Road, Curdworth	Weekday	0800-1800	1	No exceedances

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
FAEU	FAEU-N1*	South of Orchard Cottage, Newlands Lane, Curdworth	All days	All periods	No exceedances	No exceedances
WOSC	WOSC-N1	53 Watton Lane, Water Orton CP	Weekday	0800-1800	1	1
CHBS	CHBS-N1*	6 Gorsey Way, Coleshill	All days	All periods	No exceedances	No exceedances
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton	Weekday	0800-1800	7	No exceedances
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD	Weekday	0800-1800	2	No exceedances
	AFE-N1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD	Weekday	0800-1800	21	No exceedances
GE	GE-N1	The Cottage, Gilson Road, Coleshill	All days	All periods	No exceedances	No exceedances
	GE-N2	Lovelock Cottage, Gilson Road	Saturday	0800-1300	1	No exceedances
GLD	GLD-N1	10 Gilson Dr, Coleshill	All days	All periods	No exceedances	No exceedances
	CM-N1	Coleshill Manor Office Campus, Birmingham	Weekday Saturday	0800-1800 0800-1300	1 1	No exceedances
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill	All days	All periods	No exceedances	No exceedances
	BRD-N3*	1 New Cottages, Birmingham Road, Coleshill	Weekdays Saturday	0800-1800 0800-1300	16 1	No exceedances

*A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

OFFICIAL

- 2.2.6 Exceedances of the LOAEL were recorded at ten (10) monitoring locations, within weekday periods.
- 2.2.7 For the purpose of assessing eligibility for noise insulation or temporary rehousing, multiple exceedances of the SOAEL in a 24-hour period would be counted as a single exceedance during that day. Over the reporting period, the overall number of SOAEL exceedances at each measurement location is shown in Table 6 and may be lower than the total sum of individual exceedances reported in Table 5 for each location.

Table 6: Summary of Total Exceedances of SOAEL

Worksite Reference	Measurement Reference	Monitor Address	Total of SOAEL exceedances in the month
WOSC	WOSC-N1	53 Watton Lane, Water Orton CP	1

- 2.2.8 One (1) 24-hour period that experienced an exceedance of the SOAEL was recorded due to HS2 construction works during September 2023. Exceedance occurred at noise monitor WOSC-N1 during weekday daytime period.

2.3 Exceedances of Trigger Level

- 2.3.1 Table 7 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 7: Summary of Exceedances of Trigger Levels

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	Identified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-

2.4 Complaints

- 2.4.1 Table 8 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.

OFFICIAL


Table 8: Summary of Complaints

Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
HS2-23-100422-E-C HS2-23-100428-E-C	ALO	Disturbance from beeping and constant noise during the night.	No exceedances were reported at the monitoring stations, works in the area are now complete.	A response was provided to the complainant detailing the results of the investigation.
HS2-23-44943-C HS2-23-99792-E-C	ALO/AFE	Disturbance from beeping, alarms and vehicle reversing noise during the night from site.	Contractor investigated noise sources.	A response was personally provided to the complainant by the contractor detailing the results of the investigation.
HS2-23-44927-C	ALO/AFE	Disturbance from constant droning noise.	Extra noise barriers have been installed to mitigate noise.	A response was provided to the complainant detailing the results of the investigation.
HS2-23-44949-C	ALO/AFE	Disturbance from vibrations near the property during the day.	Extra noise barriers have been installed to mitigate noise.	A response was provided to the complainant detailing the results of the investigation.
HS2-23-44972-C	GE	Disturbance from loud machinery noise during the night.	Extra noise barriers have been installed to mitigate noise.	A response was provided to the complainant detailing the results of the investigation.
HS2-23-44974-C	ALO/AFE	Disturbance from banging and hammering noise from site.	Extra noise barriers have been installed to mitigate noise.	A response was provided to the complainant detailing the results of the investigation.

OFFICIAL

Appendix A Site Locations


HS2 Worksite Identification Plan - Overview

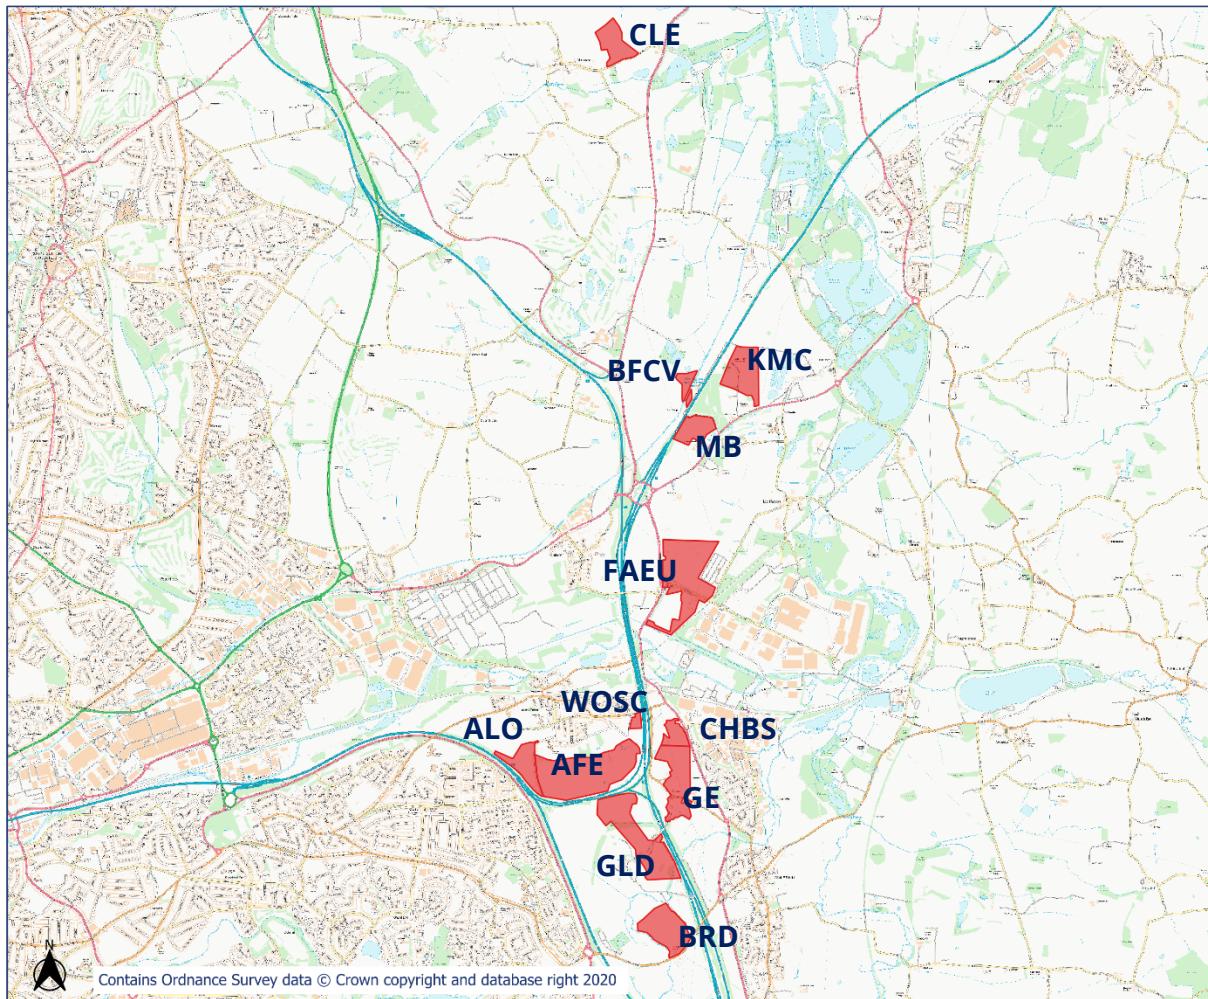

OFFICIAL

HS2

Worksite Identification Plan - 1

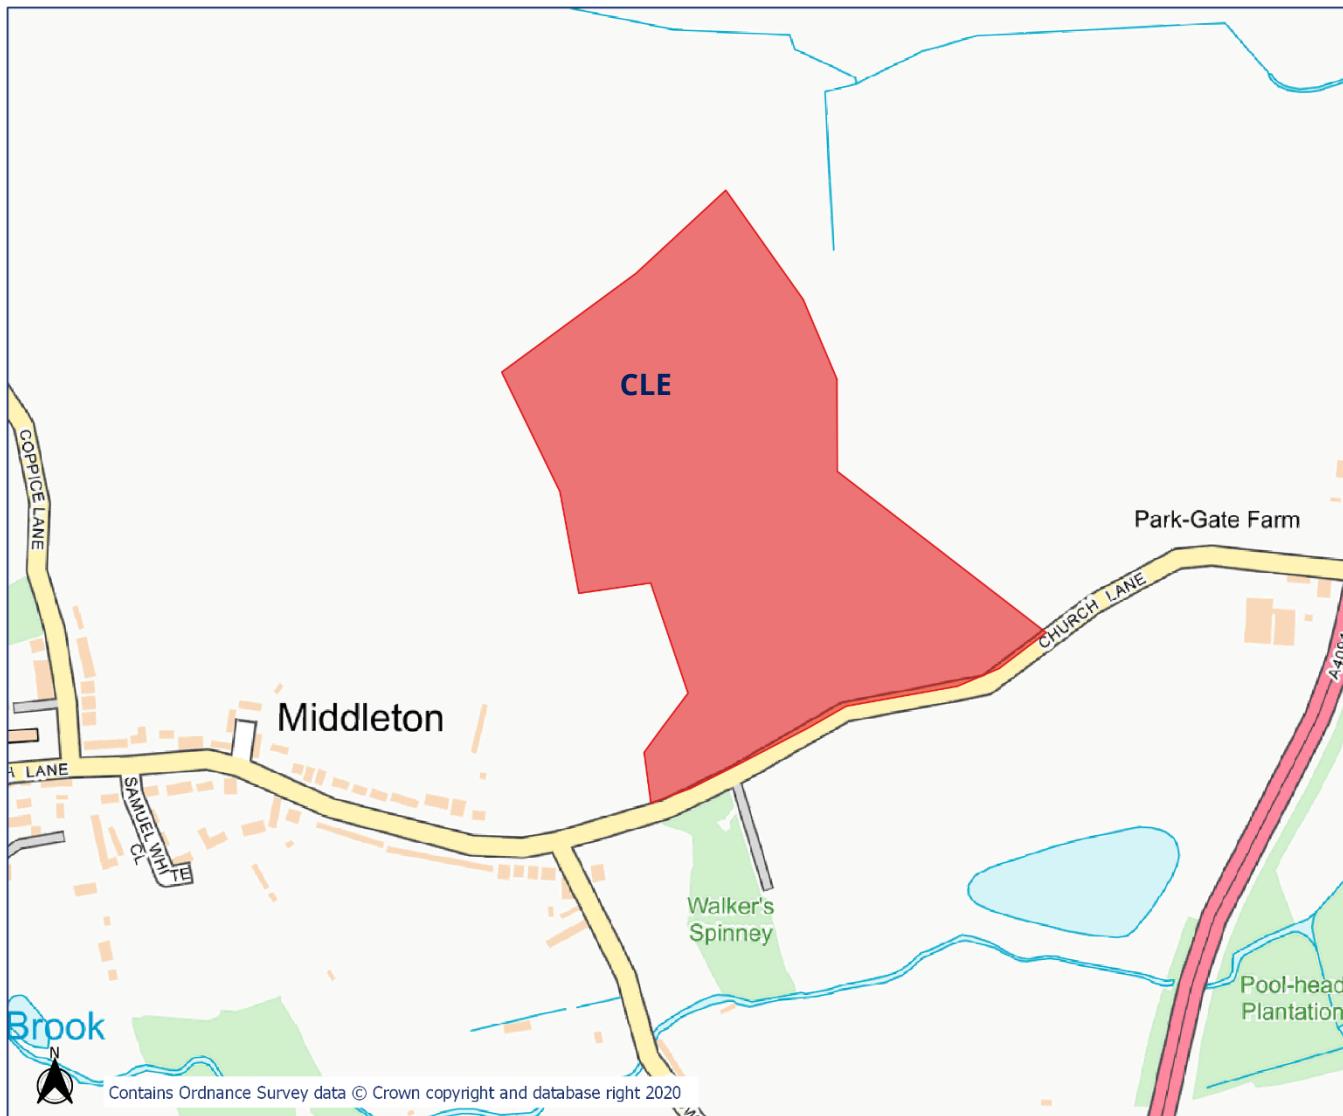


Legend
■ Active Worksites

OFFICIAL

HS2

Worksite Identification Plan - 2

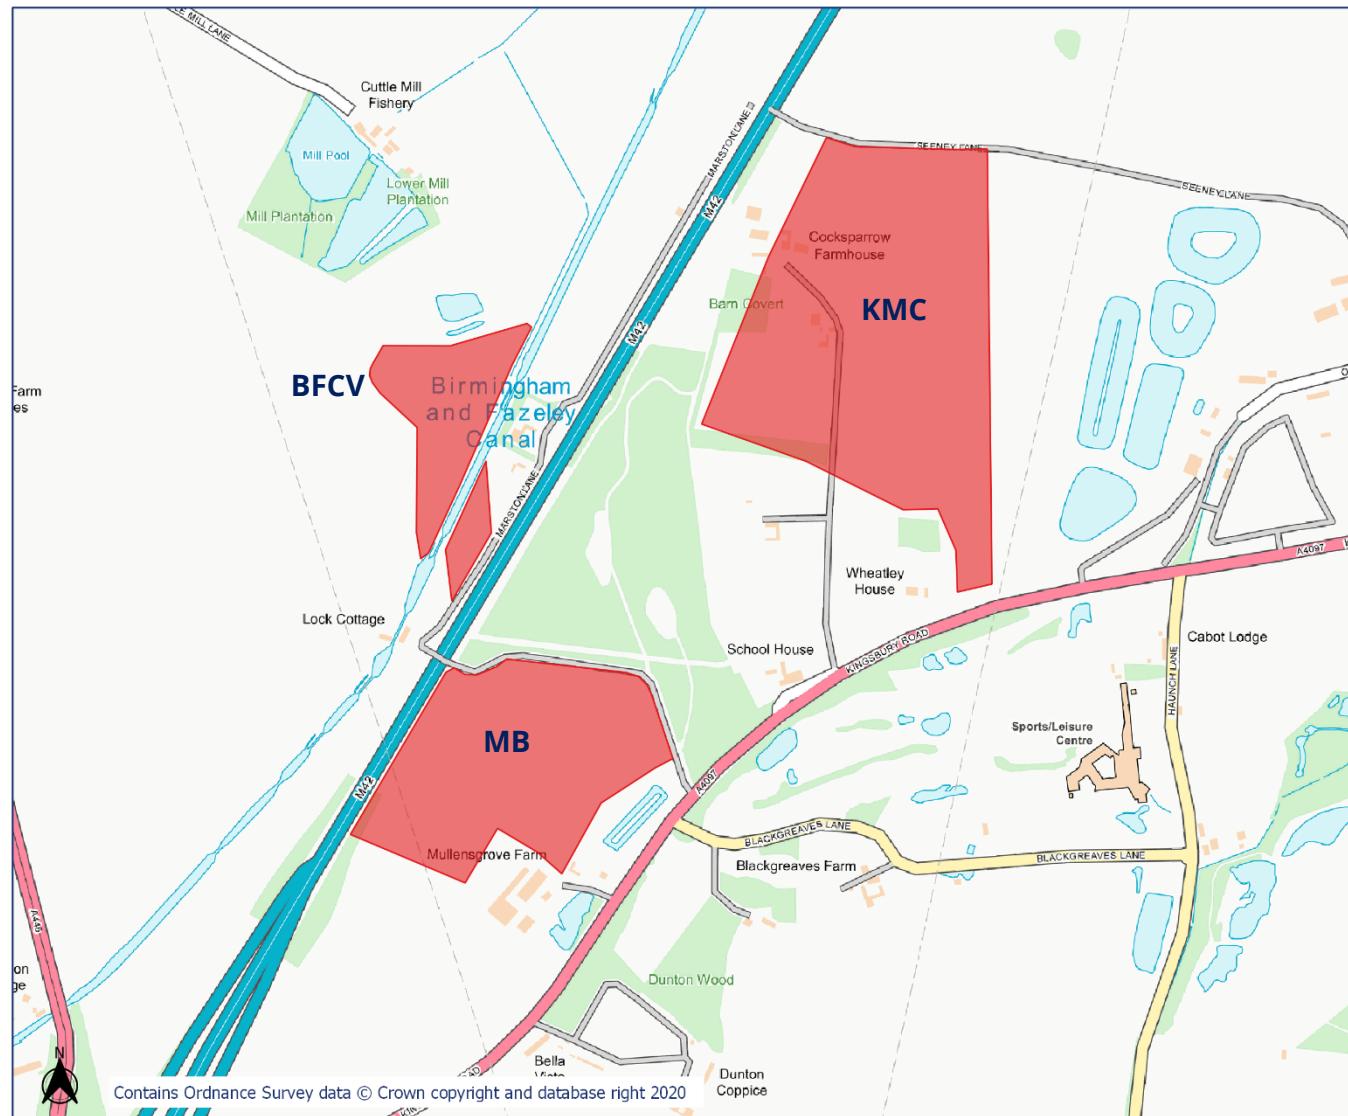


Legend
■ Active Worksites

OFFICIAL

HS2

Worksite Identification Plan - 3

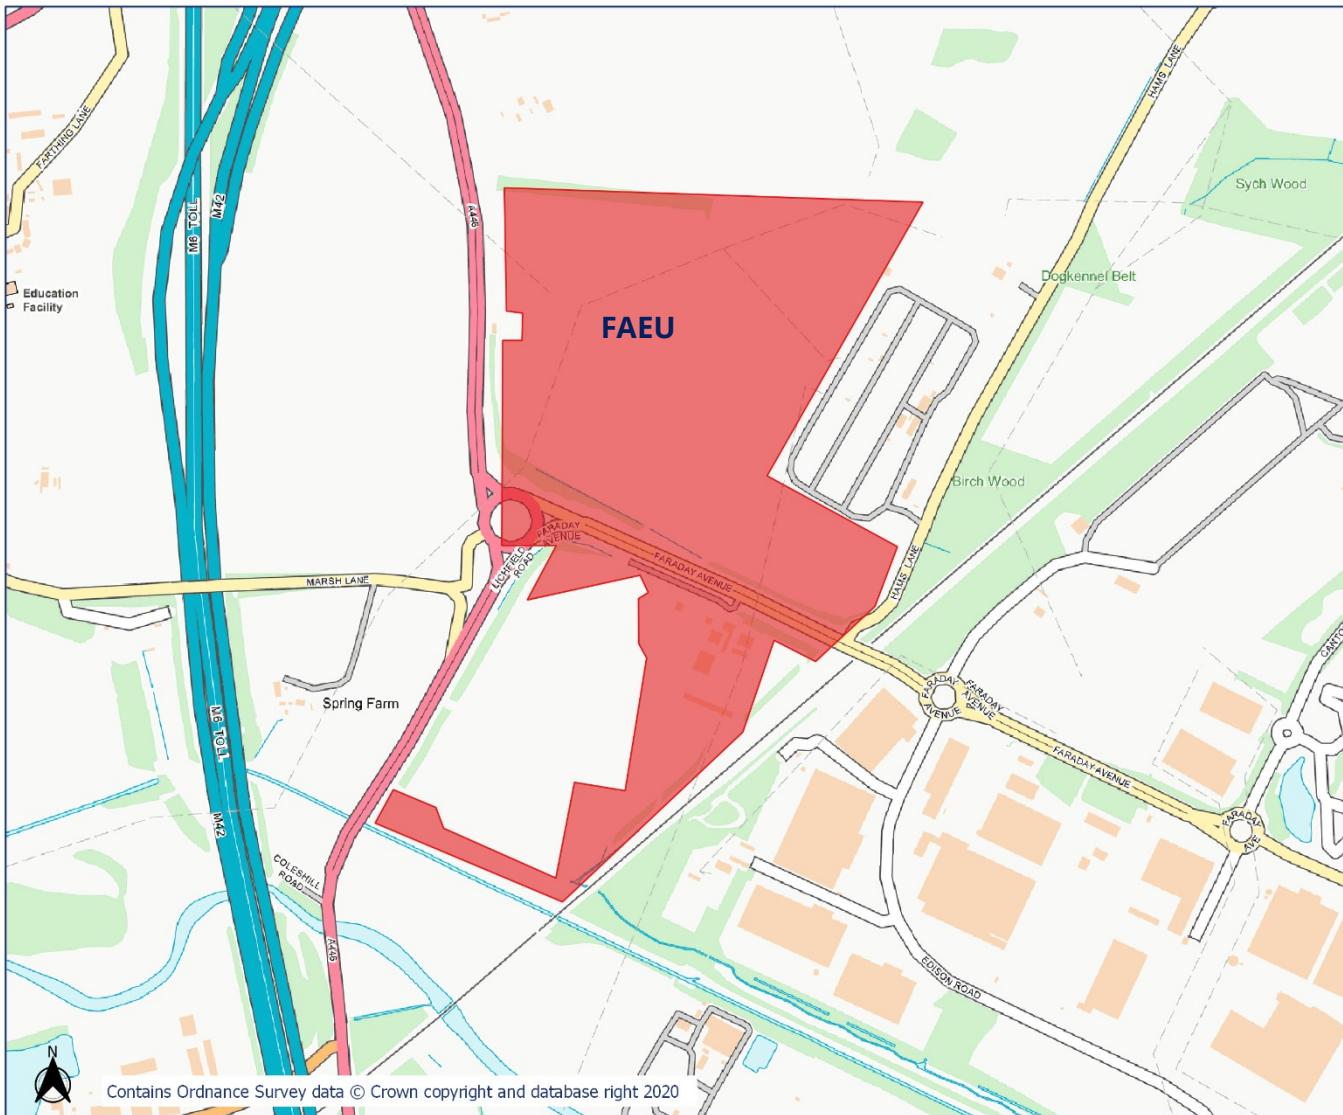


Legend
■ Active Worksites

OFFICIAL

HS2

Worksite Identification Plan - 4

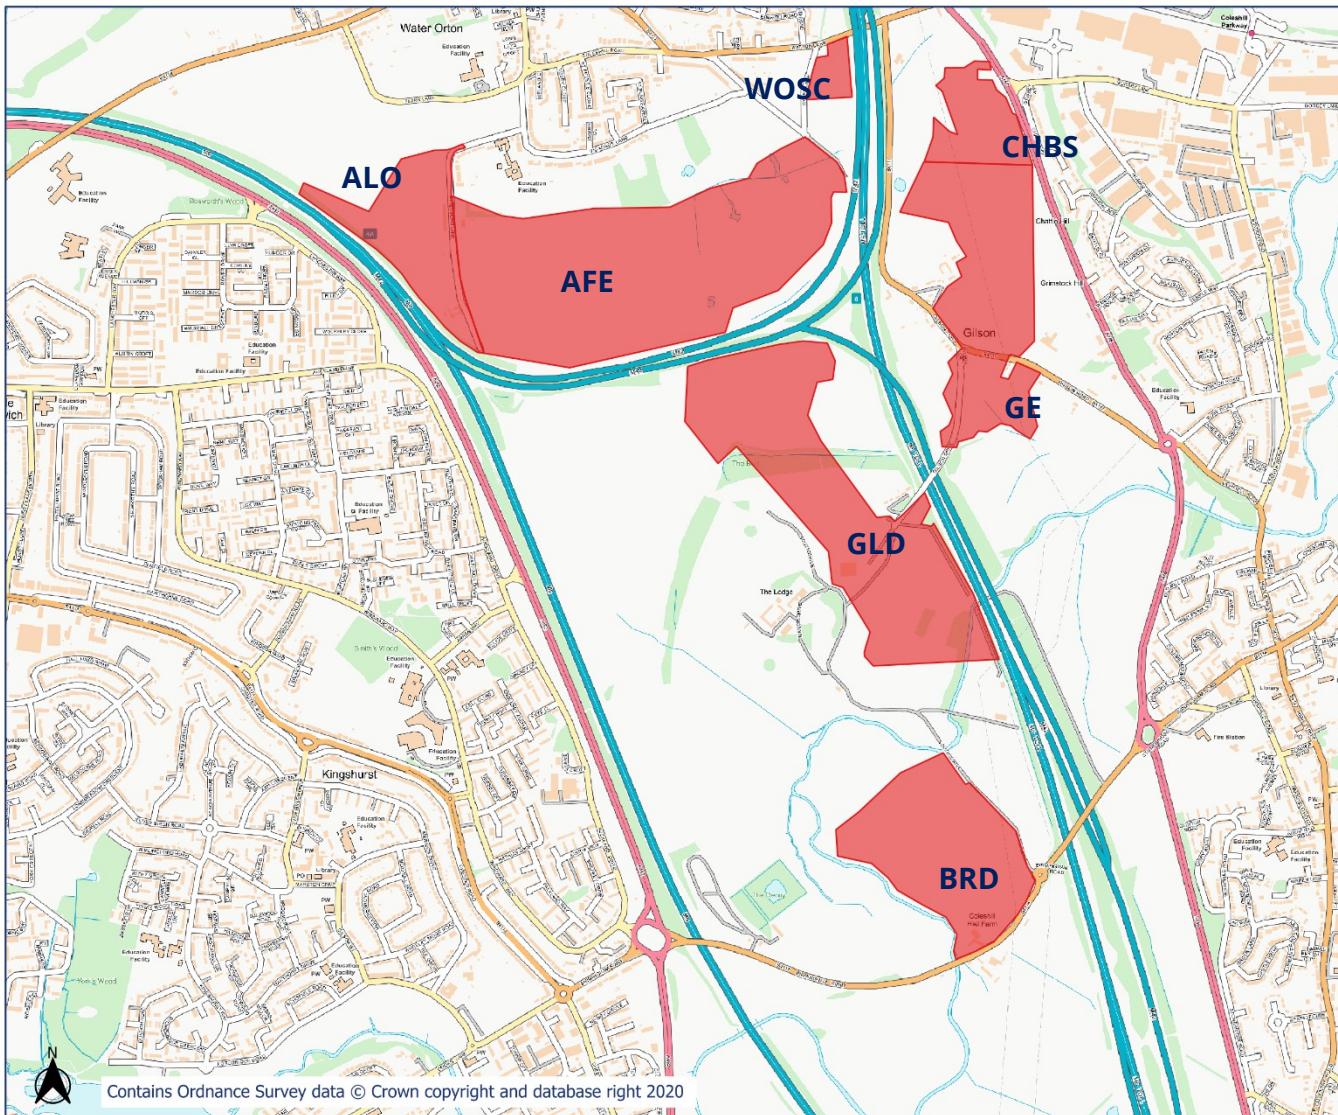

OFFICIAL

Appendix B Monitoring Locations

OFFICIAL

HS2


Noise and Vibration Monitoring Plan - 1



OFFICIAL

HS2

Noise and Vibration Monitoring Plan - 2

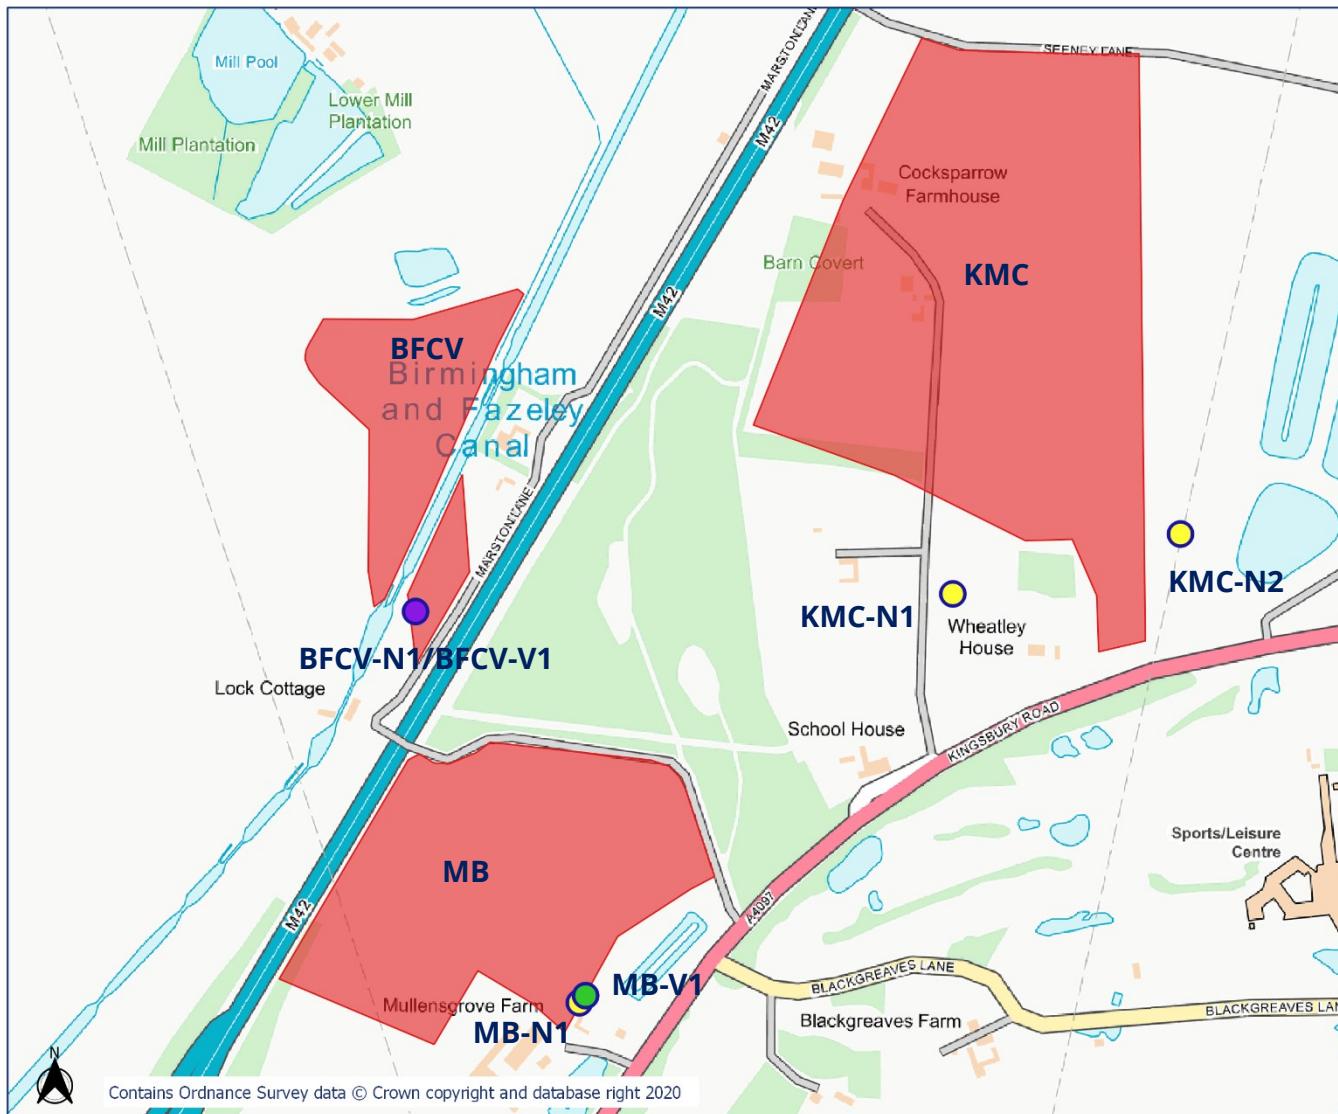


Legend
Noise Monitor
Vibration Monitor
Noise and Vibration Monitor
Active Worksites

OFFICIAL

HS2

Noise and Vibration Monitoring Plan - 3

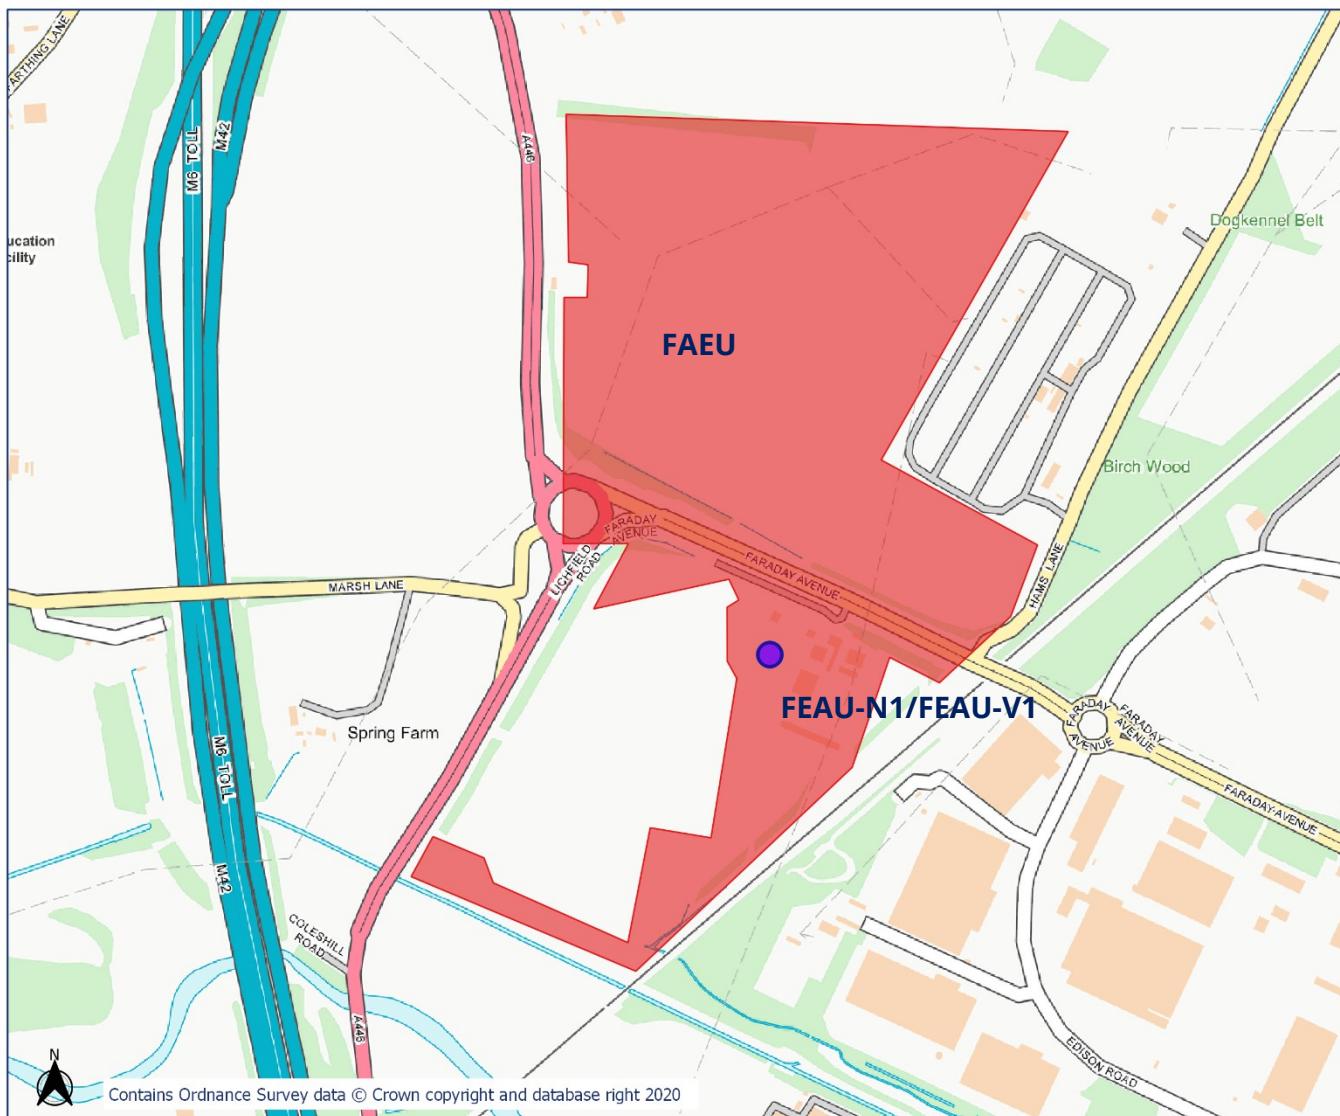


Legend
Noise and Vibration Monitor
Active Worksites

OFFICIAL

HS2

Noise and Vibration Monitoring Plan - 4

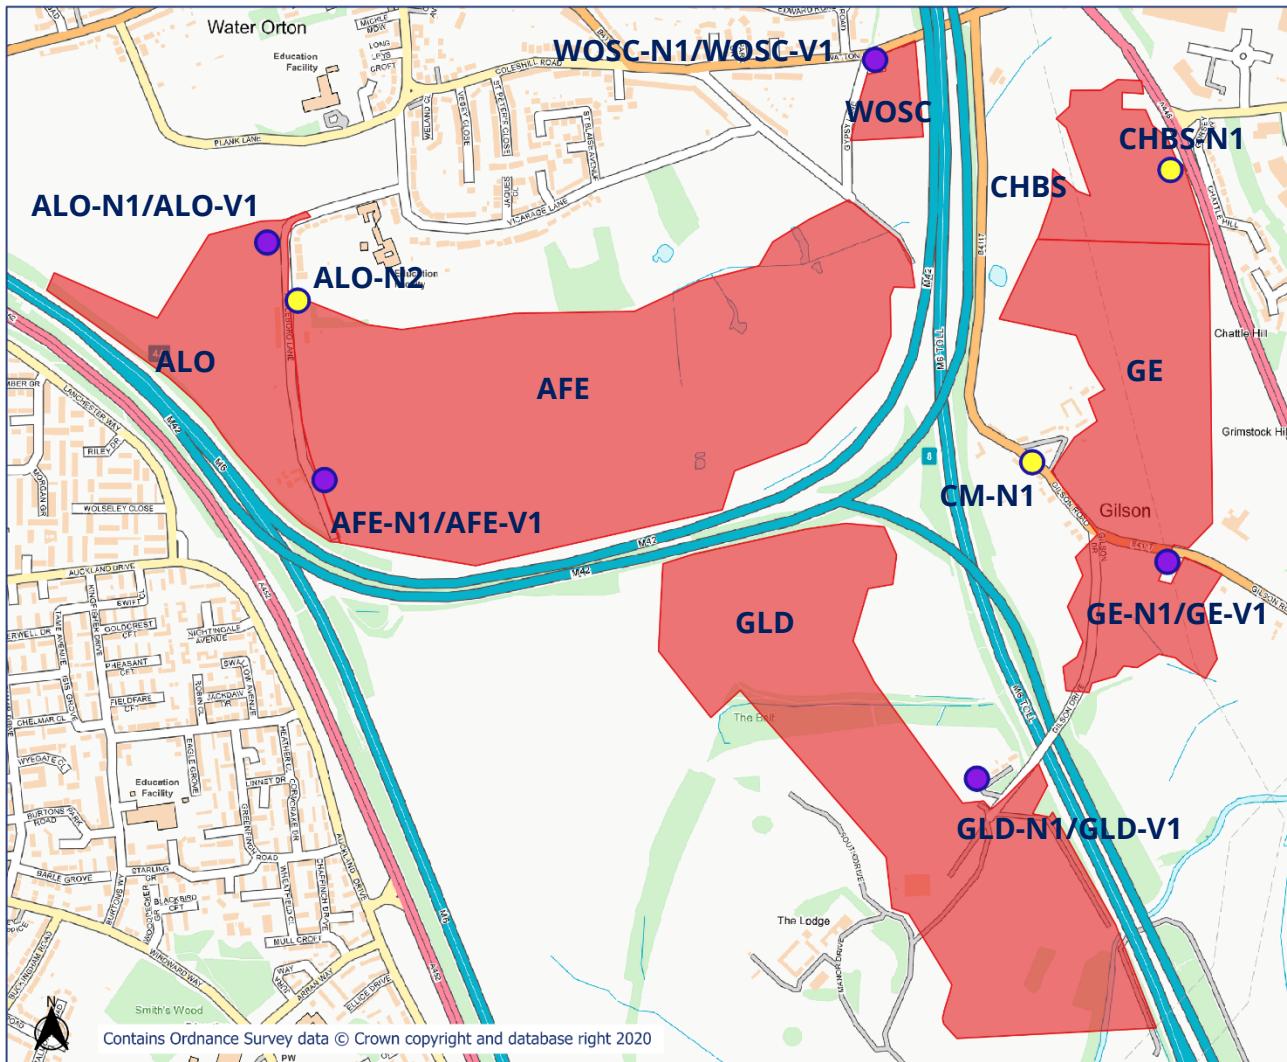


Legend

- Yellow circle: Noise Monitor
- Purple circle: Noise and Vibration Monitor
- Red shaded area: Active Worksites

OFFICIAL

HS2

Noise and Vibration Monitoring Plan - 5

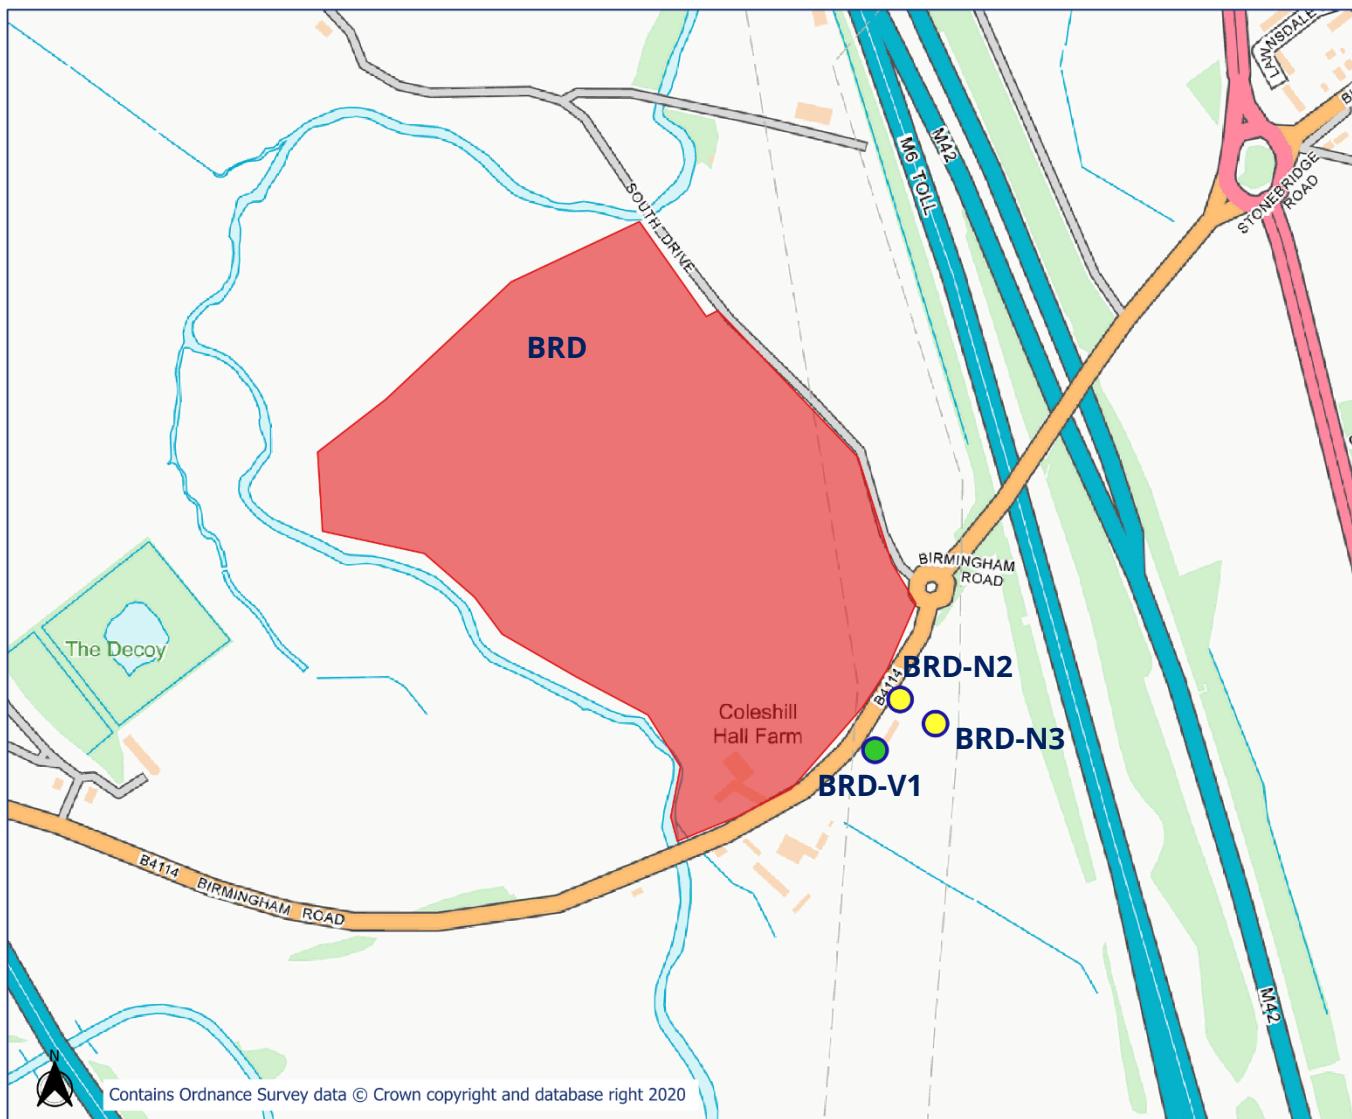

Legend	
Yellow circle	Noise Monitor
Green circle	Vibration Monitor
Red area	Active Worksites



OFFICIAL

Appendix C Data



Noise

The following graphs show the hourly measured ambient noise level $L_{Aeq,1h}$ and, where relevant, the averaged noise level $L_{Aeq,T}$ values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the $L_{Aeq,T}$ values in Table 3 of the main report.:.

Worksite: CLE – Monitoring Ref: CLE-N1


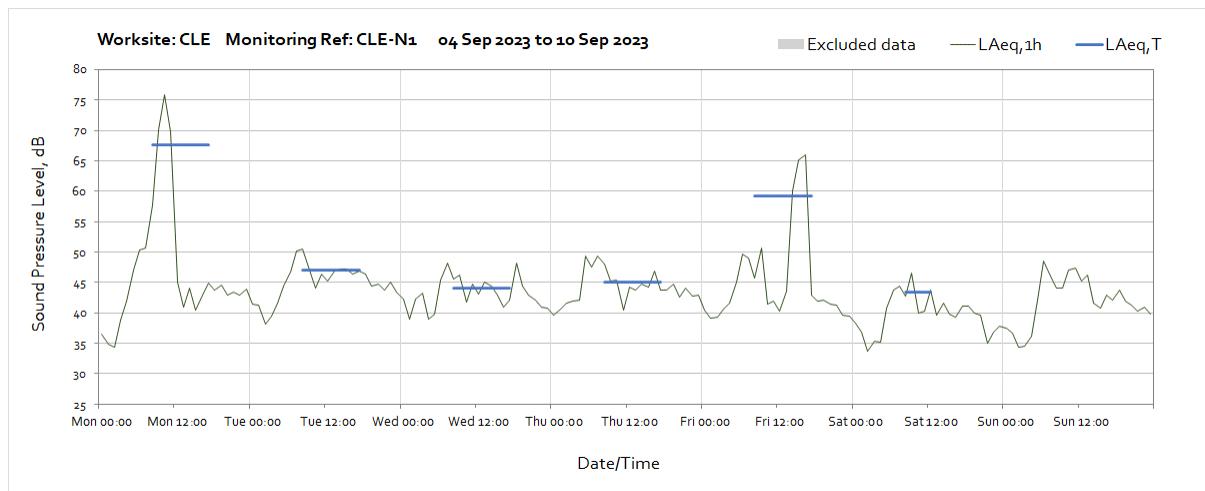
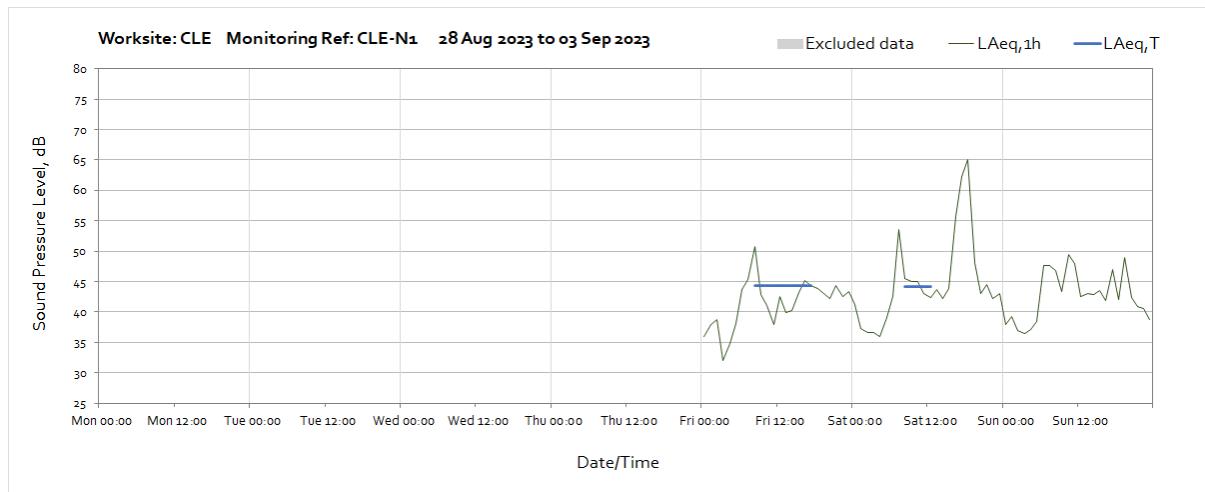


OFFICIAL

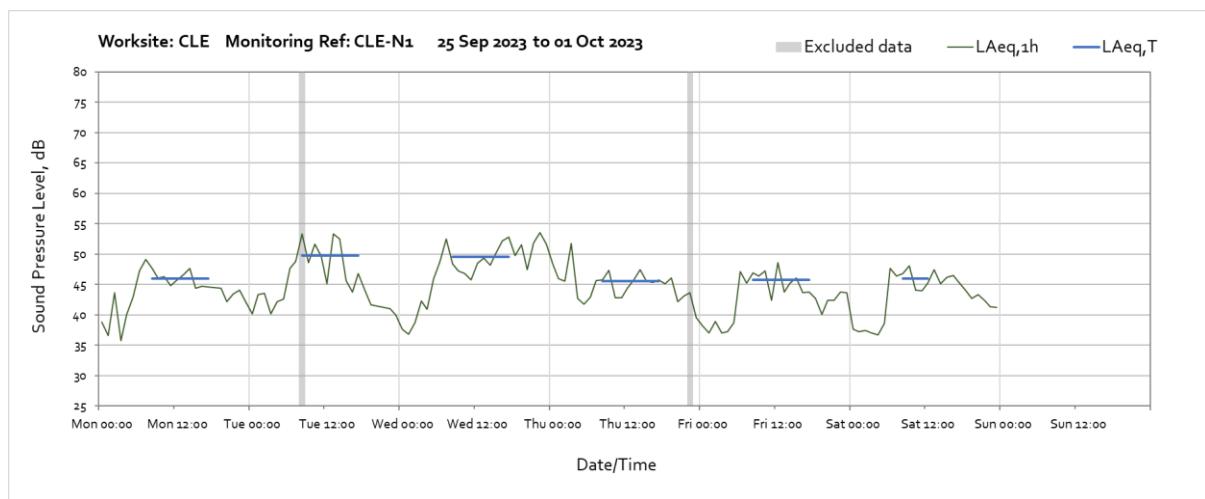
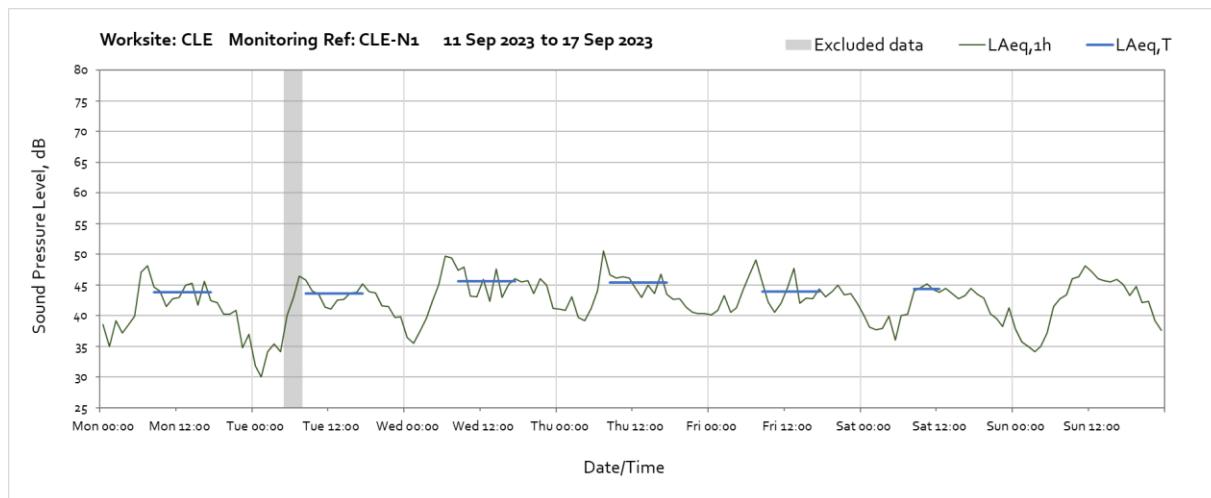


OFFICIAL

Worksite: KMC – Monitoring Ref: KMC-N1

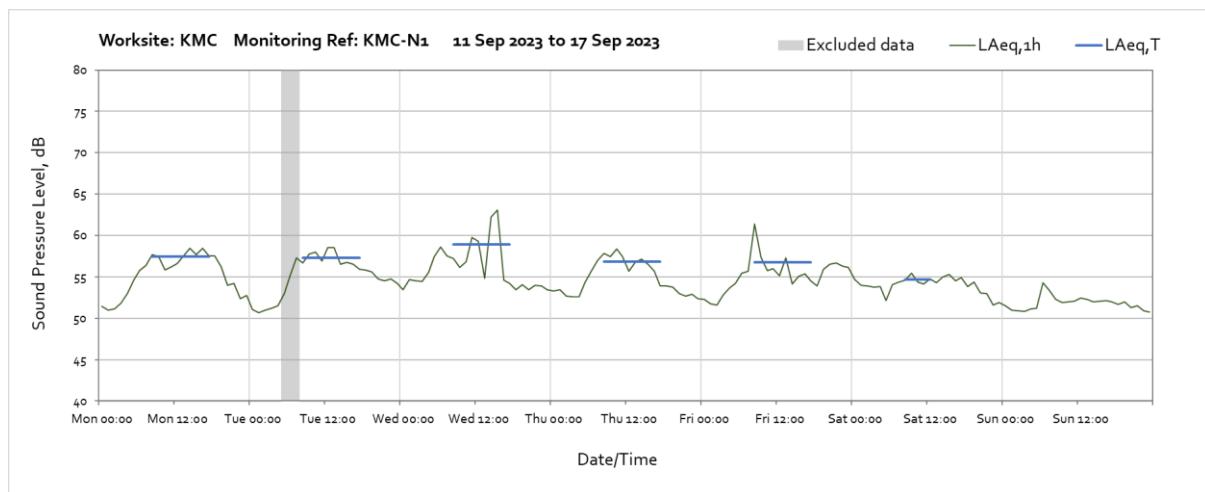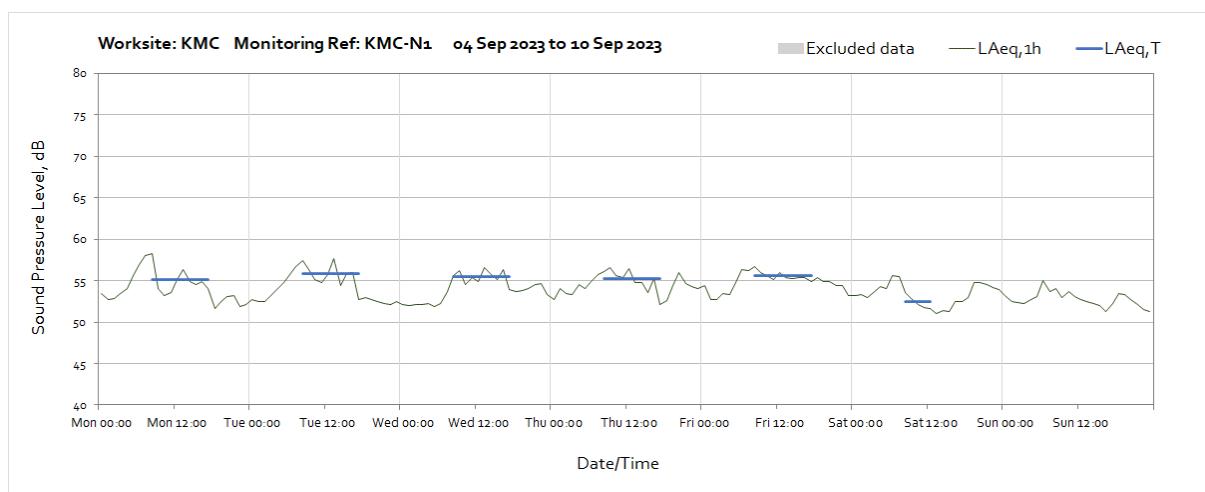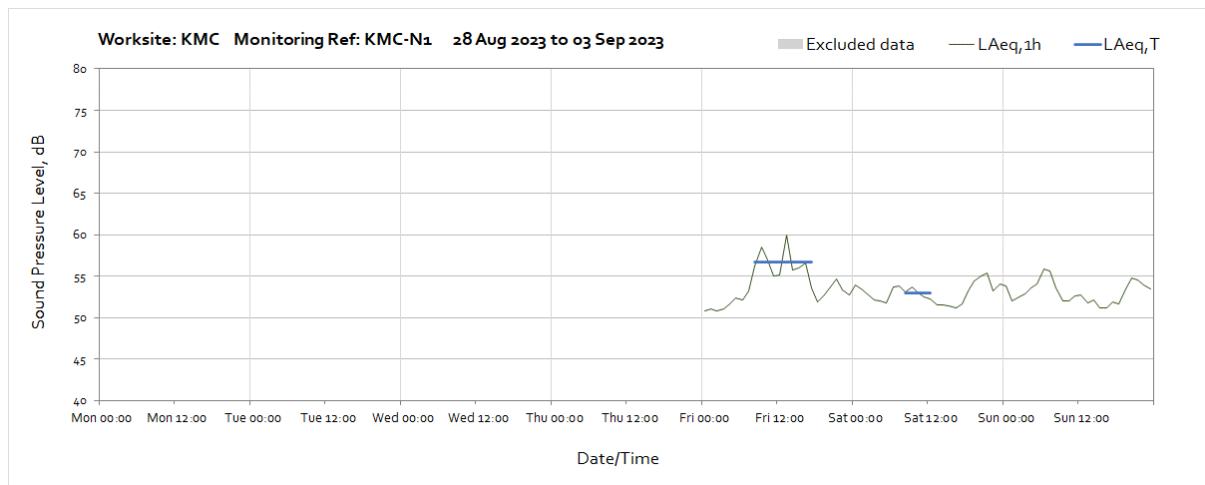


OFFICIAL

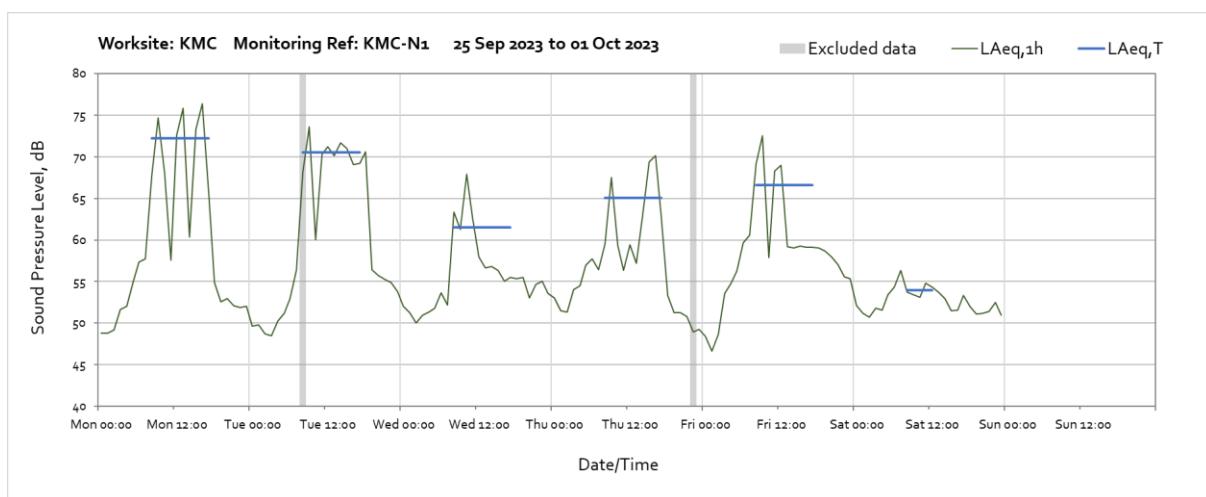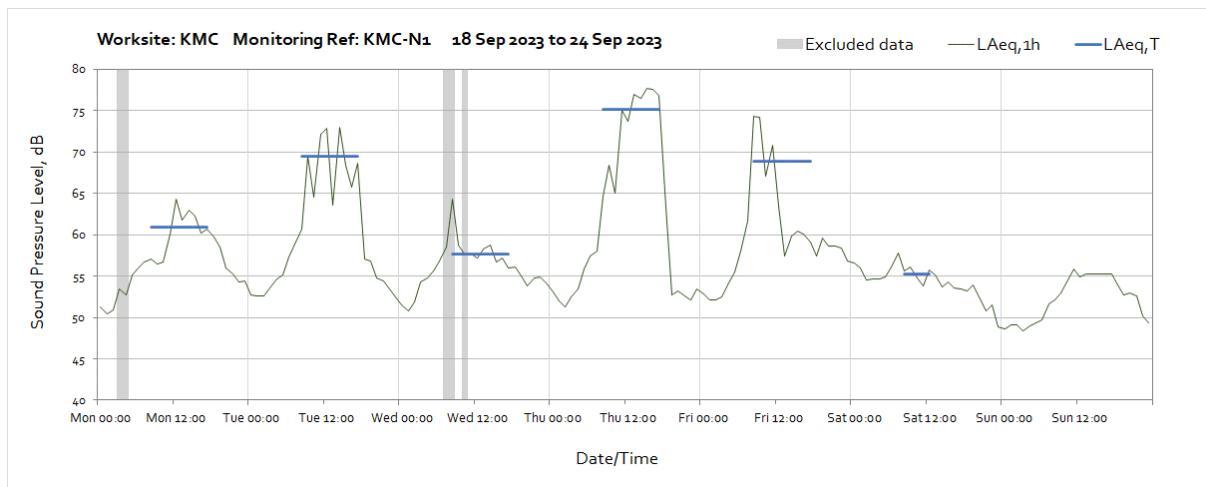


OFFICIAL


Worksite: KMC – Monitoring Ref: KMC-N2

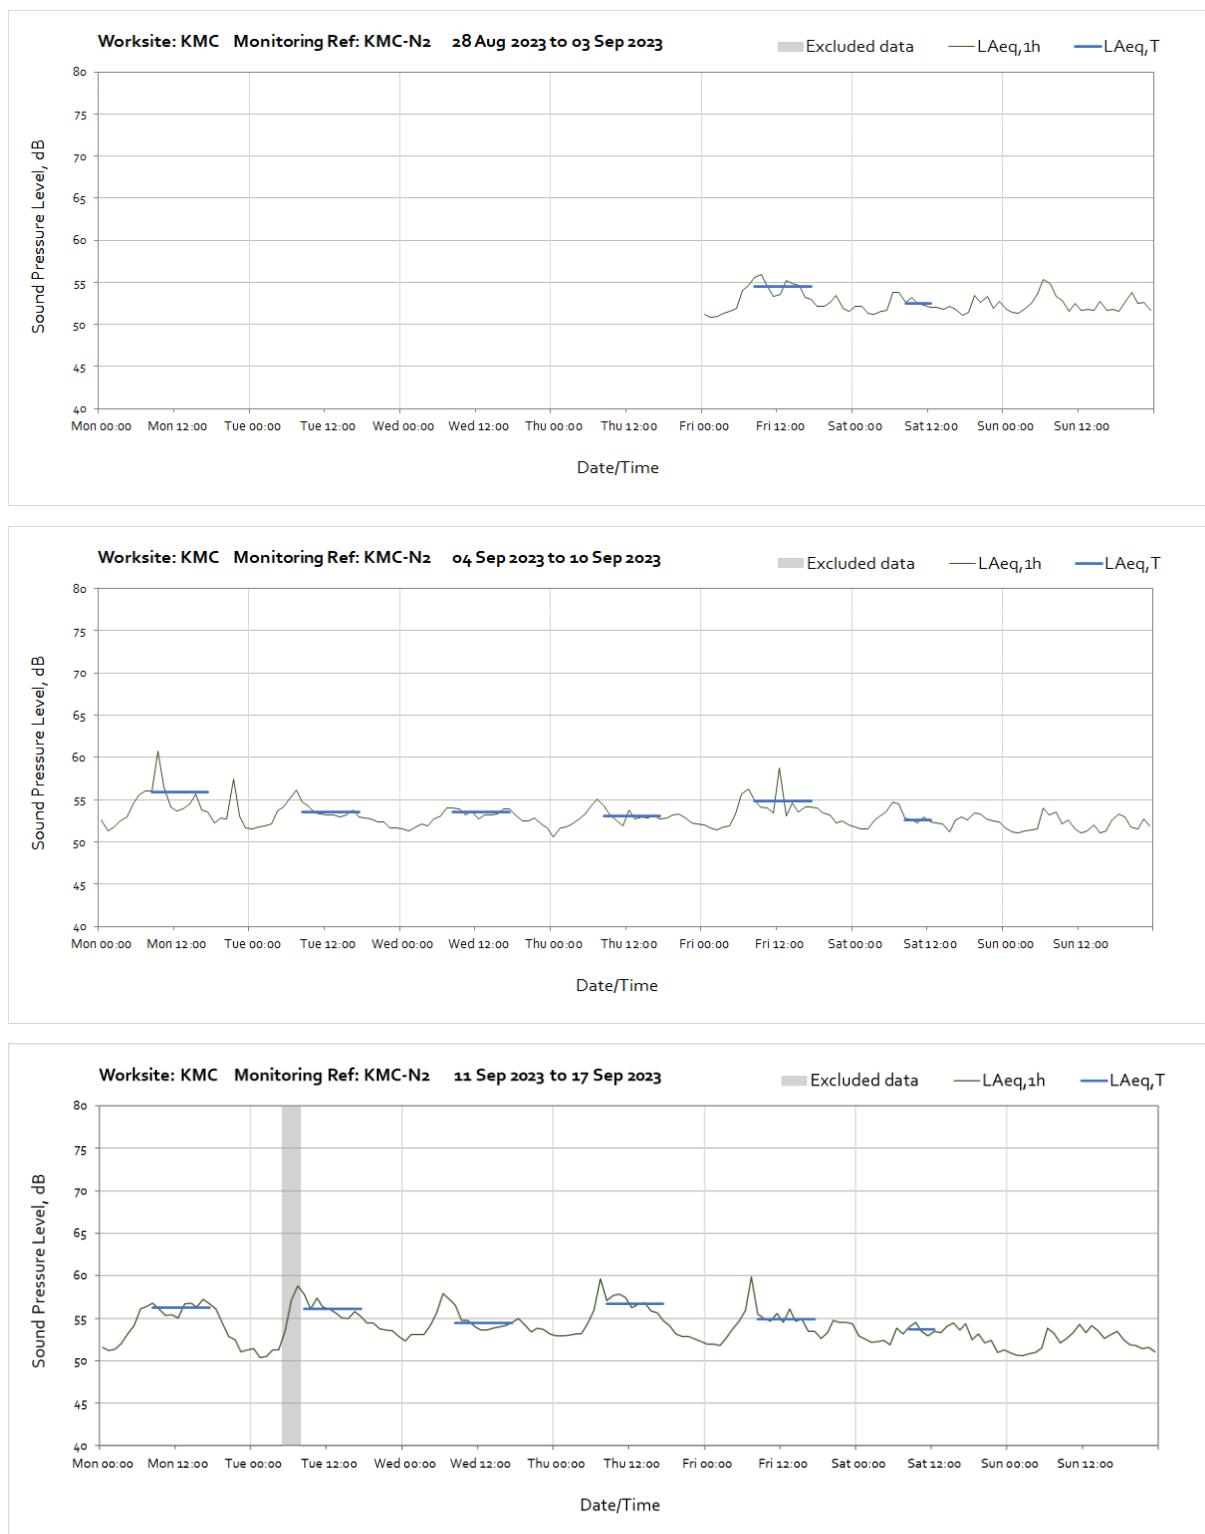




OFFICIAL

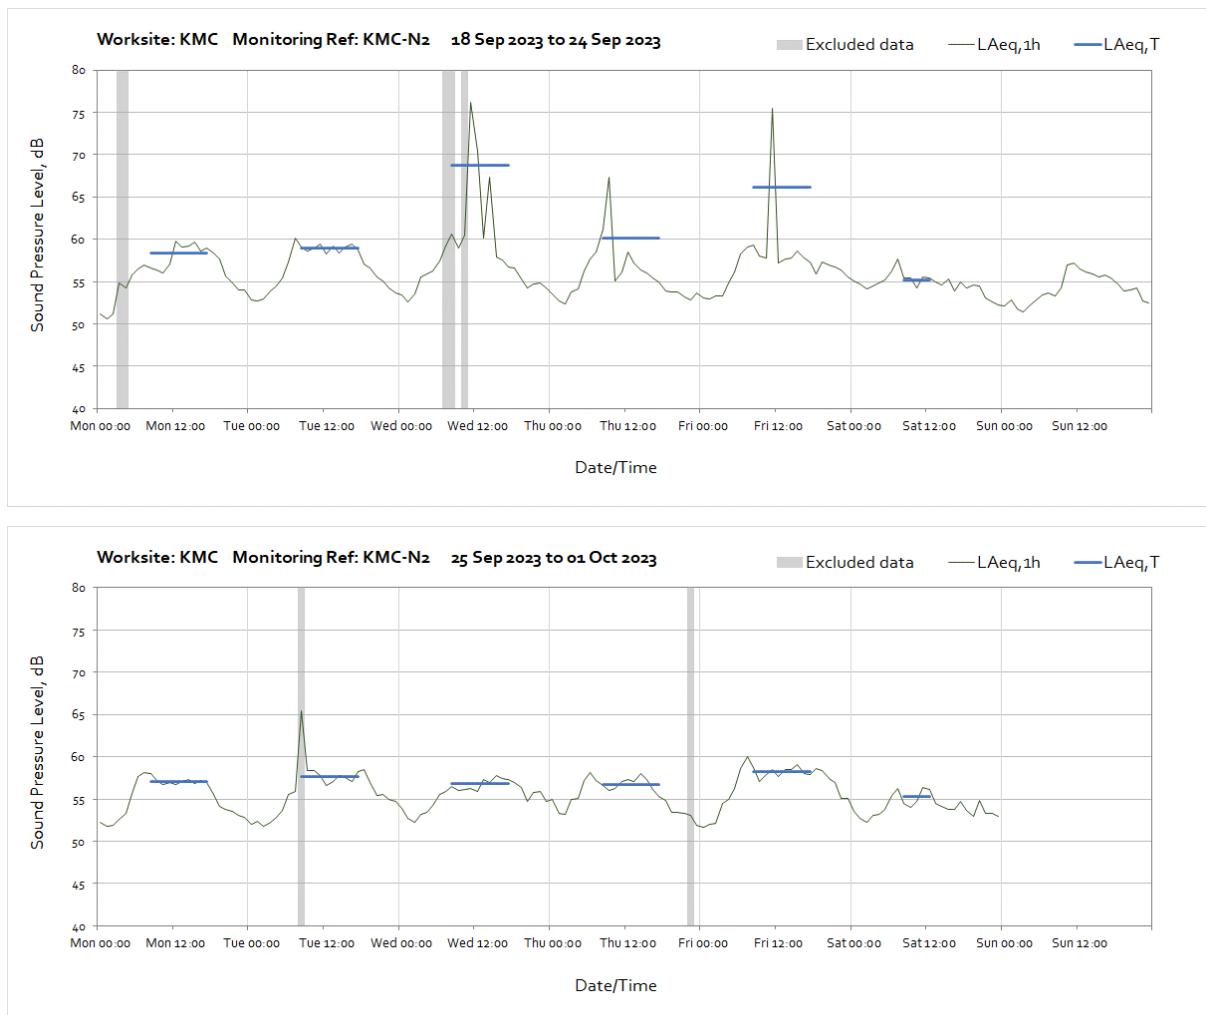


Worksite: BFCV – Monitoring Ref: BFCV-N2

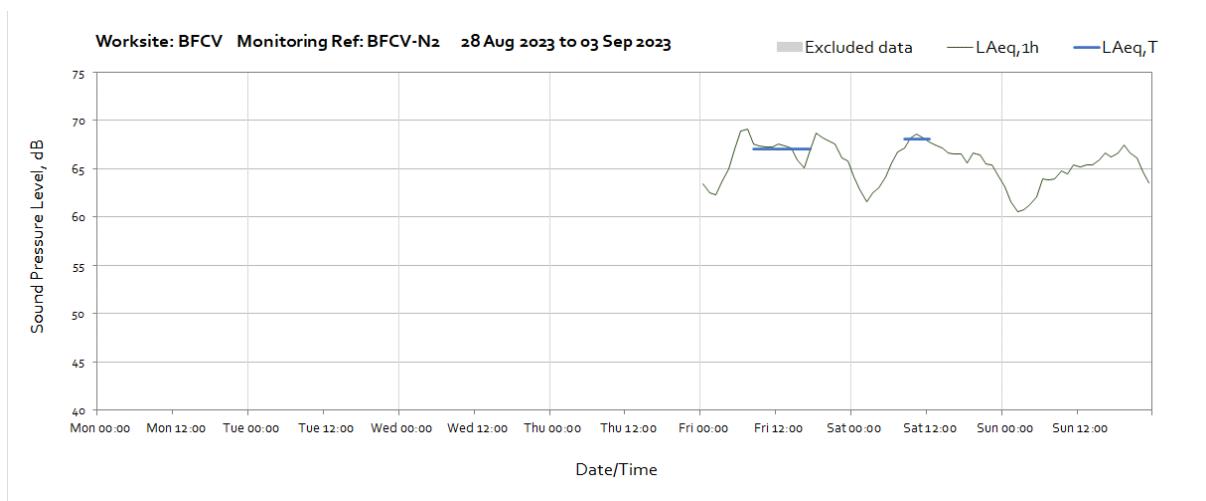


OFFICIAL

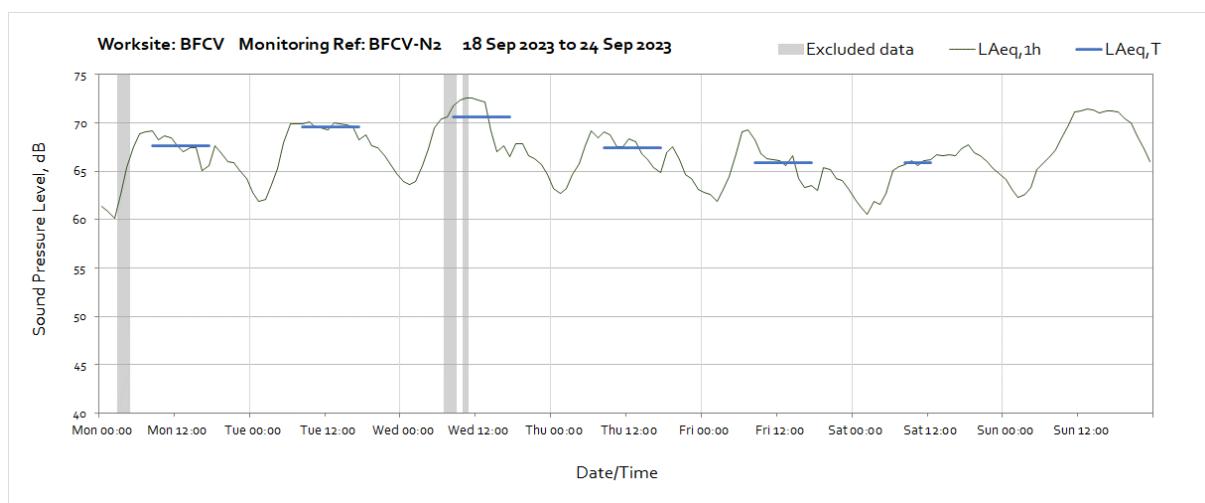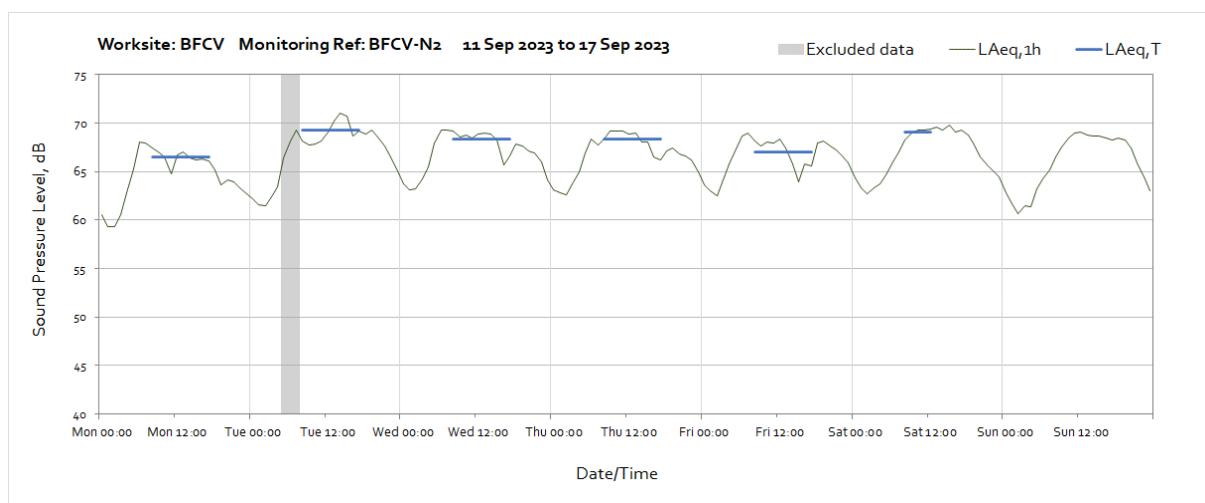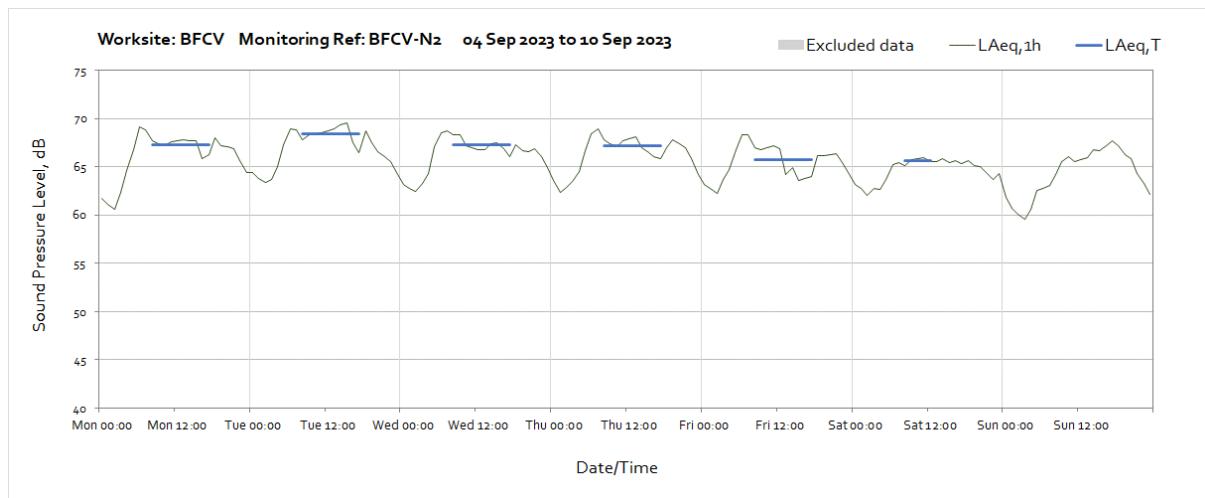


OFFICIAL

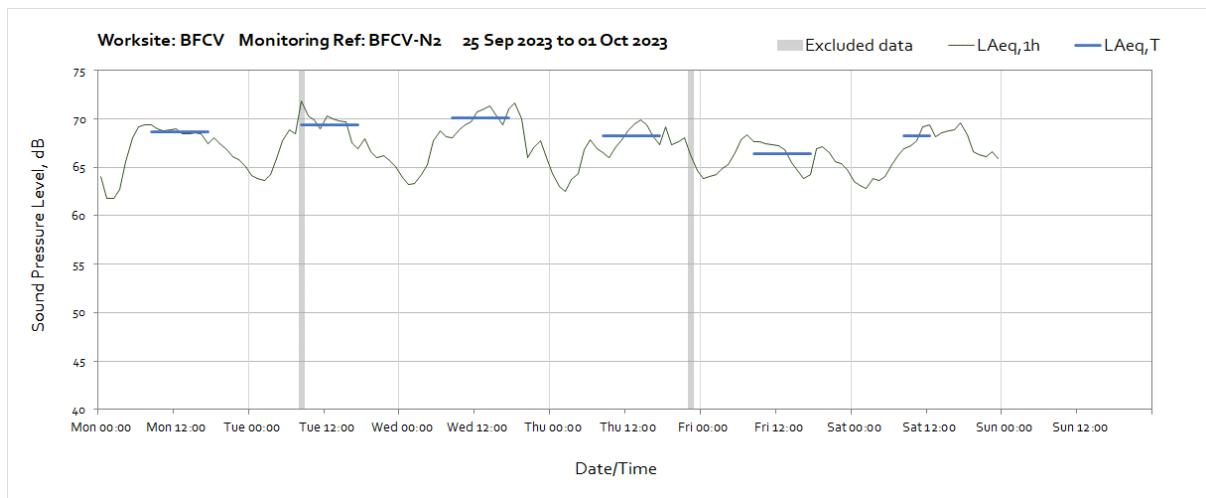

Worksite: MB – Monitoring Ref: MB-N1

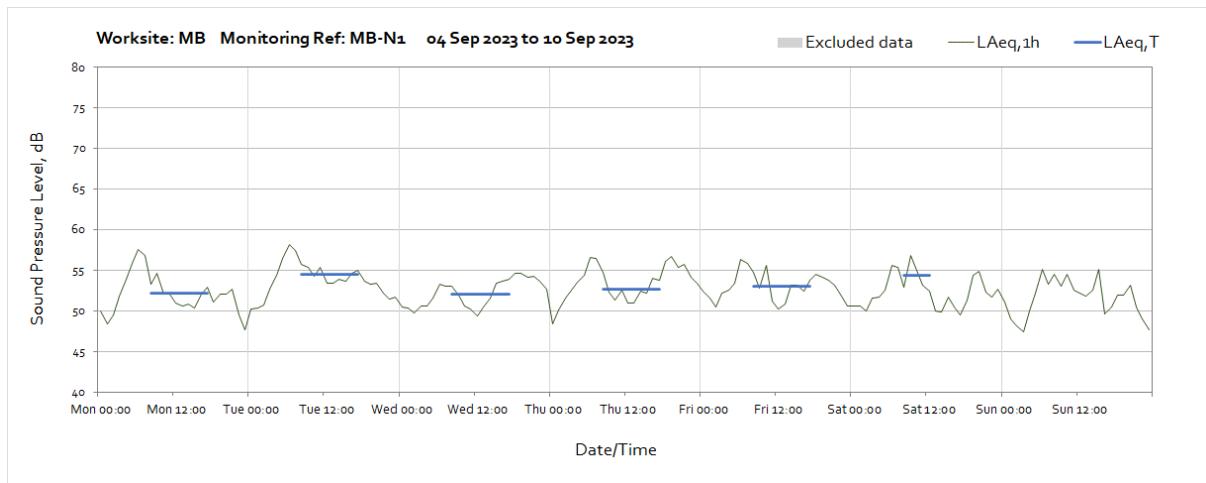


OFFICIAL

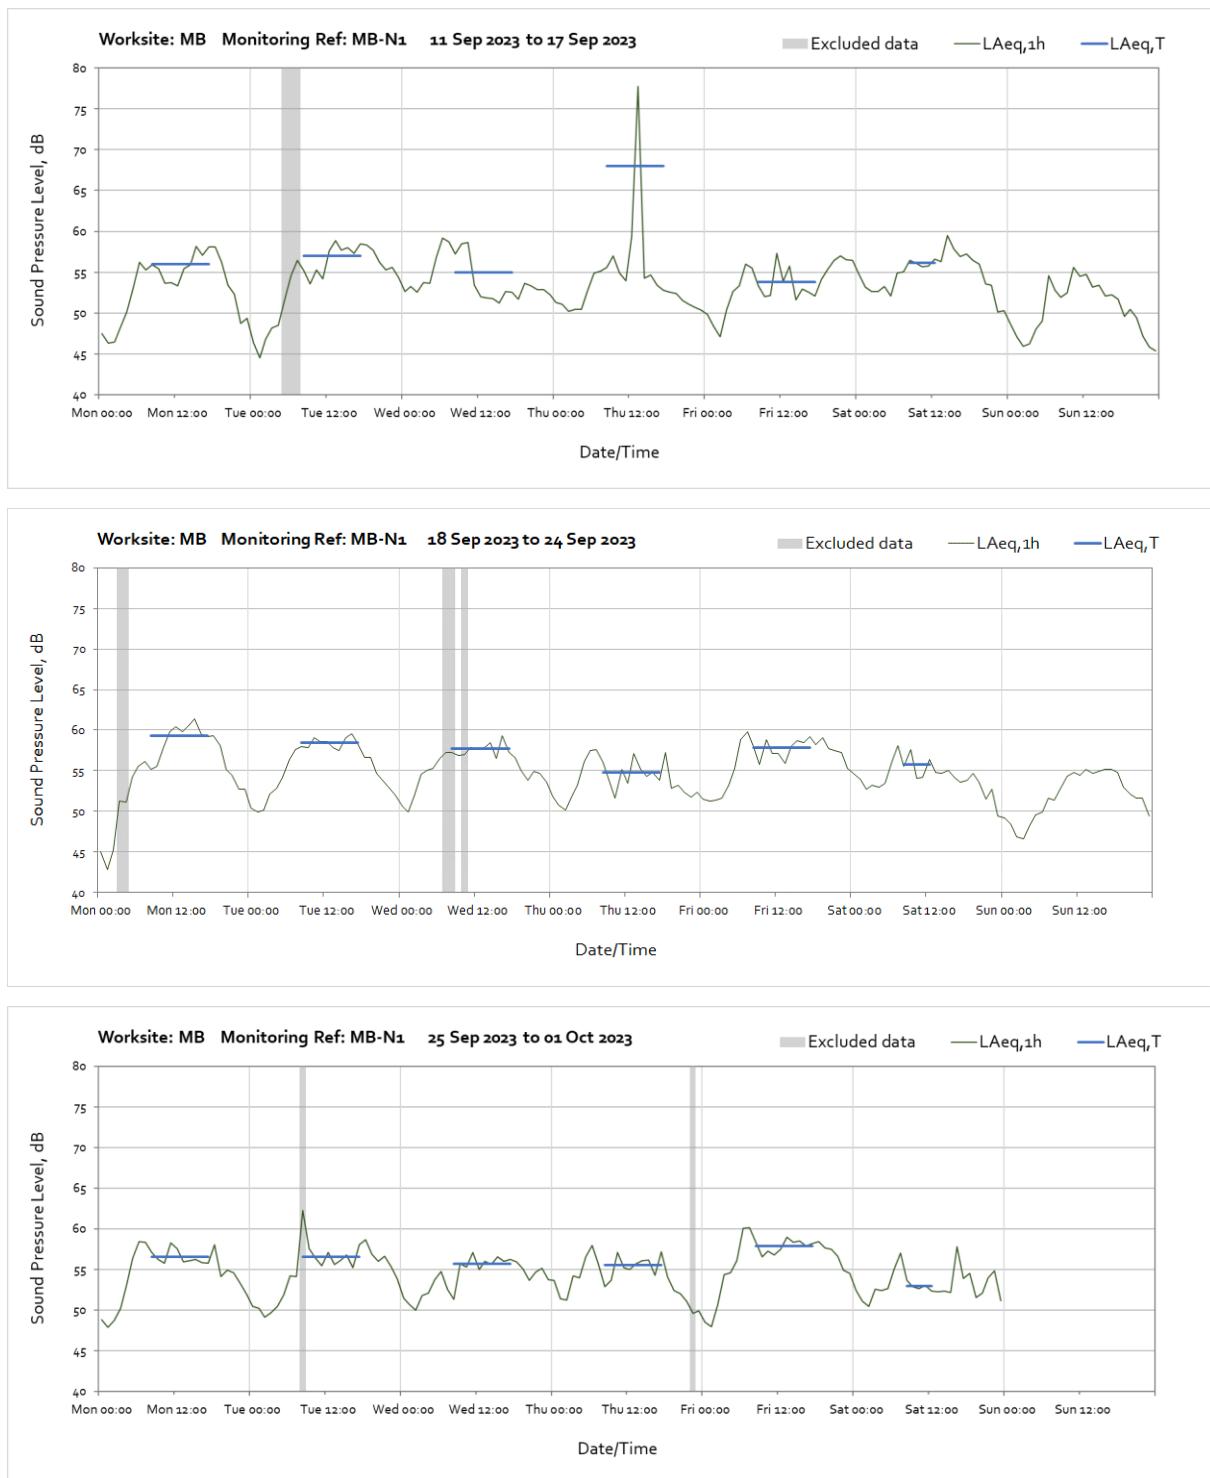


OFFICIAL

Worksite: FAEU – Monitoring Ref: FAEU-N1

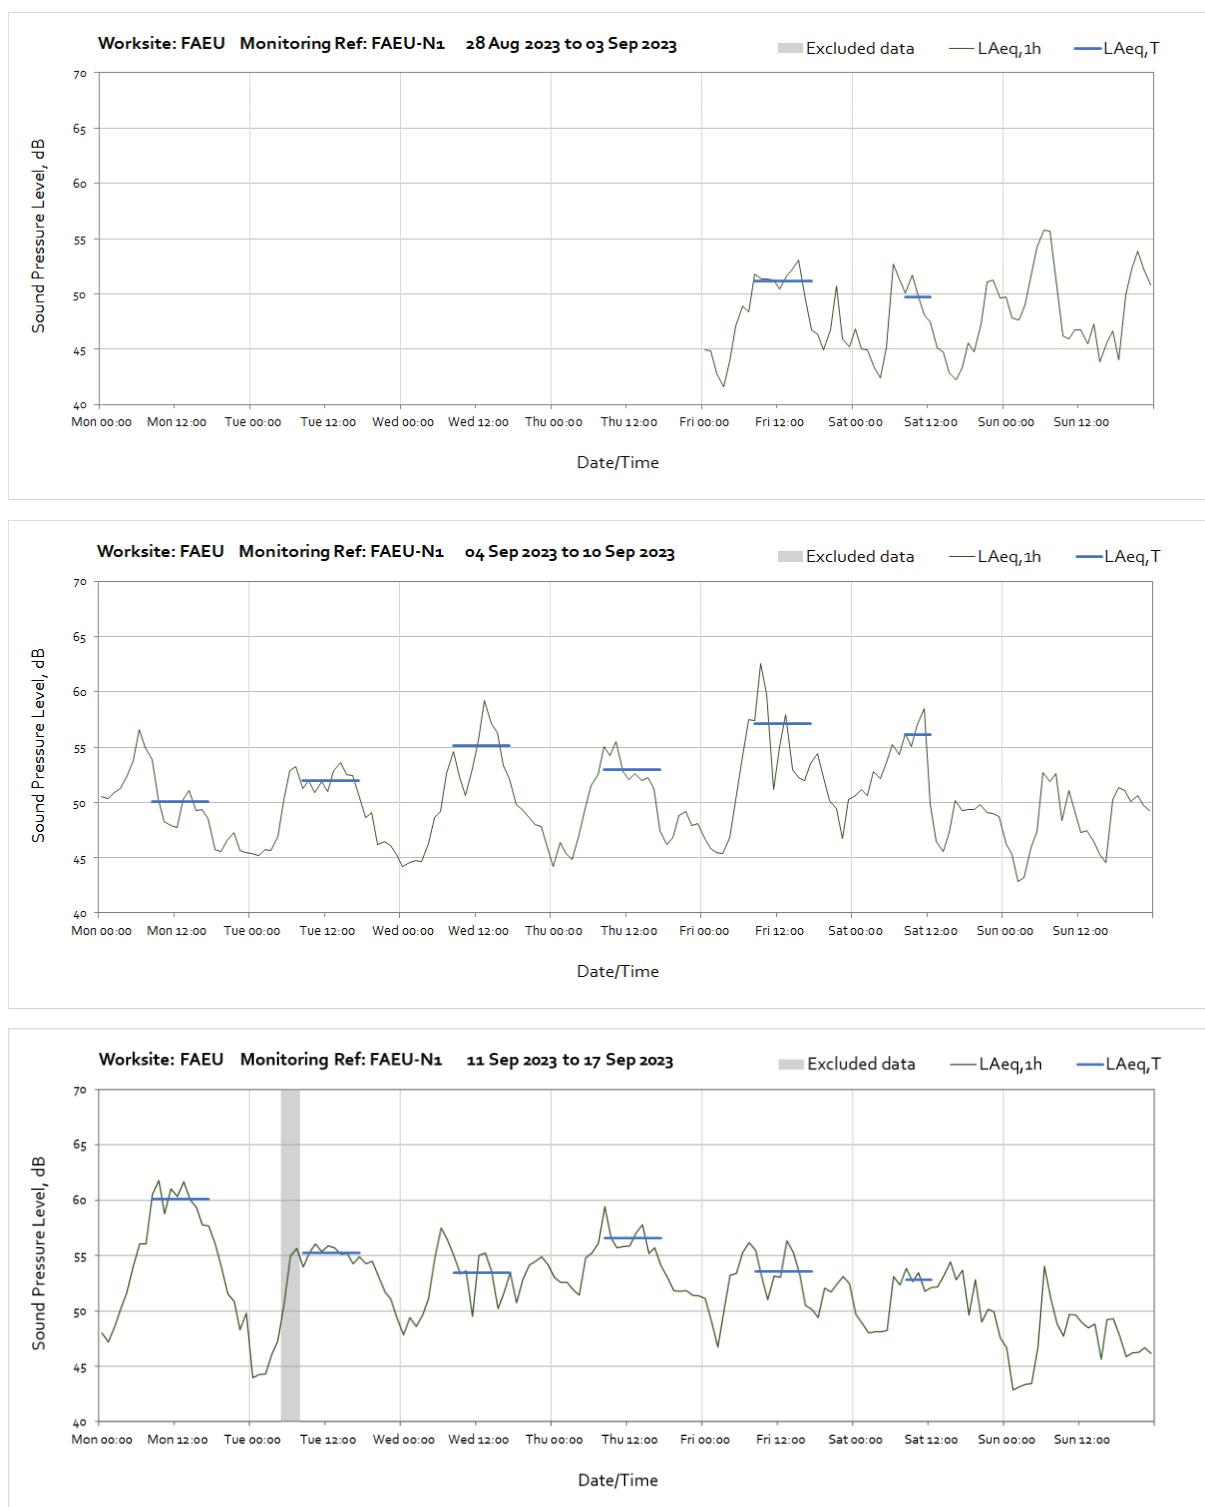


OFFICIAL

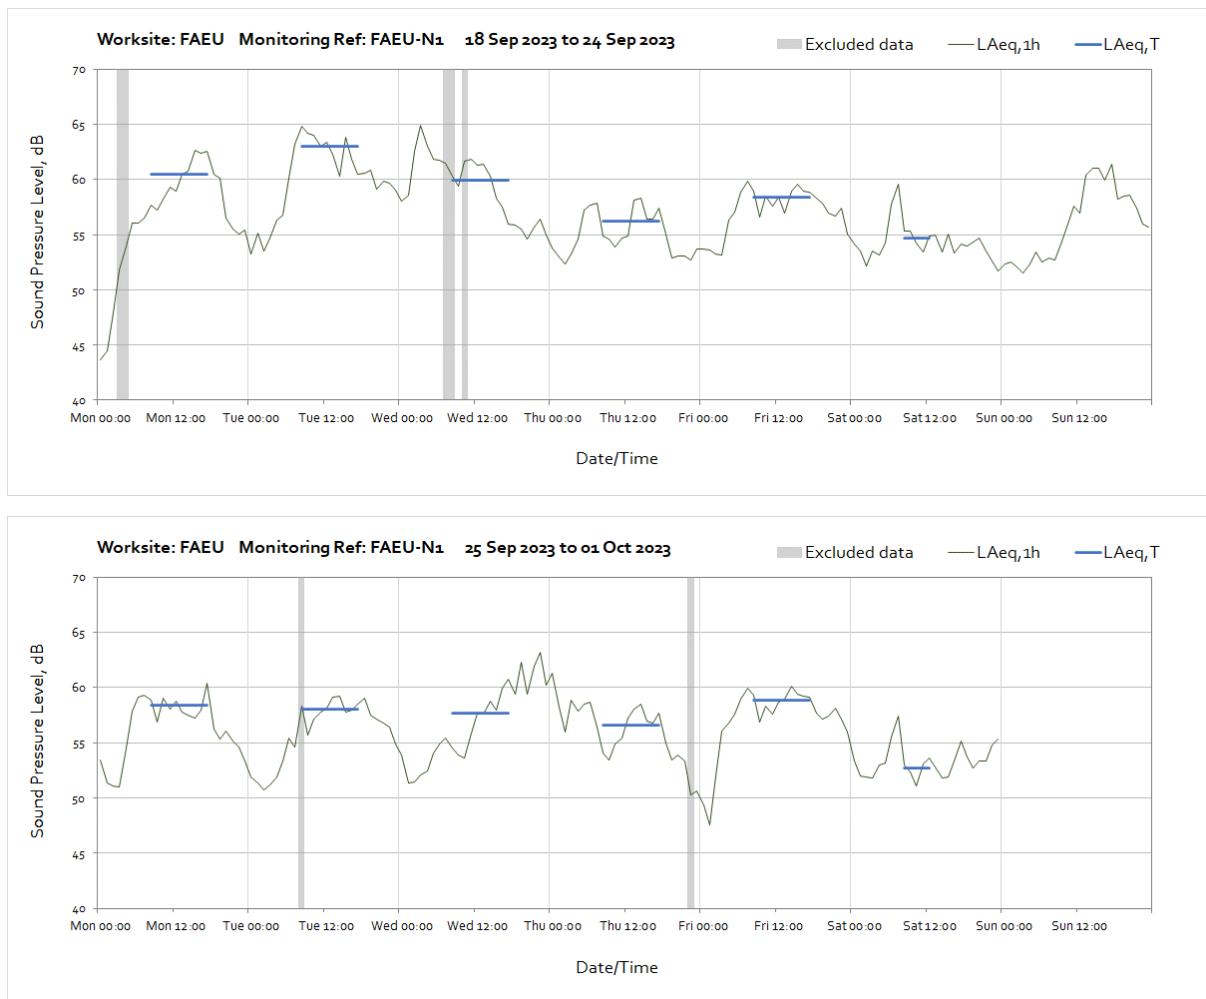

Worksite: WOSC – Monitoring Ref: WOSC-N1



OFFICIAL

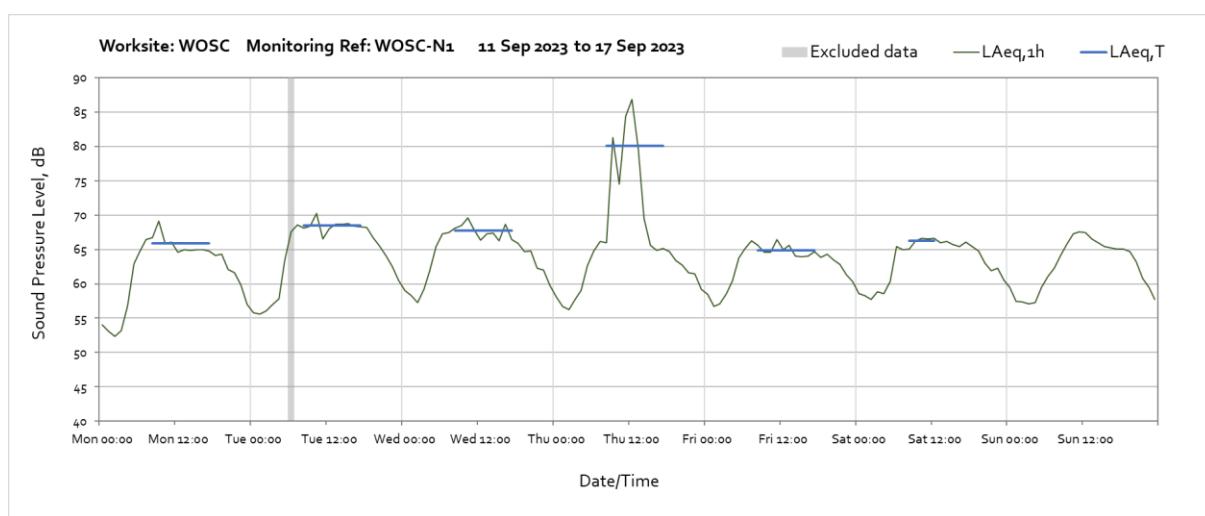


Note: Monitor was decommissioned at 12:00 on Thursday 21st September.

OFFICIAL

Worksite: CHBS – Monitoring Ref: CHBS-N1






OFFICIAL

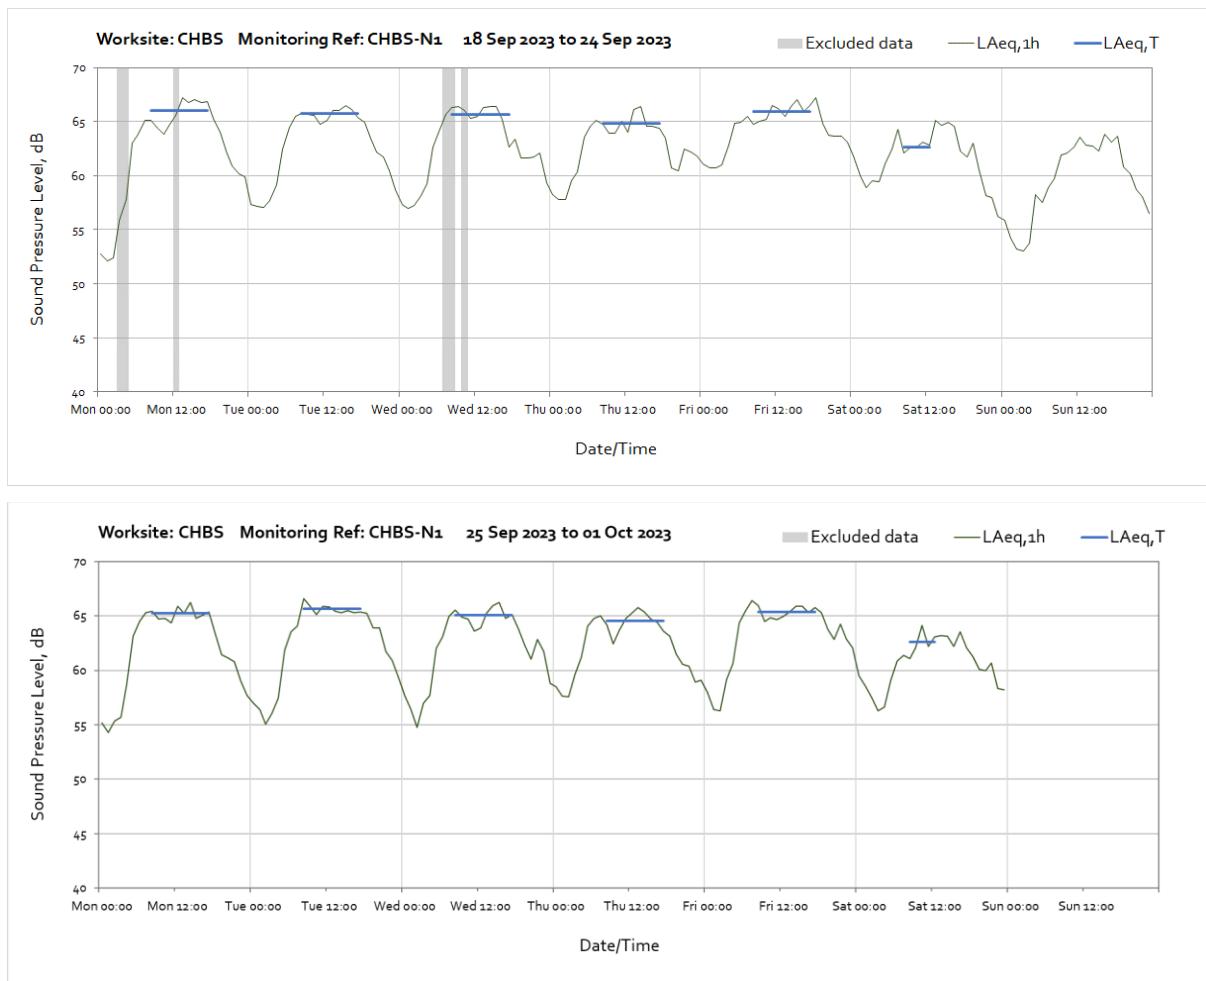


Worksite: ALO – Monitoring Ref: ALO-N1




OFFICIAL

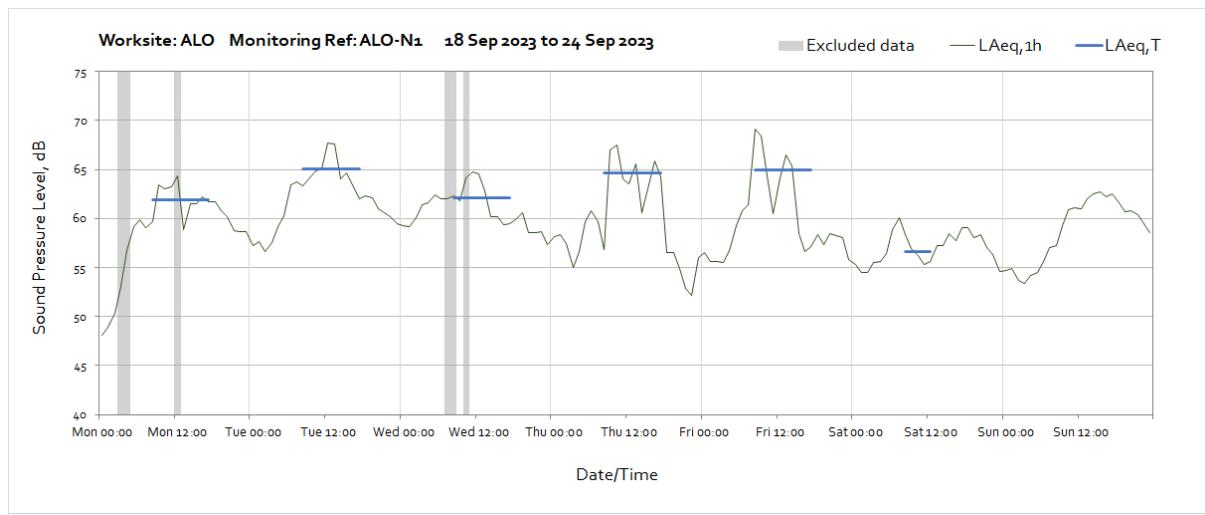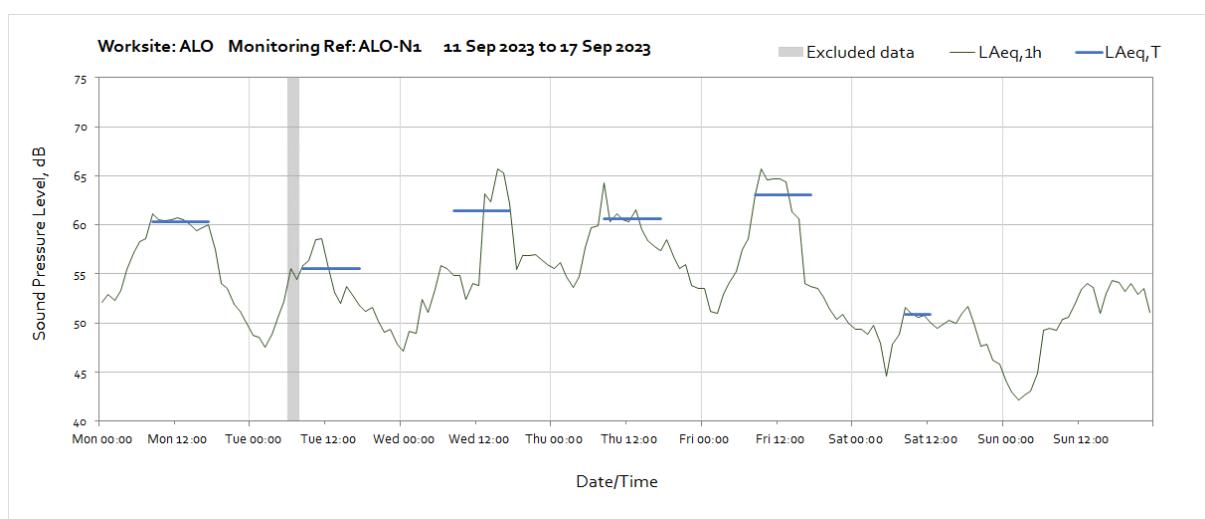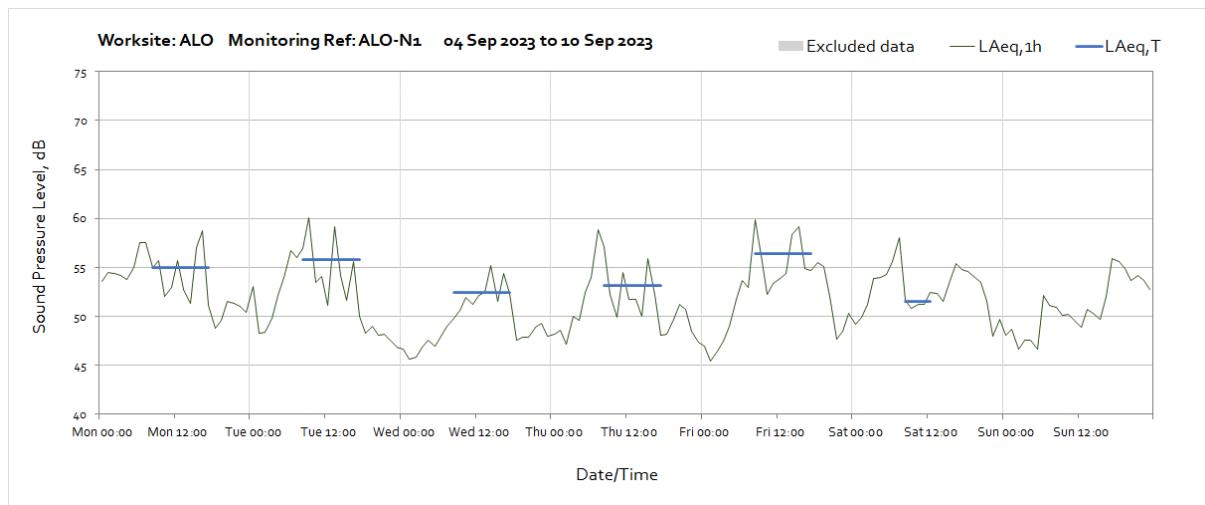




OFFICIAL

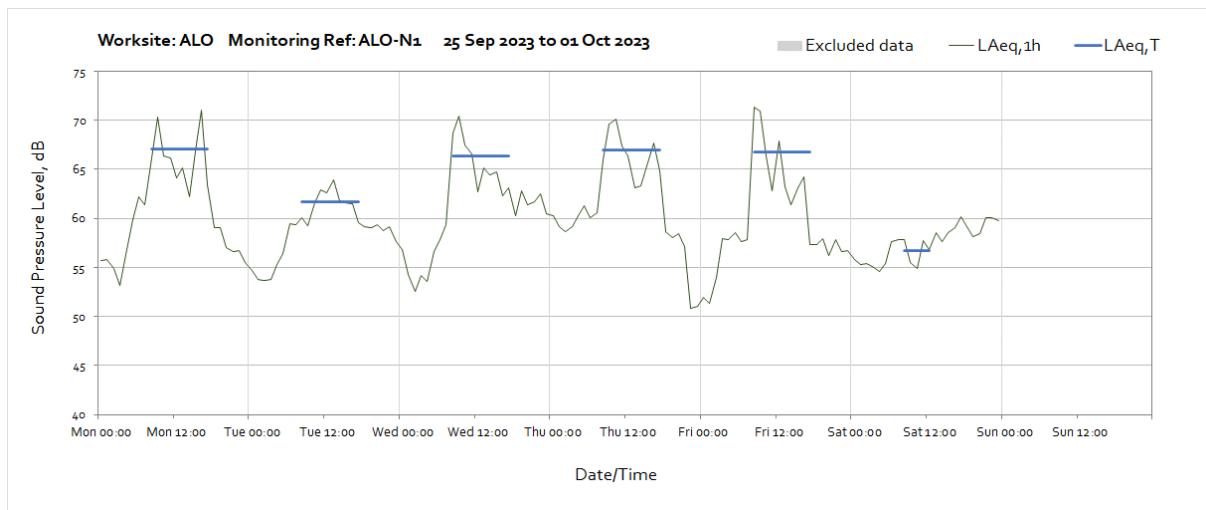

Worksite: ALO – Monitoring Ref: ALO-N2



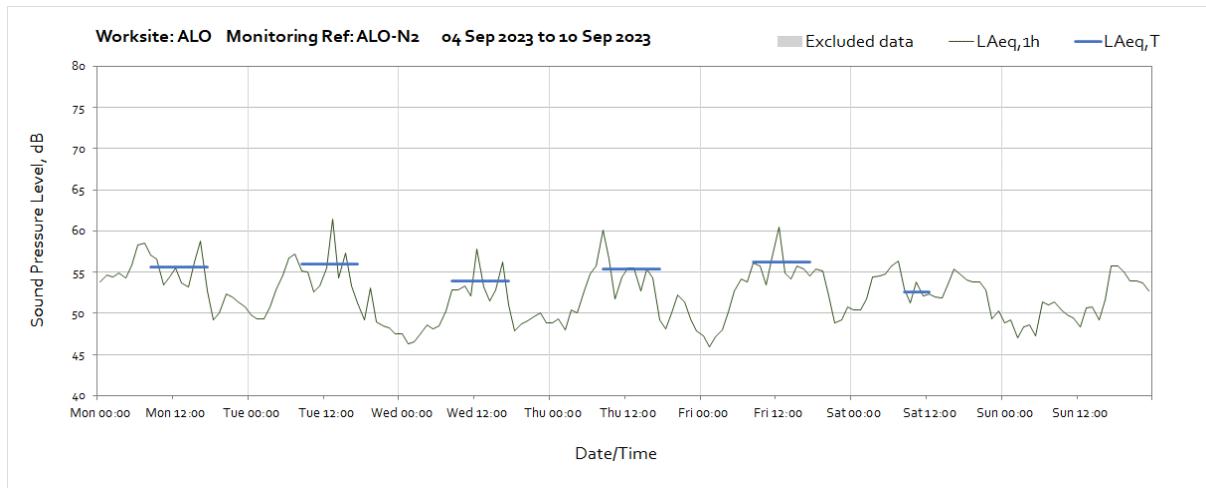


OFFICIAL

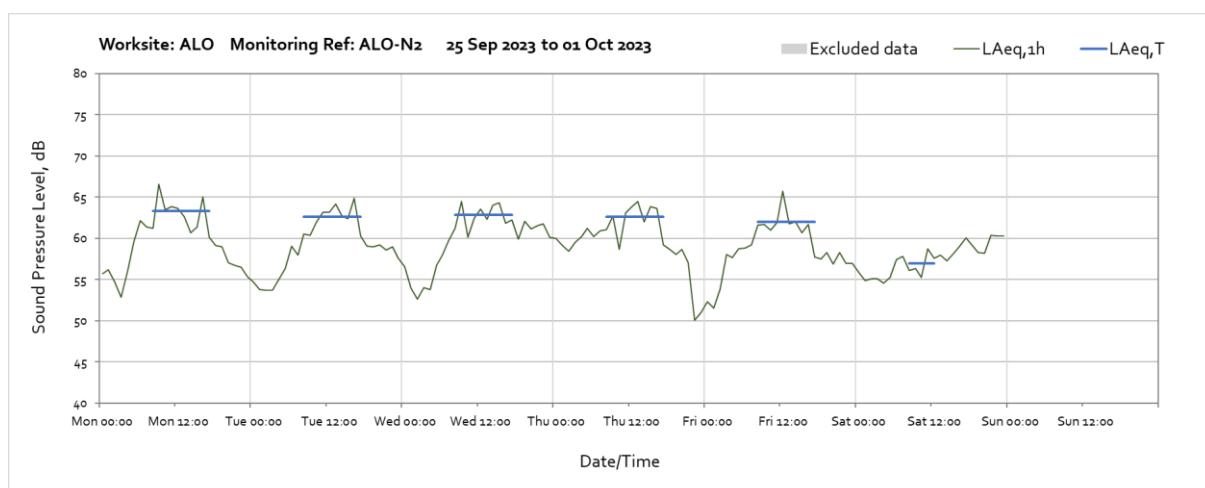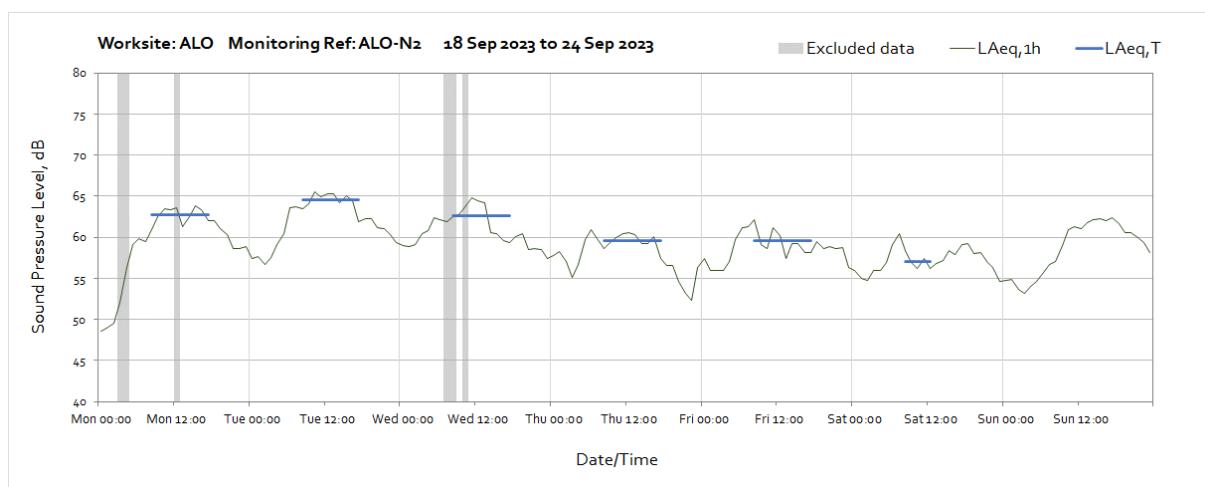
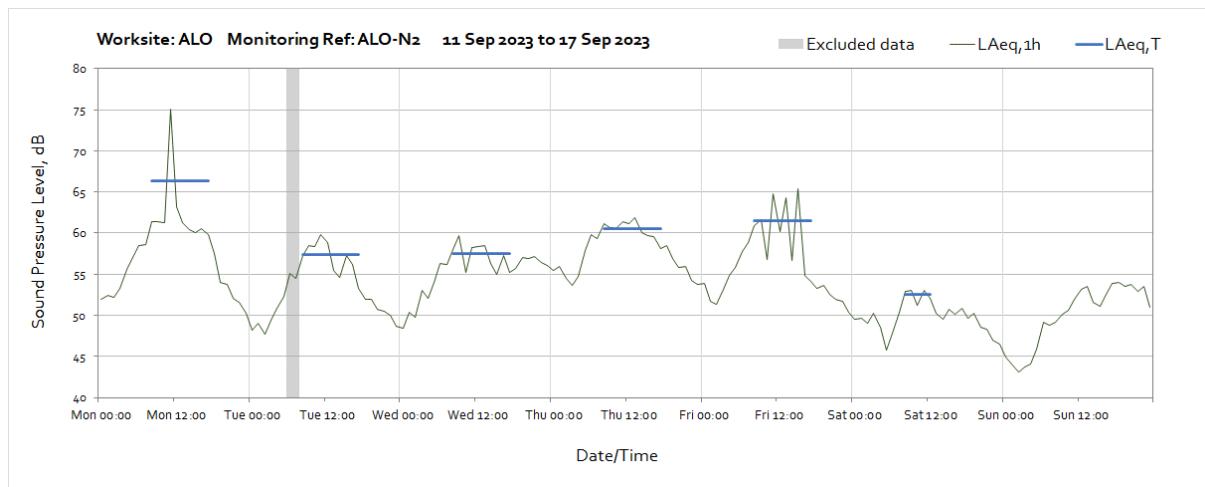


OFFICIAL


Worksite: AFE - Monitoring Ref: AFE-N1

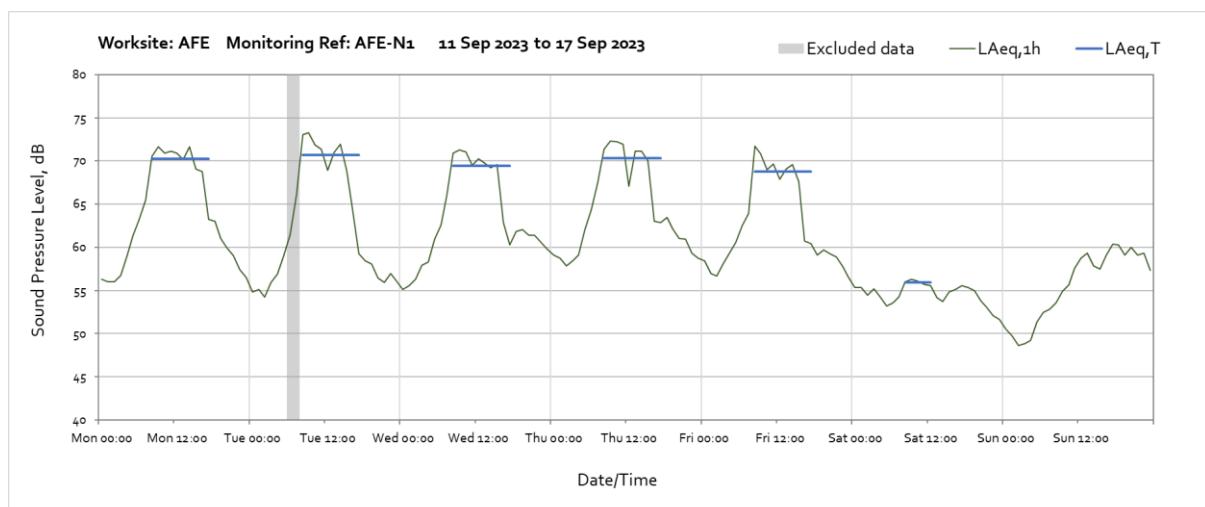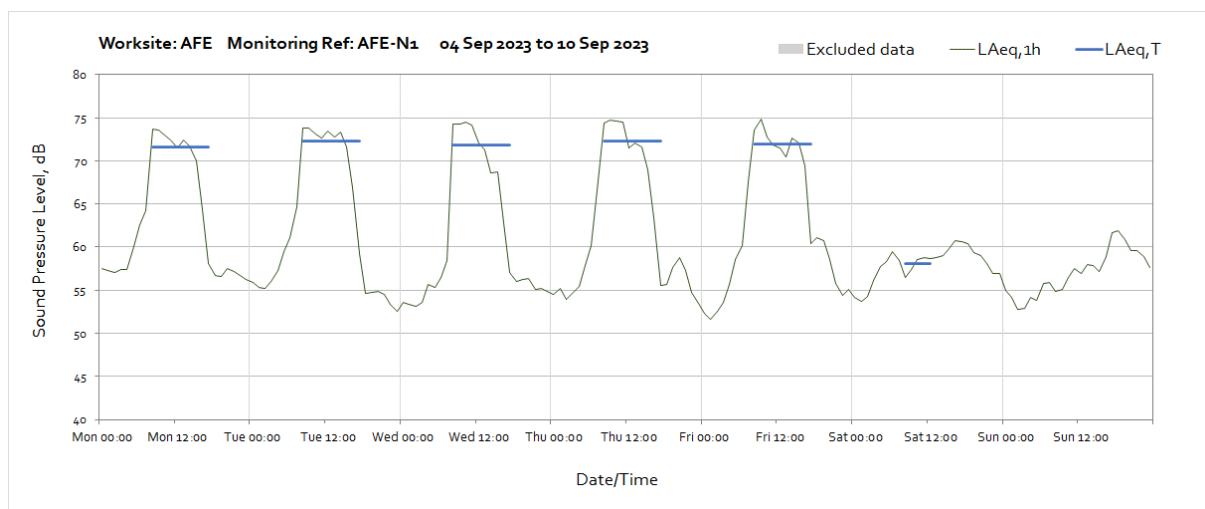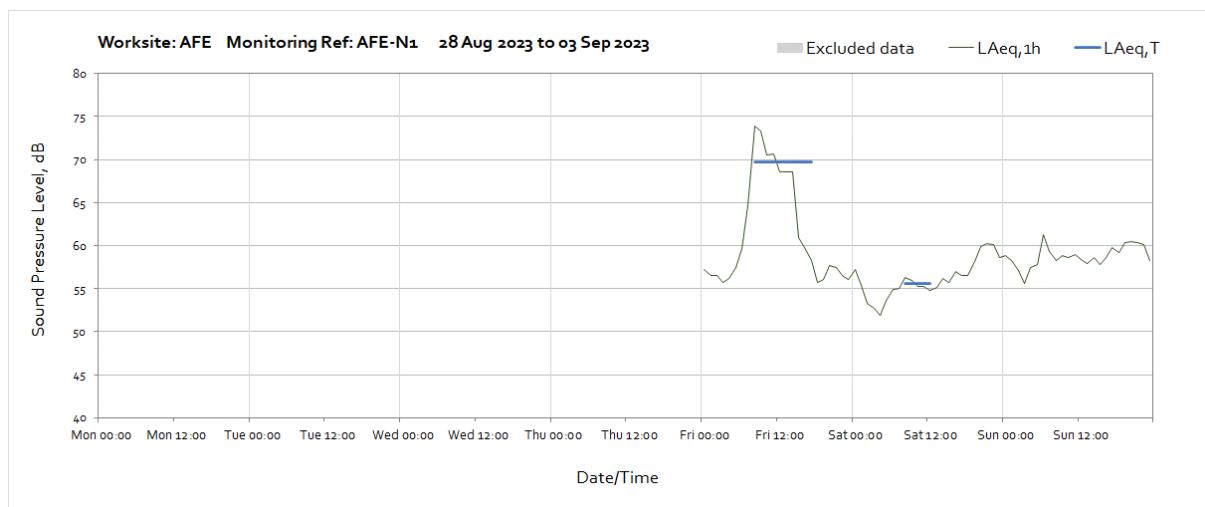




OFFICIAL

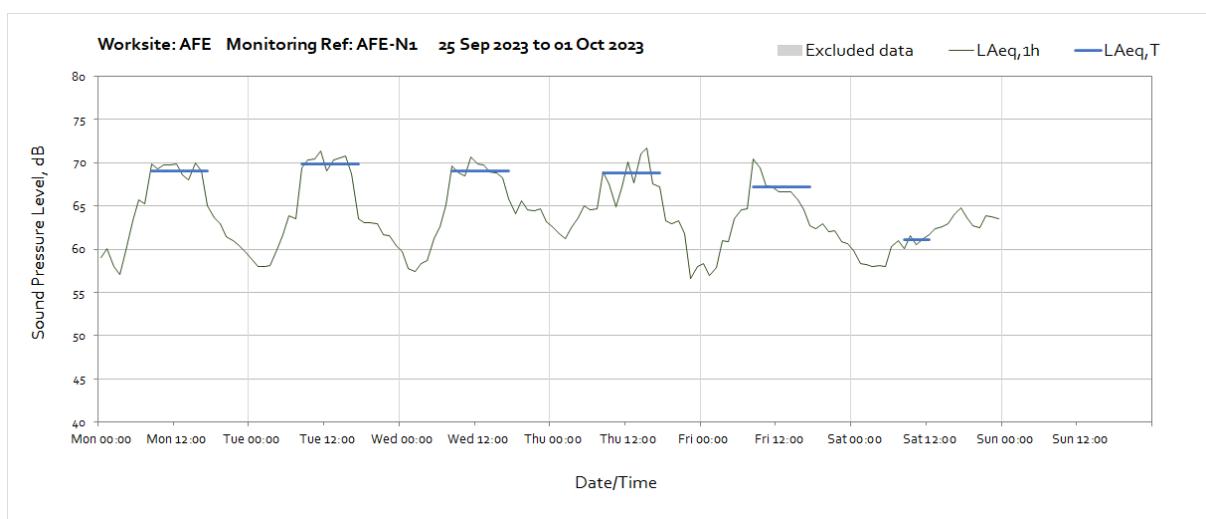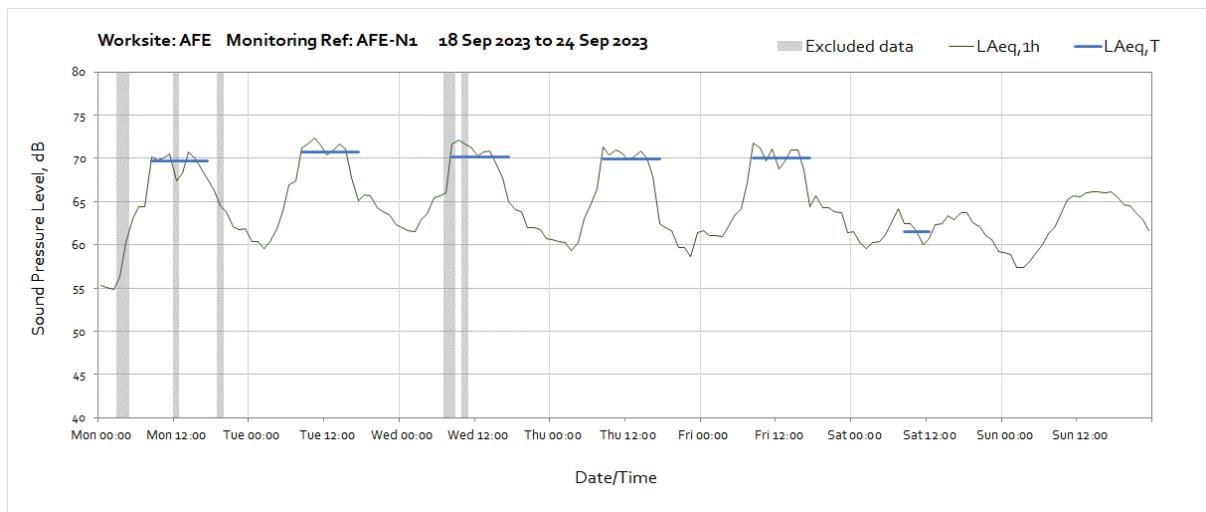


Worksite: GE – Monitoring Ref: GE-N1

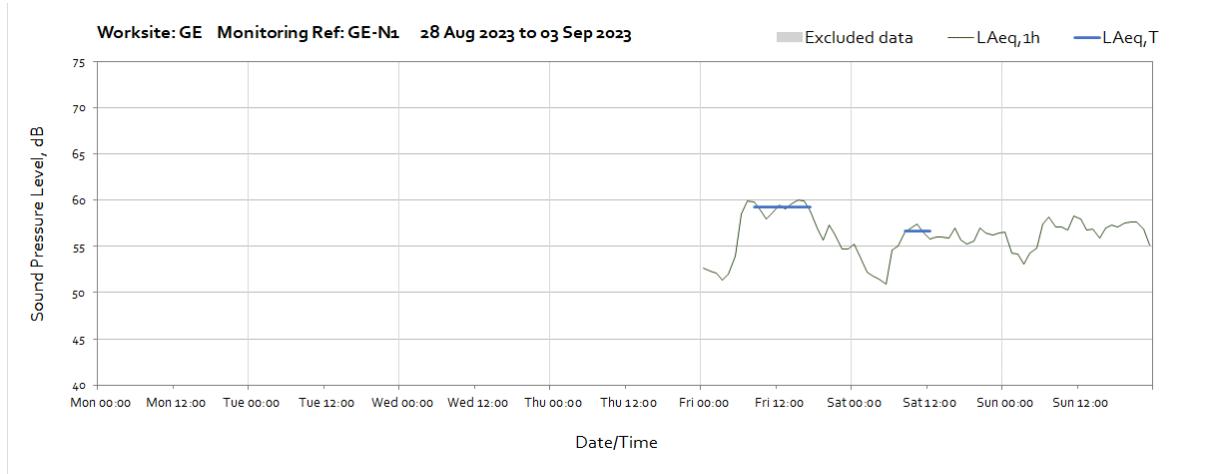


OFFICIAL

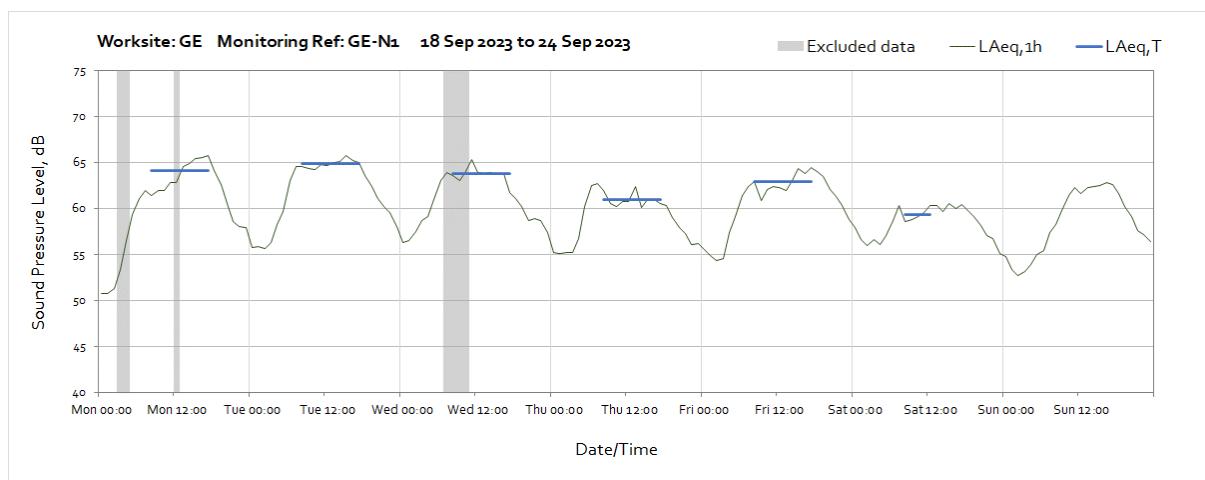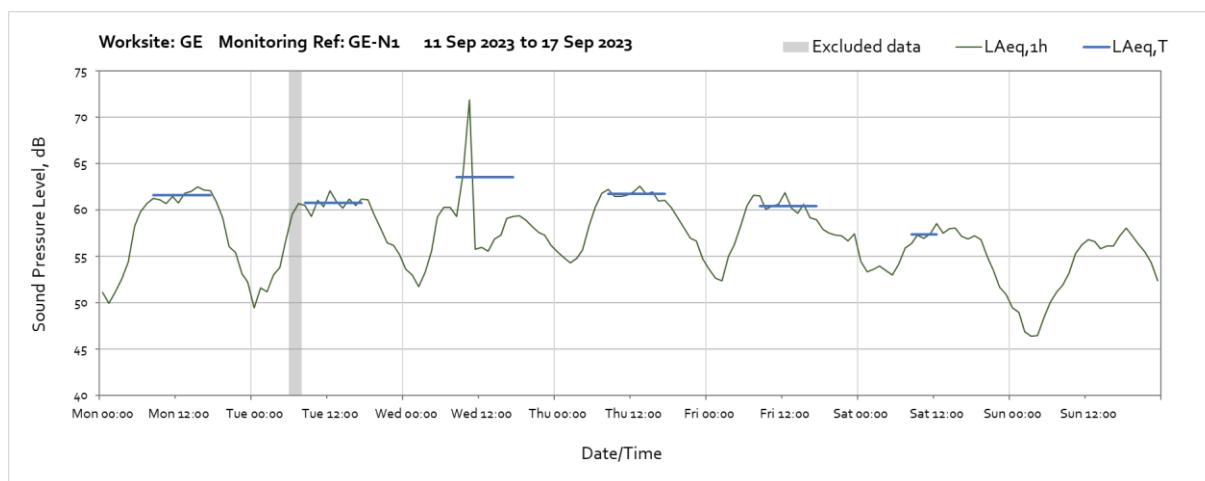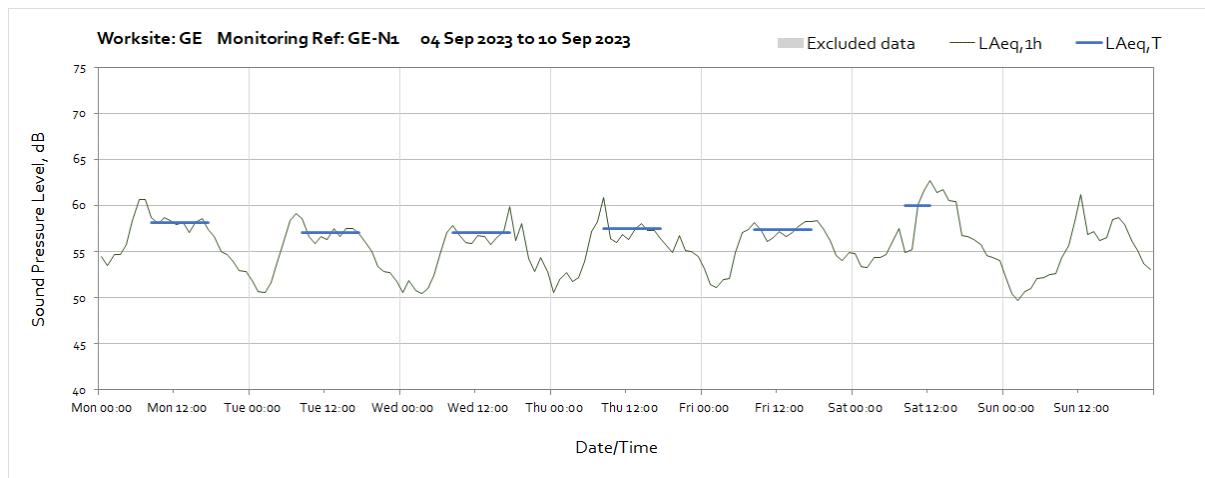




OFFICIAL

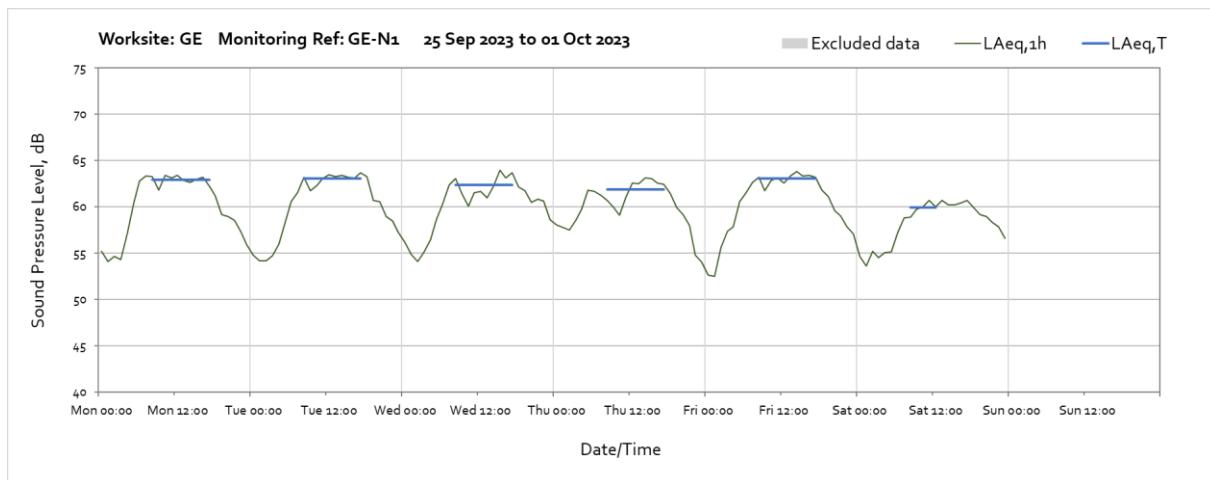

Worksite: GE – Monitoring Ref: GE-N2

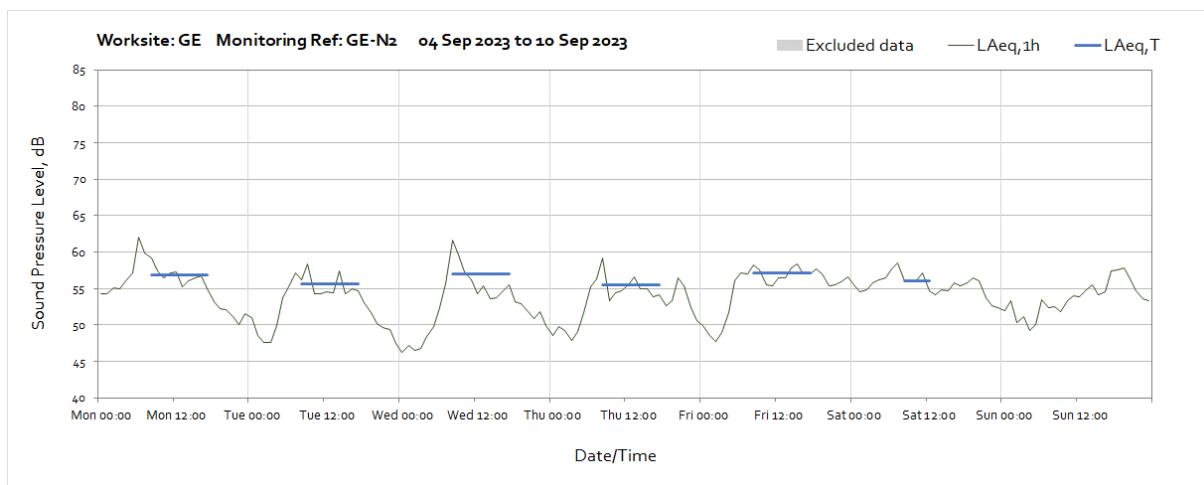


OFFICIAL

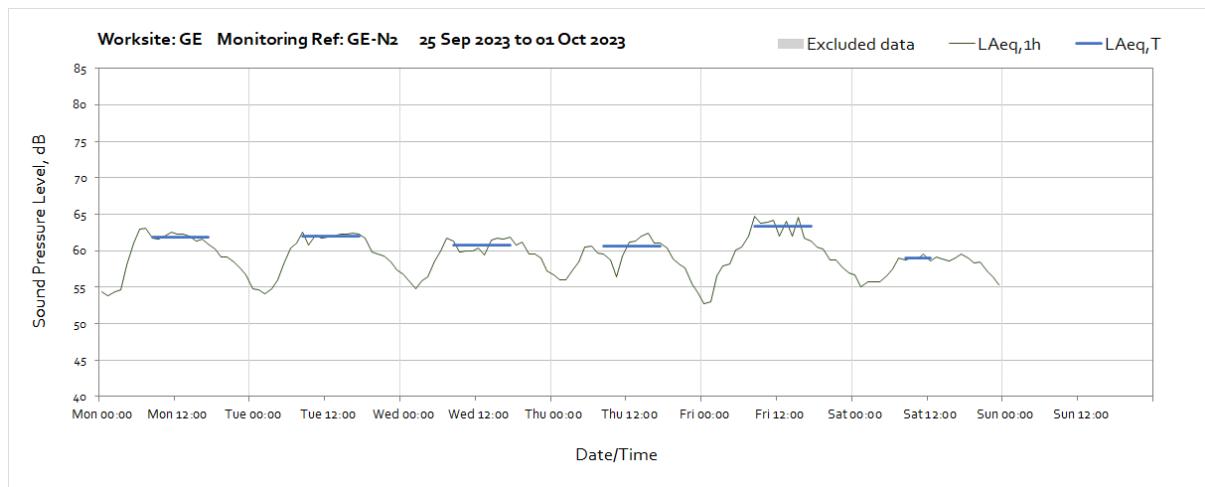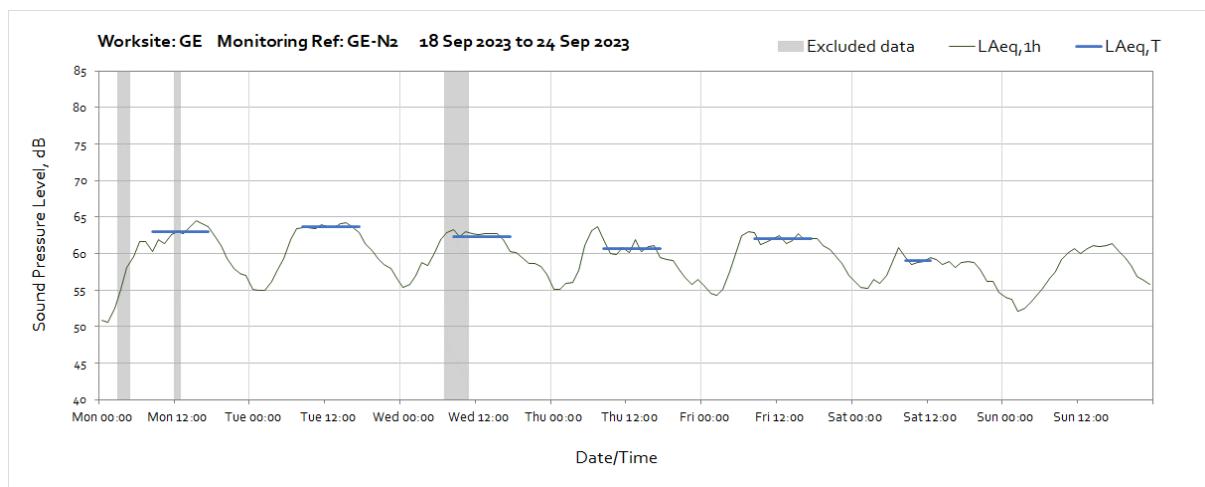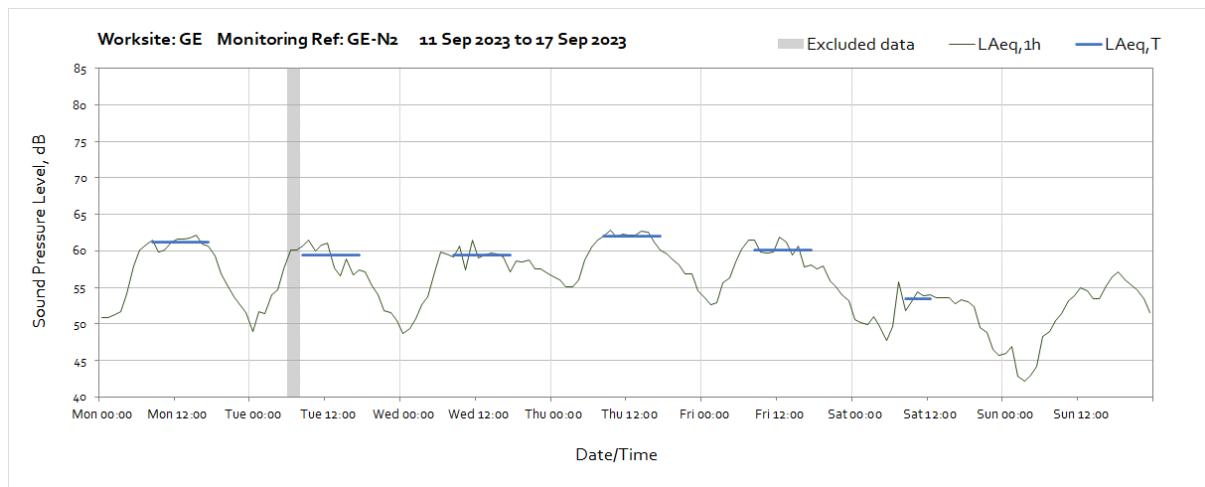


OFFICIAL


Worksite: GLD - Monitoring Ref: GLD-N1

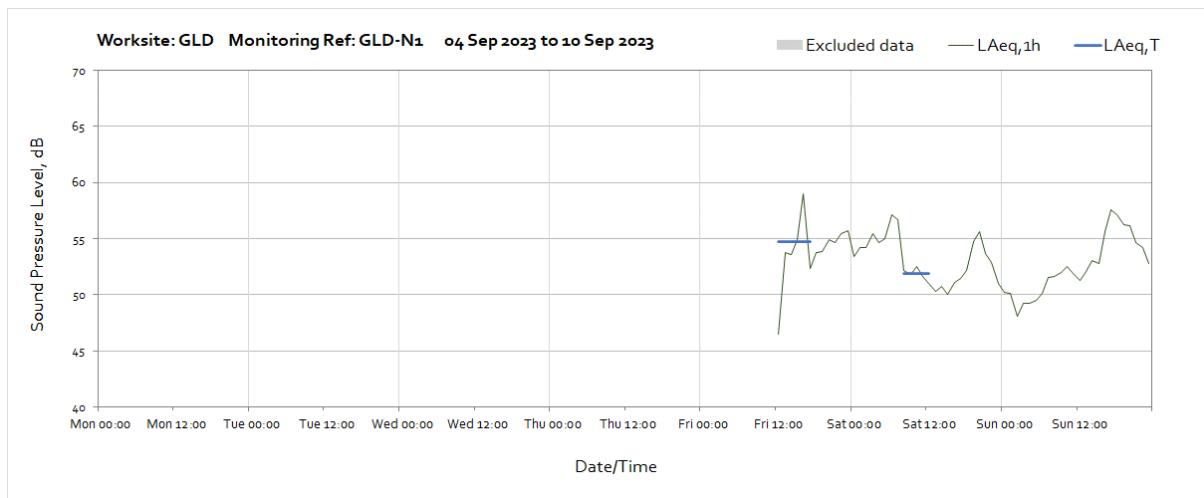


Note: Missing data from the beginning of the month until 12:00 on Friday 8th of September was due to loss of power to the monitoring station.

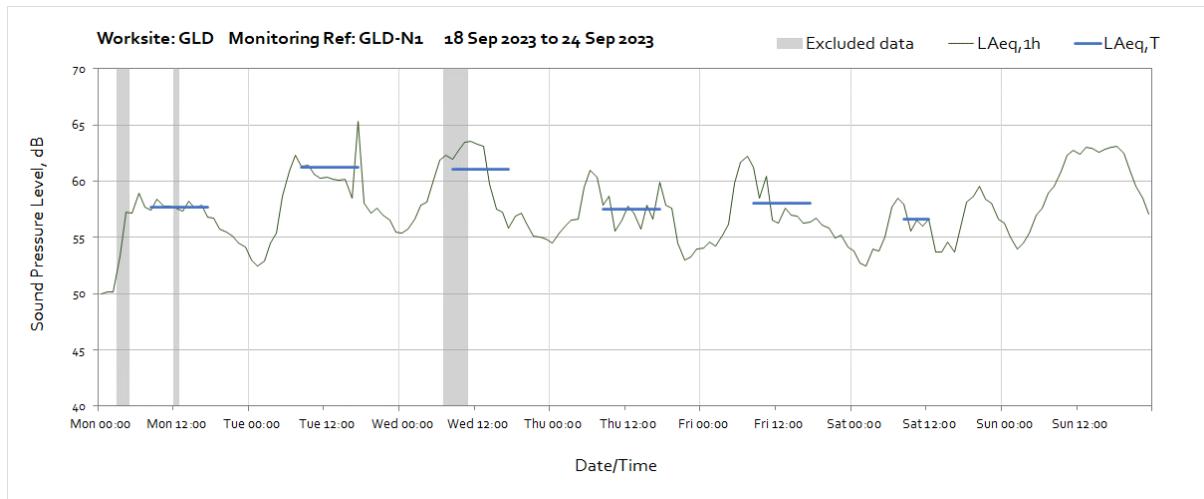



OFFICIAL

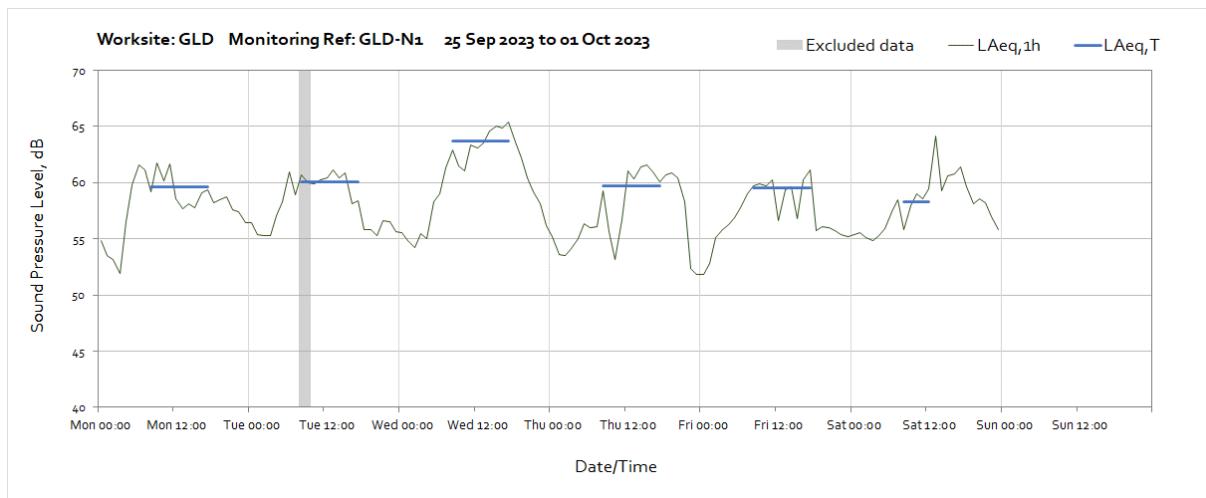

Worksite: GLD - Monitoring Ref: CM-N1

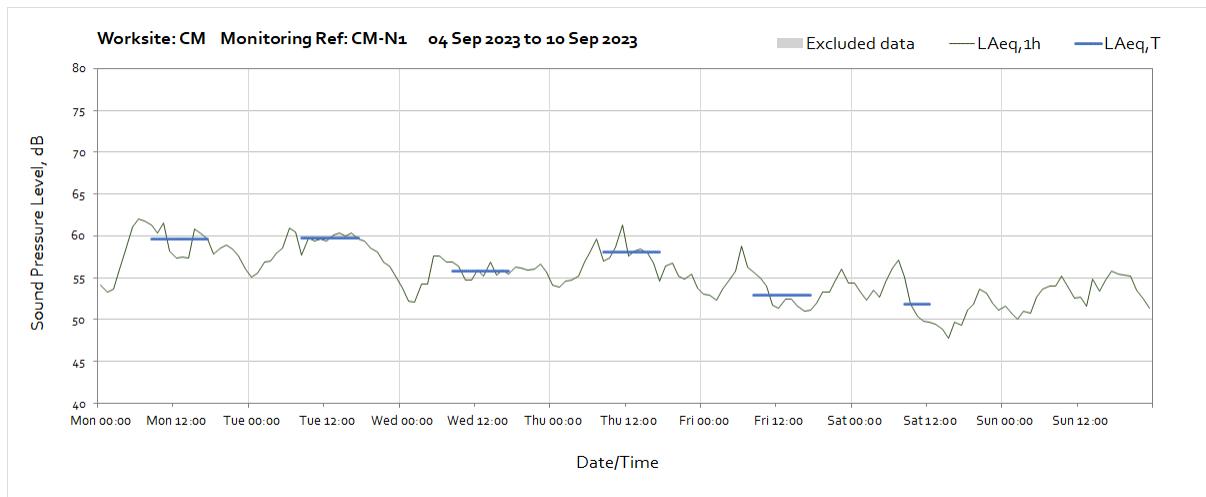

OFFICIAL

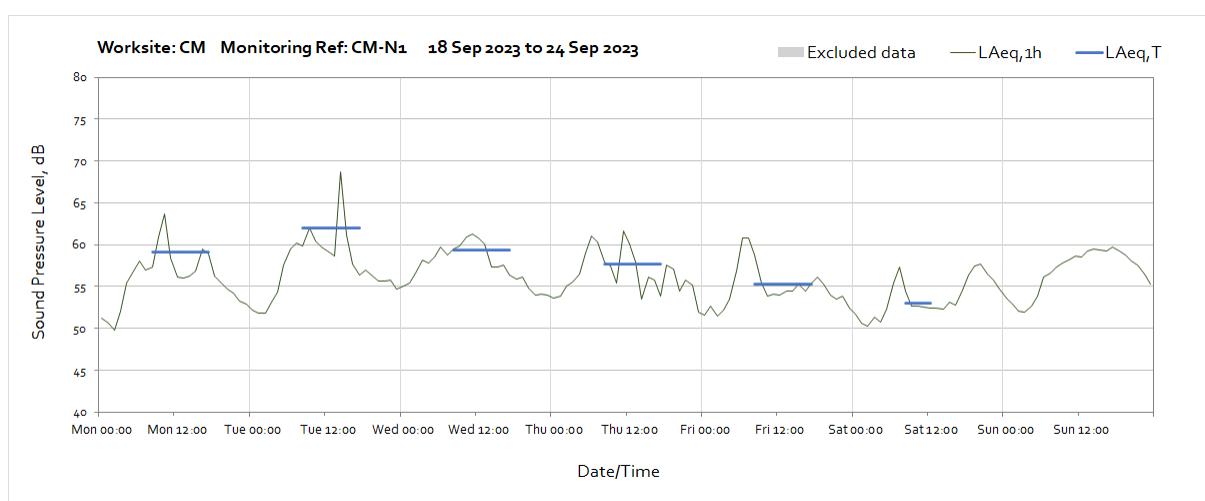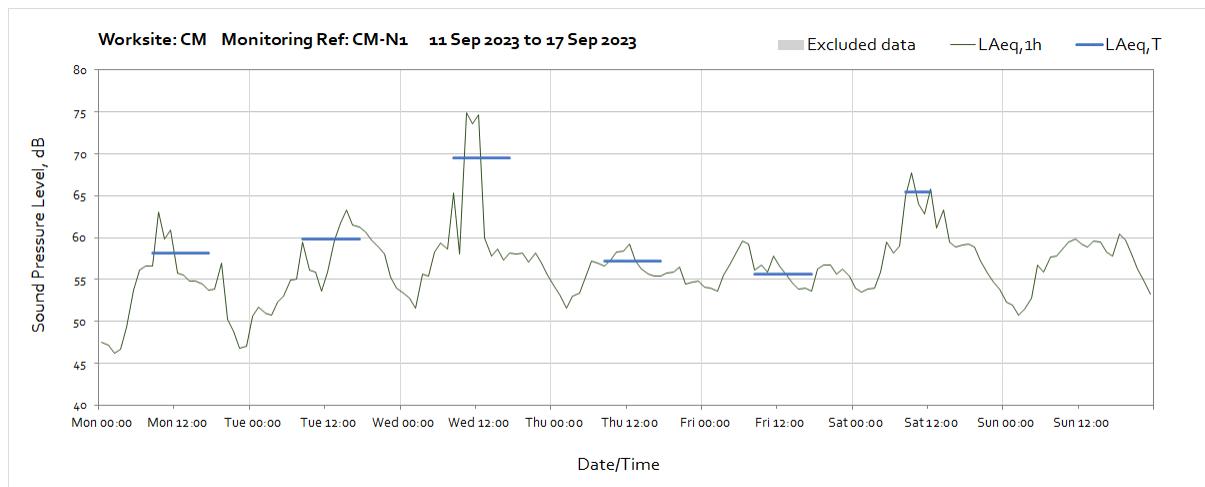


OFFICIAL


Worksite: BRD - Monitoring Ref: BRD-N2






OFFICIAL

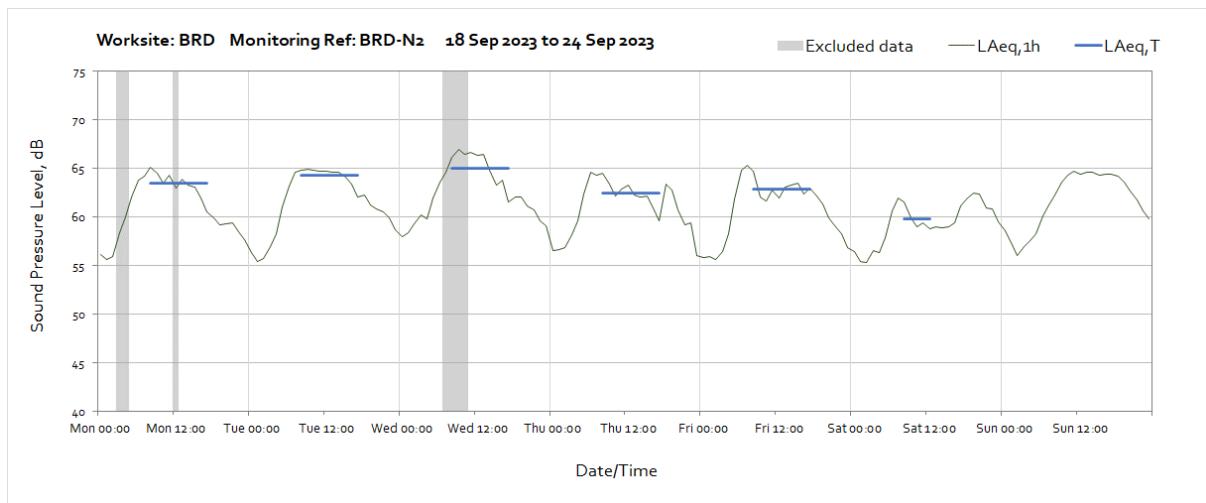


Worksite: BRD - Monitoring Ref: BRD-N3

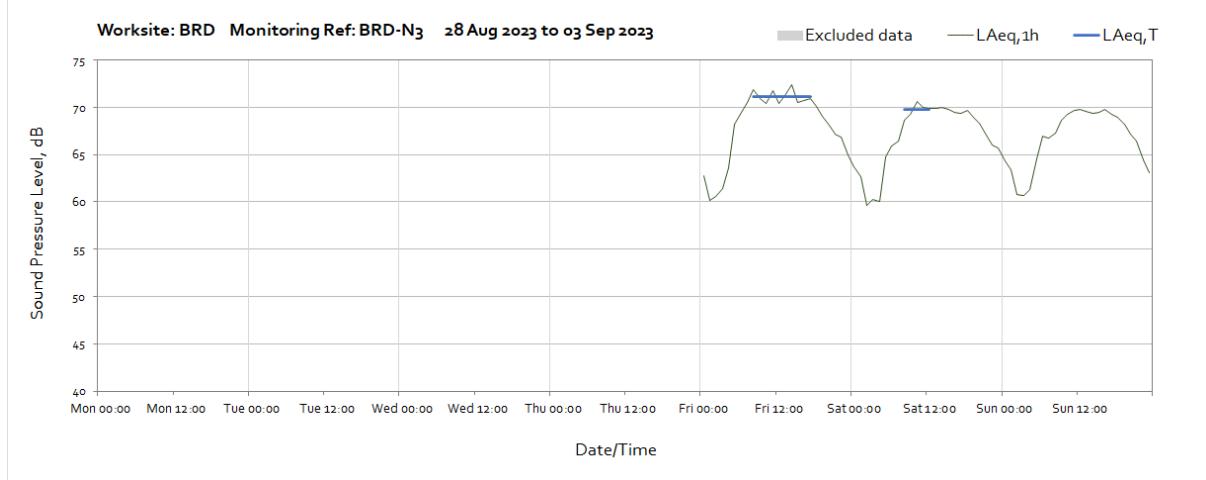

OFFICIAL

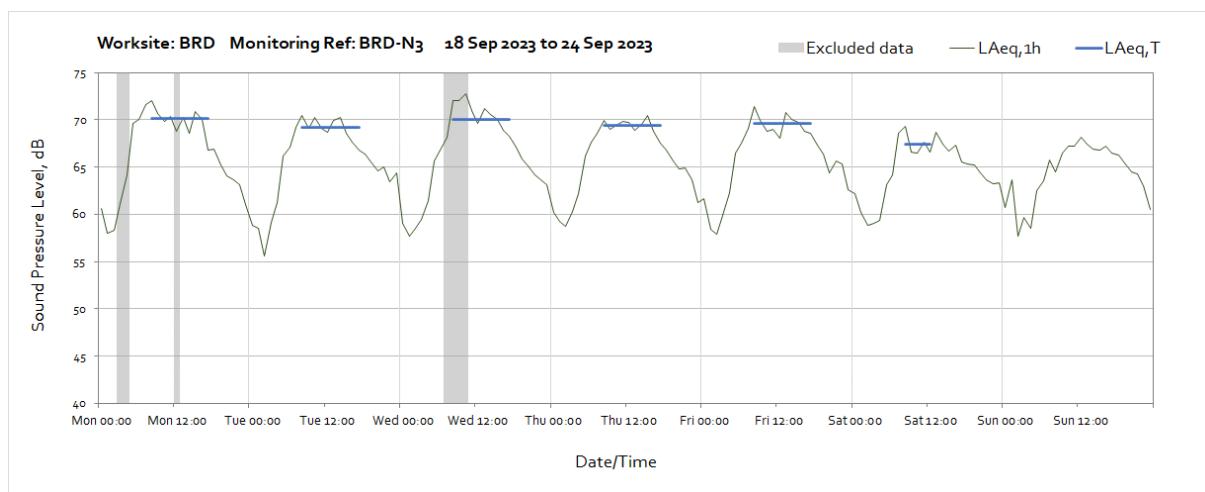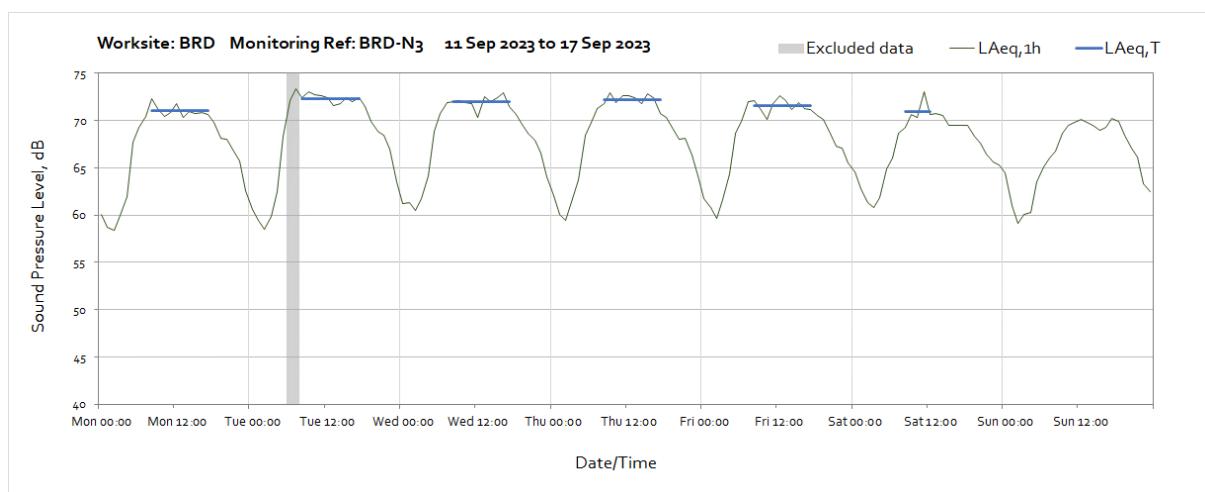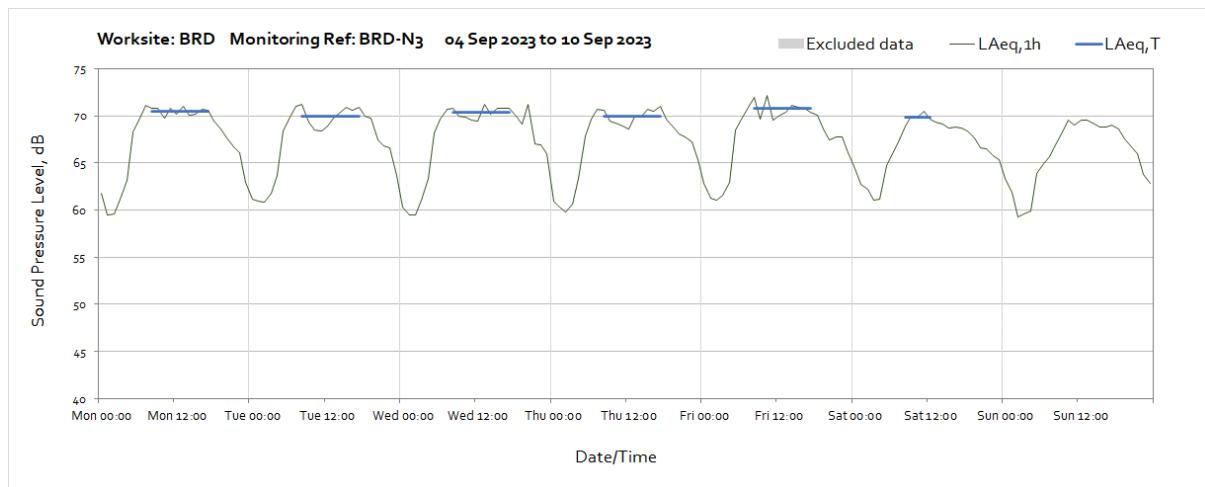

OFFICIAL


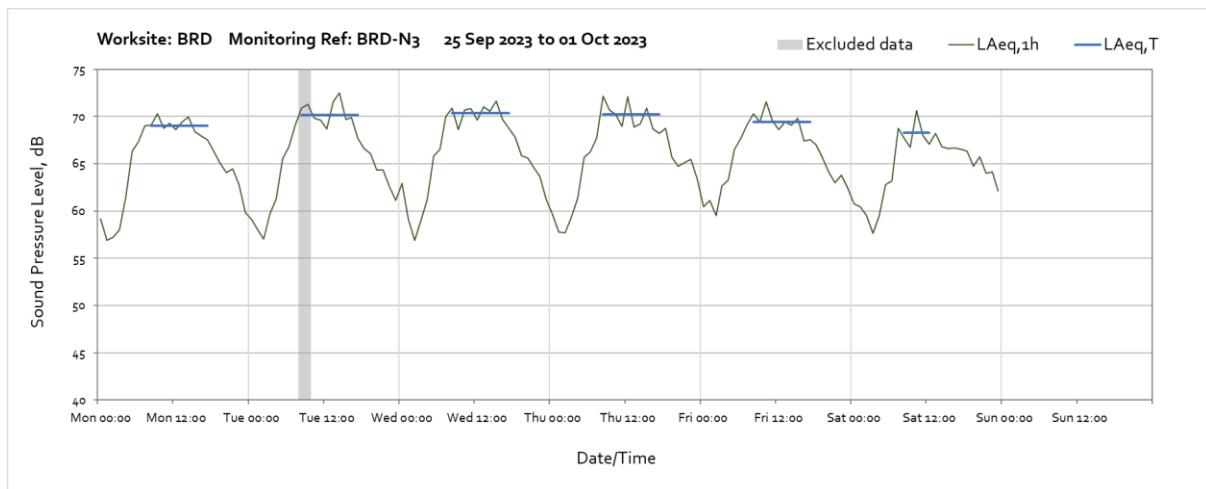


OFFICIAL




Vibration

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.

Worksite: BFCV – Monitoring Ref: BFCV-V4


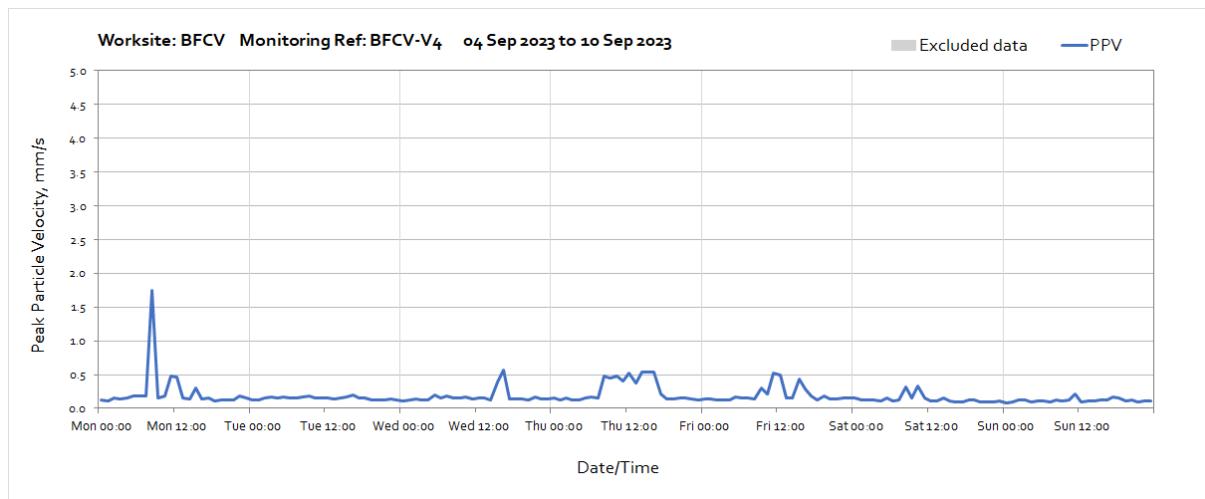
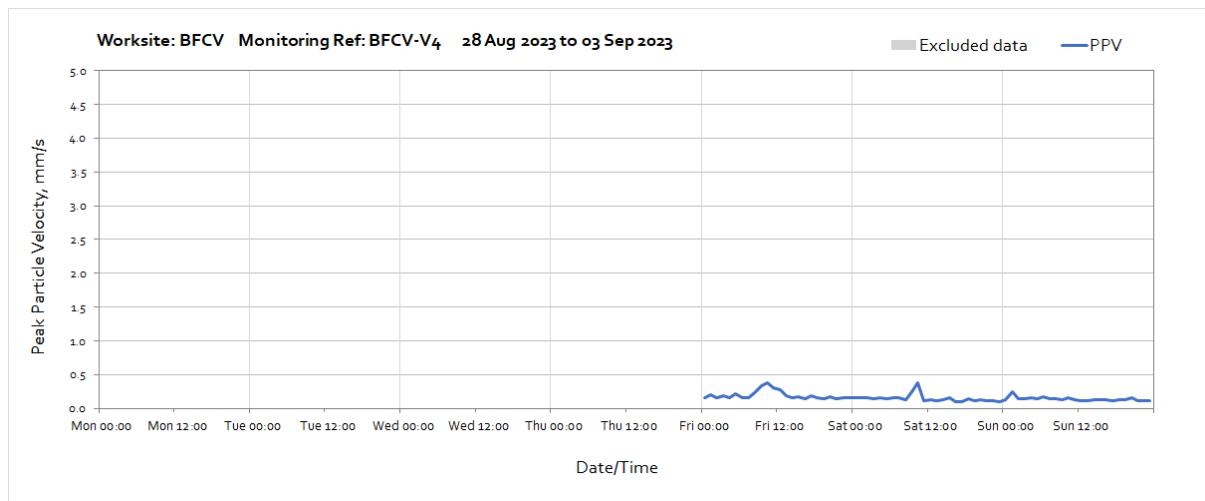


OFFICIAL

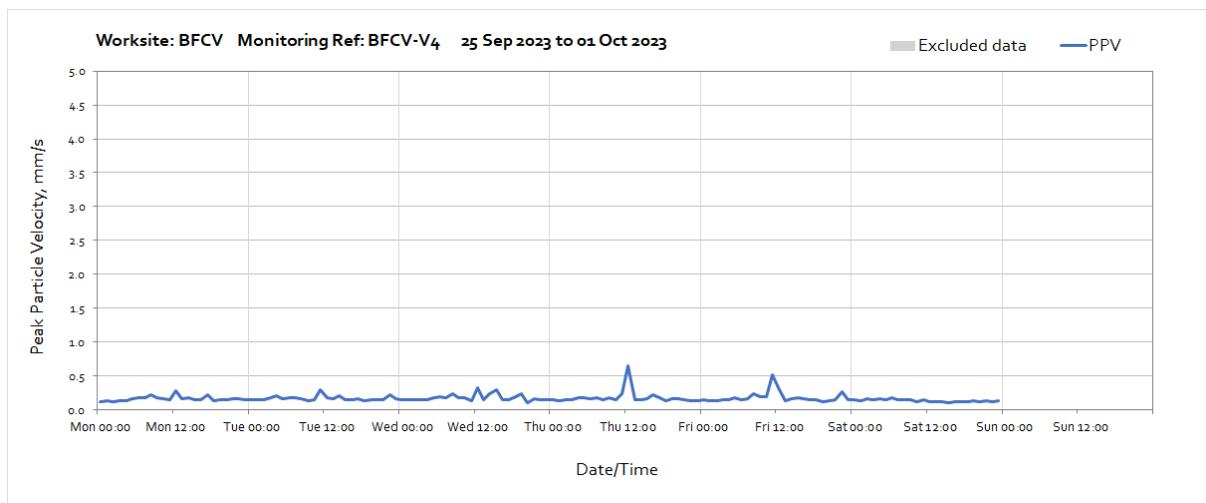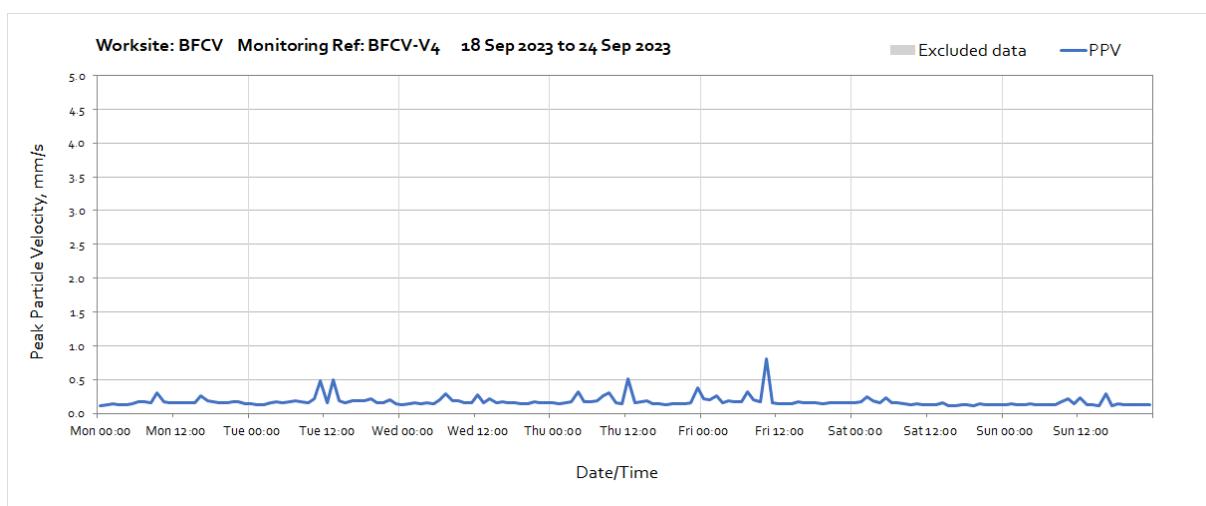
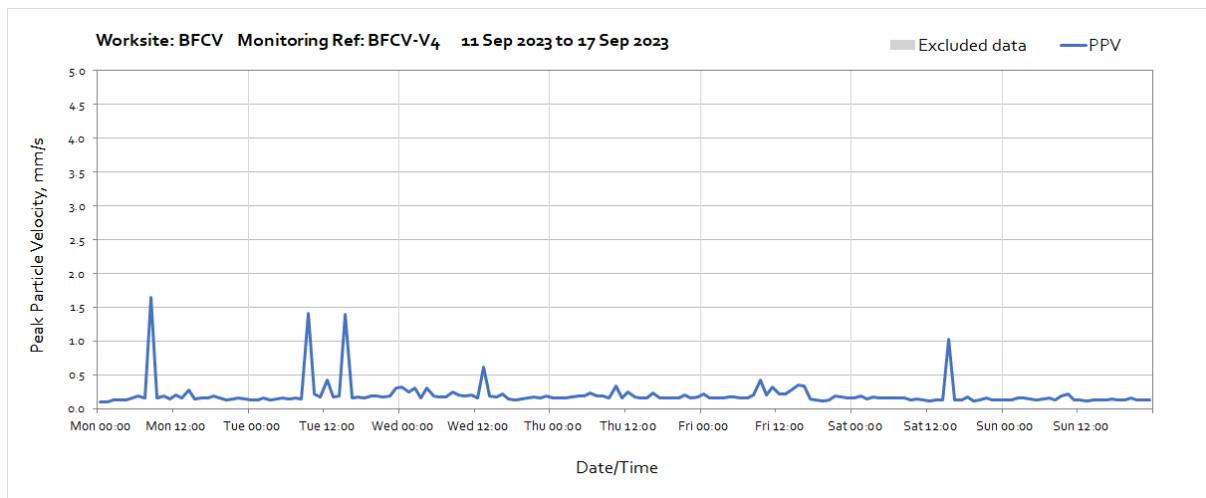


OFFICIAL

Worksite: MB – Monitoring Ref: MB-V1

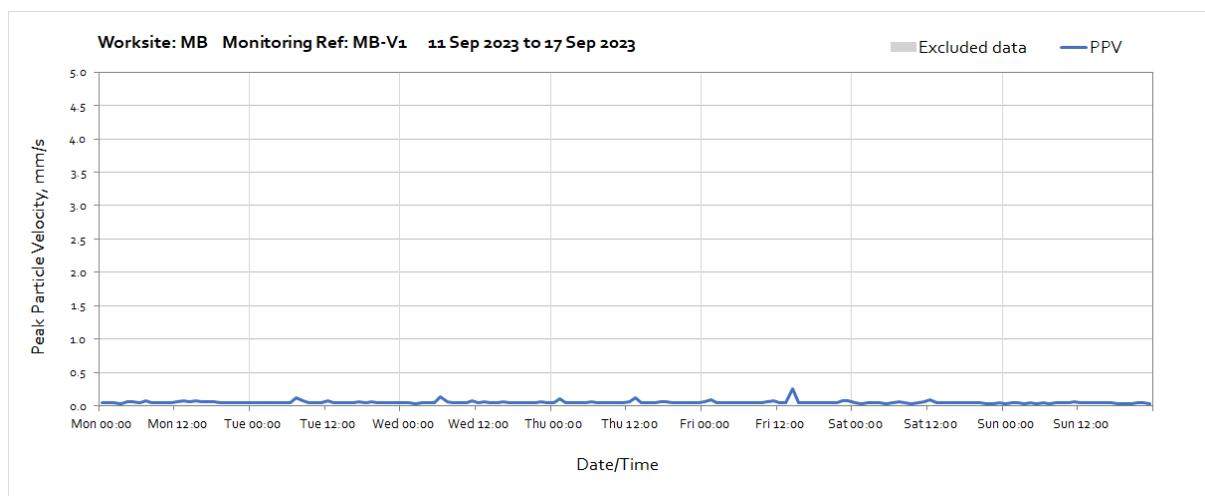
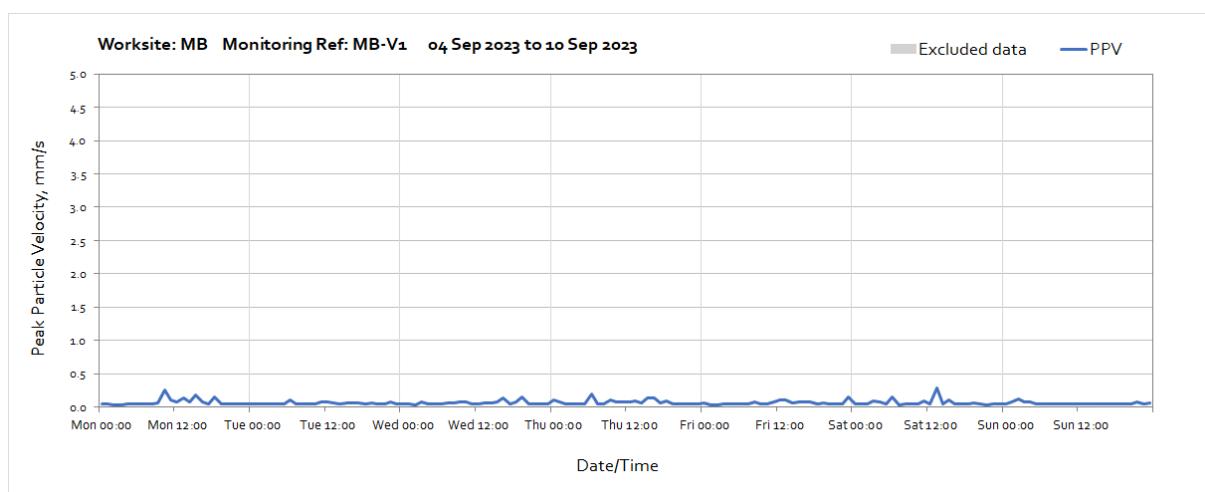
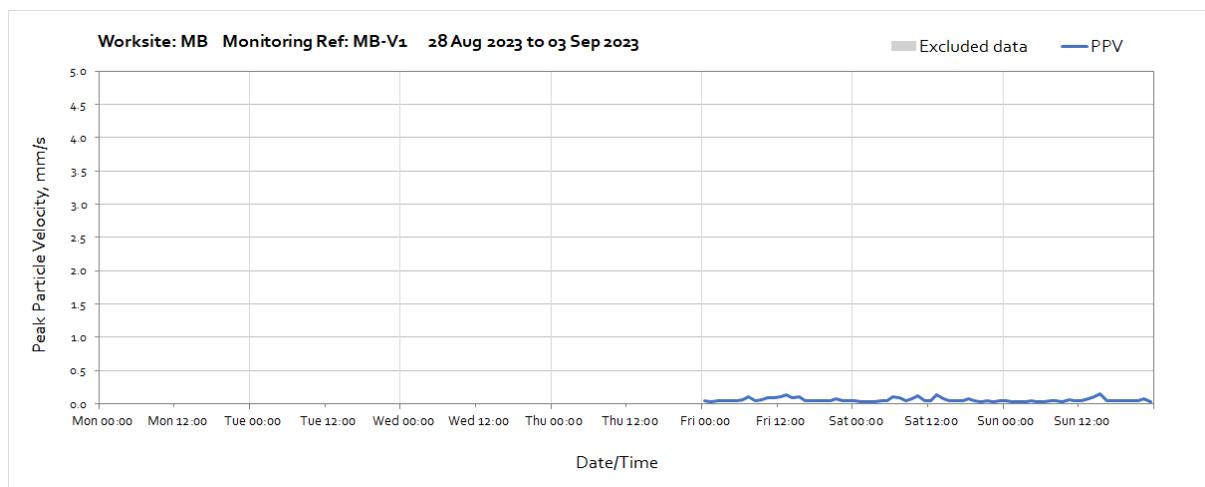


OFFICIAL

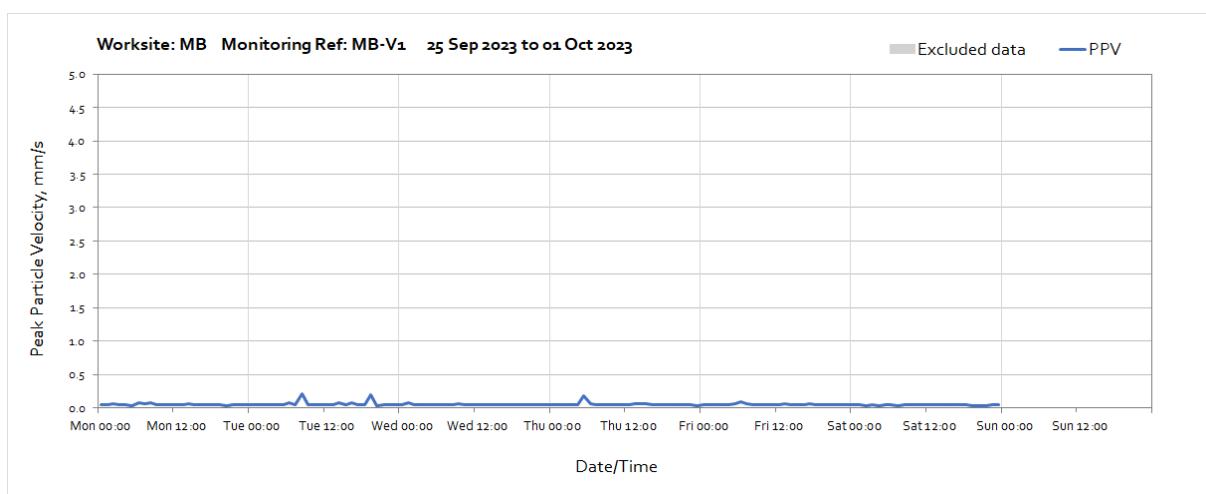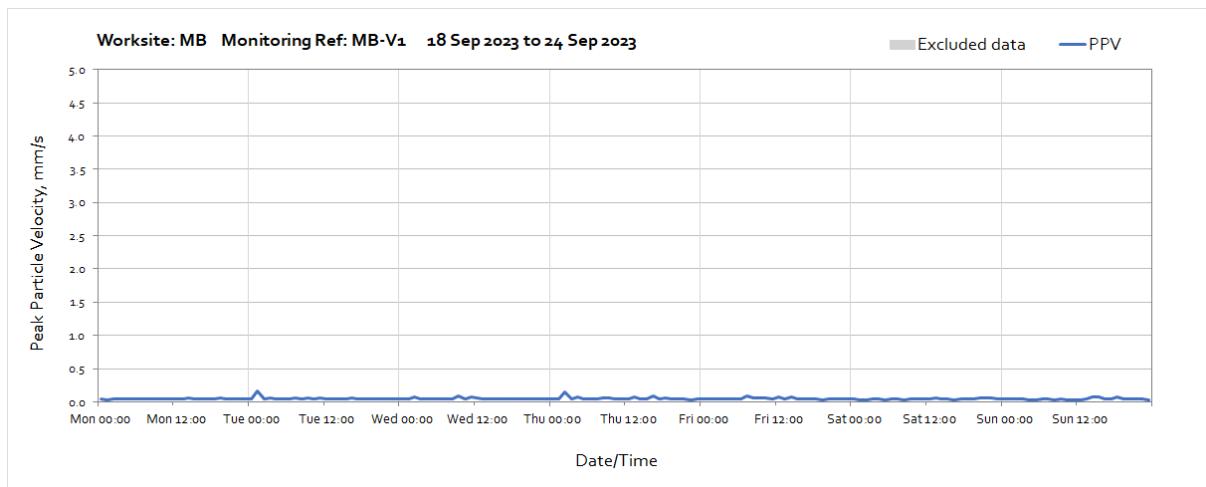


OFFICIAL


Worksite: FAEU – Monitoring Ref: FAEU-V1

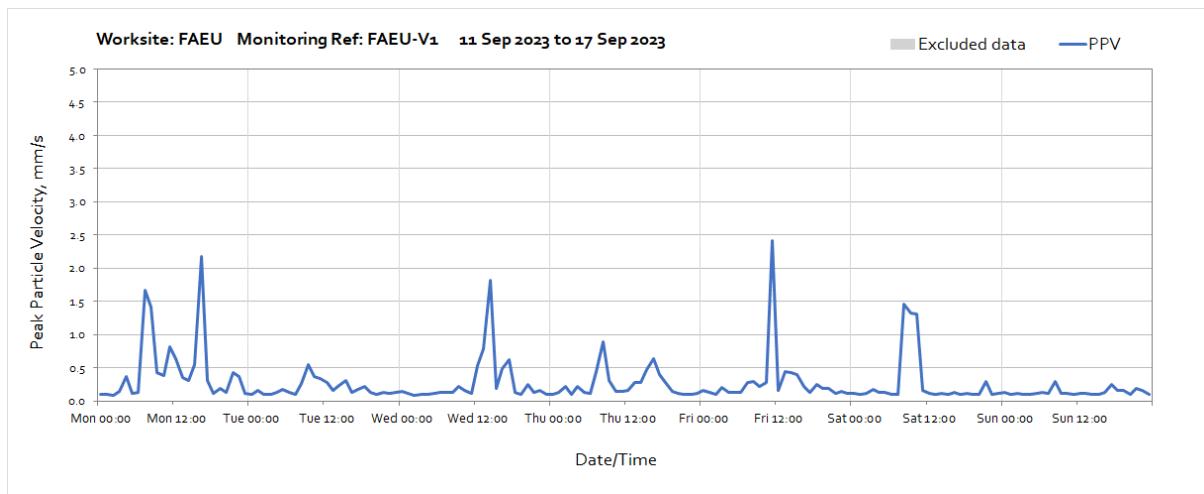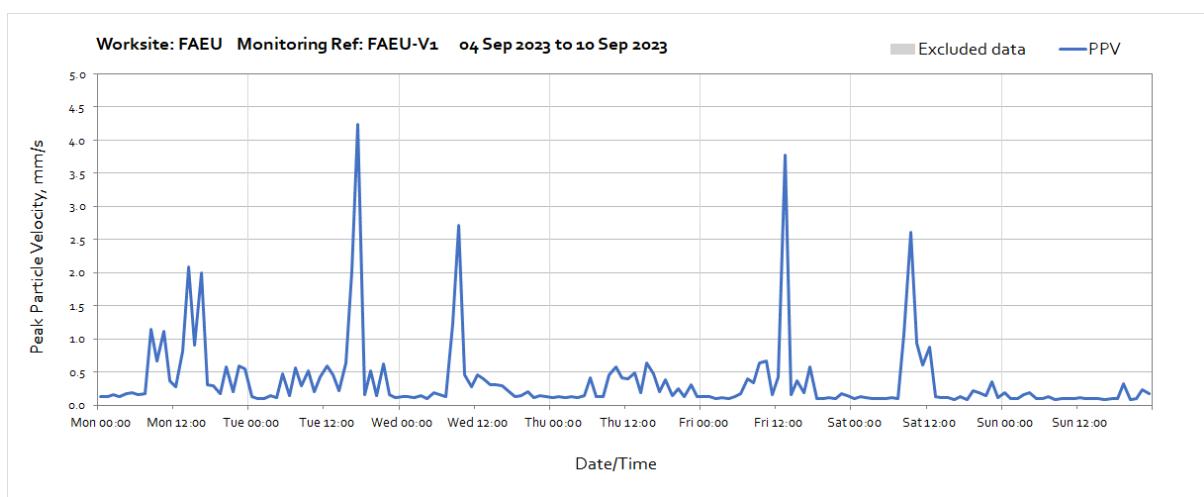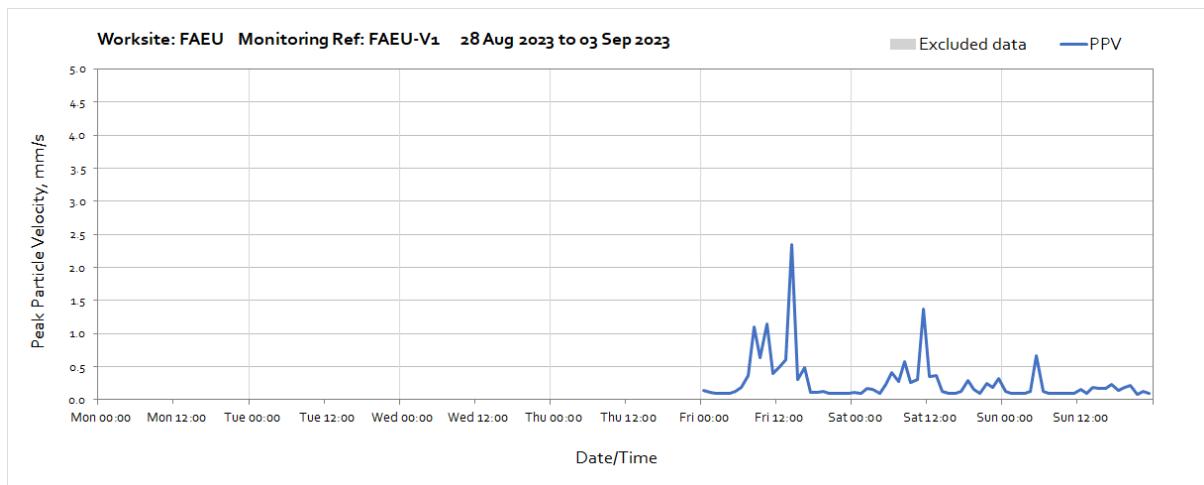



OFFICIAL

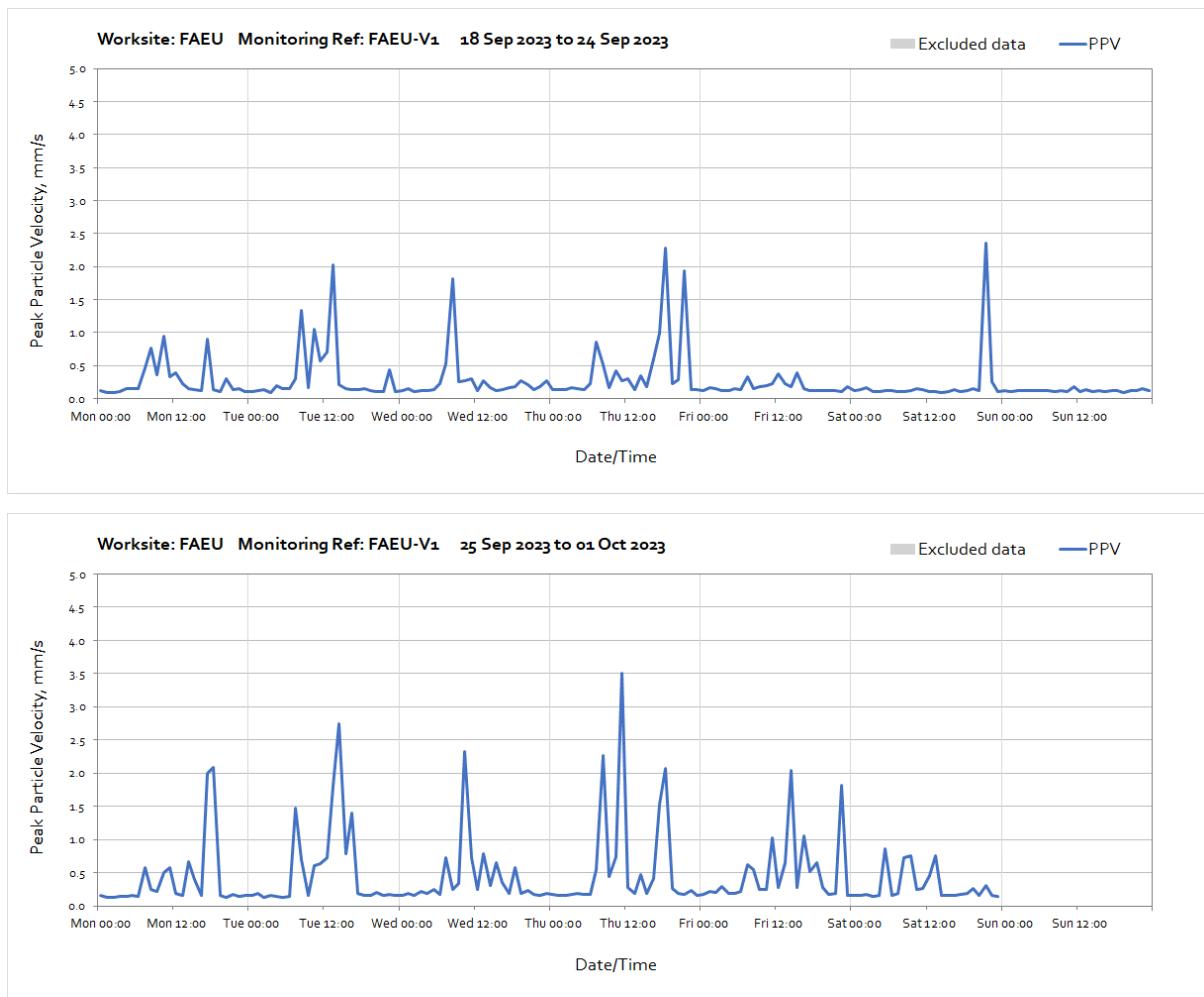

Worksite: WOSC – Monitoring Ref: WOSC-V1

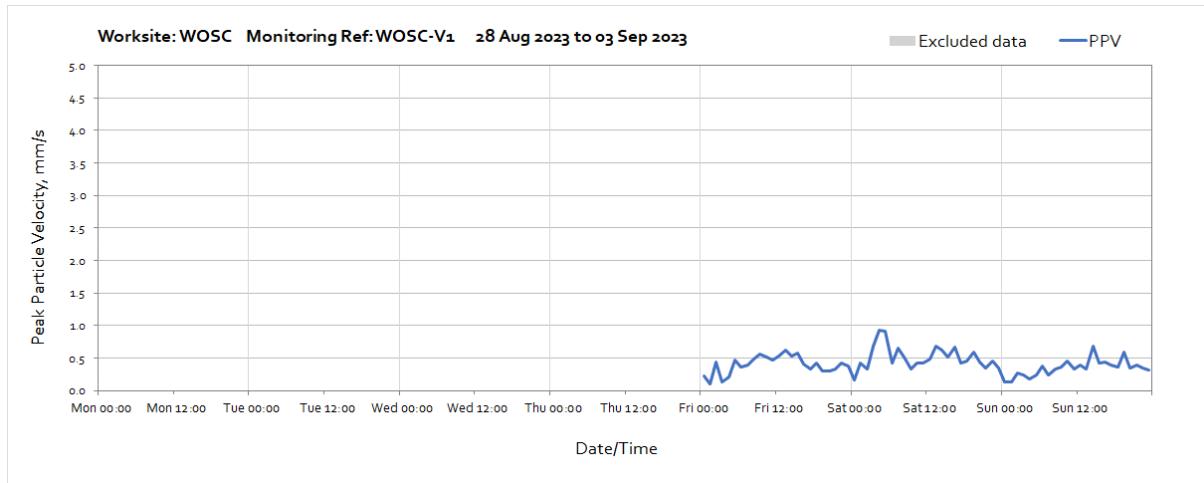




OFFICIAL

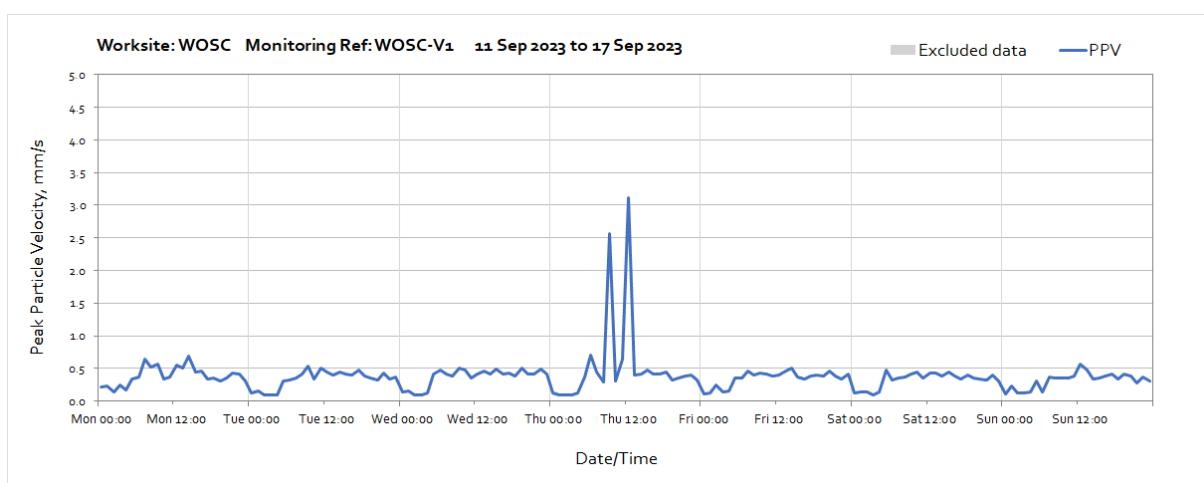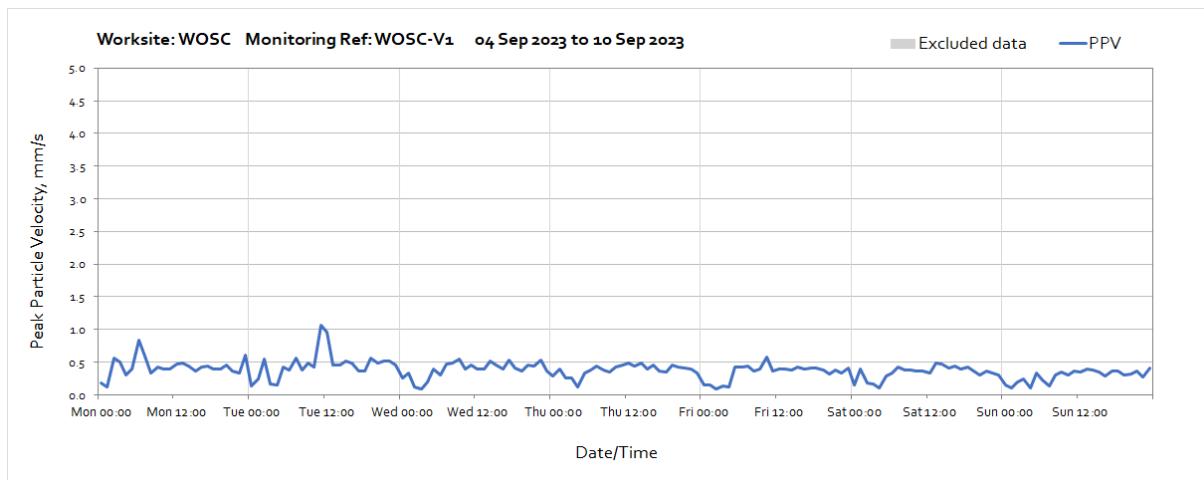



Note: Monitor was decommissioned at 12:00 on Thursday 21st September.

OFFICIAL

Worksite: ALO – Monitoring Ref: ALO-V1

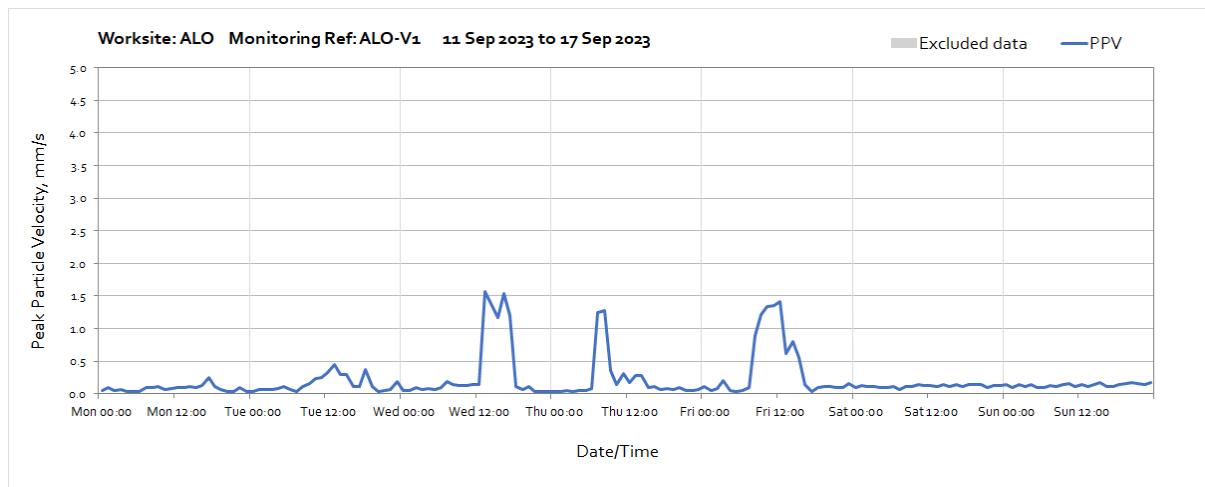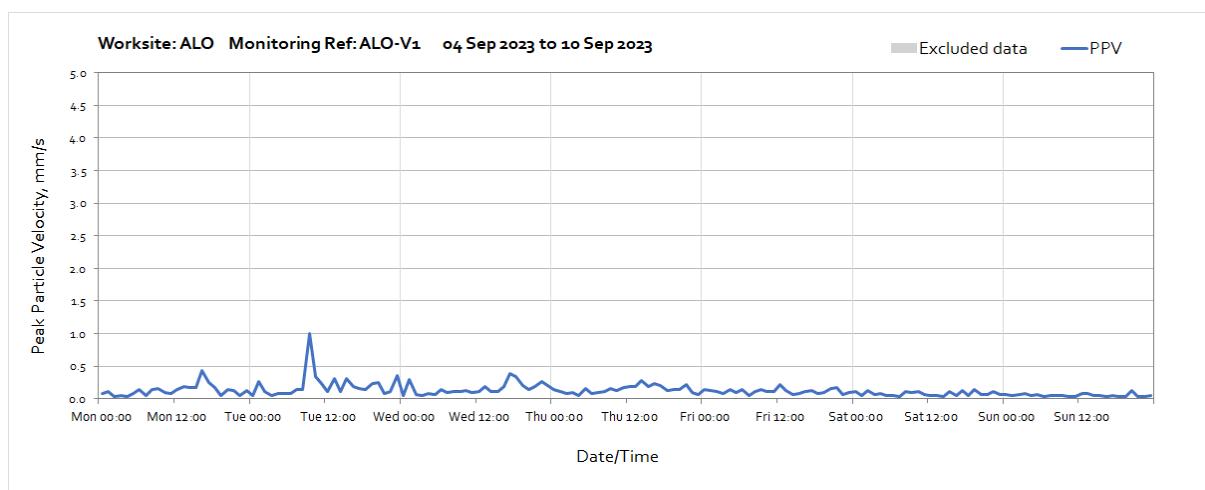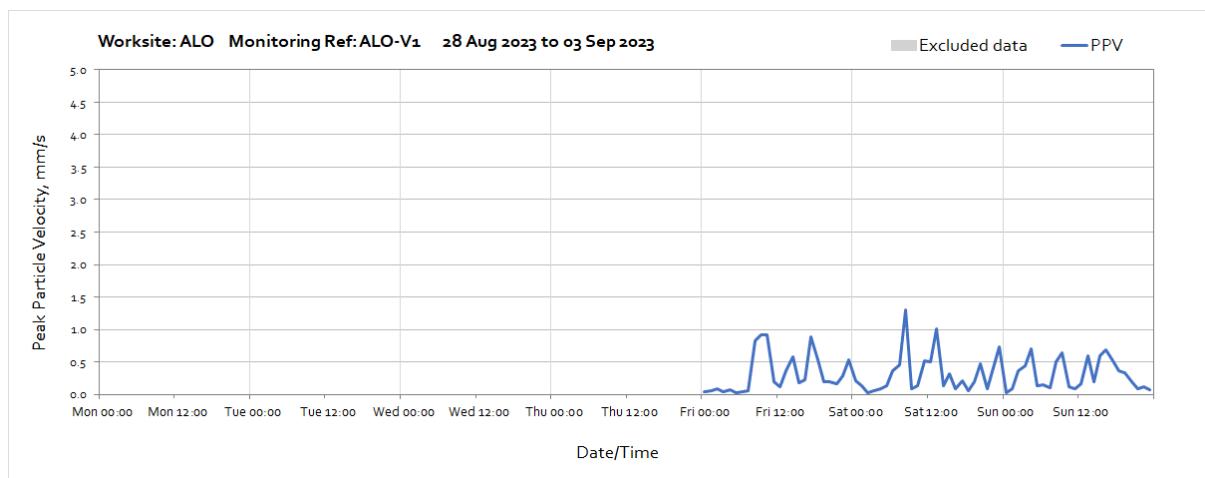


OFFICIAL

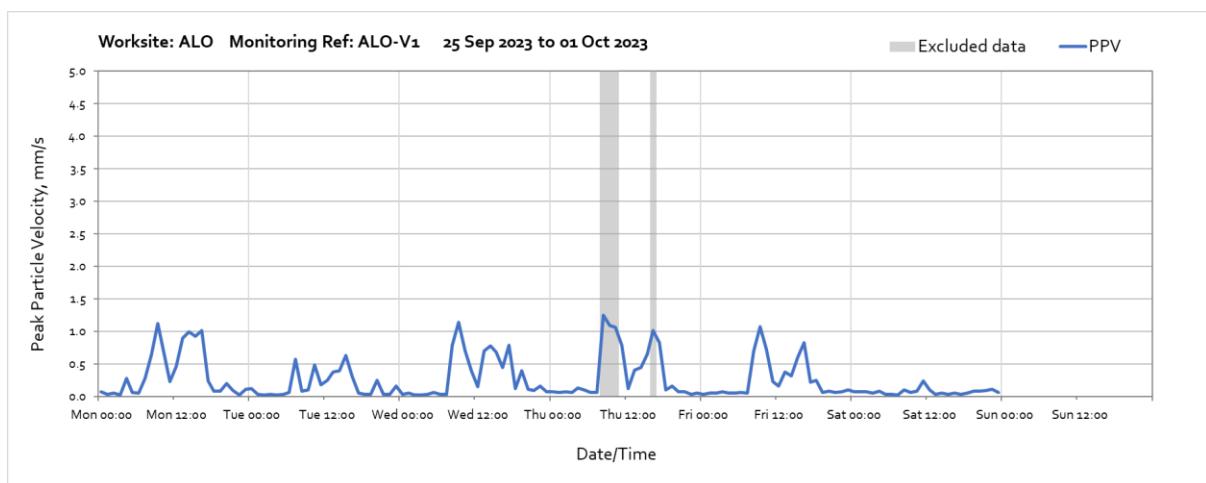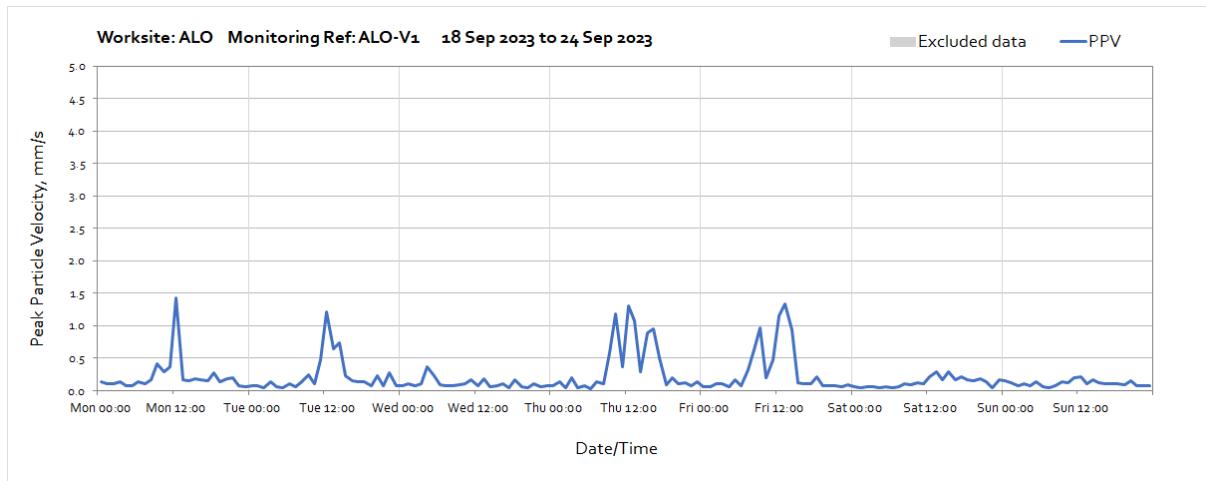


OFFICIAL


Worksite: AFE - Monitoring Ref: AFE-V1

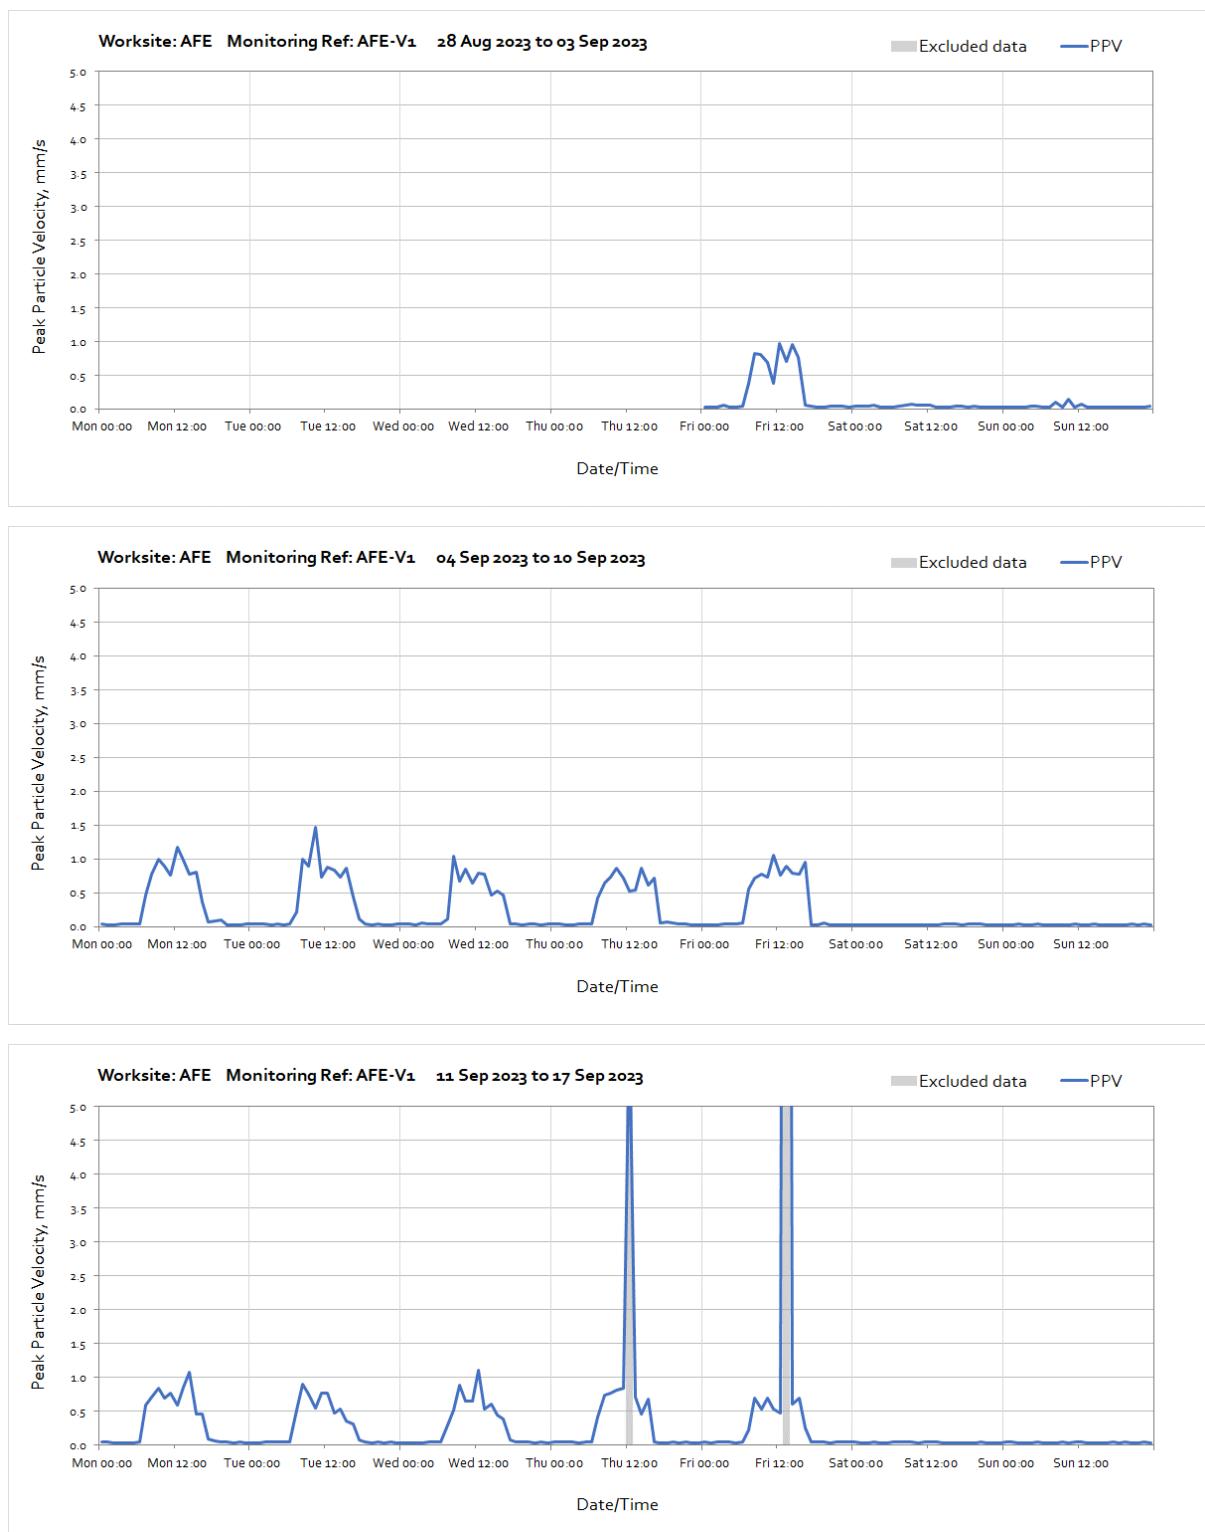




OFFICIAL

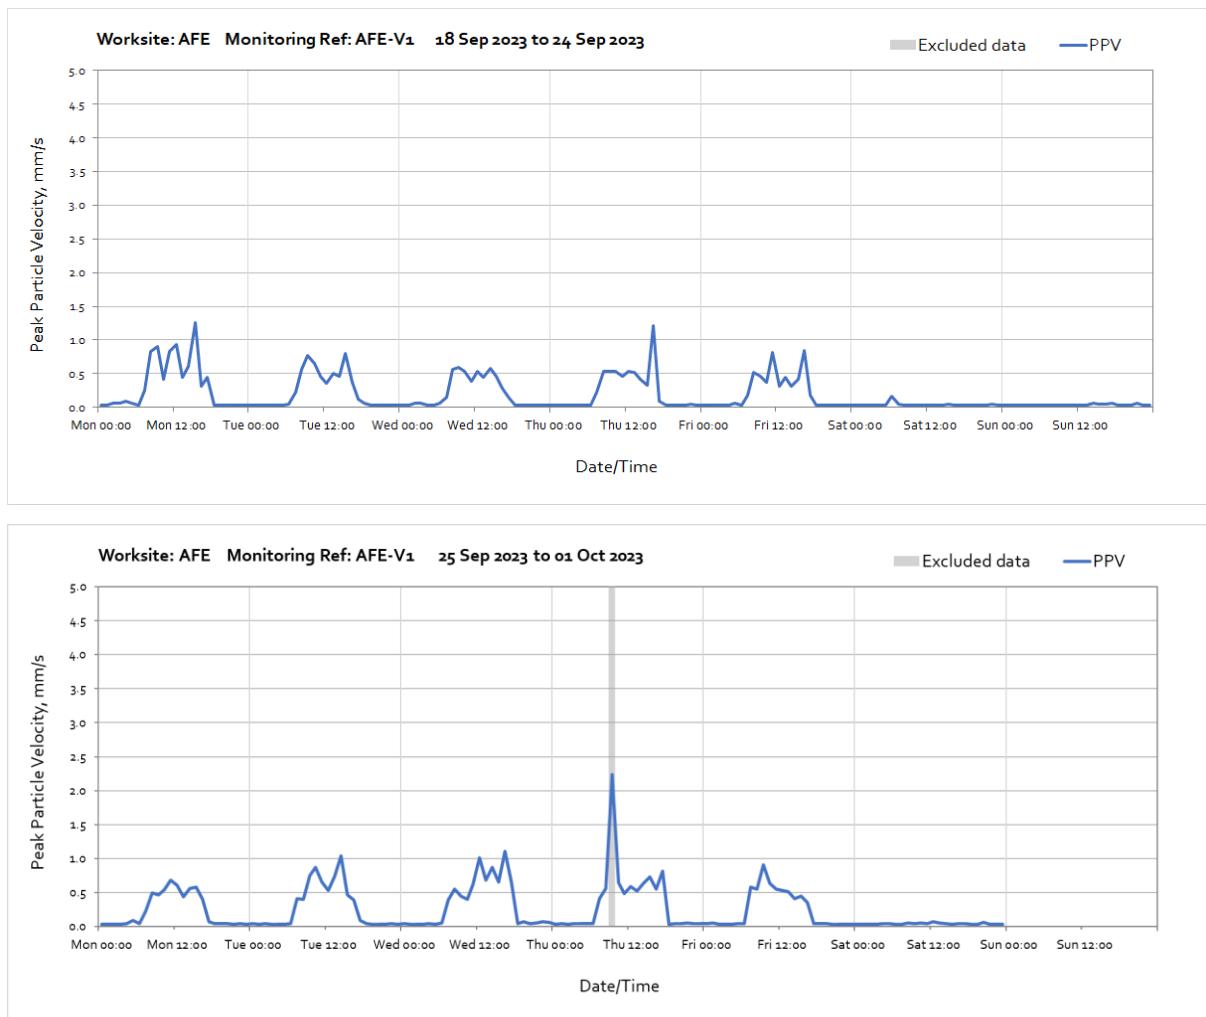


Worksite: GE - Monitoring Ref: GE-V1

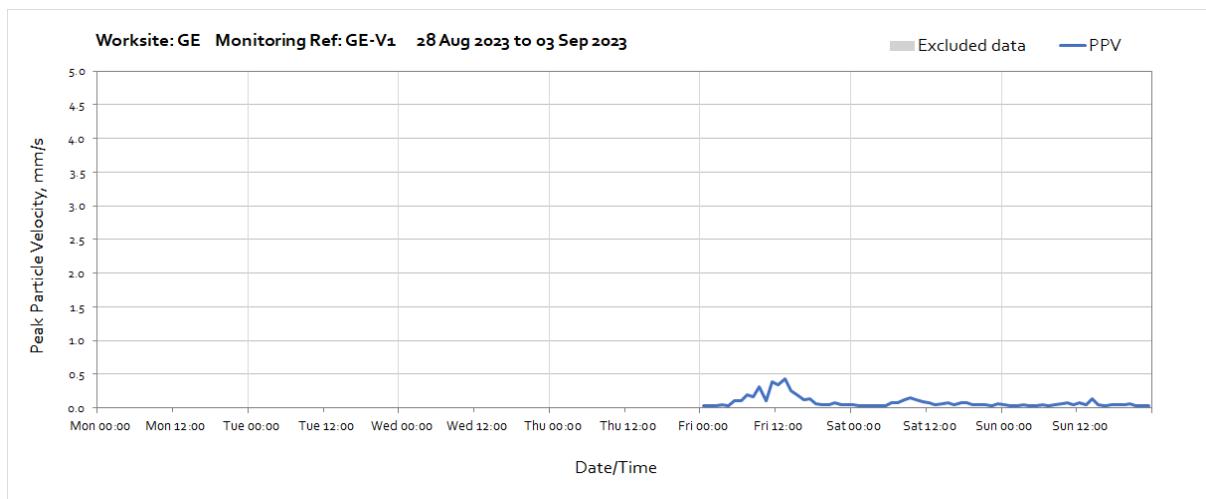



OFFICIAL

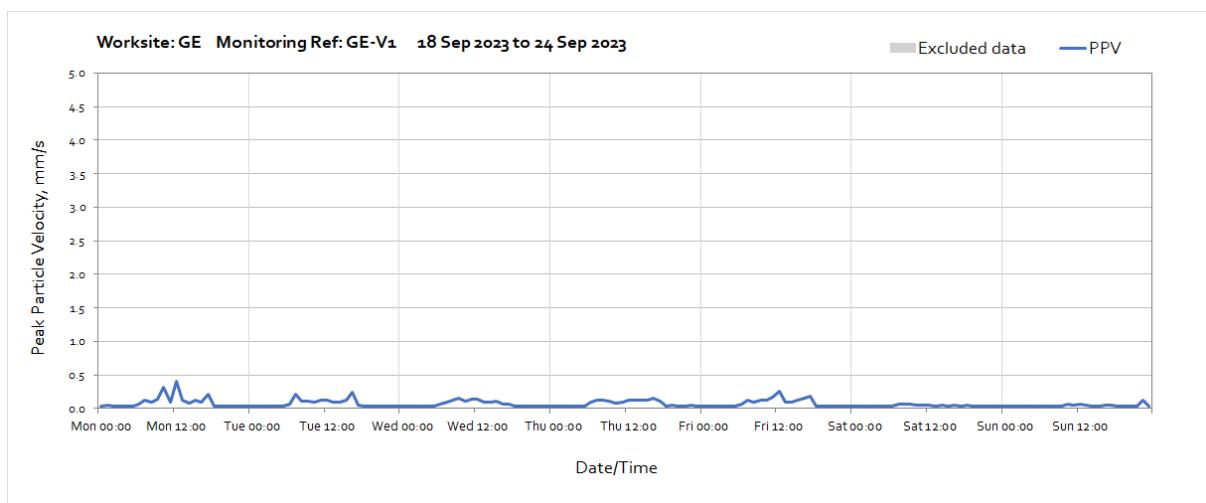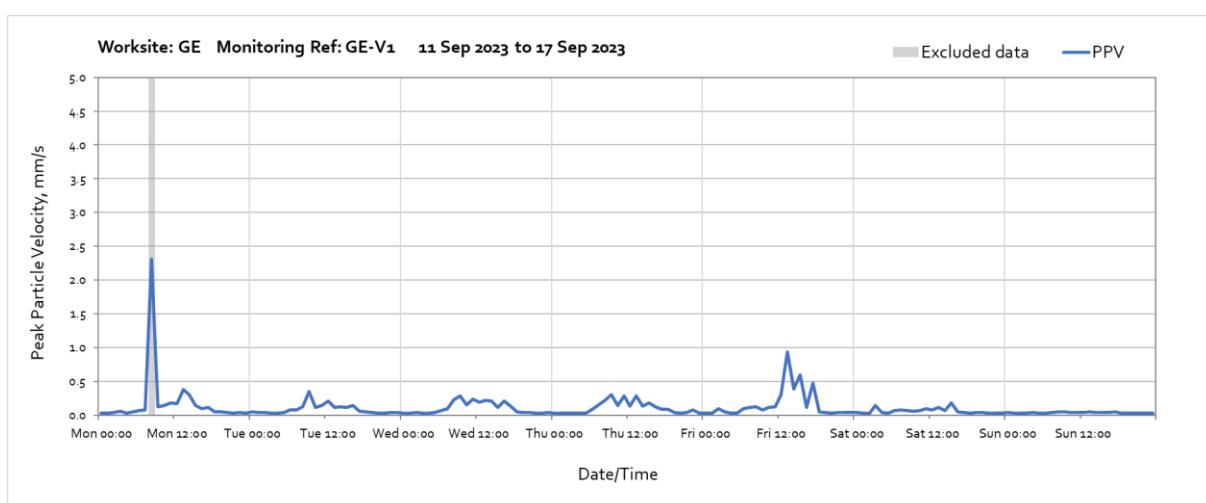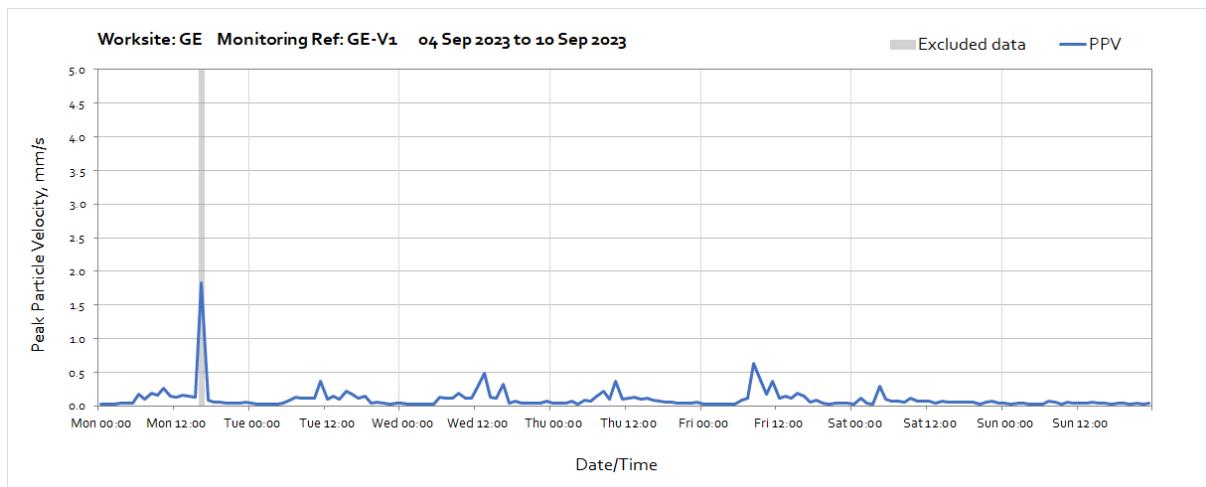




OFFICIAL

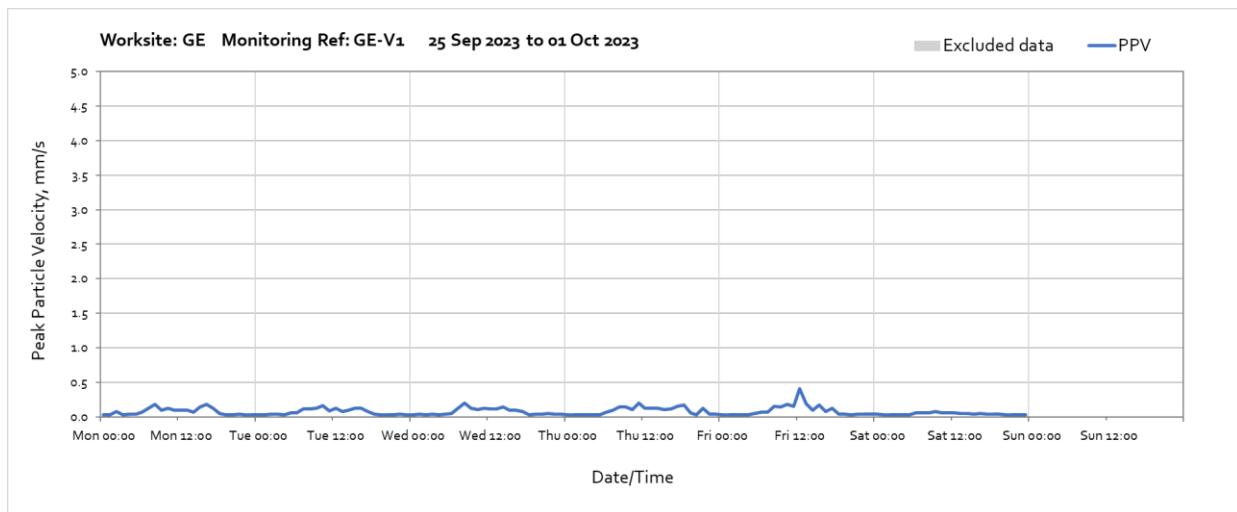

Worksite: GLD – Monitoring Ref: GLD-V1


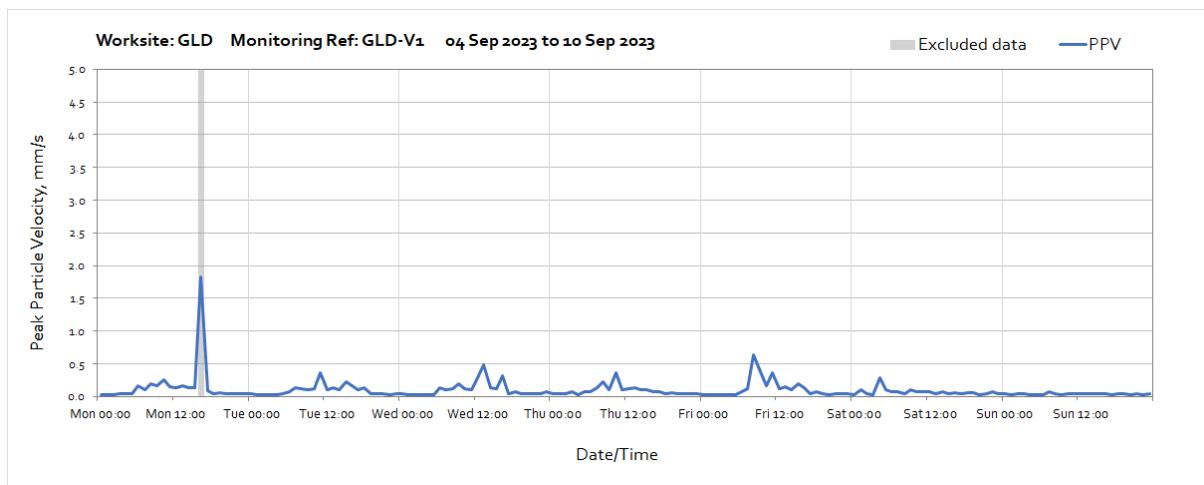
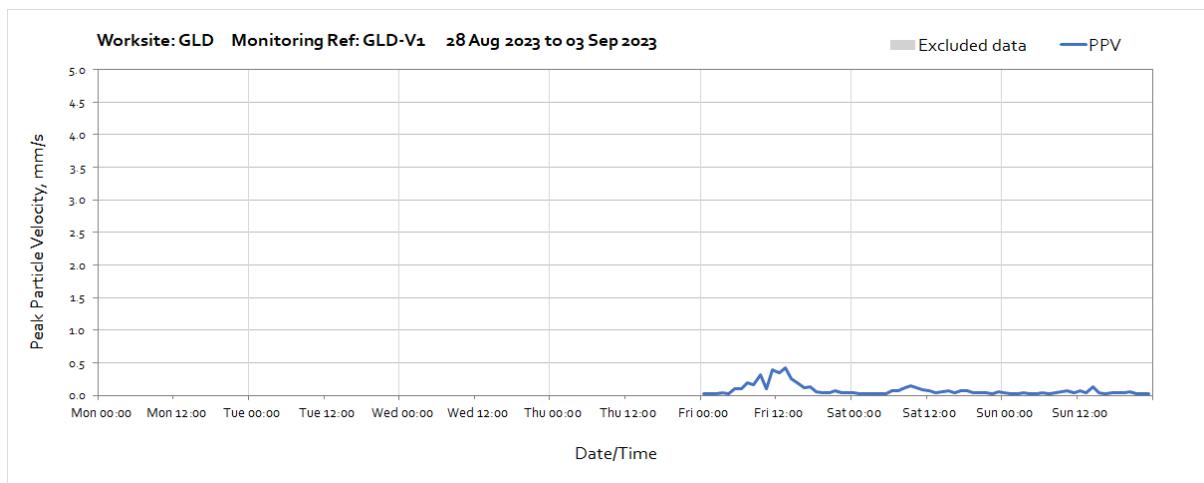


OFFICIAL

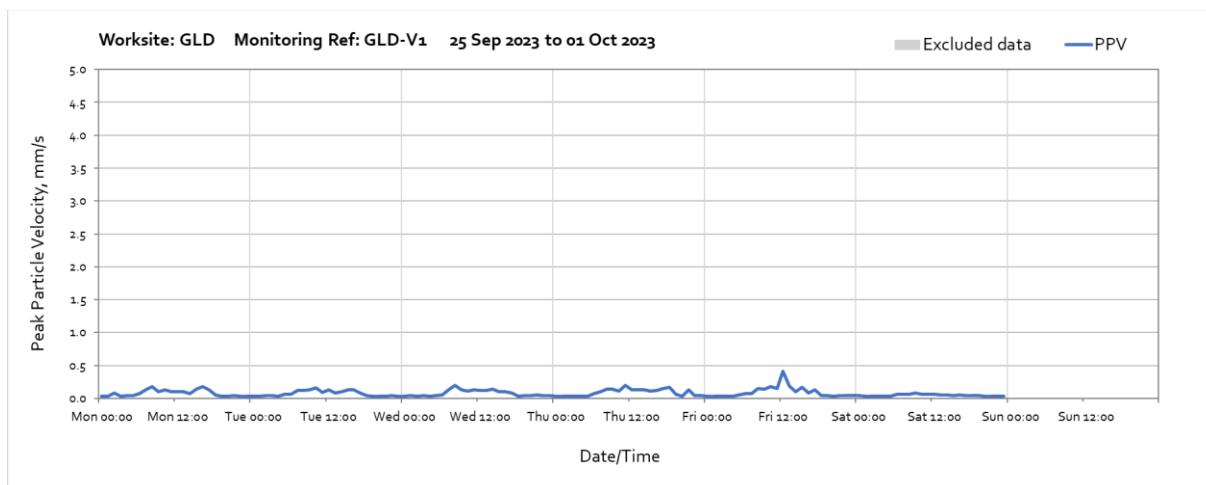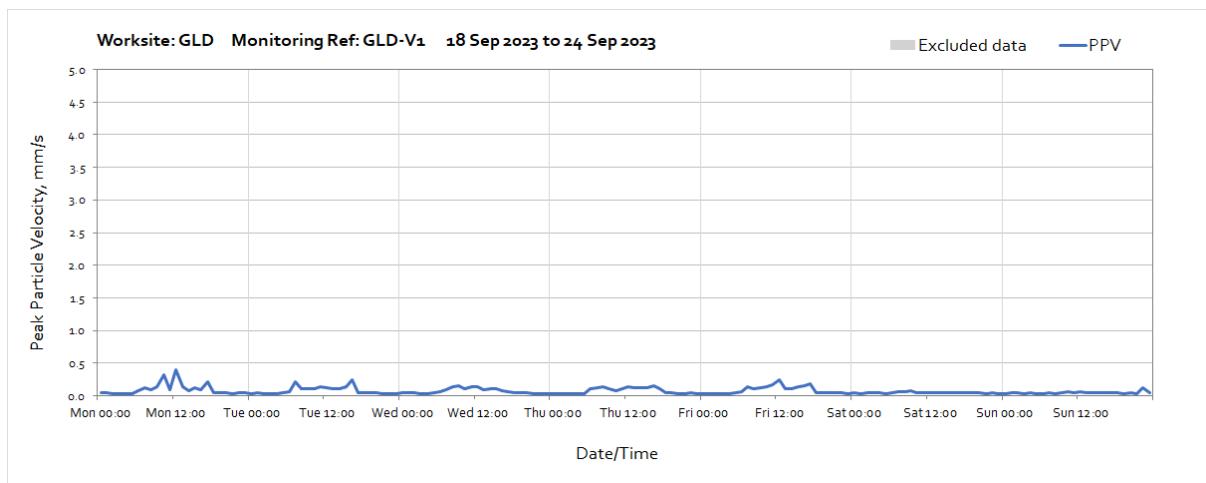
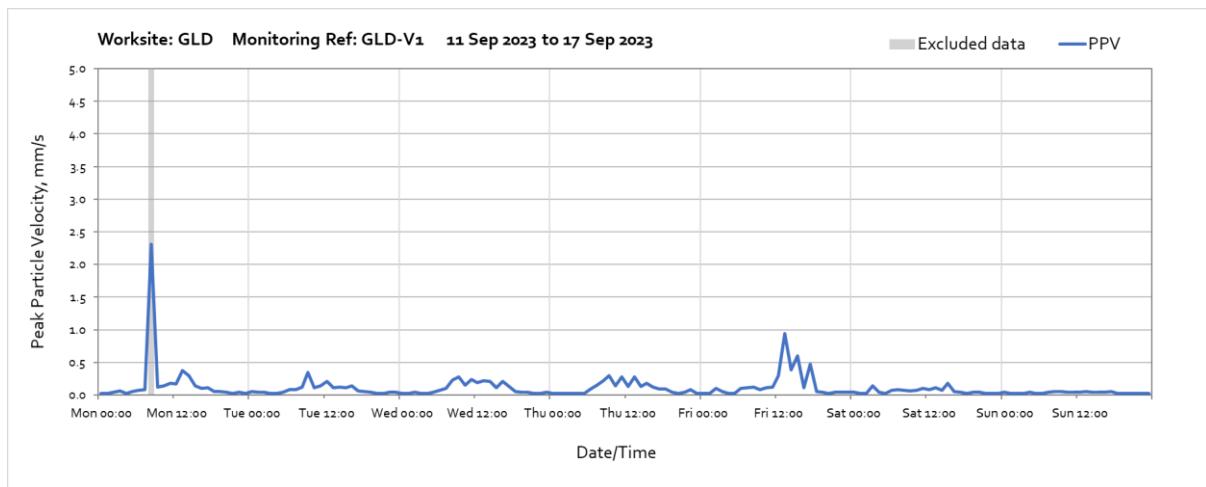


OFFICIAL

Worksite: BRD – Monitoring Ref: BRD-V1

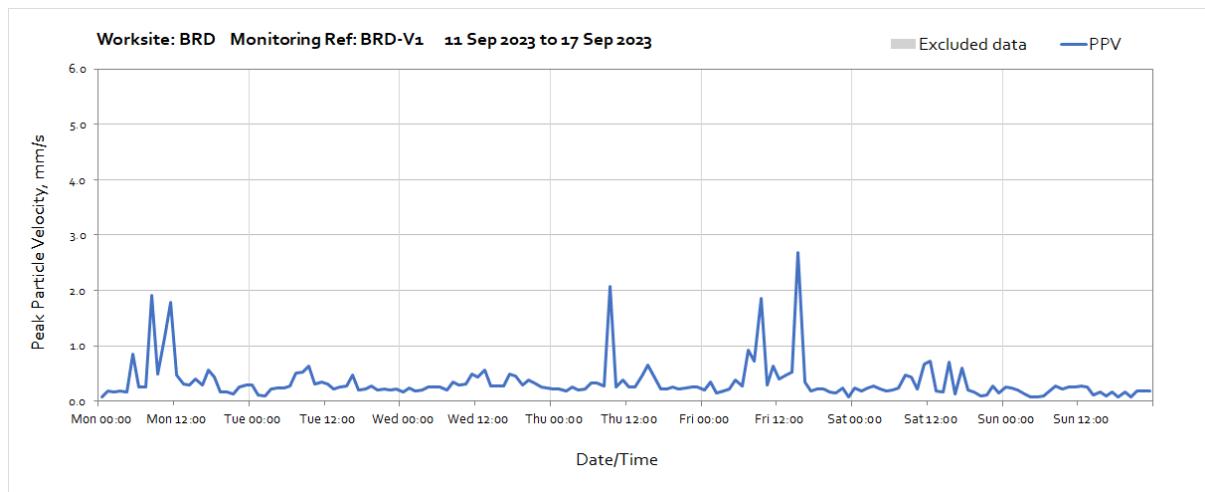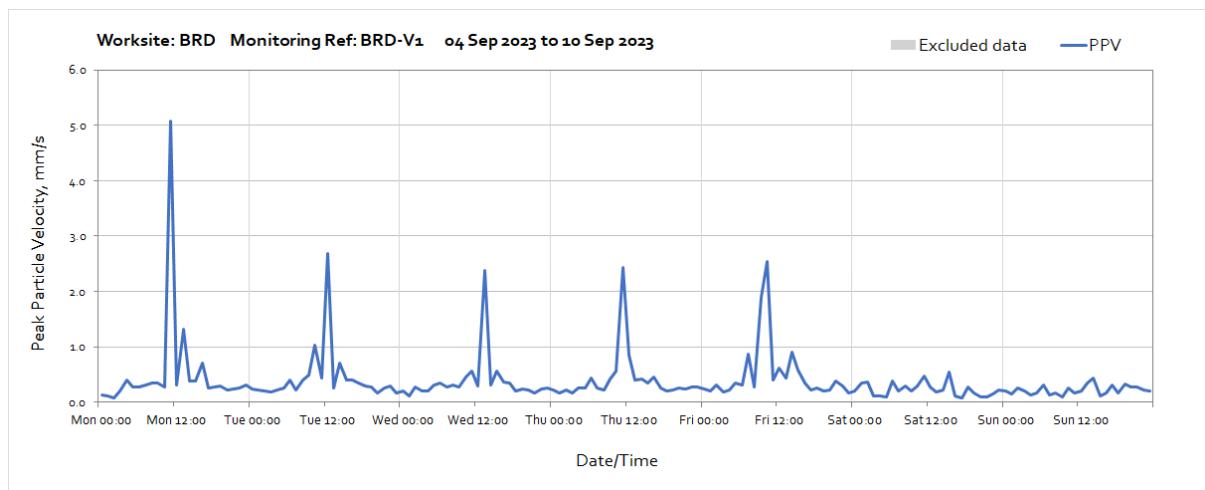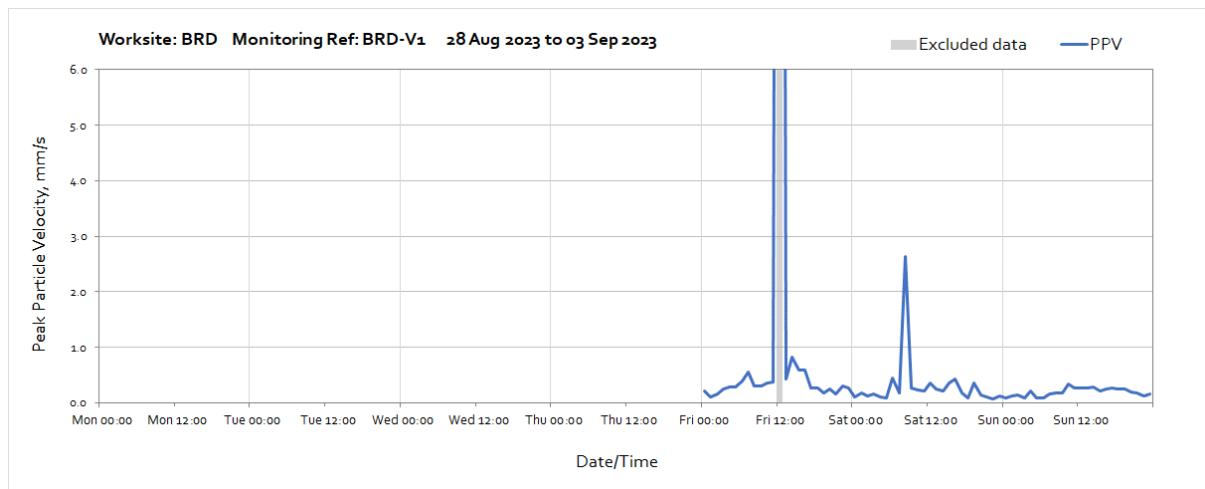

OFFICIAL

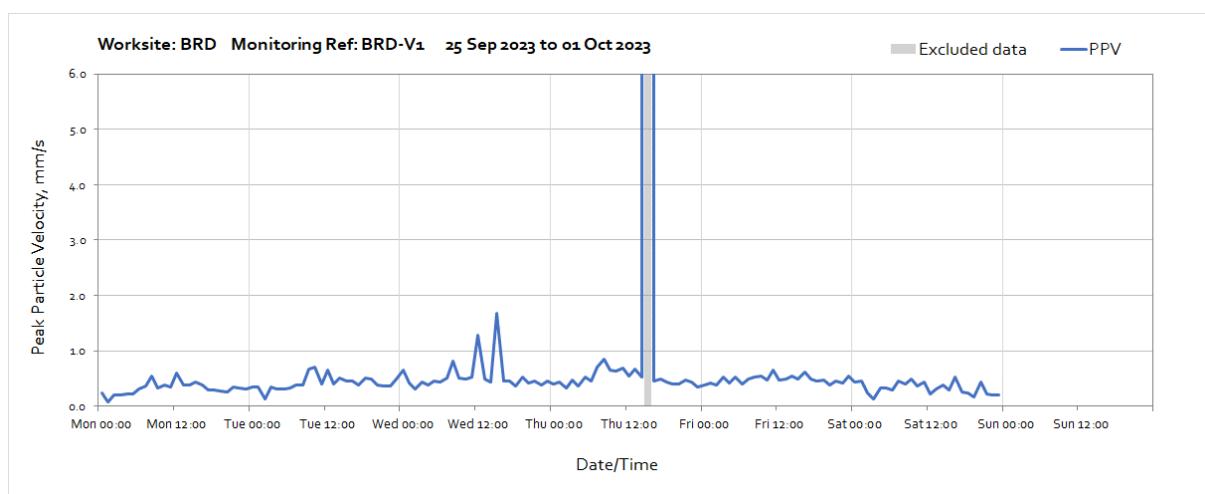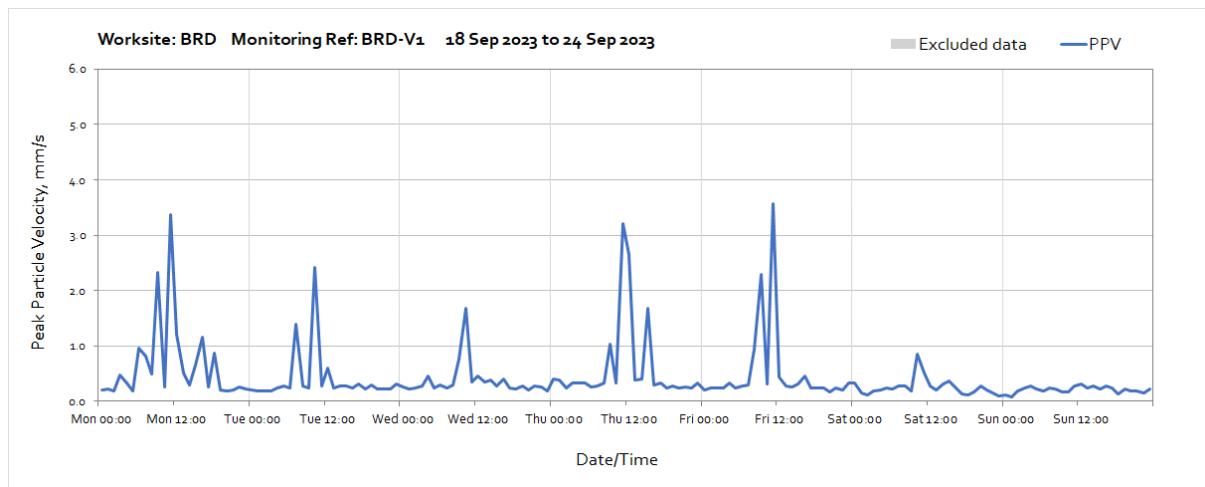

OFFICIAL