

## **Construction Noise and Vibration Monthly Report – March 2025**

**North Warwickshire Borough Council**

<b>Non-Technical Summary</b>	<b>1</b>
<b>Abbreviations and Descriptions</b>	<b>3</b>
<b>1 Introduction</b>	<b>4</b>
1.2 Measurement Locations	6
<b>2 Summary of Results</b>	<b>8</b>
2.1 Summary of Measured Noise and Vibration Levels	8
2.2 Exceedances of the LOAEL and SOAEL	12
2.3 Exceedances of Trigger Level	15
2.4 Complaints	15
<b>Appendix A Site Locations</b>	<b>16</b>
<b>Appendix B Monitoring Locations</b>	<b>23</b>
<b>Appendix C Data</b>	<b>29</b>

## List of tables

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	6
Table 3: Summary of Measured dB L <sub>Aeq</sub> Data over the Monitoring Period	9
Table 4: Summary of Measured PPV Data over the Monitoring Period	12
Table 5: Summary of Exceedances of LOAEL and SOAEL	13
Table 7: Summary of Exceedances of Trigger Levels	15
Table 8: Summary of Complaints	15

# Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within North Warwickshire Borough Council (NWBC) area during the month of March 2025.

Within this period noise and vibration monitoring were undertaken at the following worksites:

- Church Lane Embankment worksite (ref.: CLE), where shuttering, pile cropping, steel fixing and concrete pours were underway.
- Kingsbury Main Compound worksite (ref.: KMC), where operation of precast segment yard, operation of concrete batching plants and operation of offices and welfare were underway.
- Birmingham & Fazeley Canal Viaduct worksite (ref.: BFCV), where no works were underway.
- Marston Box worksite (ref.: MB), where plywood removal, concrete breaking, concrete cutting, concrete remedial works and steel plate removal were underway.
- Faraday Avenue Embankment and Underbridge worksite (ref.: FAEU), where concrete finishing works were underway.
- Chattle Hill Box Structure worksite (ref.: CHBS), where earthworks and box structure construction were underway.
- Attleboro Lane Overbridge worksite (ref.: ALO), where capping beam installation, wall and deck slab construction, excavation and removal of guide walls, wire sawing, piling, drainage works, base slab and wall construction, and highway tie-in works were underway.
- Marsh Lane Embankment (ref.: MLE), where dig and replace works were underway.
- Gilson Embankment worksite (ref.: GE), where earthworks, pile cap construction and wall construction were underway.
- Gilson Drive worksite (ref.: GLD), where culvert construction and vegetation clearance were underway.
- Birmingham Road worksite (ref.: BRD), where road construction and assembly of pre-cast structures were underway.

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<https://www.gov.uk/government/publications/hs2-information-papers-environment>), were not exceeded due to HS2 works during March 2025.

There were no exceedances of trigger levels as defined in section 61 consents during the reporting period.

Two (2) complaints regarding noise and vibration were received by HS2 during the monitoring period.



# Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
$L_{Aeq,T}$	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A-weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or $L_{Aeq,T}$	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in $m/s^{1.75}$ .

# 1 Introduction

1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:

- monitoring the impact of construction works;
- to investigate complaints, incidents and exceedance of trigger levels; or
- monitoring the effectiveness of noise and vibration control measures.

1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the North Warwickshire Borough Council (NWBC) area for the period 1<sup>st</sup> to 31<sup>st</sup> of March 2025.

1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:

- Church Lane Embankment worksite, ref.: CLE (see Plan 1 in Appendix A), where work activities included:
  - Shuttering.
  - Pile cropping.
  - Stee fixing.
  - Concrete pours.
- Kingsbury Main Compound worksite, ref.: KMC (see Plan 2 in Appendix A), where work activities included:
  - Operation of precast segment yard.
  - Operation of concrete batching plants.
  - Operations of offices and welfare.

- Birmingham & Fazeley Canal Viaduct worksite, ref.: BFCV (see Plan 2 in Appendix A), where no works were underway.
- Marston Box/Marston Lane worksite, ref.: MB (see Plan 2 in Appendix A), where work activities included:
  - Plywood removal.
  - Concrete breaking.
  - Concrete cutting.
  - Concrete remedial works.
  - Steel plate removal.
- Faraday Avenue Embankment and Underbridge worksite, ref.: FAEU (see Plan 3 in Appendix A), where work activities included:
  - Concrete finishing works
- Chattle Hill Box Structure worksite, ref.: CHBS (see Plan 4 in Appendix A), where work activities included:
  - Earthworks, including dig and replace, rigid inclusions, technical backfill and embankment works.
  - Box structure construction, including steel fixing, installation and striking of formwork, and concrete pouring.
- Attleboro Lane Overbridge worksite, ref.: ALO (see Plan 4 in Appendix A), where work activities included:
  - Capping beam installation.
  - Wall and deck slab construction including, steel installation, formwork installation and removal, and concrete pours.
  - Excavation and removal of guide walls.
  - Wire sawing.
  - Piling.
  - Drainage works.
  - Base slab and wall construction.
  - Highway tie-in works.
- Marsh Lane Embankment worksite, ref: MLE (See Plan 4 in Appendix A), where work activities included:

- Dig and replace works.
- Gilson Embankment worksite, ref.: GE (see Plan 4 in Appendix A)
  - Earthworks, including road realignment and site maintenance.
  - Pile cap and wall construction, including steel installation, formwork installation and removal, and concrete pours.
- Gilson Drive worksite, ref.: GLD (see Plan 4 in Appendix A), works activities included:
  - Culvert construction.
  - Vegetation clearance.
- Birmingham Road worksite, ref.: BRD (see Plan 4 in Appendix A), work activities included:
  - Road construction.
  - Assembly of pre-cast structures.

1.1.4 The applicable standards, guidance, and monitoring methodology is outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2>. Noise and vibration monitoring reports for previous months can also be found at this location.

## 1.2 Measurement Locations

1.2.1 Sixteen (16) noise monitoring installations and nine (9) vibration monitoring installations were active in March in the NWBC area. Table 2 summarises the location of noise and vibration monitoring installations within the NWBC area in March 2025.

1.2.2 Maps showing the position of noise and vibration monitoring installations are presented in Appendix B.

1.2.3 The vibration monitor at measurement location ref BFCV-V4, worksite ref BFCV, was removed on the 18<sup>th</sup> of March as works in the vicinity / at the worksite have ceased.

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
Church Lane Embankment (CLE)	CLE-N1	Highfields Cottage, Middleton, North Warwickshire

Worksite Reference	Measurement Reference	Address
Kingsbury Main Compound (KMC)	KMC-N1	Wheatley House, Kingsbury Road, Curdworth CP, Marston, Warwick
Birmingham Fazeley Canal Viaduct (BFCV)	BFCV-N2	North of Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire
	BFCV-V4	North of Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire
Marston Box (MB)	MB-N1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
	MB-V1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
Faraday Avenue Embankment and Underbridge (FAEU)	FAEU-N1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire
	FAEU-V1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire
Chattle Hill Box Structure (CHBS)	CHBS-N1	6 Gorsey Way, Coleshill, Warwickshire, Birmingham
Marsh Lane Embankment (MLE)	MLE-N1	Rostrevor, Vicarage Lane, Water Orton CP, North Warwickshire
Attleboro Lane Overbridge (ALO)	ALO-N1	West of 47 Attleboro Lane, Water Orton, Birmingham
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD
	ALO-V1	West of 47 Attleboro Lane, Water Orton, Birmingham
	ALO-V5	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD
	AFE-N1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD
Gilson Embankment (GE)	GE-N1	The Cottage, Gilson Road, Coleshill, Warwickshire
	GE-N2	Lovelock Cottage, Gilson Road, Warwickshire
	GE-V1	The Cottage, Gilson Road, Coleshill, Warwickshire
Gilson Drive (GLD)	GLD-N1	10 Gilson Dr, Coleshill, Birmingham
	GLD-V1	10 Gilson Dr, Coleshill, Birmingham
	CM-N1	Coleshill Manor Office Campus, Birmingham
Birmingham Road (BRD)	BRD-N2	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-N3	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-V1	1 New Cottages, Birmingham Road, Coleshill, Birmingham

## 2 Summary of Results

### 2.1 Summary of Measured Noise and Vibration Levels

- 2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The  $L_{Aeq,T}$  is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period  $L_{Aeq,T}$  that was found to occur within the month.

Table 3: Summary of Measured dB L<sub>Aeq</sub> Data over the Monitoring Period

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Saturday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )					Sunday / Public Holiday Average L <sub>Aeq,T</sub> (Highest Day L <sub>Aeq,T</sub> )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
CLE	CLE-N1	Highfields Cottage, Middleton	Free-field	52.4 (60.6)	49.6 (53.6)	46.4 (49.9)	44.3 (49.6)	46.1 (60.0)	49.0 (59.6)	48.4 (51.1)	47.2 (49.6)	47.2 (61.1)	43.3 (55.0)	48.5 (57.9)	43.4 (56.1)
KMC	KMC-N1	Kingsbury Road, Curdworth	Free-field	63.9 (68.7)	65.4 (69.1)	58.6 (67.4)	60.7 (67.9)	63.6 (68.3)	64.1 (68.4)	62.7 (66.4)	54.0 (63.8)	58.9 (67.6)	64.2 (68.3)	62.7 (67.5)	64.4 (68.4)
BFCV	BFCV-N2	(North of) Lock Cottage, Marston Lane, Curdworth	Free-field	70.1 (70.1)	68.5 (68.5)	64.1 (64.1)	-* (-*)	64.9 (66.4)	67.2 (67.2)	67.6 (67.6)	67.8 (67.8)	68.0 (69.2)	63.3 (65.7)	67.0 (68.3)	65.8 (70.2)
MB	MB-N1	Elford House, Kingsbury Road, Curdworth	Free-field	58.0 (61.4)	56.0 (60.1)	56.8 (60.8)	55.4 (59.3)	54.2 (61.2)	55.3 (58.1)	54.8 (56.6)	54.9 (57.9)	54.8 (58.7)	53.0 (57.1)	56.4 (60.1)	54.4 (60.6)
FAEU	FAEU-N1	(South of) Orchard Cottage, Newlands Lane, Curdworth	Free-field	56.2 (59.8)	55.1 (68.4)	54.1 (57.3)	53.8 (56.8)	53.4 (60.6)	53.8 (57.9)	51.8 (54.7)	51.6 (56.4)	51.0 (57.5)	50.8 (55.6)	52.1 (57.3)	51.6 (58.4)
CHBS	CHBS-N1	6 Gorsey Way, Coleshill	Free-field	62.9 (64.6)	61.7 (66.0)	60.7 (63.1)	58.9 (64.6)	57.2 (64.0)	58.5 (59.1)	60.6 (62.0)	60.8 (61.6)	59.3 (63.2)	54.4 (58.0)	59.2 (63.0)	56.6 (62.7)
MLE	MLE-N1	Rostrevor, Vicarage Lane, Water Orton CP	Free field	56.7 (61.5)	56.1 (59.1)	54.9 (64.8)	53.7 (57.4)	54.0 (62.5)	56.3 (60.2)	55.3 (59.1)	54.4 (60.8)	53.1 (58.7)	51.9 (57.6)	52.8 (57.7)	51.8 (61.2)

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Saturday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Sunday / Public Holiday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton	Free field	56.8 (61.2)	59.1 (63.0)	55.1 (60.2)	55.1 (61.1)	54.9 (62.8)	56.5 (60.9)	55.4 (59.0)	54.2 (61.7)	53.6 (63.2)	53.0 (60.1)	52.7 (60.4)	51.6 (62.6)
	ALO-N2	(South of) 57 Attleboro Lane, Water Orton	Free field	58.7 (62.5)	64.1 (66.9)	56.9 (62.9)	55.3 (61.2)	54.9 (62.8)	57.0 (61.0)	59.9 (63.4)	53.8 (61.8)	54.1 (63.8)	53.2 (60.1)	53.3 (60.1)	52.0 (62.2)
	AFE-N1	Attleboro Farm, Attleboro Lane	Free field	62.3 (67.2)	63.9 (67.3)	60.8 (65.1)	60.6 (64.3)	59.7 (68.1)	60.7 (63.3)	60.0 (63.5)	61.7 (71.3)	59.3 (67.2)	58.4 (63.0)	58.6 (65.4)	57.1 (65.1)
GE	GE-N1	The Cottage, Gilson Road, Coleshill	Free-field	59.1 (62.6)	60.3 (68.9)	55.6 (58.7)	55.0 (57.9)	55.2 (61.8)	58.1 (60.9)	57.1 (59.6)	54.4 (55.4)	53.6 (57.5)	53.2 (58.2)	53.5 (58.6)	53.5 (62.6)
	GE-N2	Lovelock Cottage, Gilson Road	Free-field	59.8 (64.0)	61.3 (66.9)	57.5 (61.8)	56.5 (60.6)	55.9 (64.1)	56.6 (59.9)	55.9 (59.2)	56.0 (60.9)	54.6 (61.4)	53.3 (58.4)	55.3 (61.7)	53.2 (62.7)
GLD	GLD-N1	10 Gilson Dr, Coleshill	Free-field	59.7 (63.0)	59.8 (61.3)	59.9 (63.1)	55.5 (58.2)	54.9 (63.3)	57.2 (61.0)	55.9 (57.3)	57.9 (59.8)	55.1 (63.2)	51.8 (55.8)	54.9 (65.2)	52.8 (62.9)
	CM-N1	Coleshill Manor Office Campus	Free-field	58.7 (61.8)	58.6 (62.9)	56.5 (59.4)	55.4 (58.5)	55.1 (62.2)	56.6 (59.3)	55.2 (56.9)	55.0 (56.8)	54.9 (57.7)	52.9 (55.6)	55.3 (57.6)	54.2 (60.6)



Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Saturday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )					Sunday / Public Holiday Average $L_{Aeq,T}$ (Highest Day $L_{Aeq,T}$ )	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill	Free-field	62.1 (64.3)	62.5 (68.4)	60.4 (62.6)	59.2 (62.3)	58.0 (65.0)	59.3 (62.4)	58.8 (60.9)	59.0 (60.6)	57.9 (60.1)	55.4 (58.5)	58.4 (61.3)	56.4 (64.2)
	BRD-N3		Free-field	61.5 (65.2)	69.4 (76.5)	58.9 (62.2)	57.5 (60.7)	56.1 (63.0)	57.9 (61.3)	62.7 (65.4)	57.3 (58.9)	56.7 (58.9)	54.2 (57.7)	57.7 (60.5)	55.3 (62.6)

\* No data measured within period due to tampering of the monitoring station.

2.1.2 Table 4 presents a summary of the measured vibration levels at each monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
BFCV	BFCV-V4	(North of) Lock Cottage, Marston Lane, Curdworth CP, North Warwickshire	0.79 (X-axis)
MB	MB-V1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midland	0.46 (X-axis)
FAEU	FAEU-V1	(south of) Orchard Cottage, Newlands Lane, Curdworth, Warwickshire	0.34 (X-axis)
ALO	ALO-V1	West of 47 Attleboro Lane, Water Orton, Birmingham	1.67 (X-axis)
	ALO-V5	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD	1.12 (Y-axis)
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD	0.75 (X-axis)
GE	GE-V1	The Cottage, Gilson Road, Coleshill, Warwickshire	0.67 (Y-axis)
GLD	GLD-V1	10 Gilson Dr, Coleshill, Birmingham	1.43 (Z-axis)
BRD	BRD-V1	1, New Cottages, Birmingham Road, Coleshill, Birmingham	8.39 (Y-axis)

2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly  $L_{Aeq}$  values and, where relevant, the  $L_{Aeq,T}$  values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location:  
<https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data>.

## 2.2 Exceedances of the LOAEL and SOAEL

2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of

the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".

- 2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."
- 2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.
- 2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.
- 2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
CLE	CLE-N1*	Highfields Cottage, Middleton	All days	All periods	No exceedances	No exceedances
KMC	KMC-N1*	Kingsbury Road, Sutton Coldfield	All days	All periods	No exceedances	No exceedances
BFCV	BFCV-N2	North of Lock Cottage, Marston Lane, Curdworth	Weekday	All periods	No exceedances	No exceedances
MB	MB-N1*	Elford House, Kingsbury Road, Curdworth	All days	All periods	No exceedances	No exceedances
FAEU	FAEU-N1*	South of Orchard Cottage, Newlands Lane, Curdworth	Weekday	0800-1800	1	No exceedances

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
CHBS	CHBS-N1*	6 Gorsey Way, Coleshill	All days	All periods	No exceedances	No exceedances
MLE	MLE-N1	Rostrevor, Vicarage Lane, Water Orton CP	All days	All periods	No exceedances	No exceedances
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton	All days	All periods	No exceedances	No exceedances
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD	Weekday	0800-1800	3	No exceedances
	AFE-N1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD	All days	All periods	No exceedances	No exceedances
GE	GE-N1	The Cottage, Gilson Road, Coleshill	Weekday	0800-1800	1	No exceedances
	GE-N2	Lovelock Cottage, Gilson Road	All days	All periods	No exceedances	No exceedances
GLD	GLD-N1	10 Gilson Dr, Coleshill	All days	All periods	No exceedances	No exceedances
	CM-N1	Coleshill Manor Office Campus, Birmingham	All days	All periods	No exceedances	No exceedances
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill	Weekday	0800-1800	1	No exceedances
	BRD-N3*	1 New Cottages, Birmingham Road, Coleshill	Weekday	0800-1800	6	No exceedances

\*A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

2.2.6 There were exceedances of the LOAEL due to HS2 construction works at five (5) monitoring locations during weekday daytime periods.

No exceedances of the SOAEL were recorded due to HS2 construction works during March 2025.

## 2.3 Exceedances of Trigger Level

- 2.3.1 Table 6 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 6: Summary of Exceedances of Trigger Levels

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	Identified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-


## 2.4 Complaints

- 2.4.1 Table 7 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.

Table 7: Summary of Complaints

Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
HS2-25-119287-E-C	N/A	General complaint due to construction noise.	No works associated with HS2 were taking place in the area, at the time of the complaint.	Information was provided to the stakeholder confirming the results of investigation.
HS2-25-46201-C	ALO/MLE	General complaint due to construction noise during the daytime.	Monitoring data reviewed, no exceedances of permitted levels were found.	Information was provided to the stakeholder confirming the results of investigation.


# Appendix A Site Locations

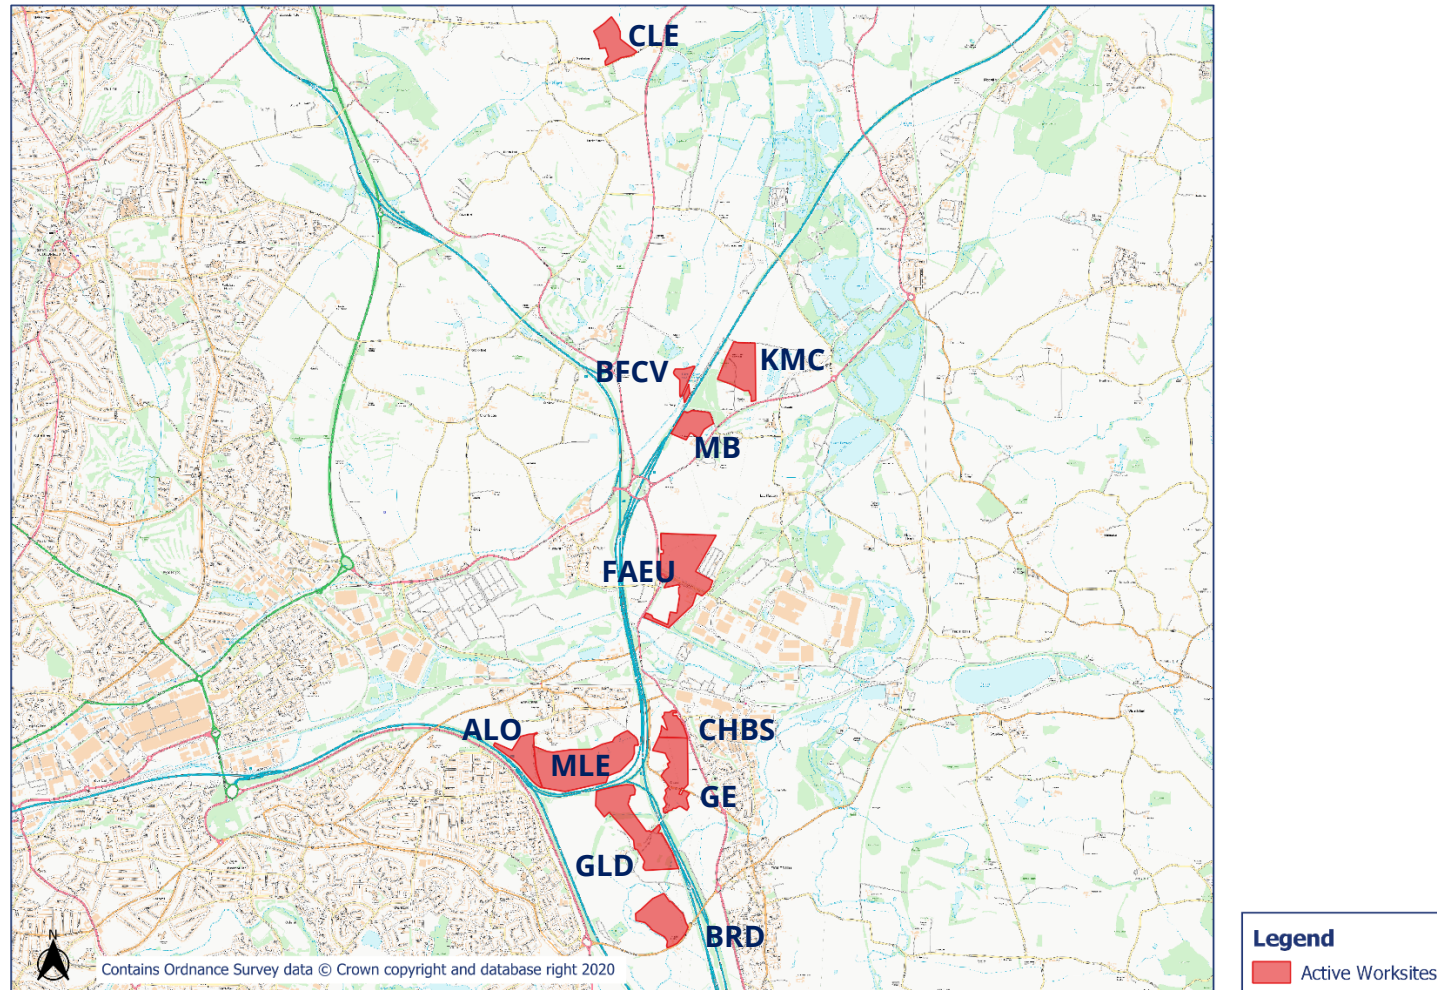

**CLE**






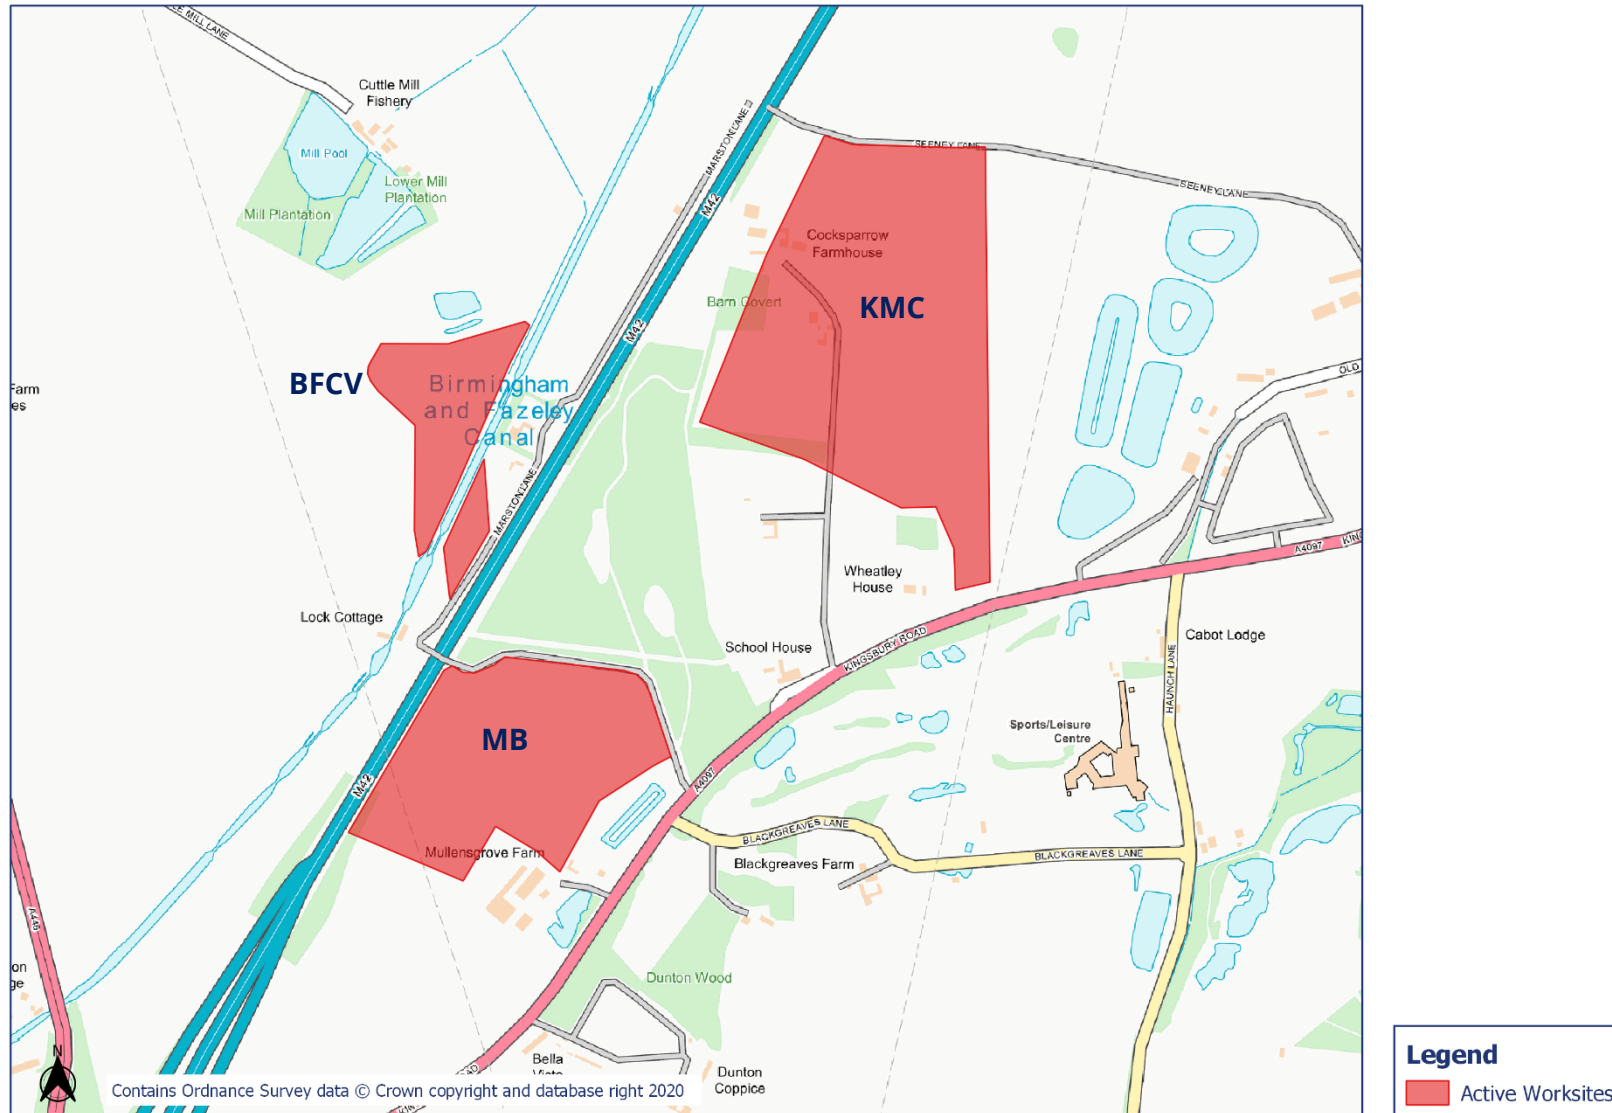






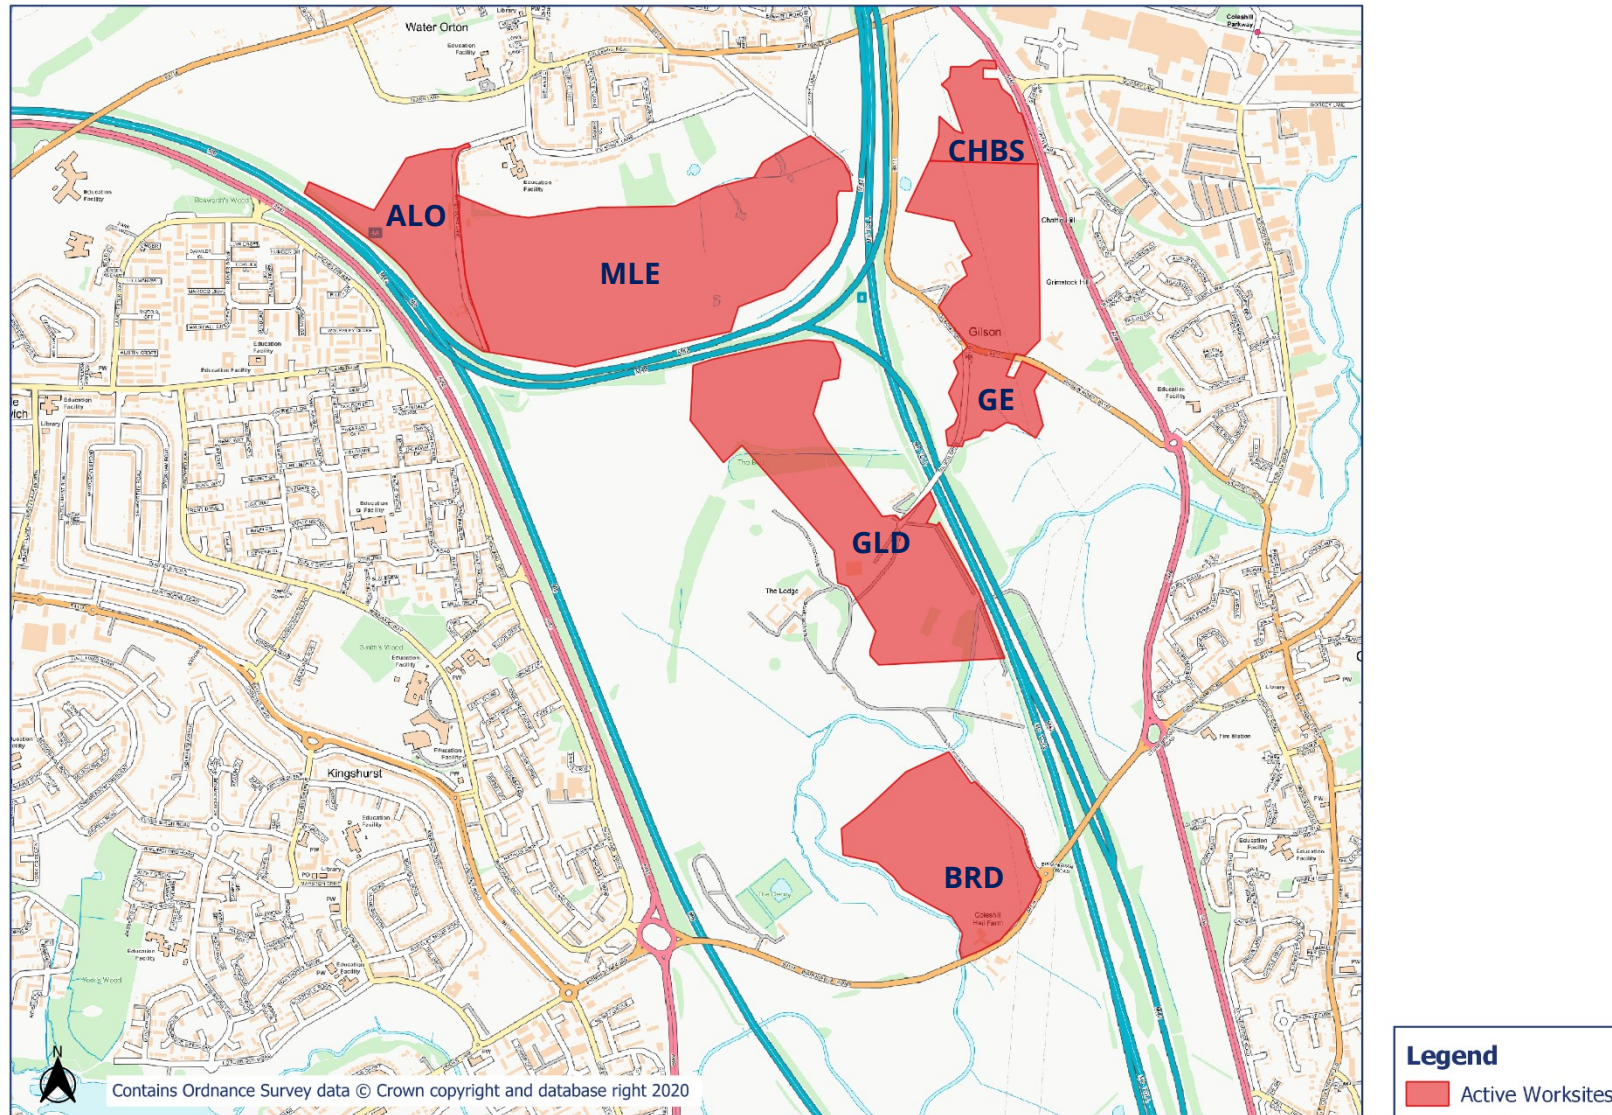


# Appendix B Monitoring Locations




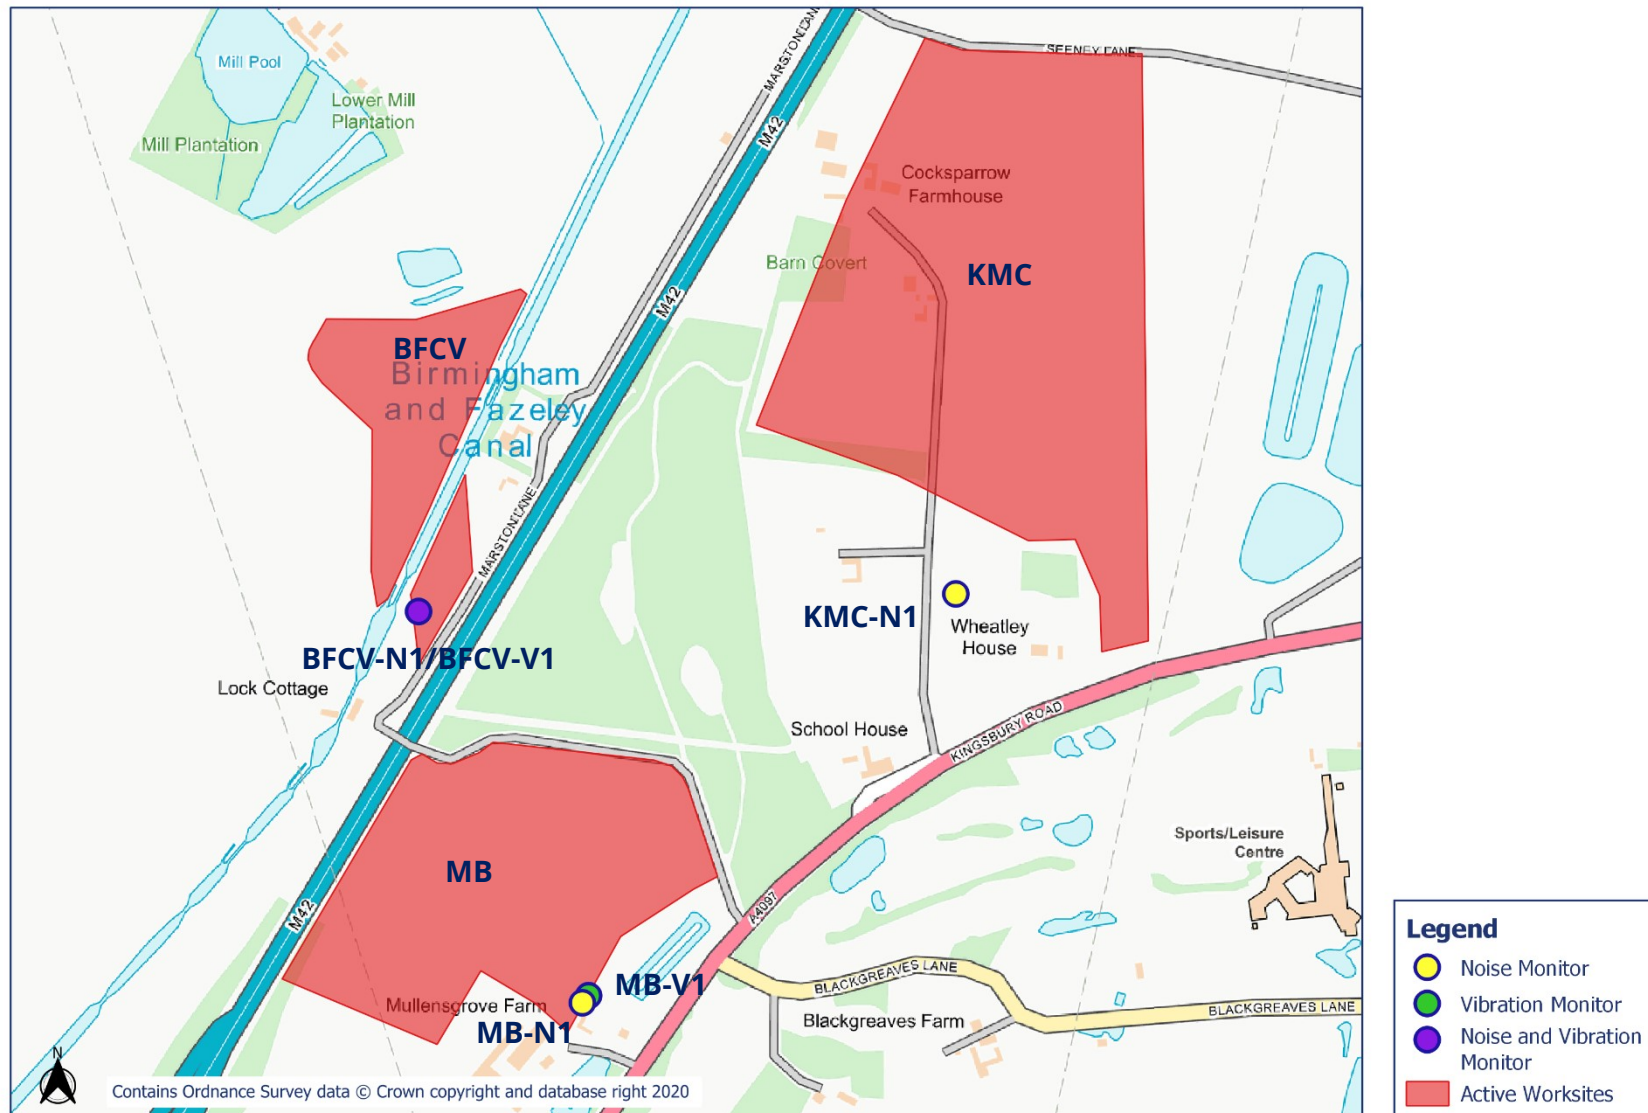




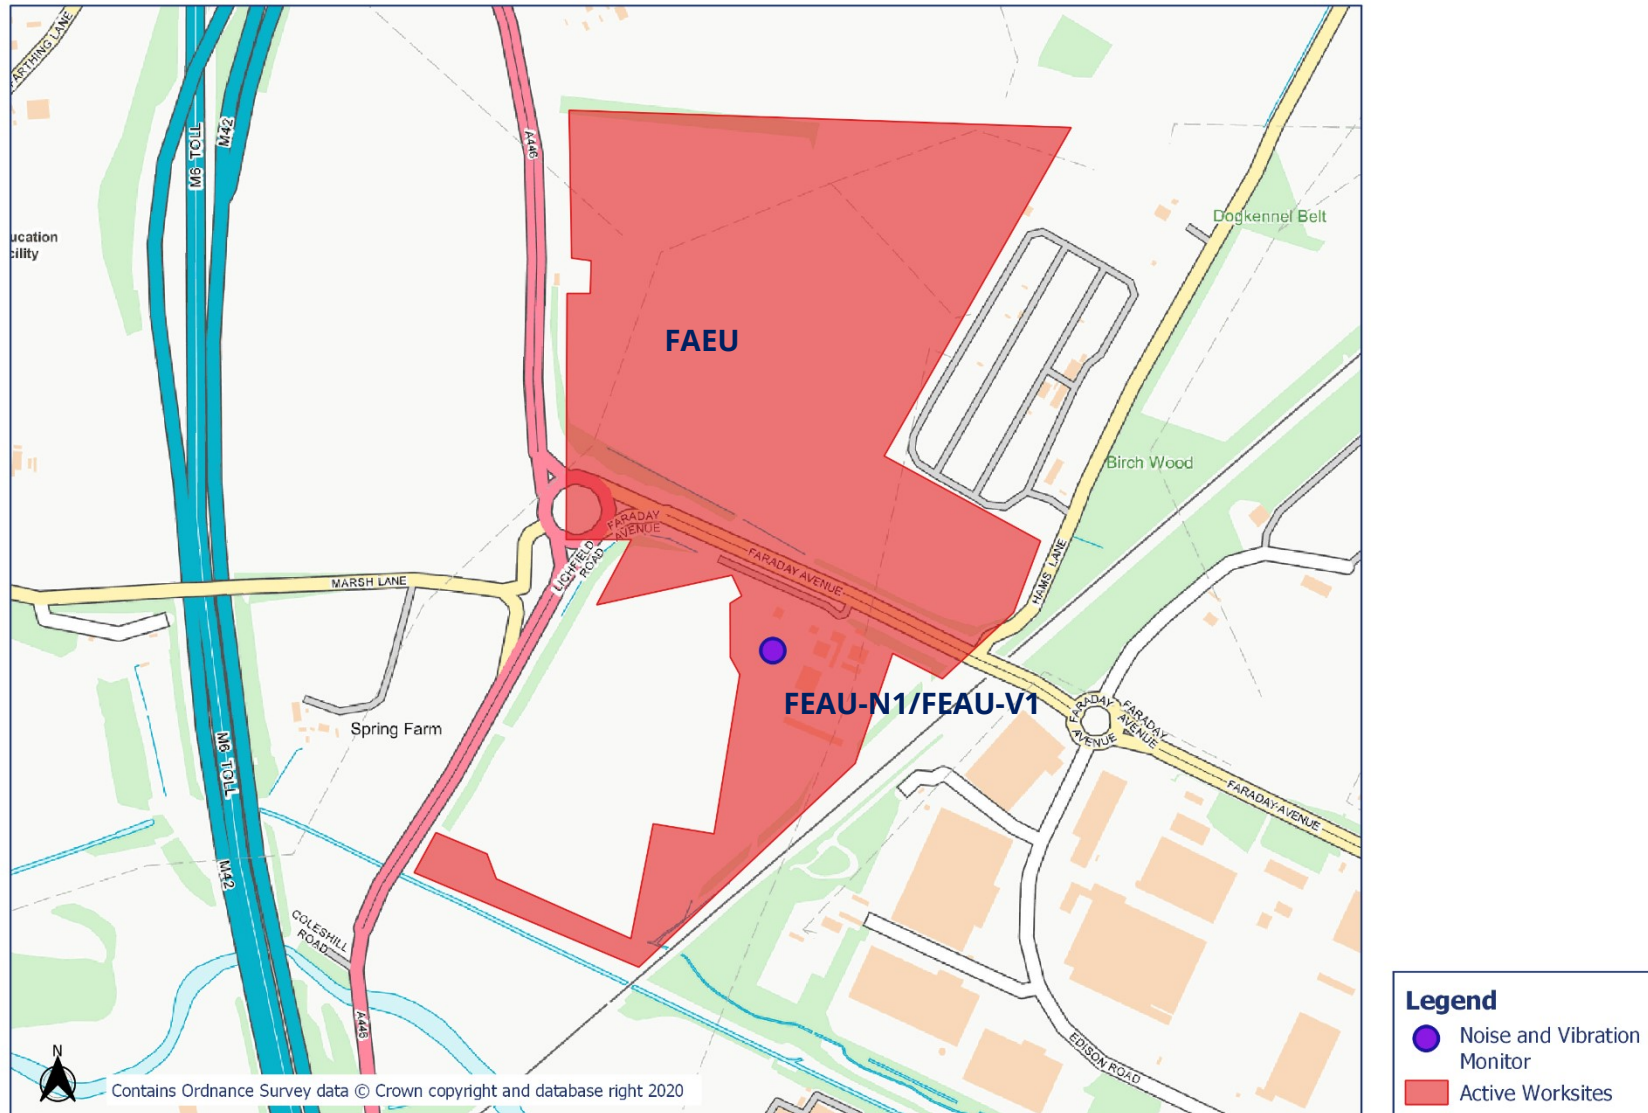



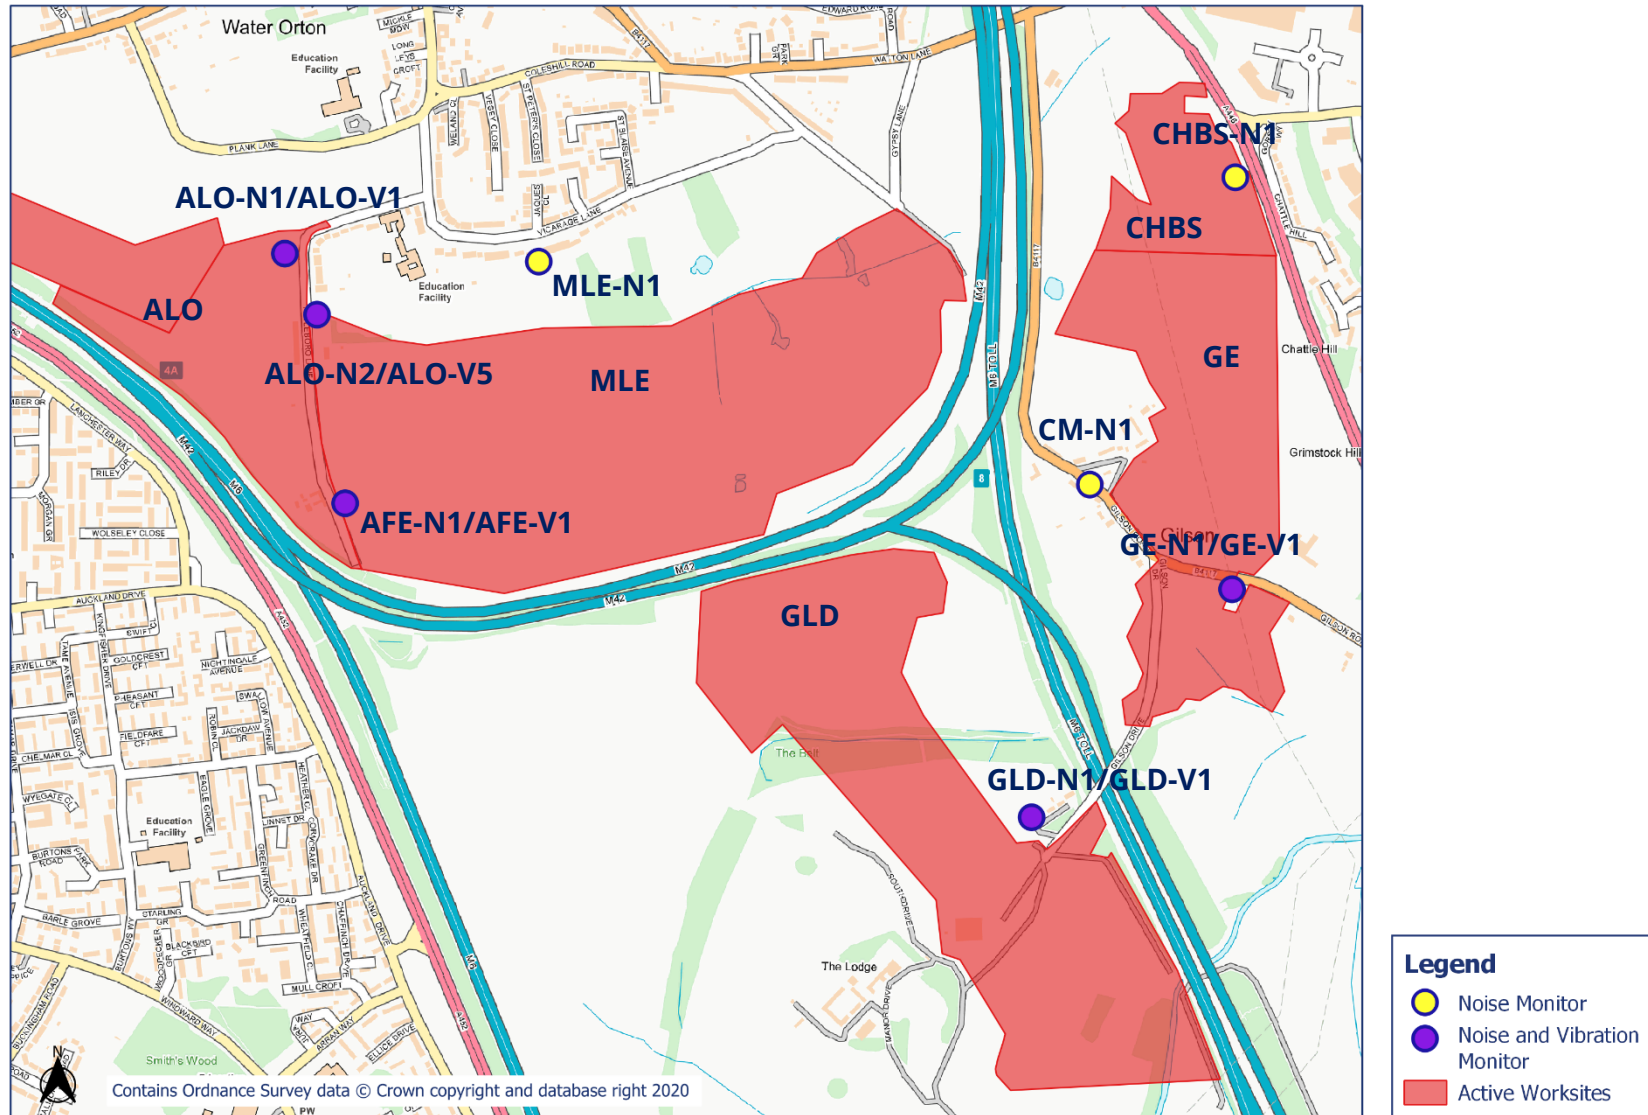


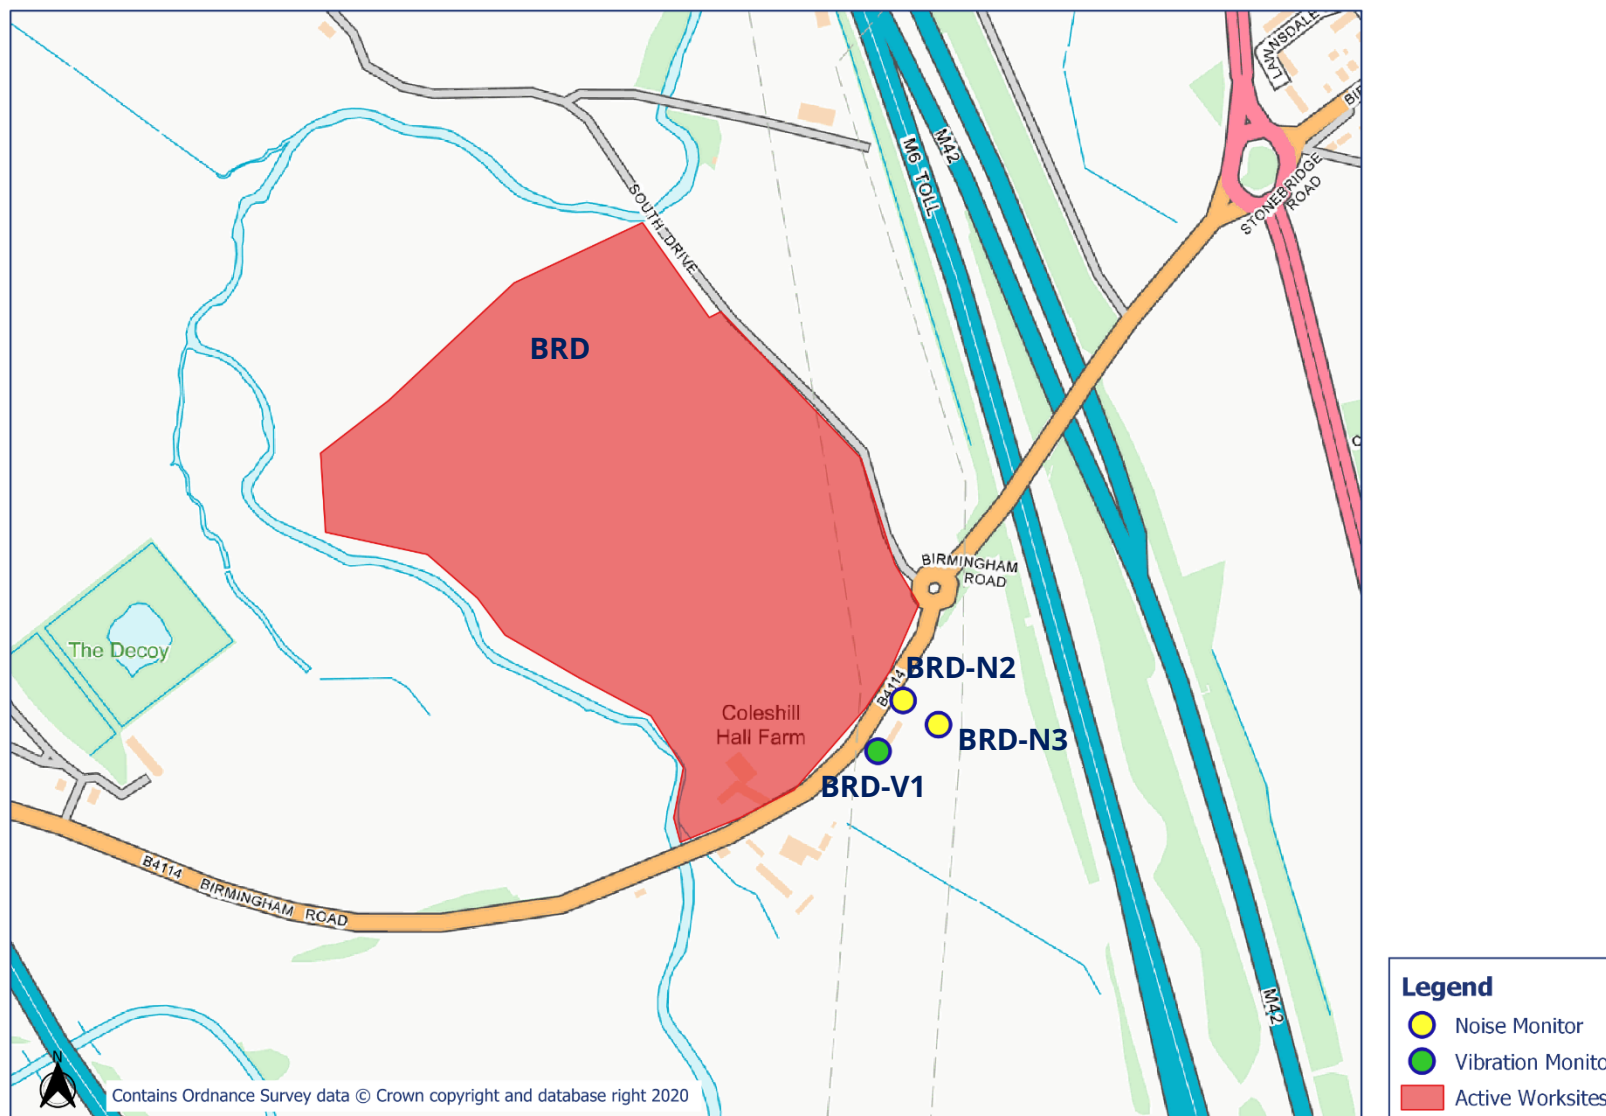





# Appendix C Data

## Noise


The following graphs show the hourly measured ambient noise level  $L_{Aeq,1h}$  and, where relevant, the averaged noise level  $L_{Aeq,T}$  values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the  $L_{Aeq,T}$  values in Table 3 of the main report.:

### Worksite: CLE – Monitoring Ref: CLE-N1

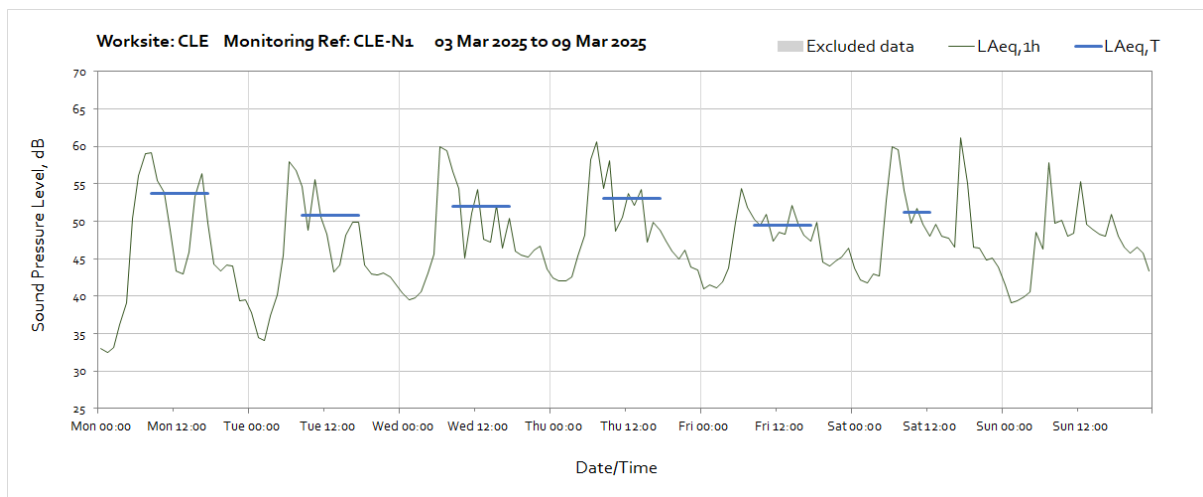
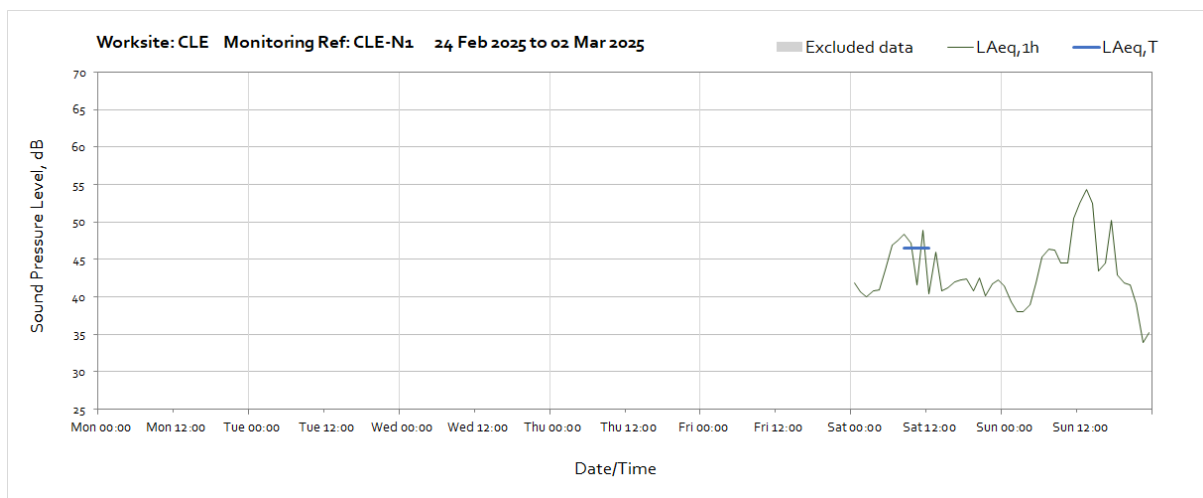


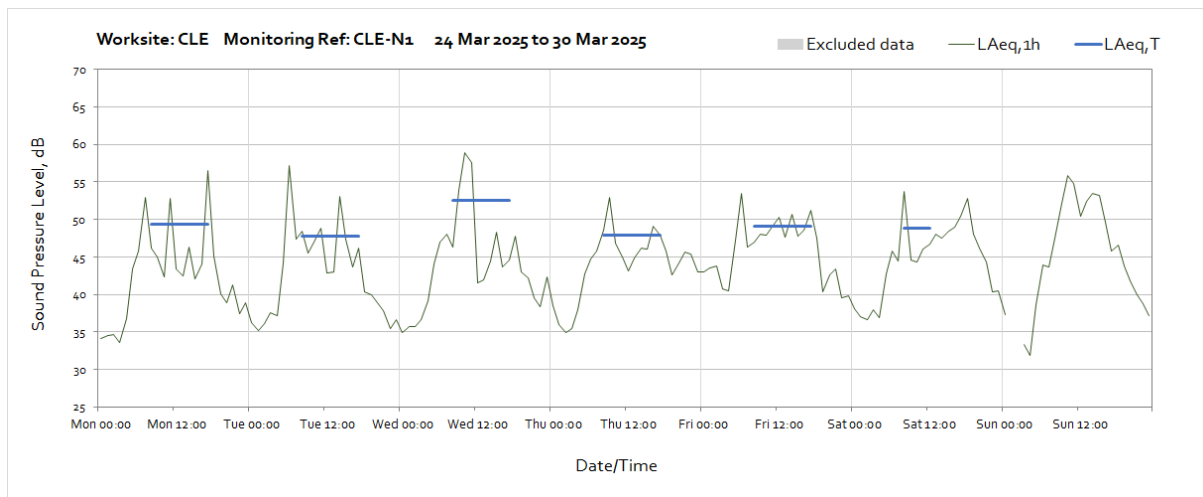
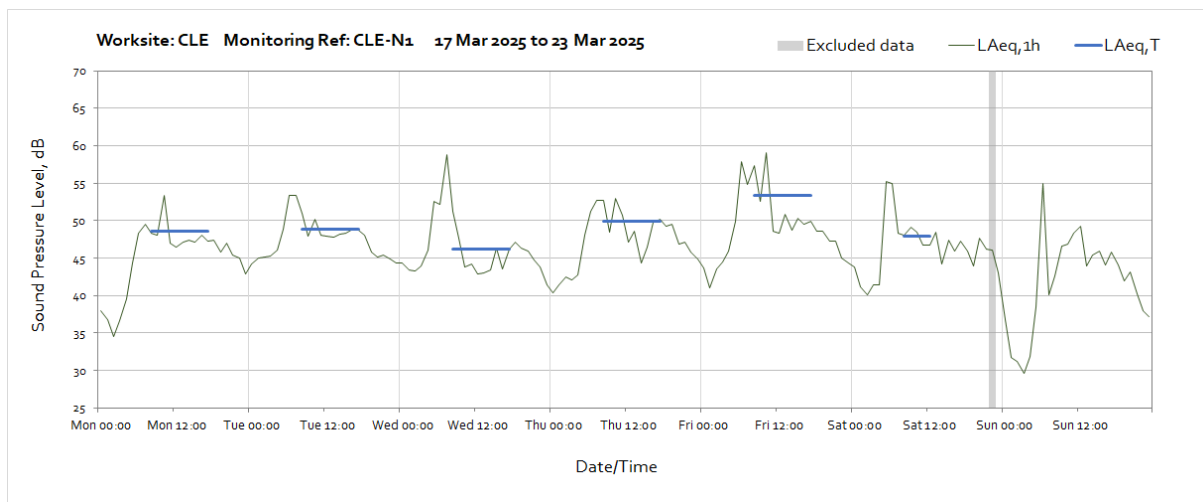
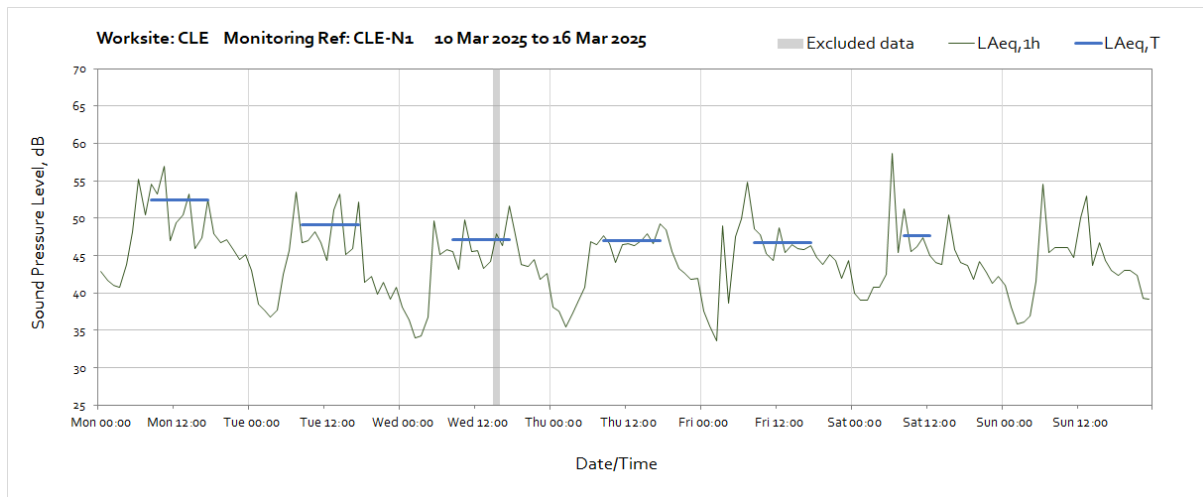


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

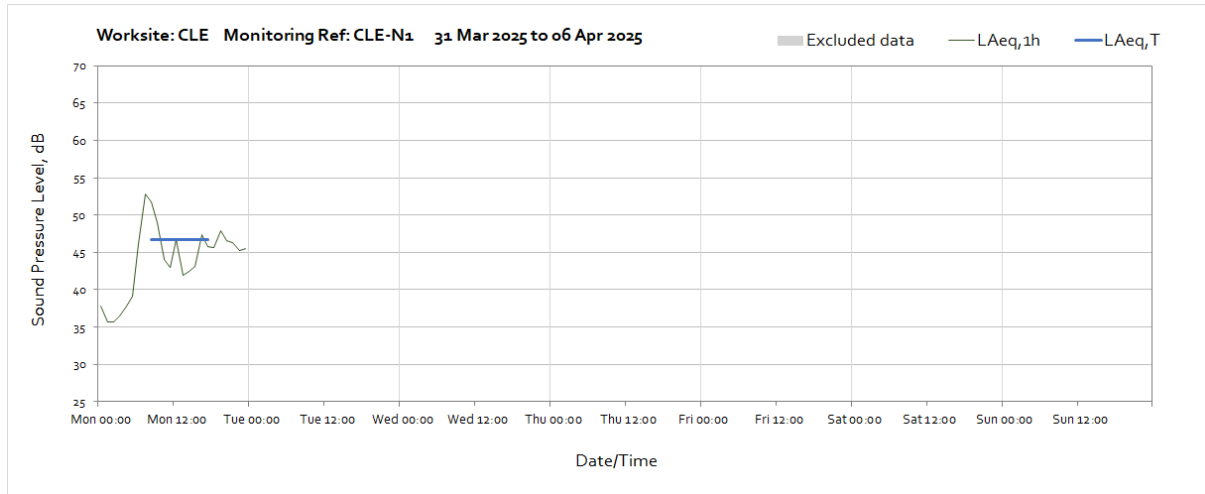


## Worksite: KMC – Monitoring Ref: KMC-N1

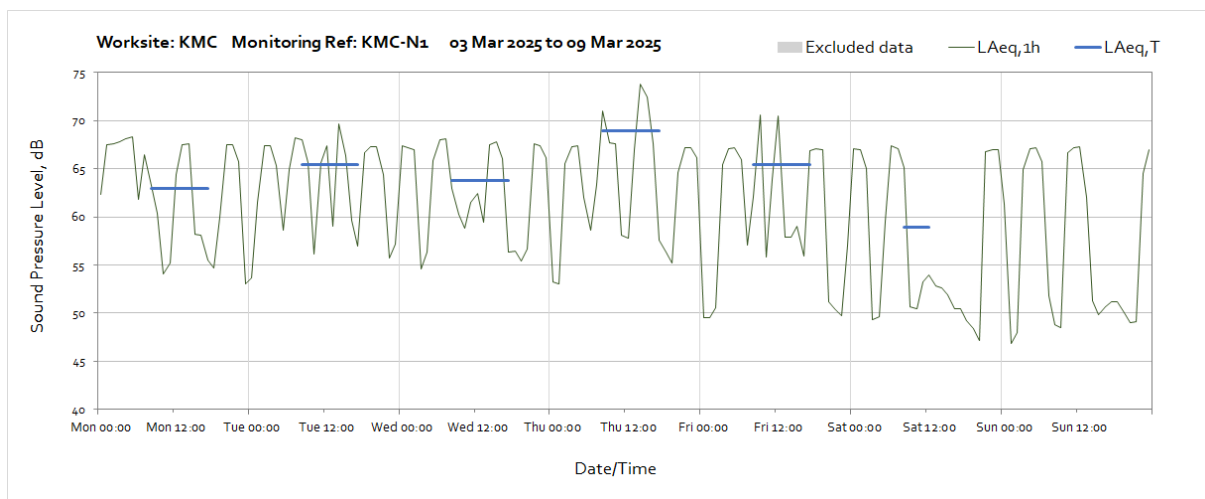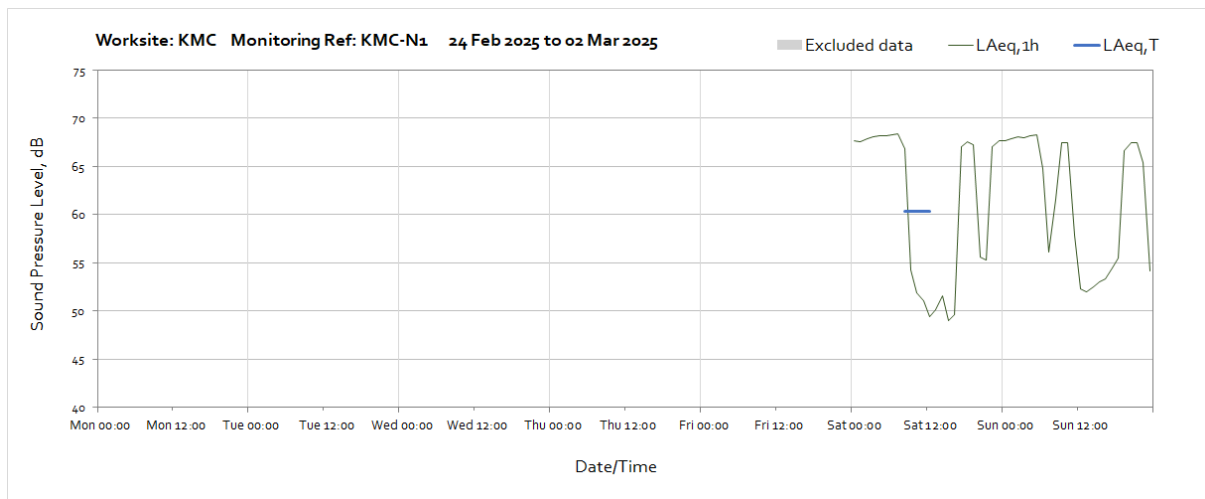

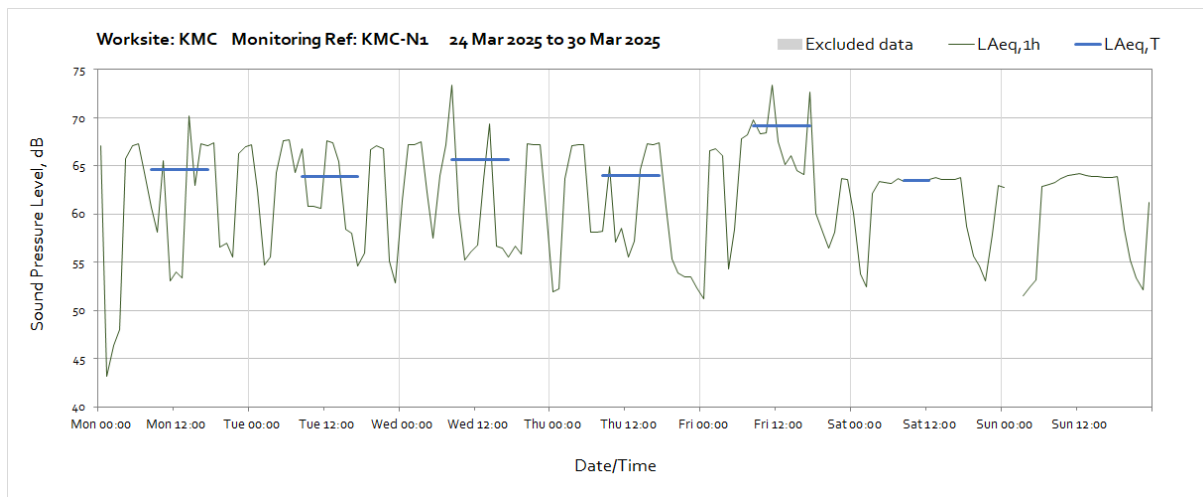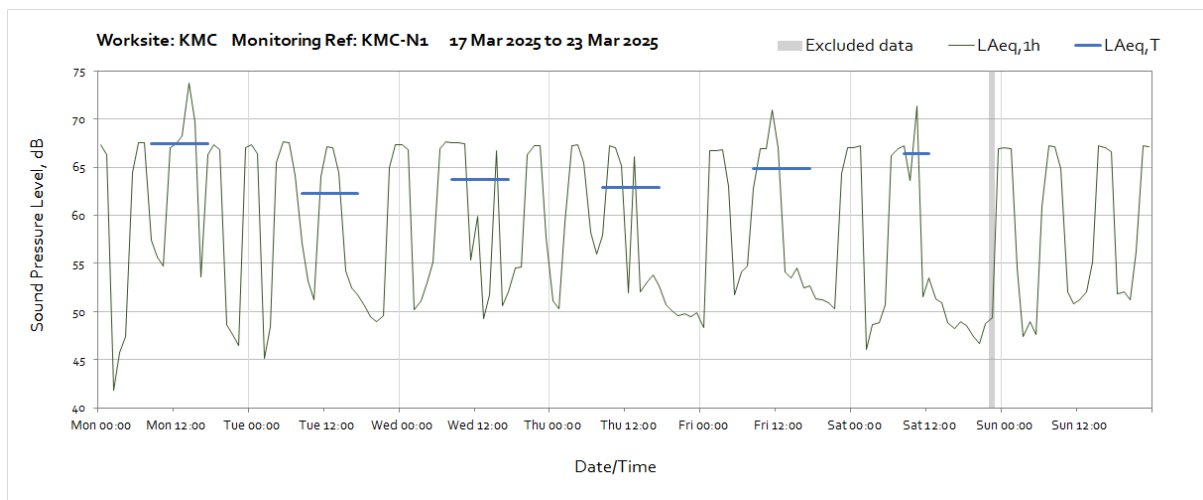
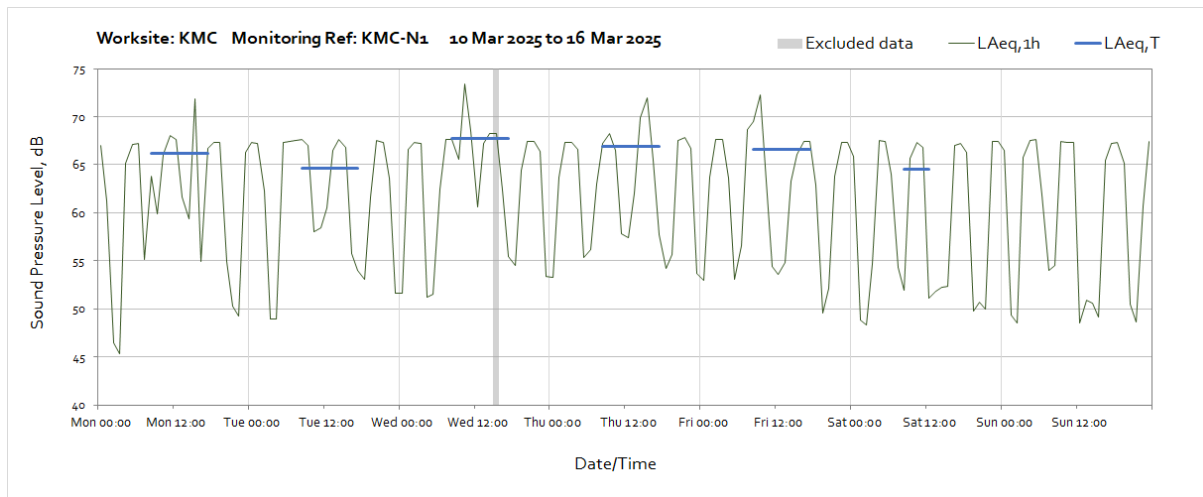


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

OFFICIAL

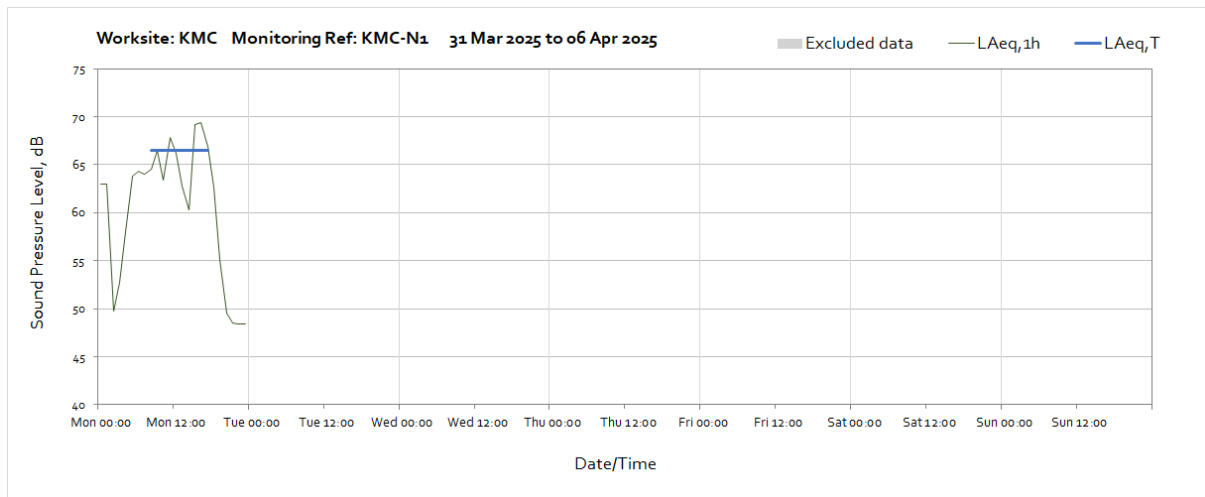




## Worksite: BFCV – Monitoring Ref: BFCV-N2

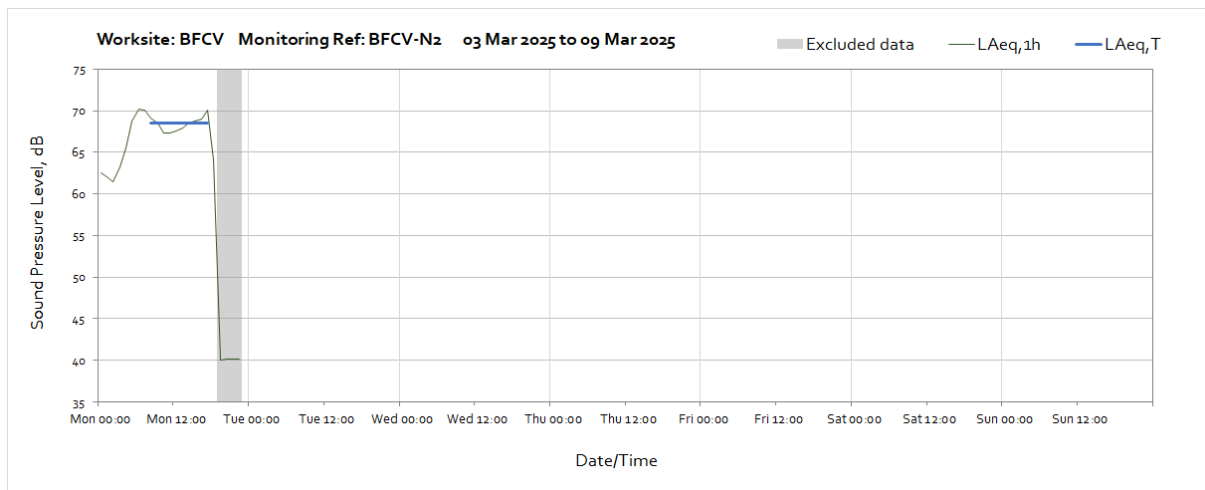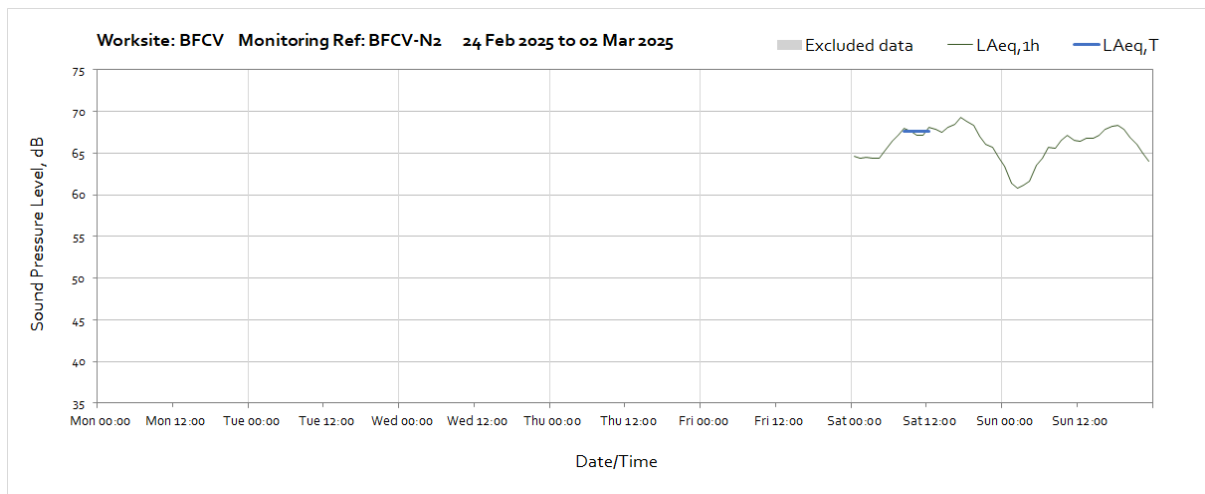



Note: Missing data from 22:00 on Monday 3<sup>rd</sup> March until the end of the month was due to tampering of the monitoring station.

OFFICIAL


## Worksite: MB – Monitoring Ref: MB-N1

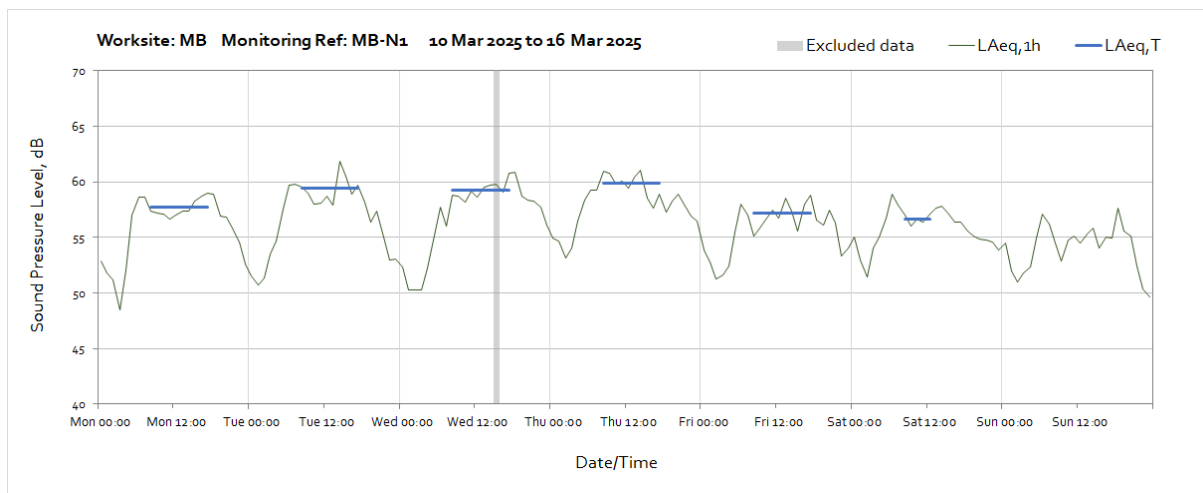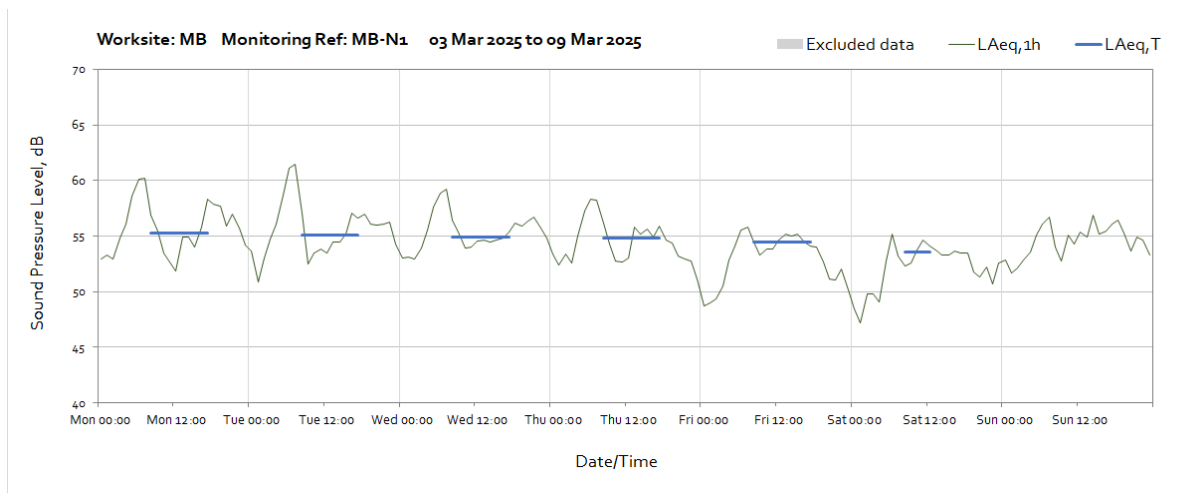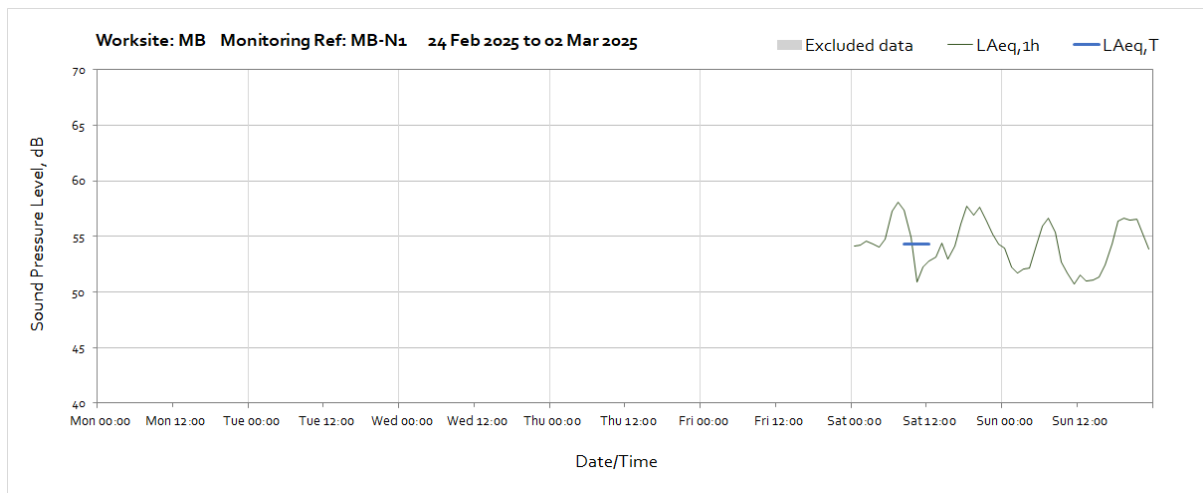






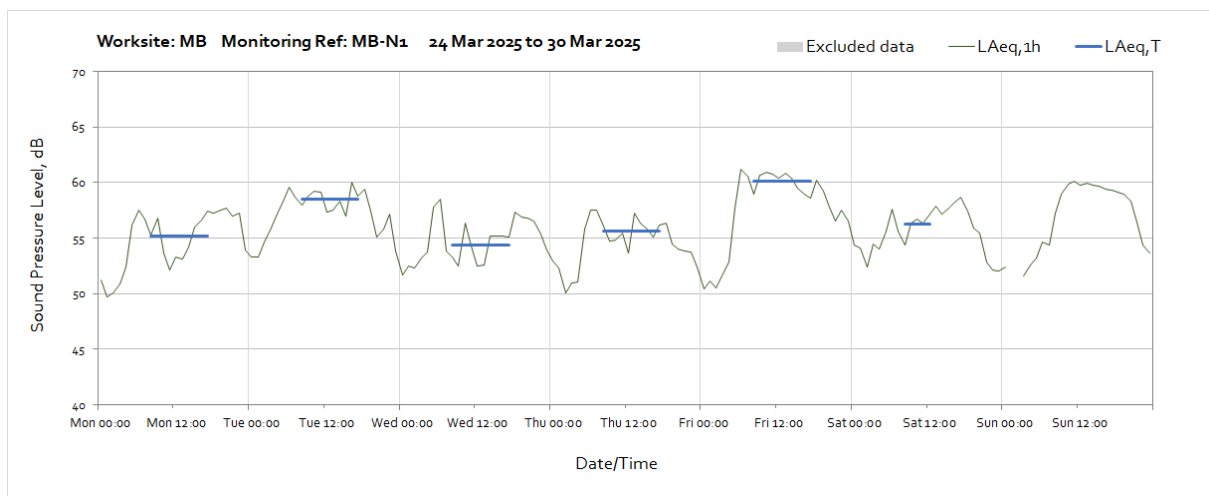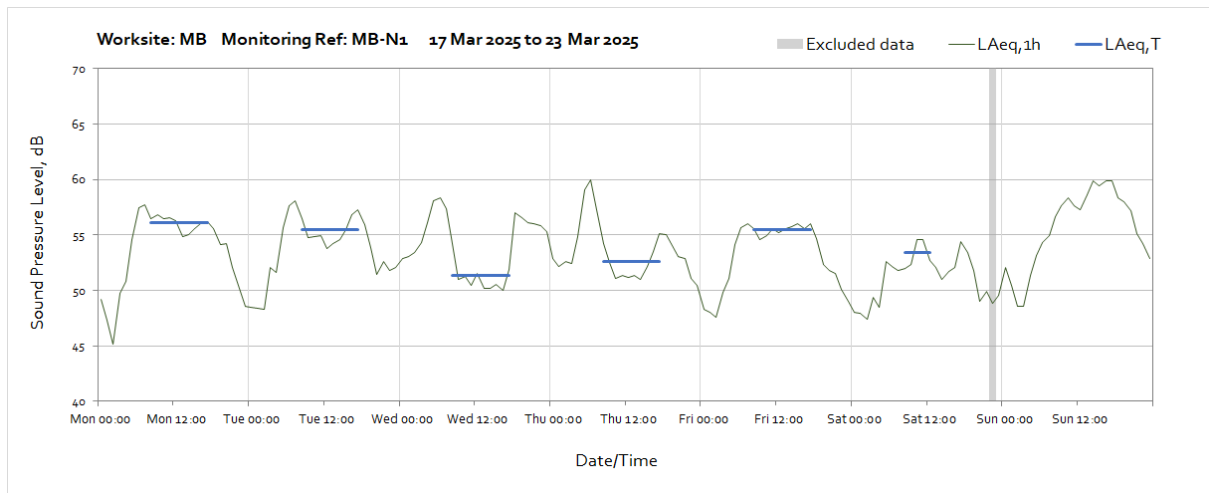



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

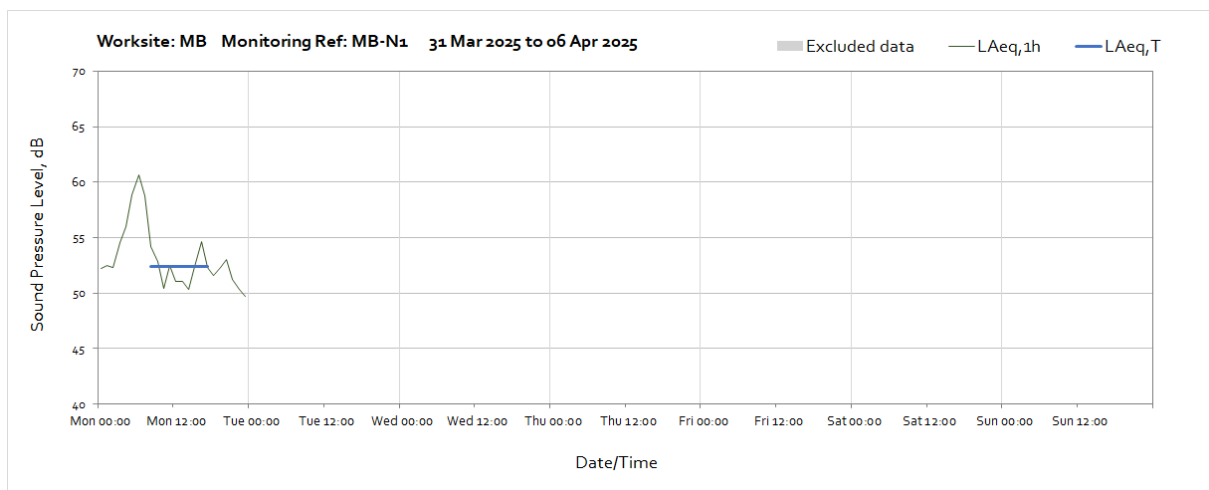


## Worksite: FAEU – Monitoring Ref: FAEU-N1

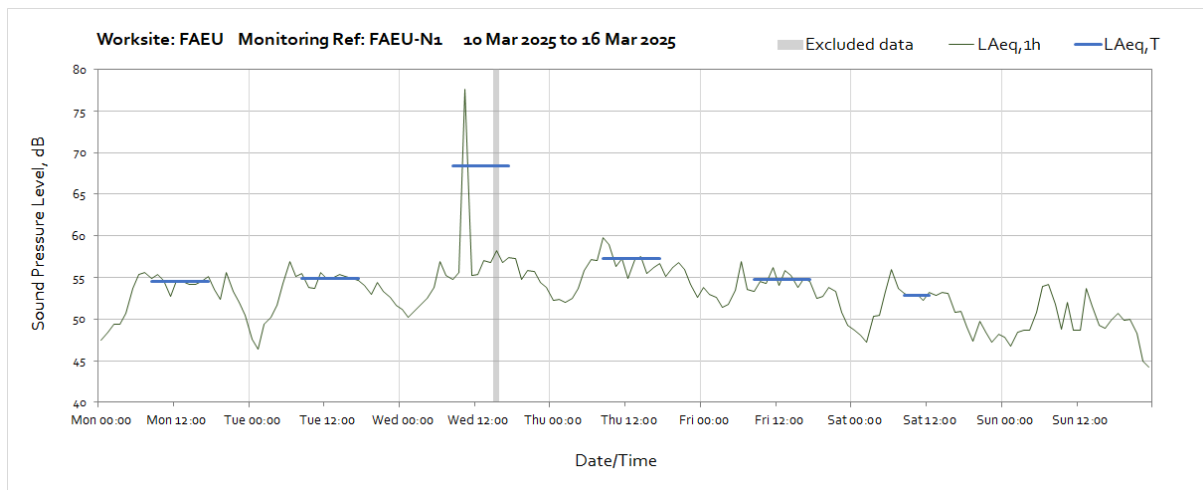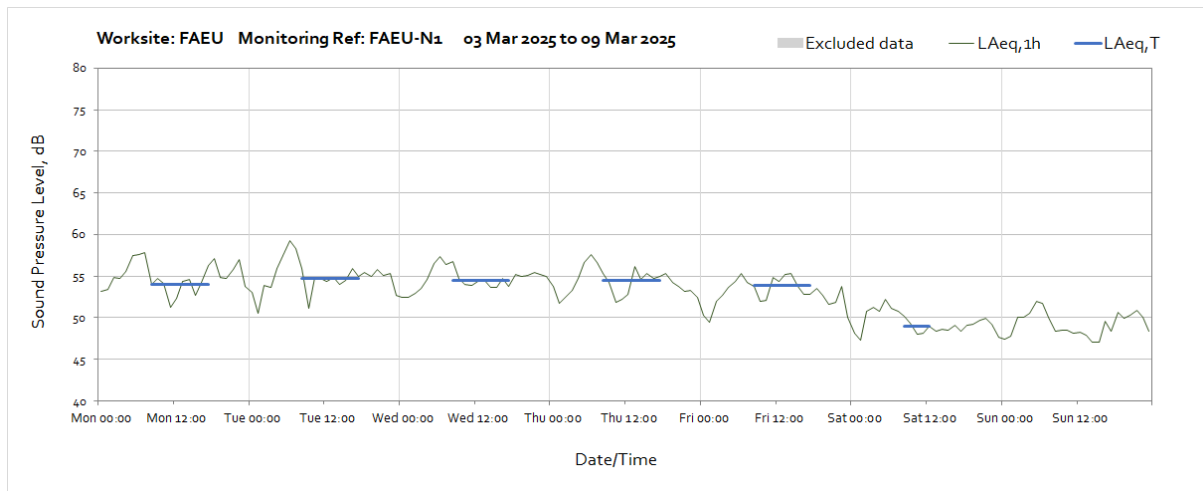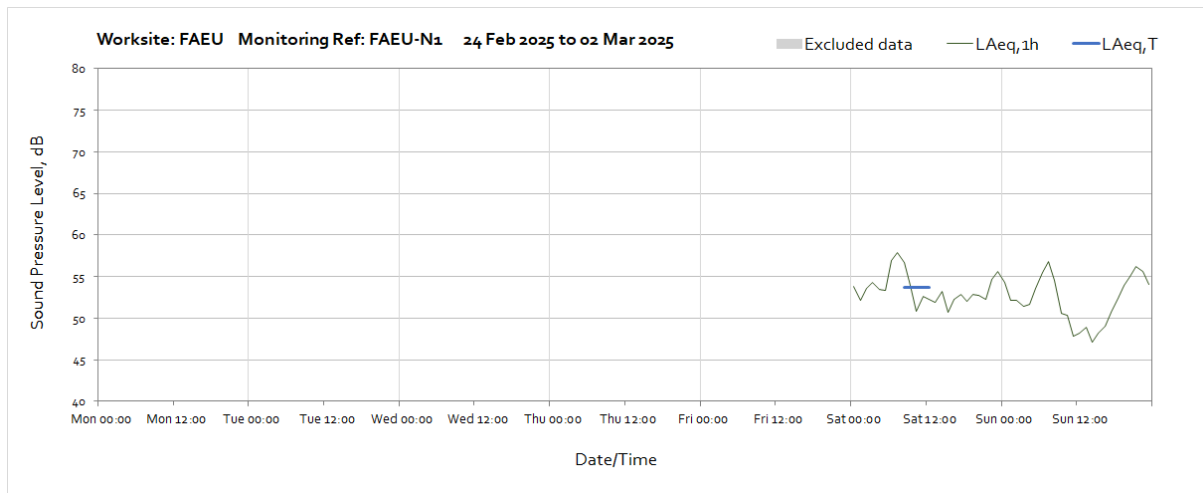




OFFICIAL

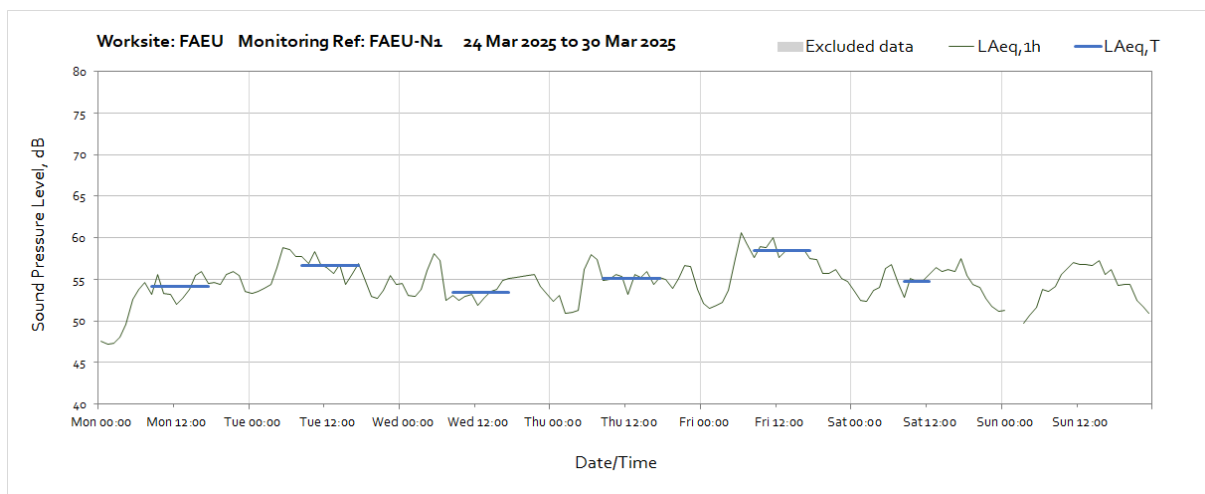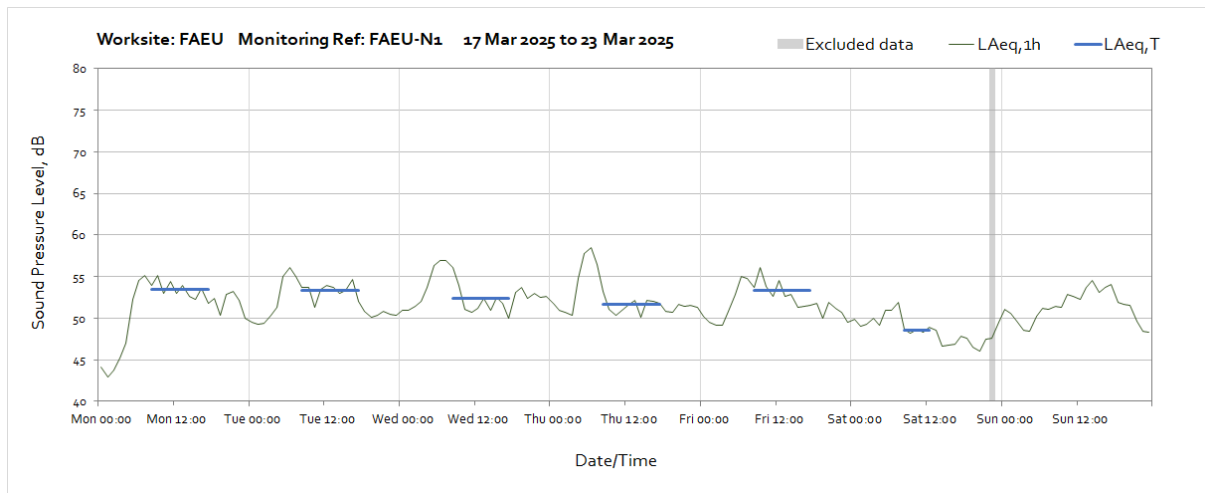



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

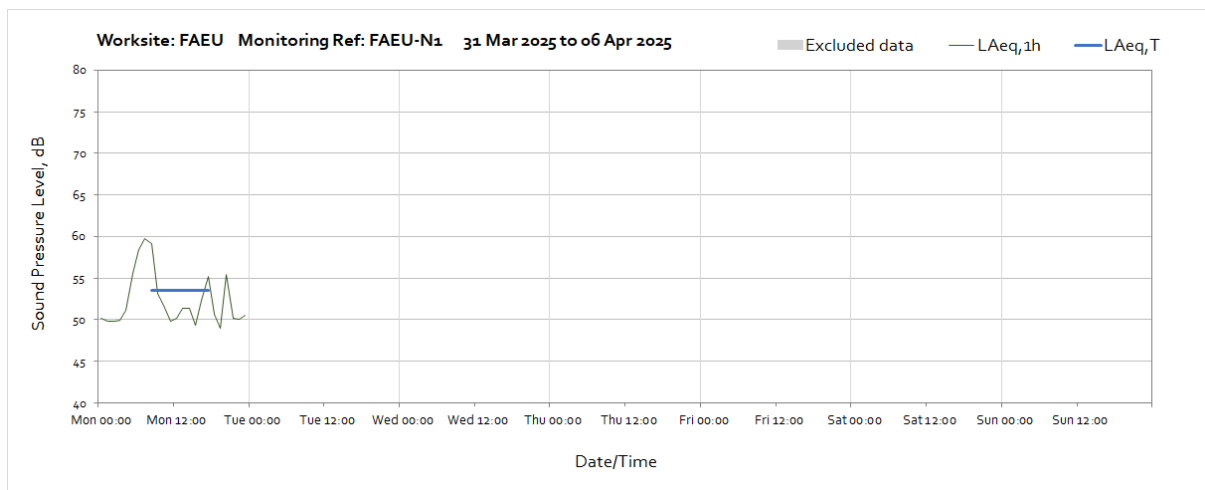


## Worksite: CHBS – Monitoring Ref: CHBS-N1

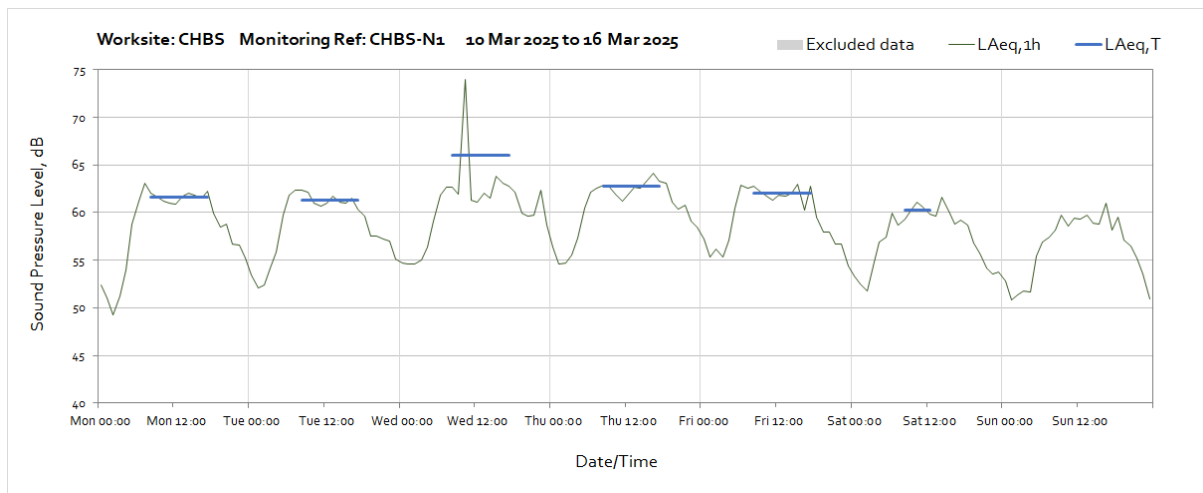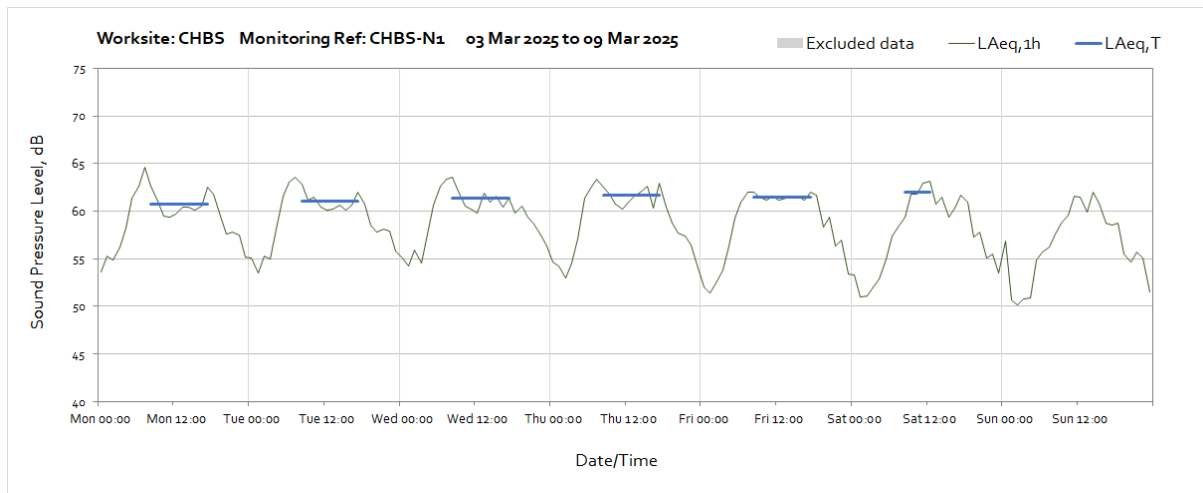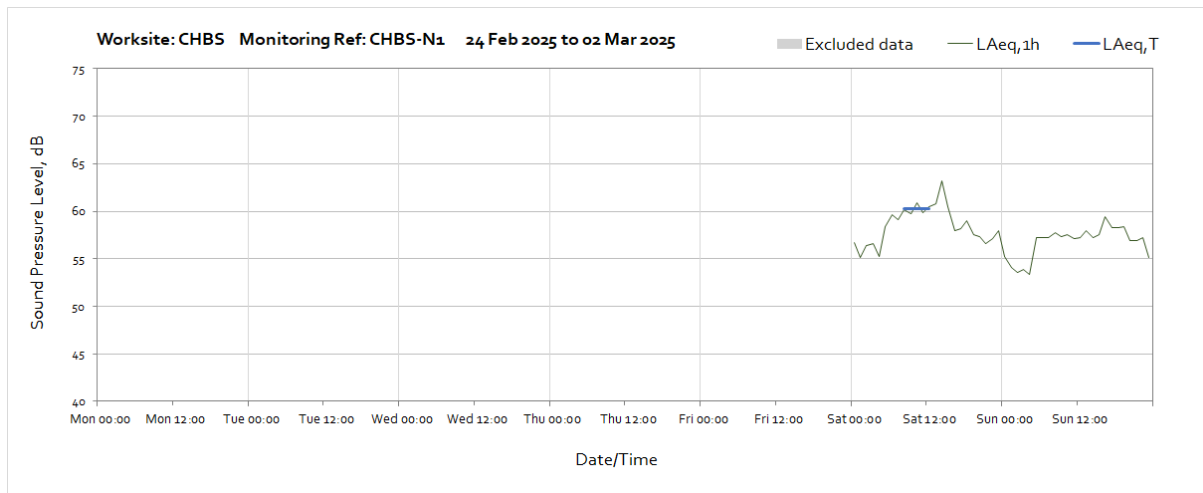




OFFICIAL

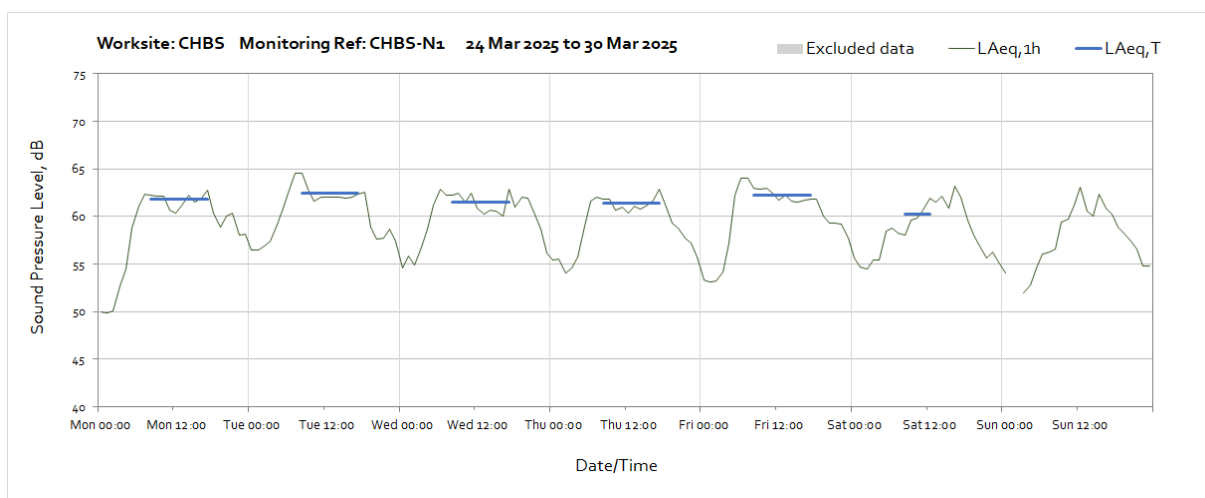
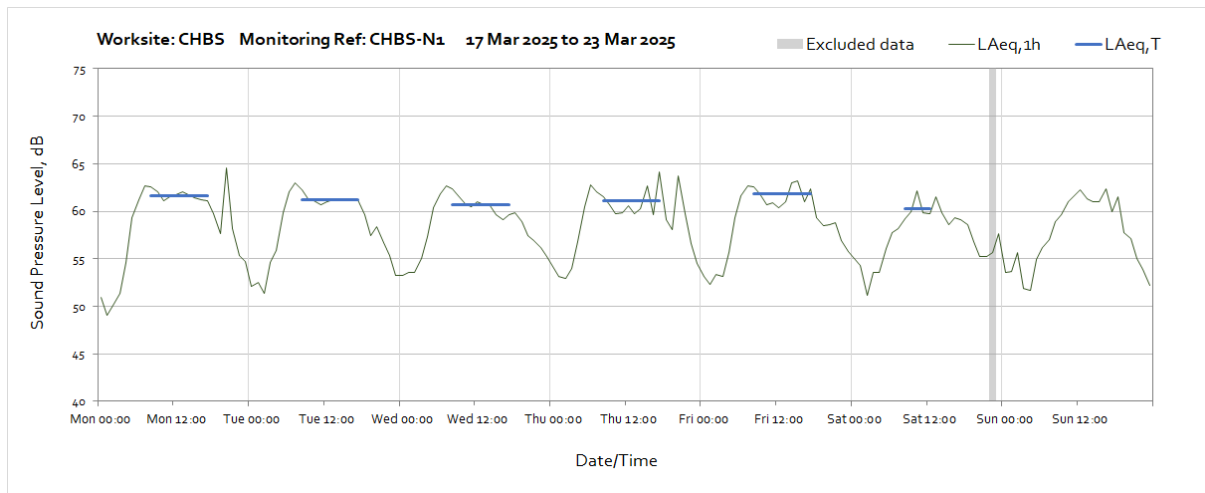


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

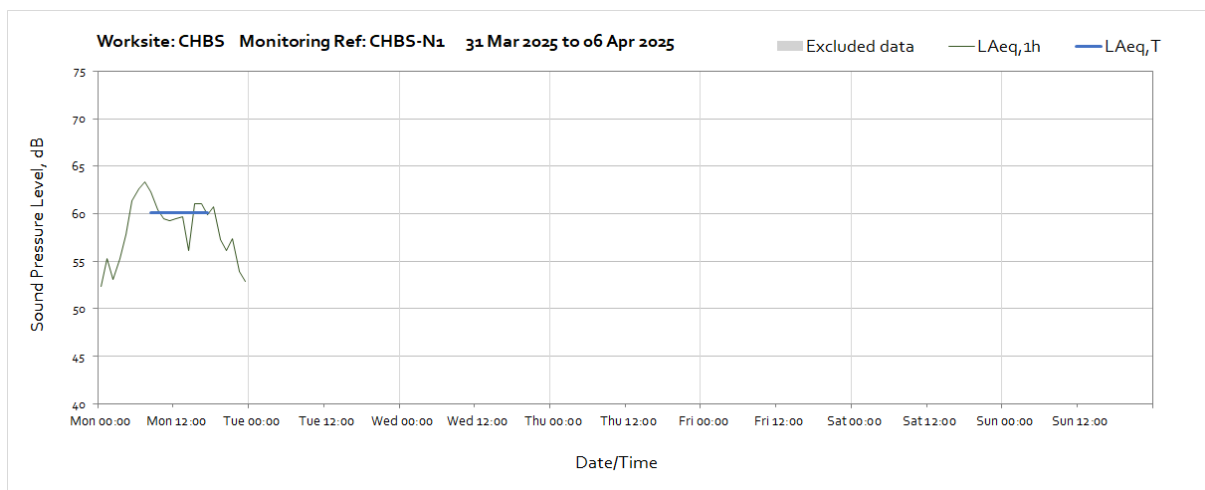


## Worksite: MLE – Monitoring Ref: MLE-N1

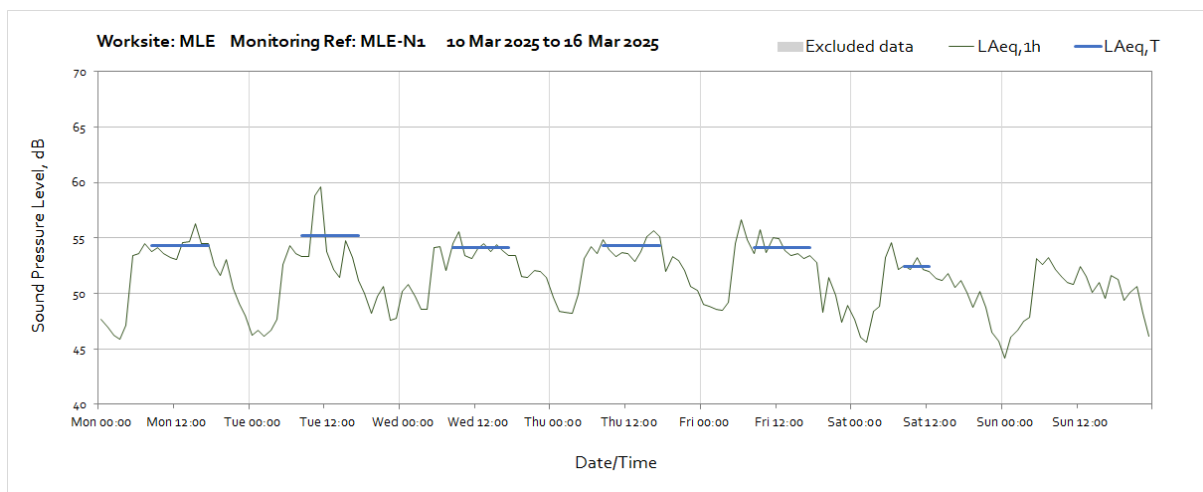
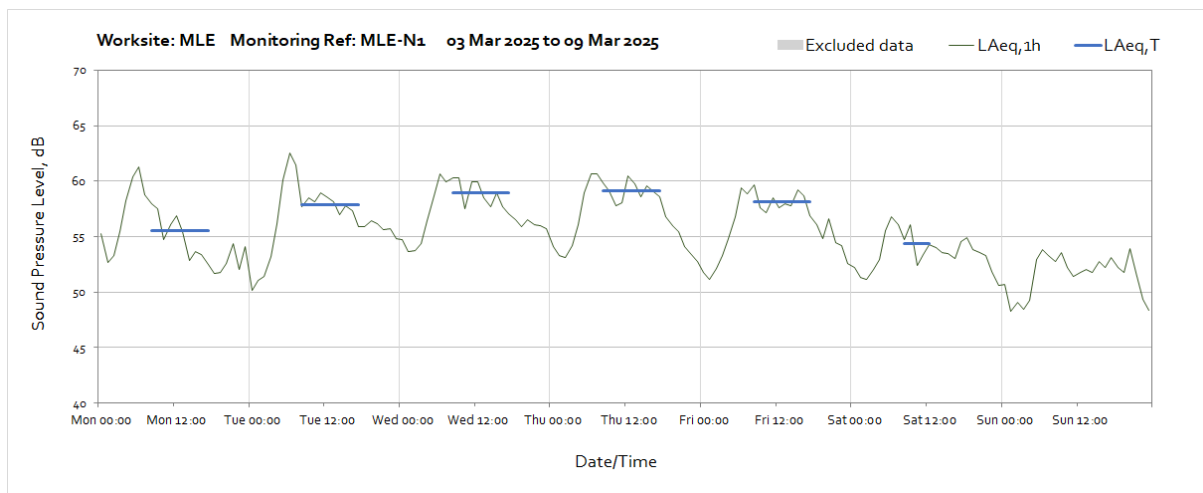
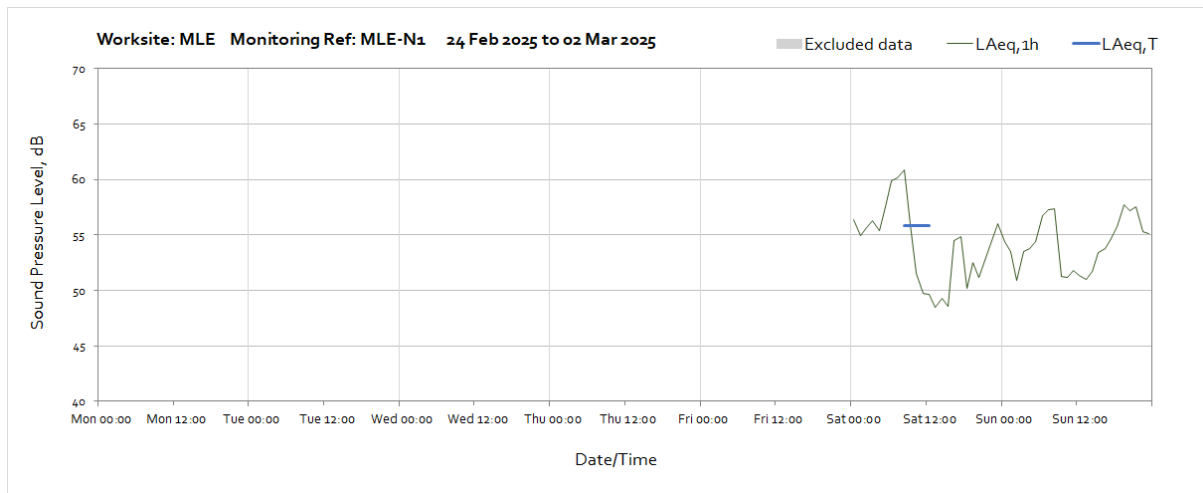


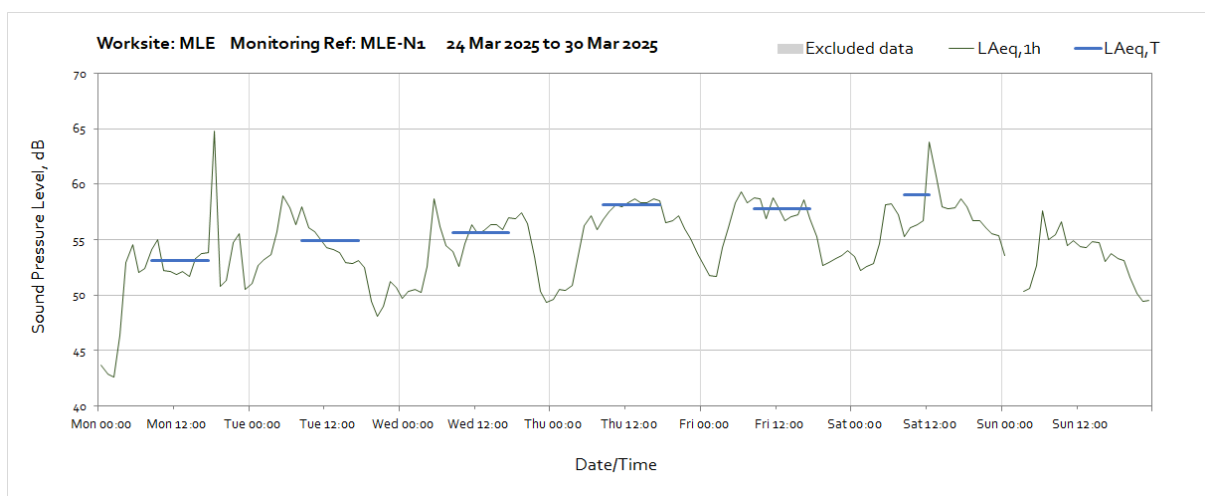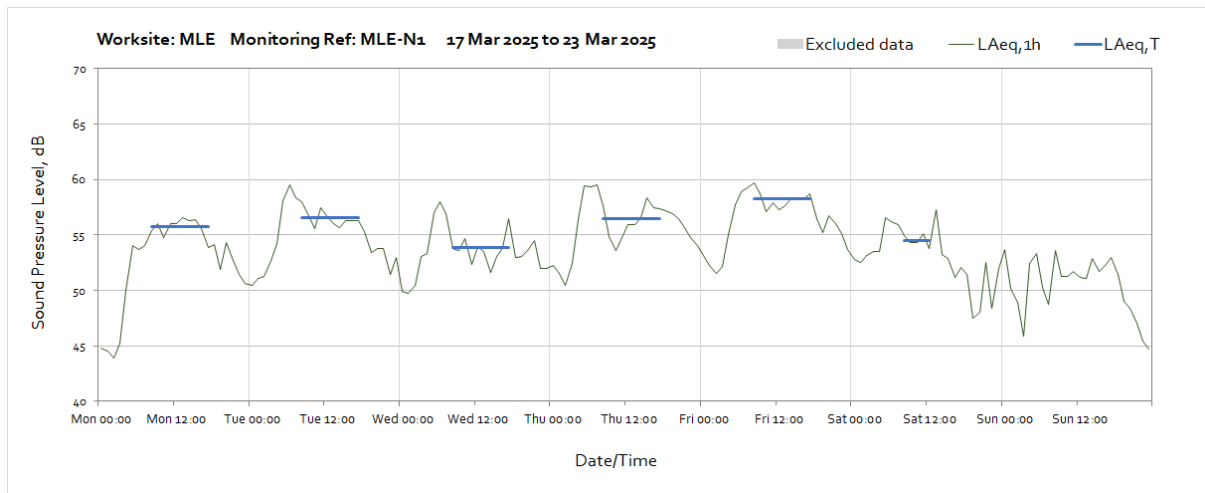

Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.


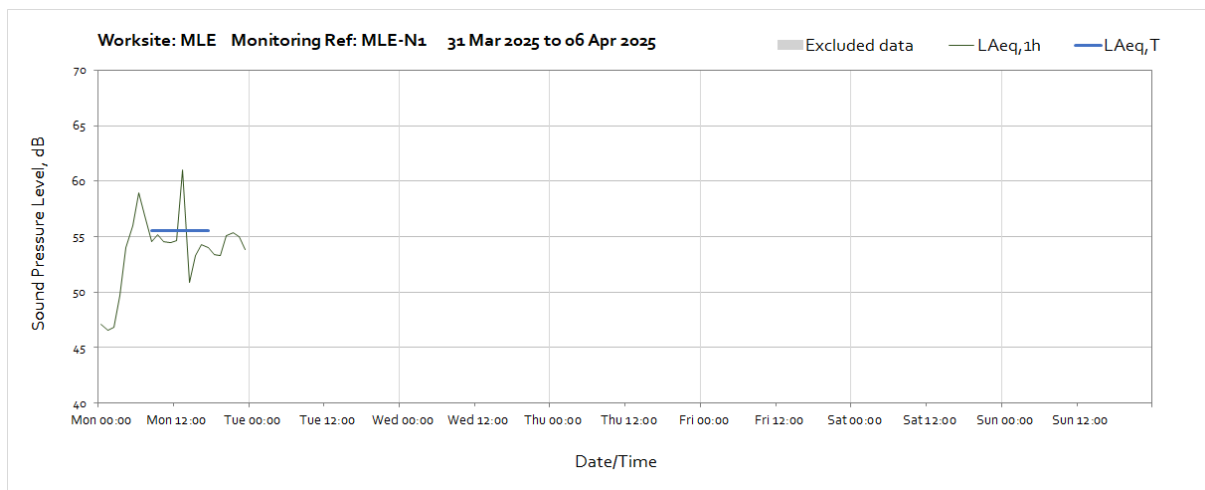


## Worksite: ALO – Monitoring Ref: ALO-N1

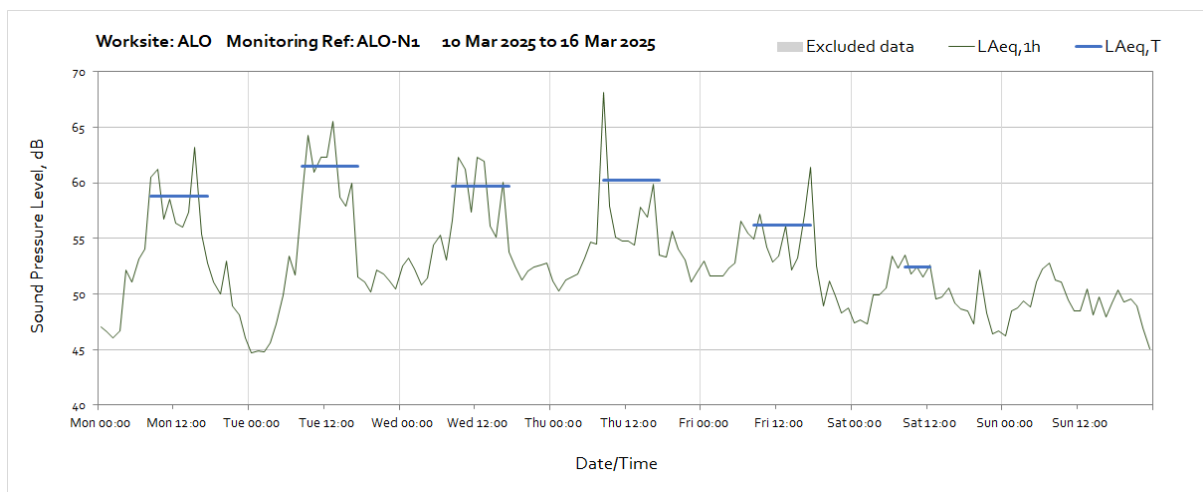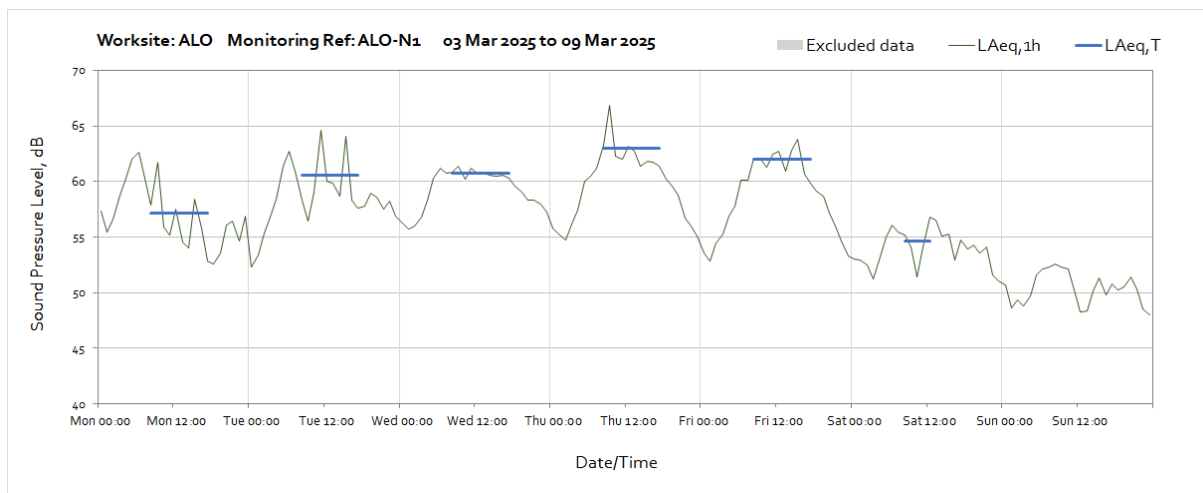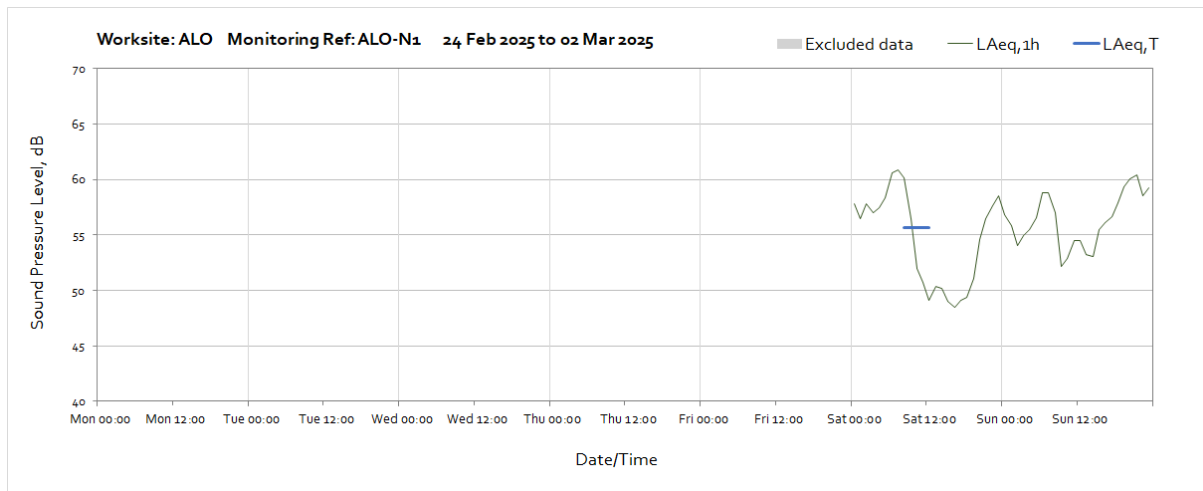


OFFICIAL






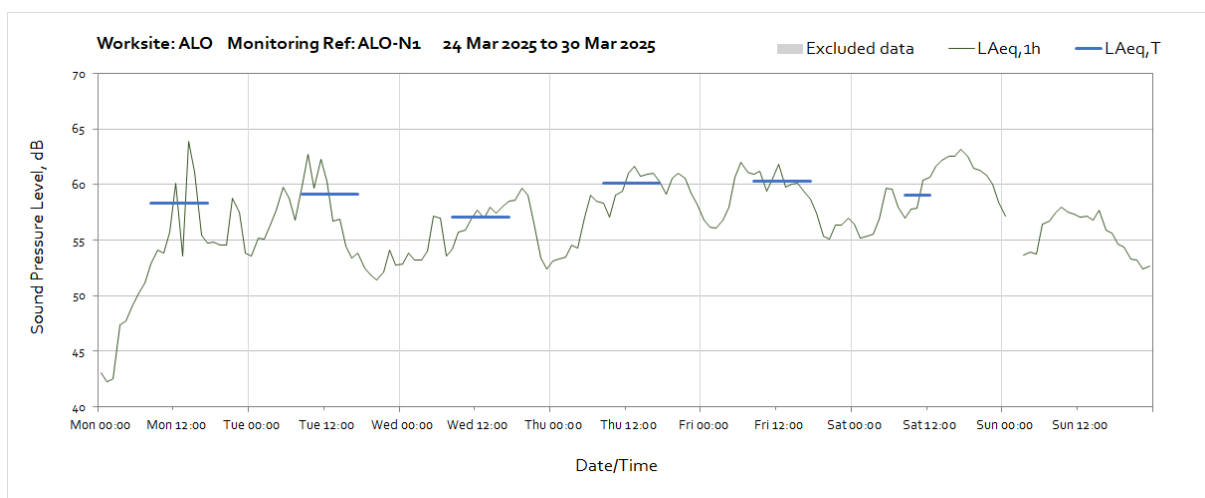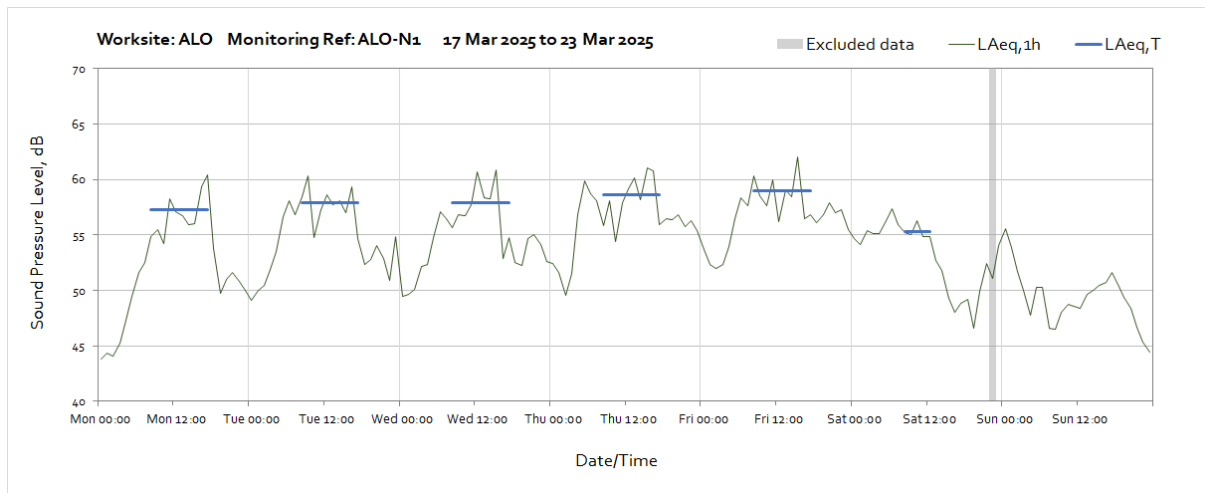



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

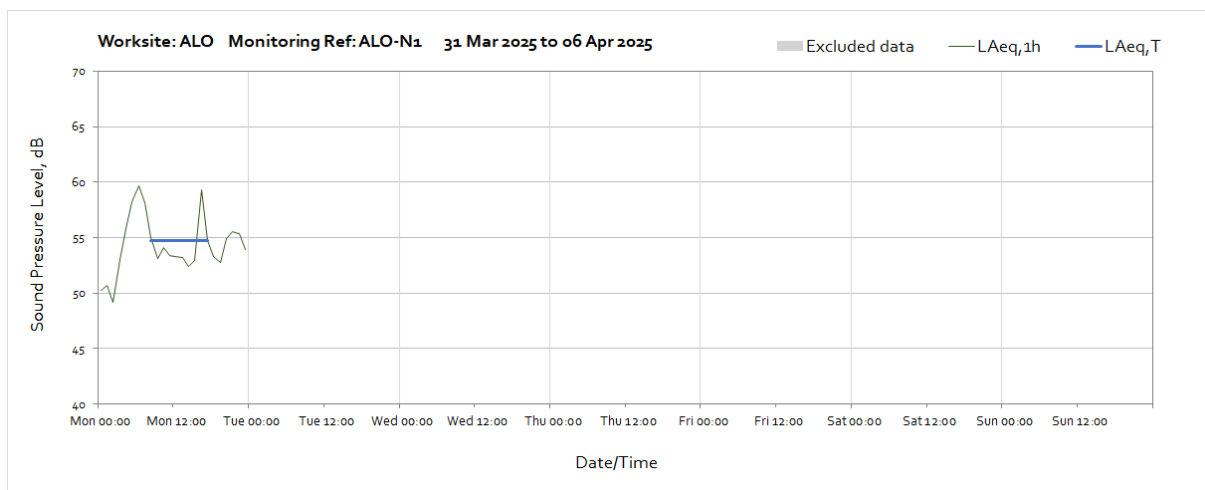


## Worksite: ALO – Monitoring Ref: ALO-N2

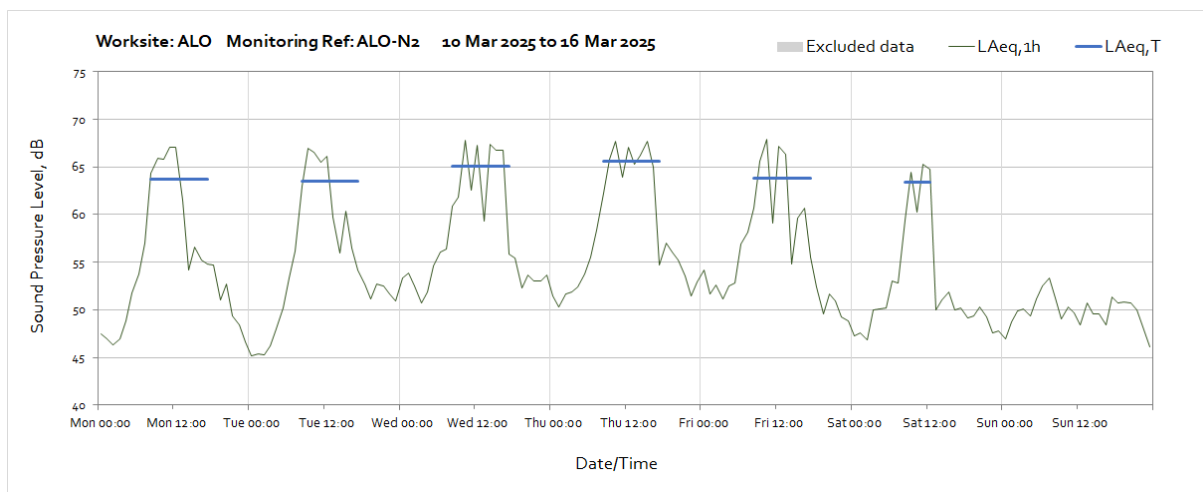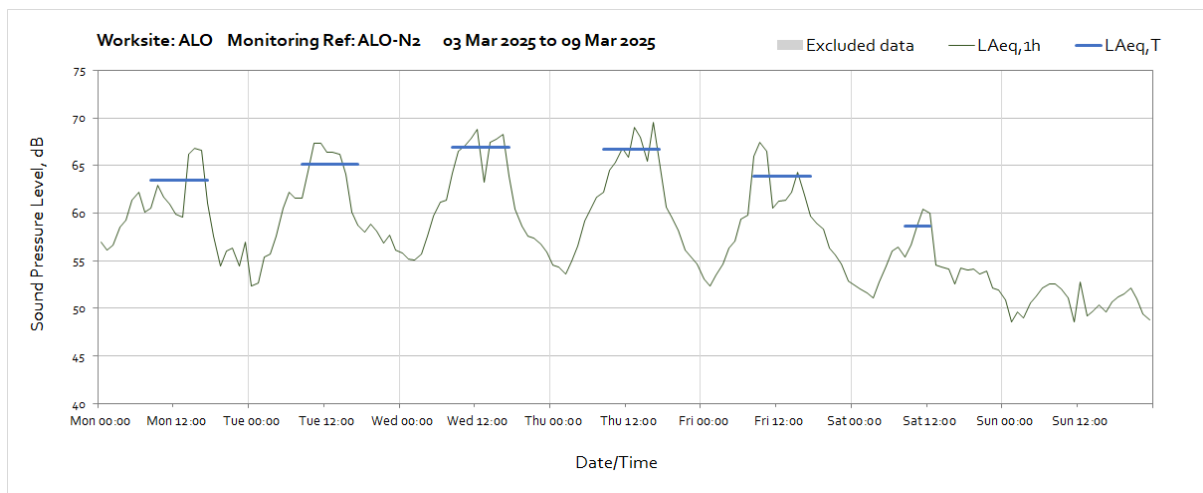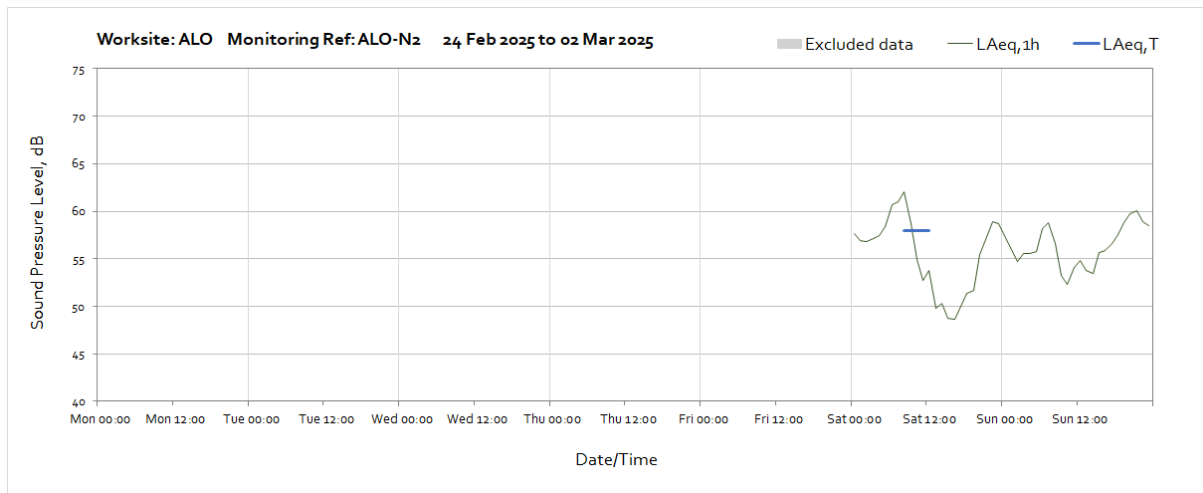




OFFICIAL

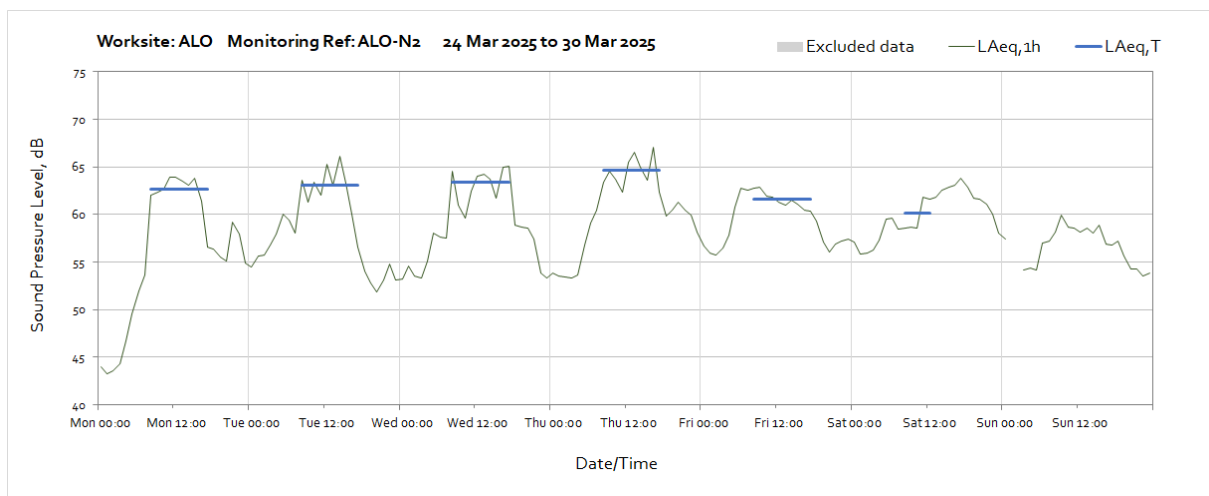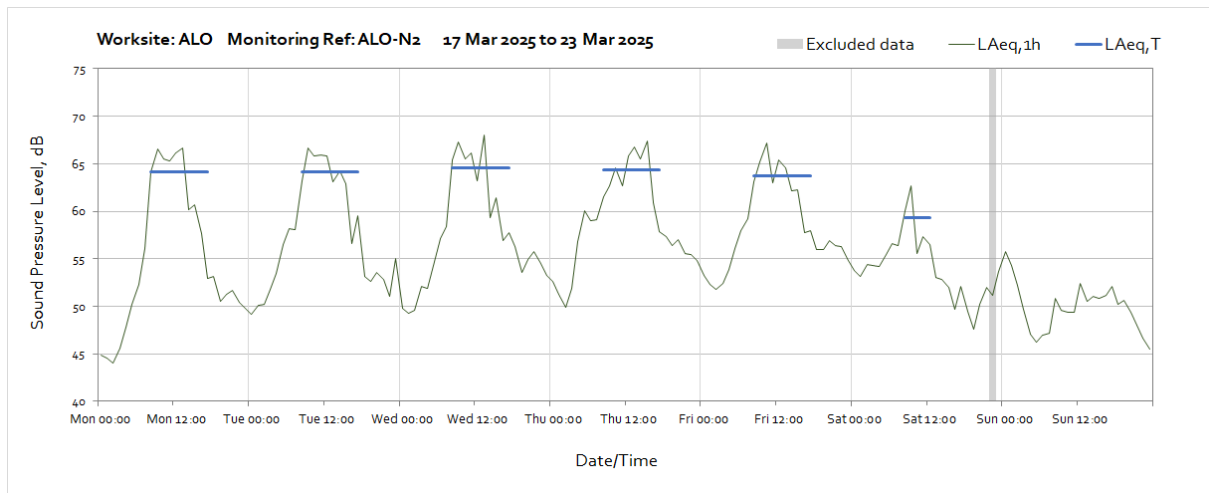



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

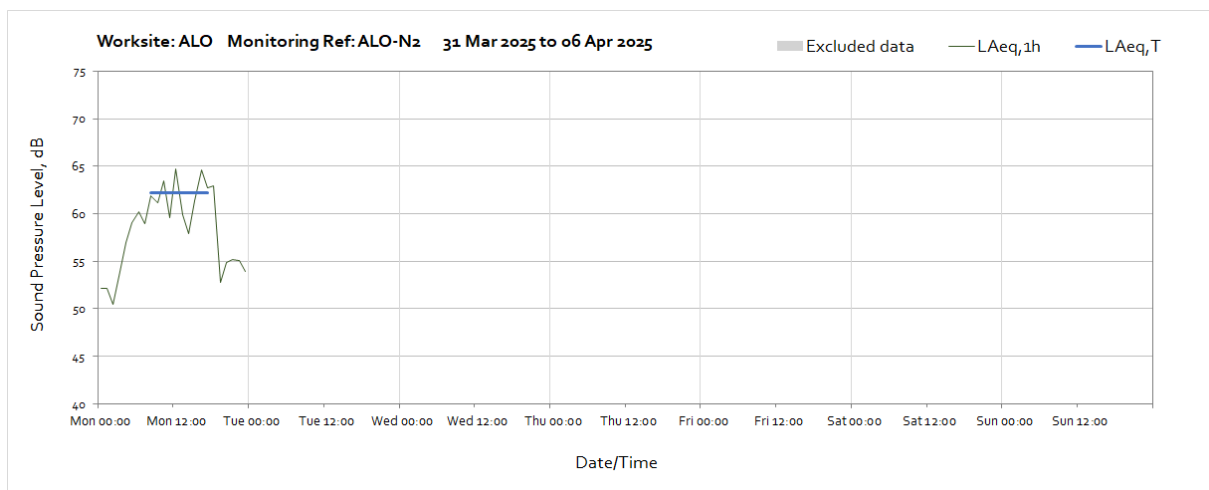


## Worksite: ALO – Monitoring Ref: AFE-N1

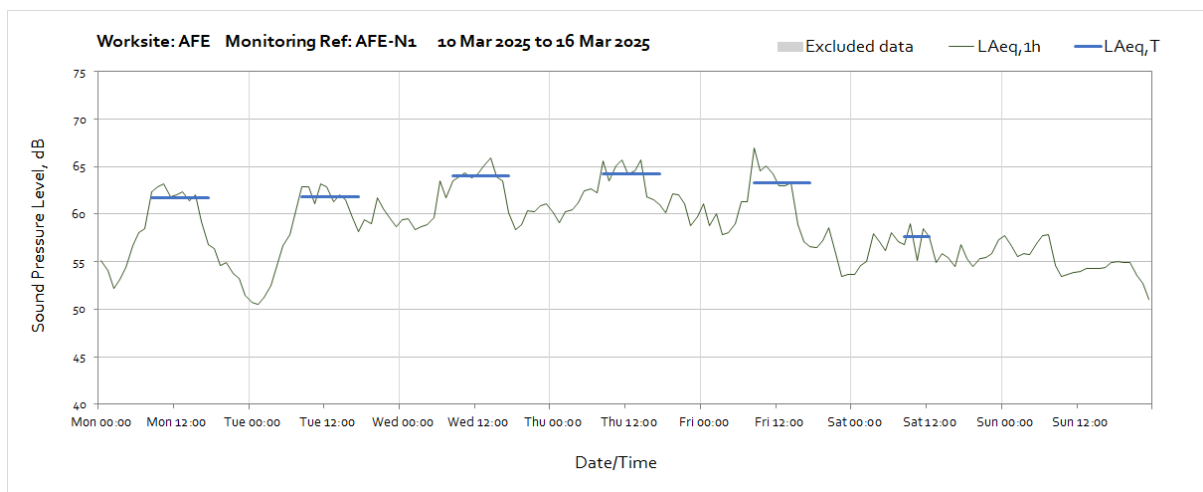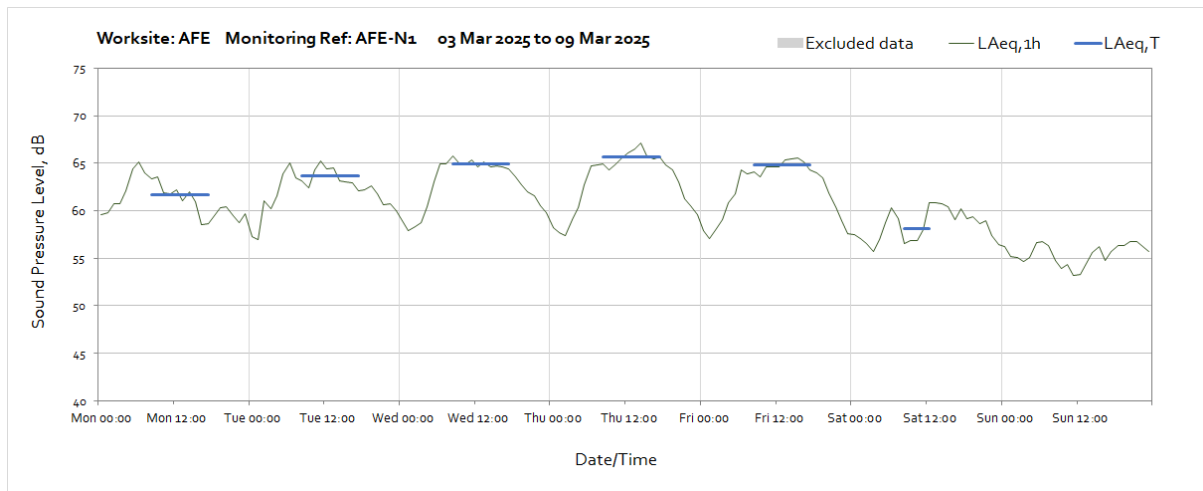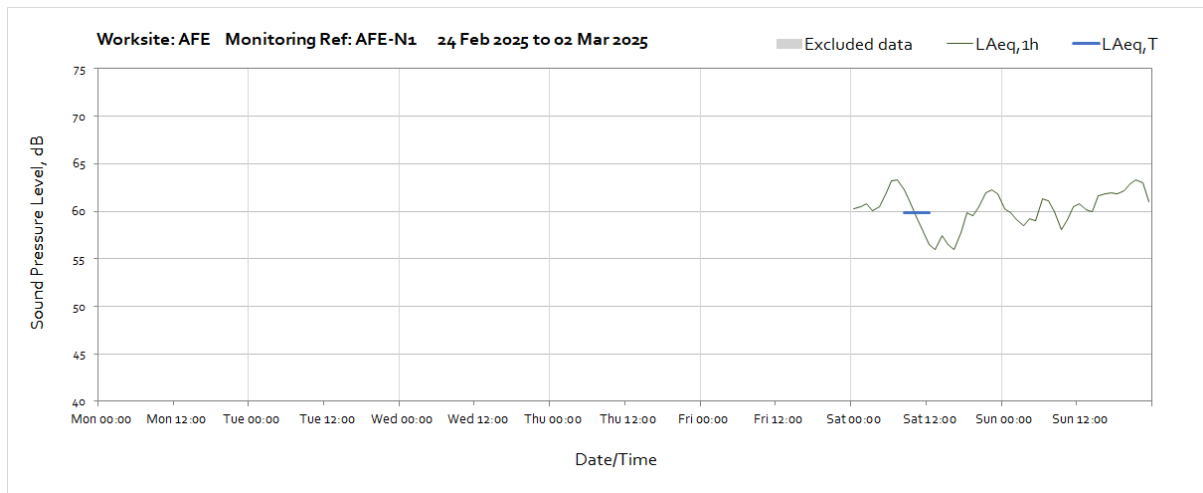




OFFICIAL

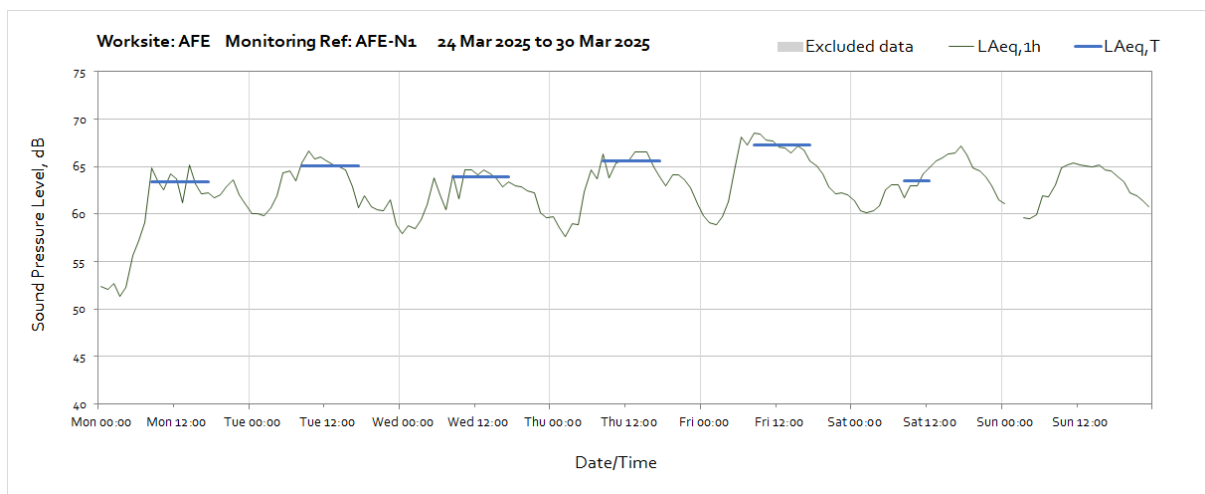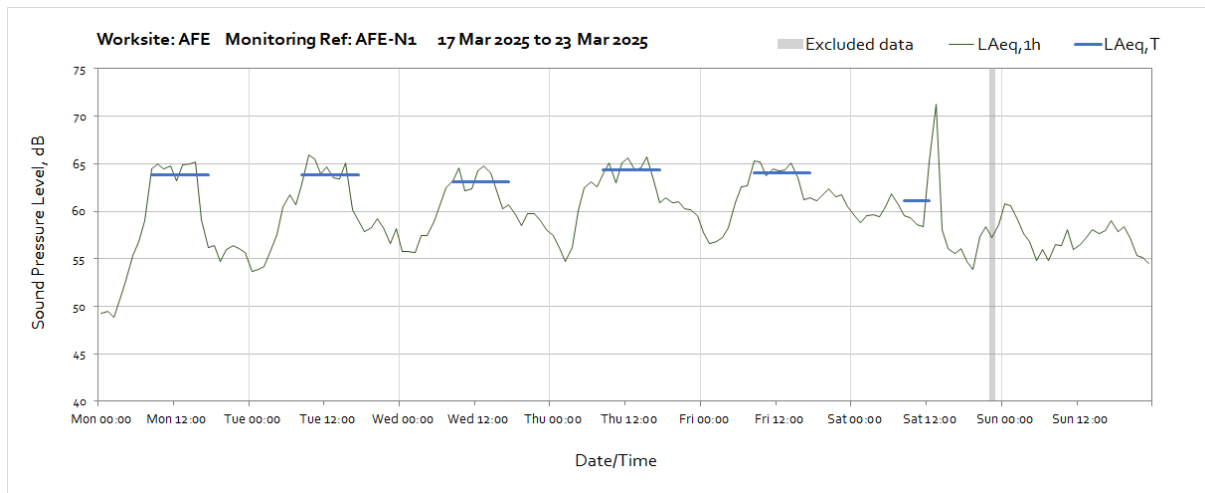

Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.


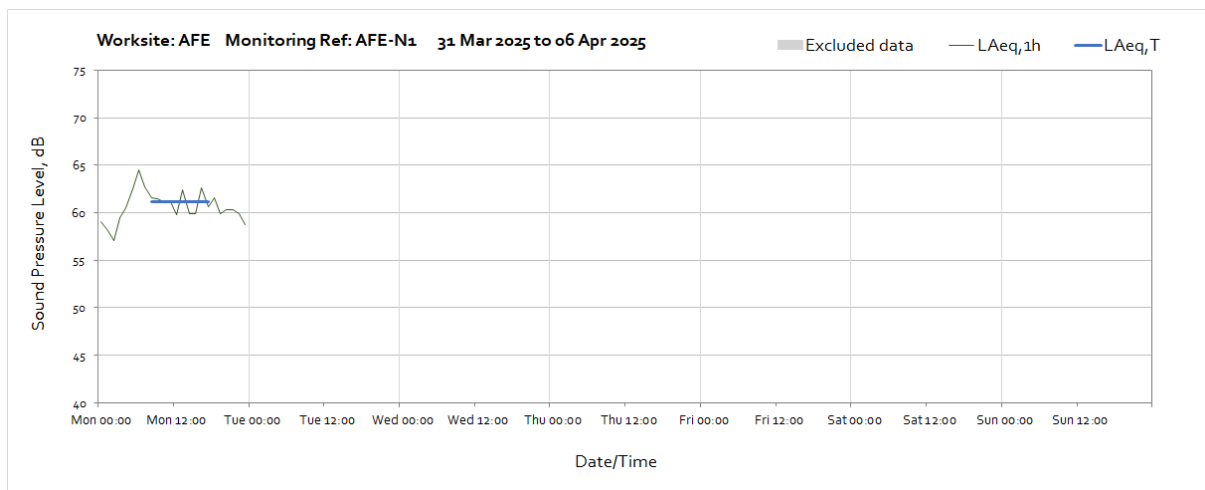


## Worksite: GE – Monitoring Ref: GE-N1

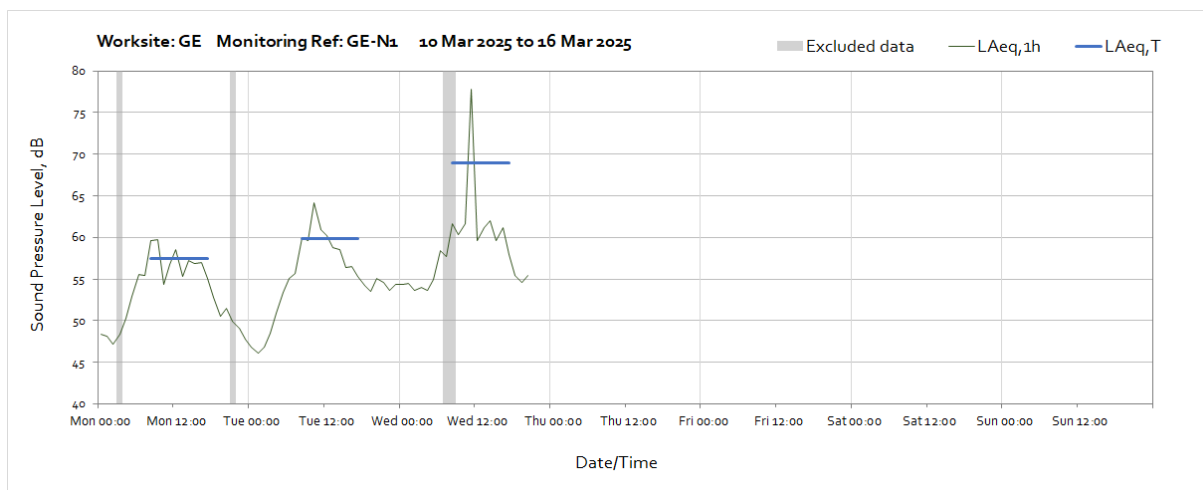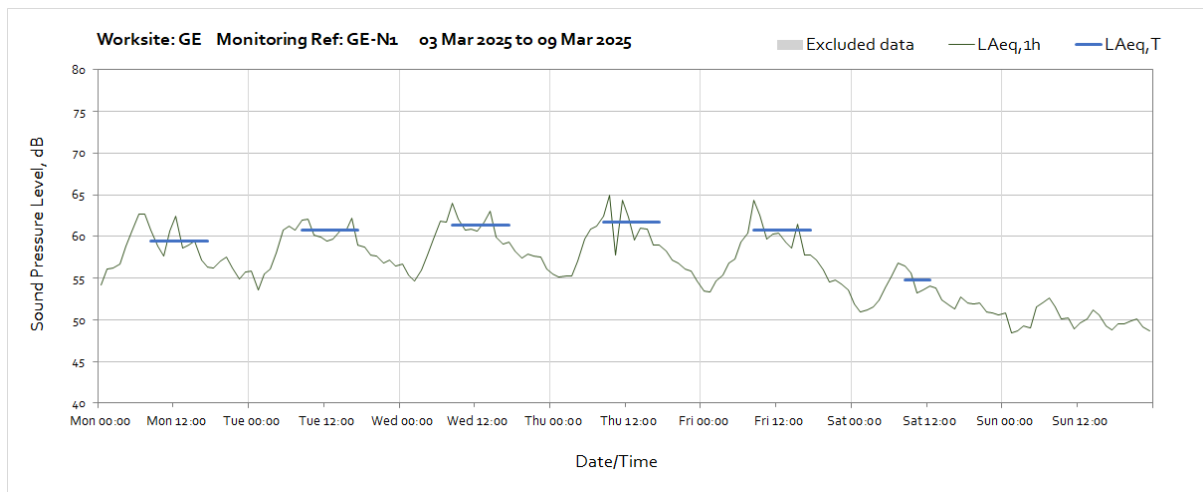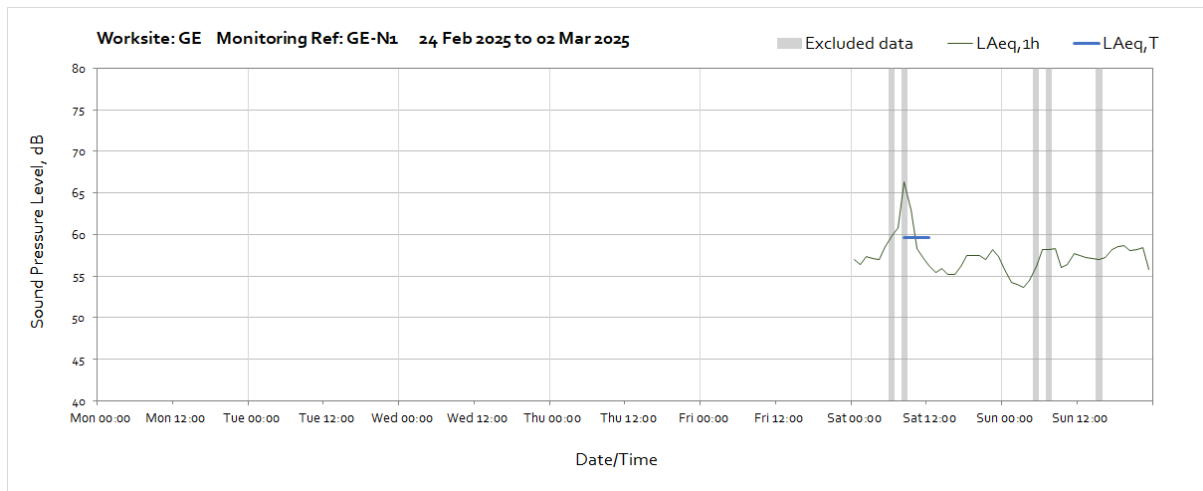


Note: Missing data from 21:00 on Wednesday 12<sup>th</sup> March until 15:00 on Tuesday 18<sup>th</sup> March was due to loss of mains power to the monitoring station.




OFFICIAL

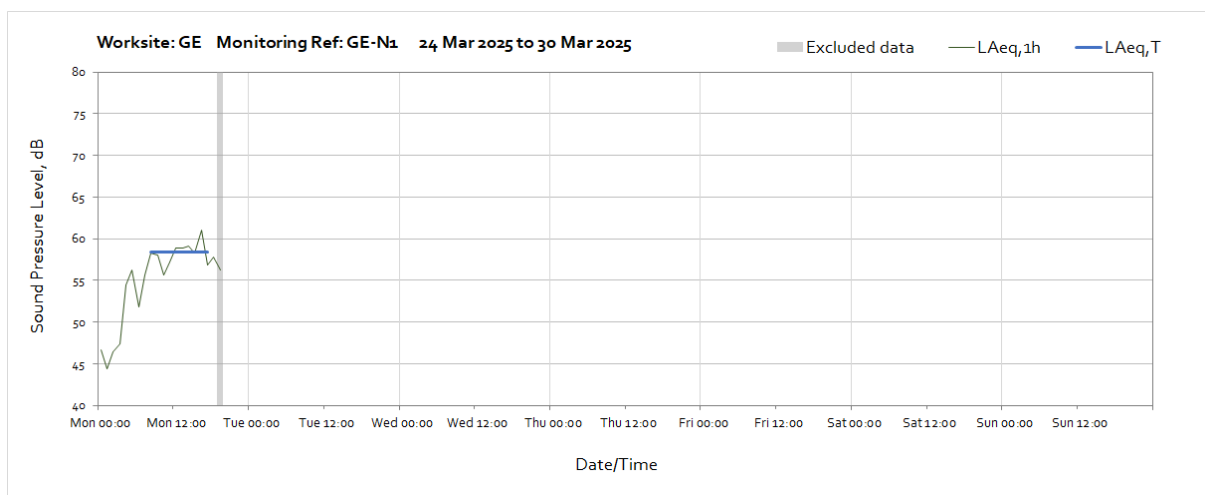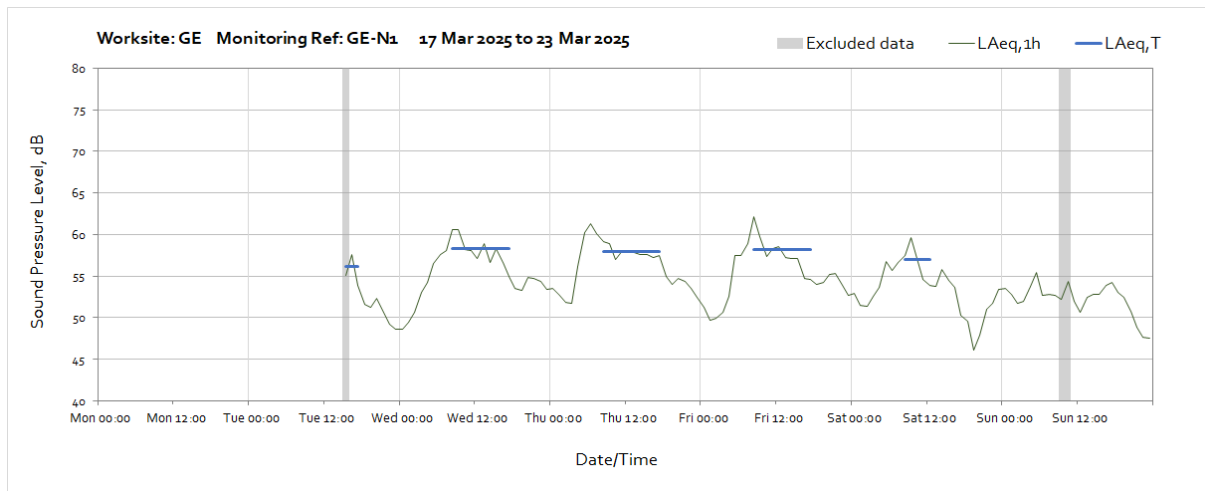


Note: Missing data from 20:00 on Monday 24<sup>th</sup> March until the end of the month was due to loss of mains power to the monitoring station.

## Worksite: GE – Monitoring Ref: GE-N2

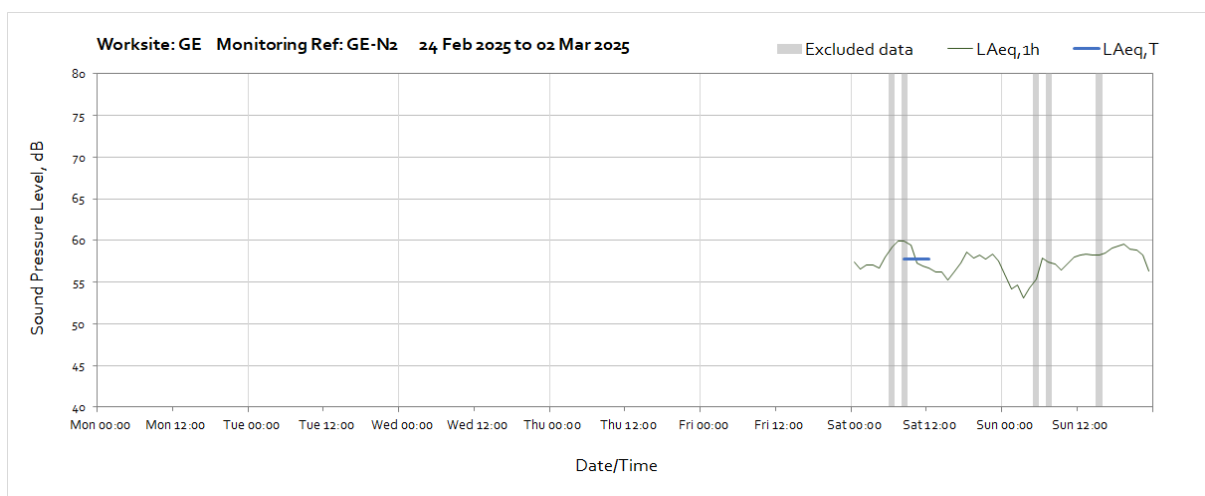


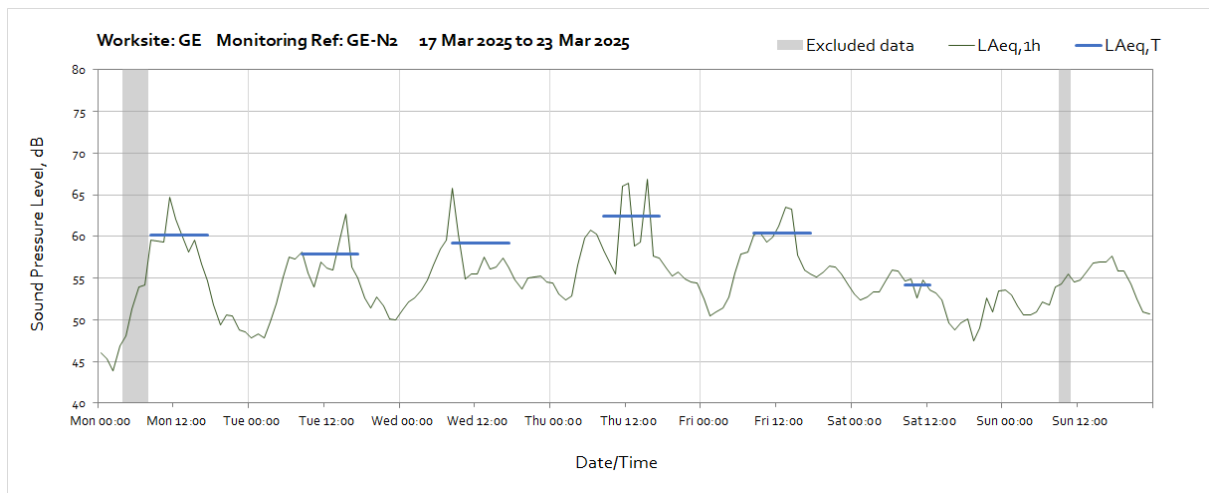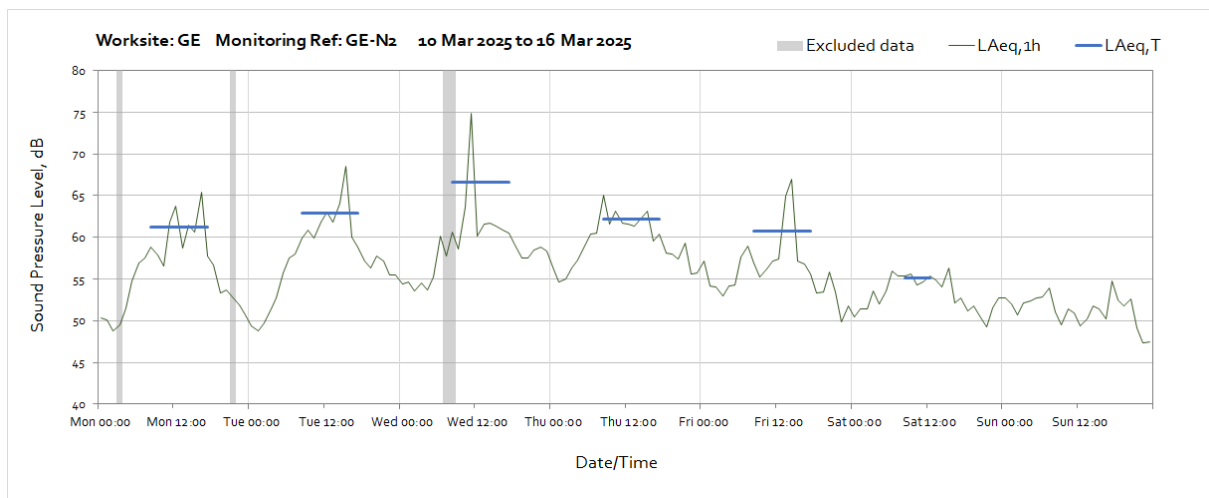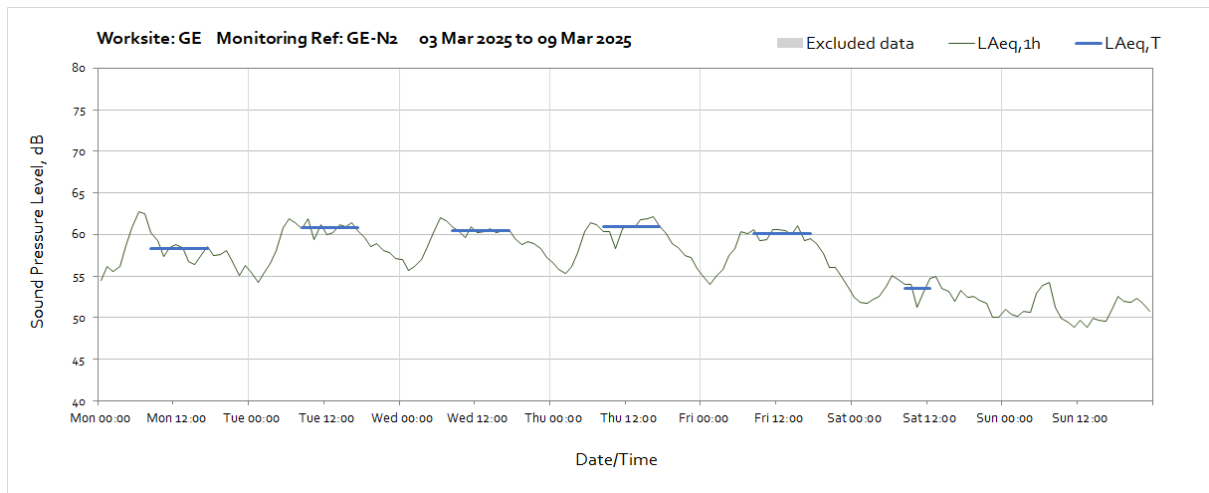






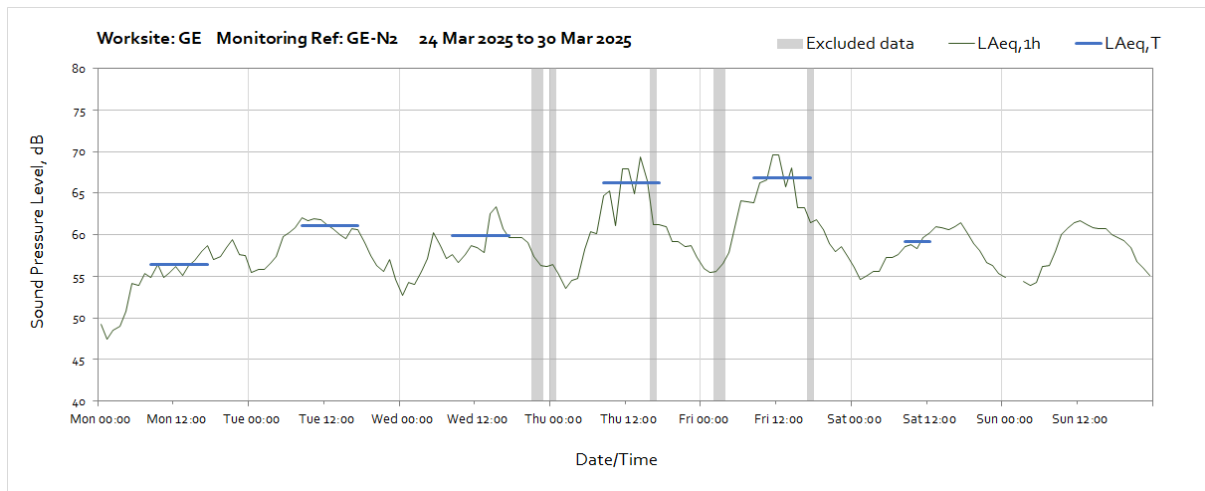



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

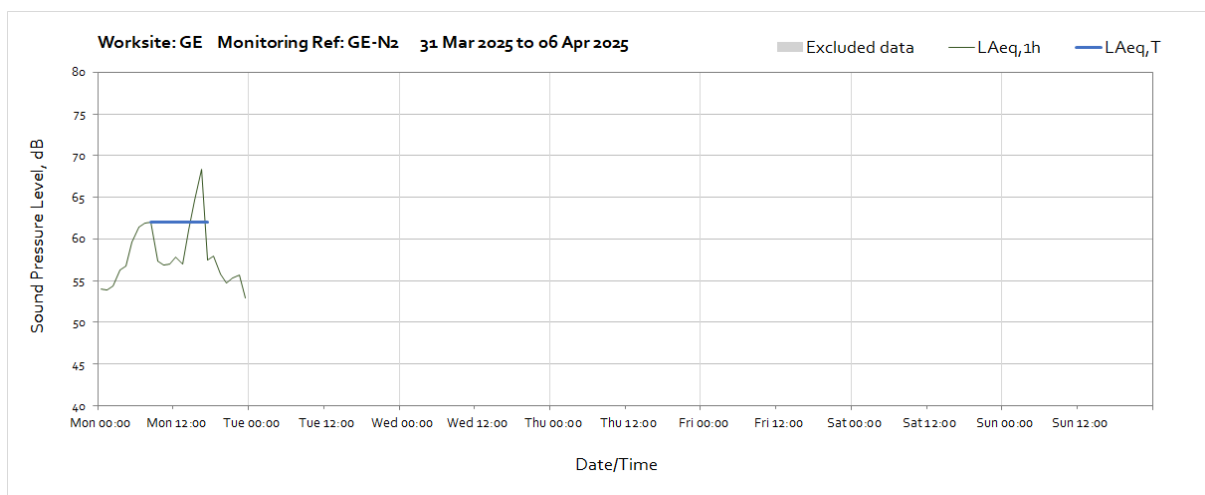


## Worksite: GLD - Monitoring Ref: GLD-N1

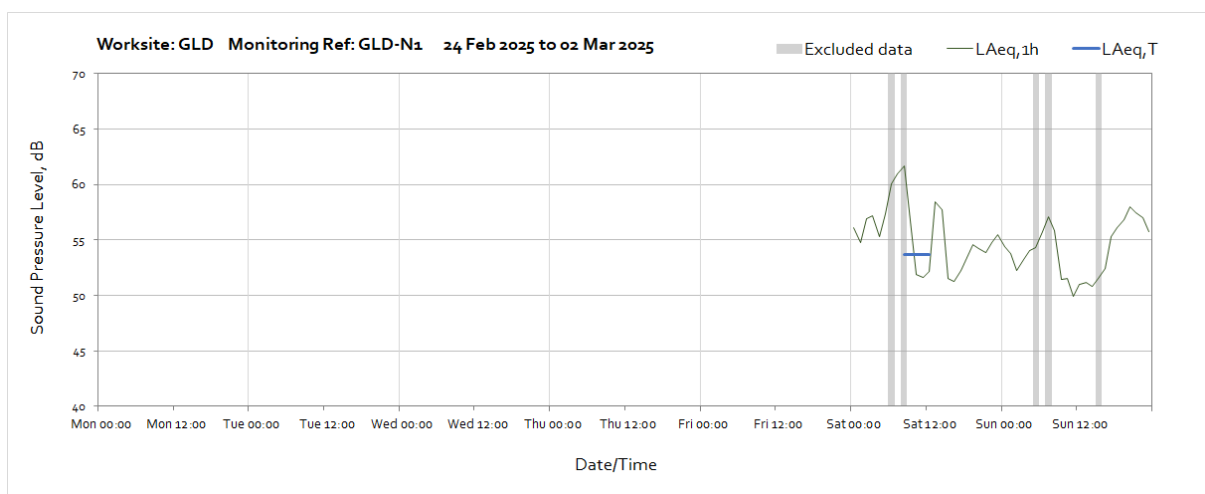

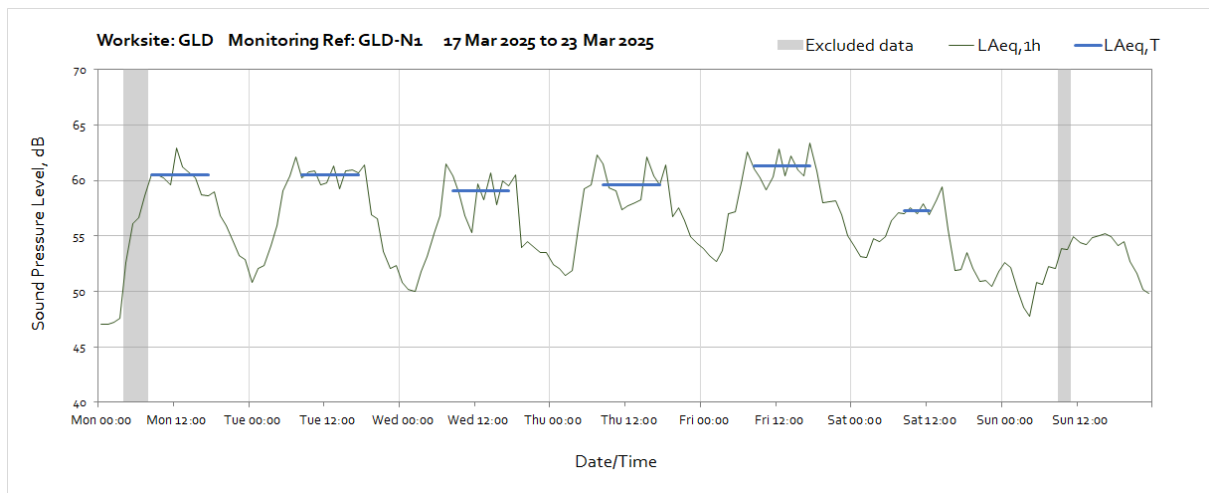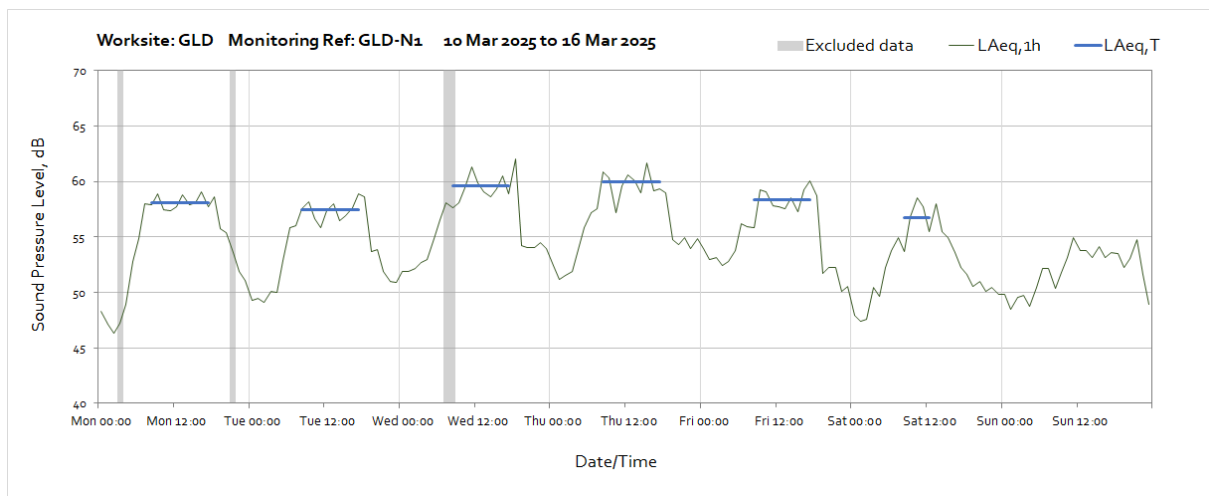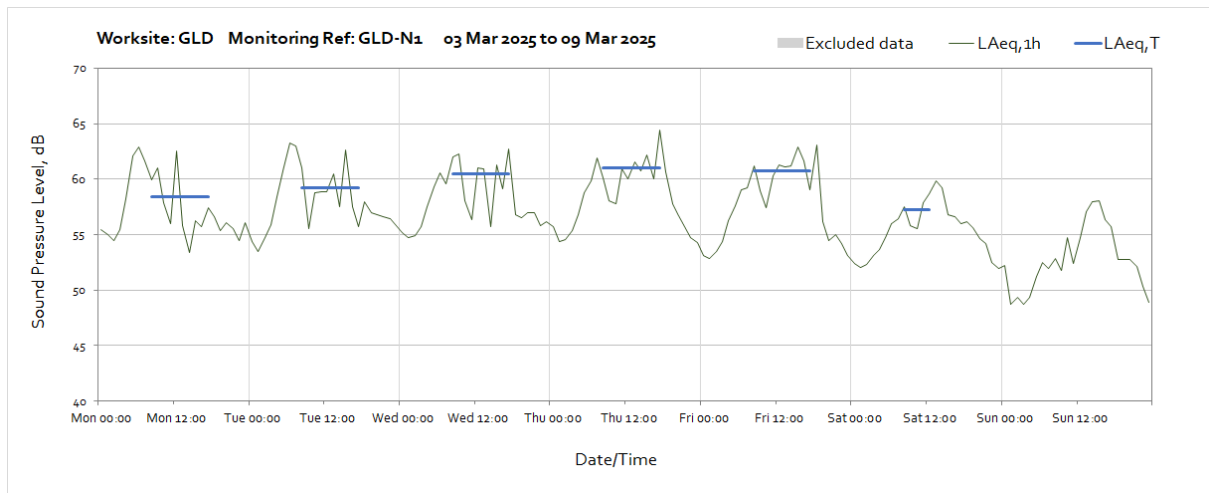




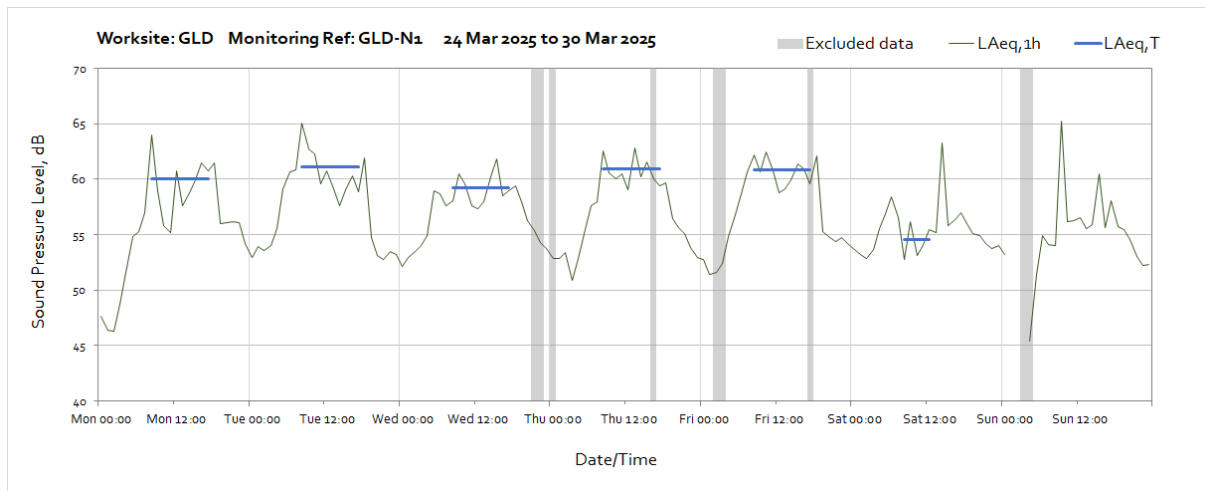



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

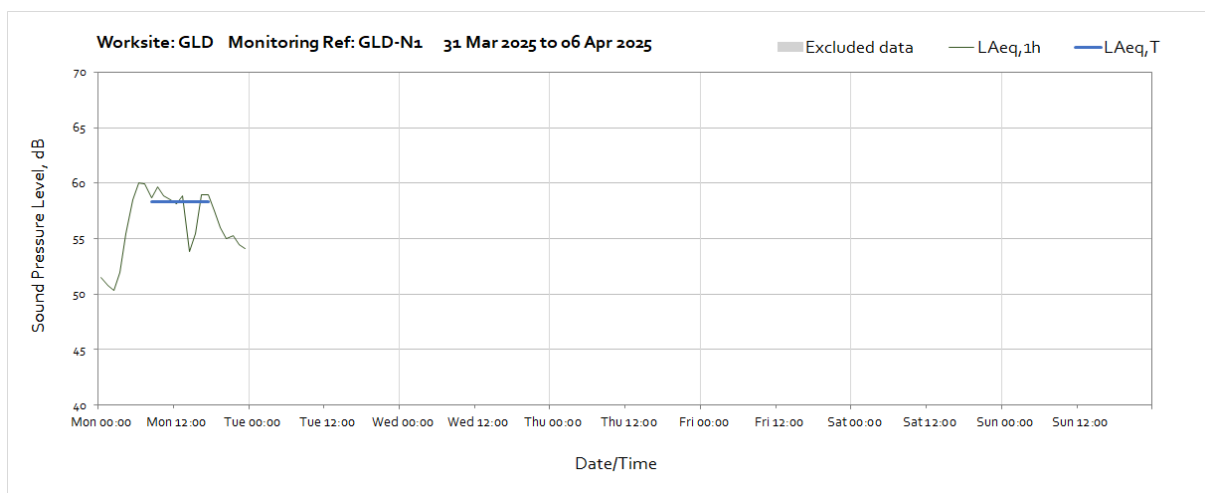


## Worksite: GLD - Monitoring Ref: CM-N1

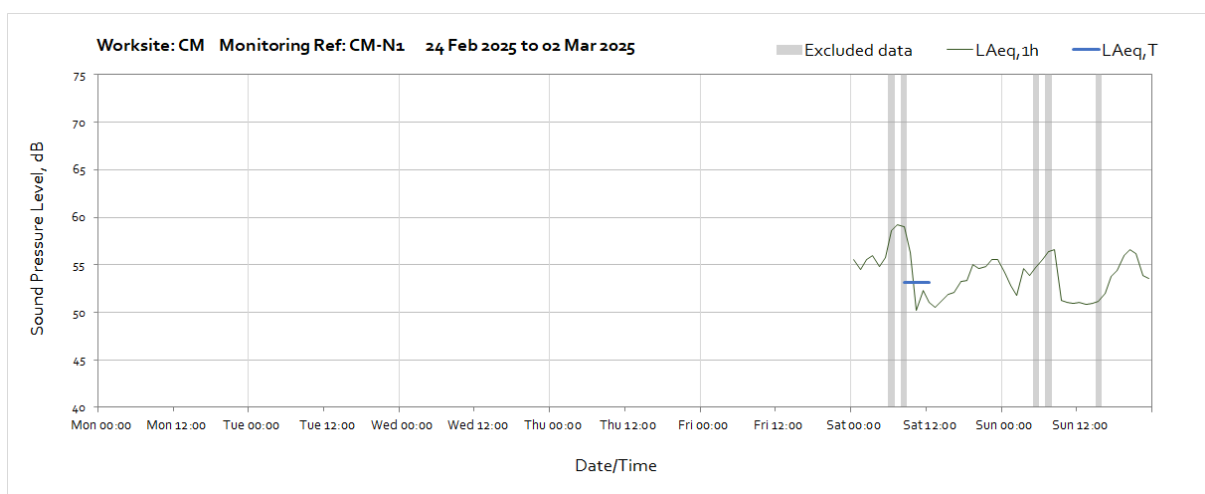

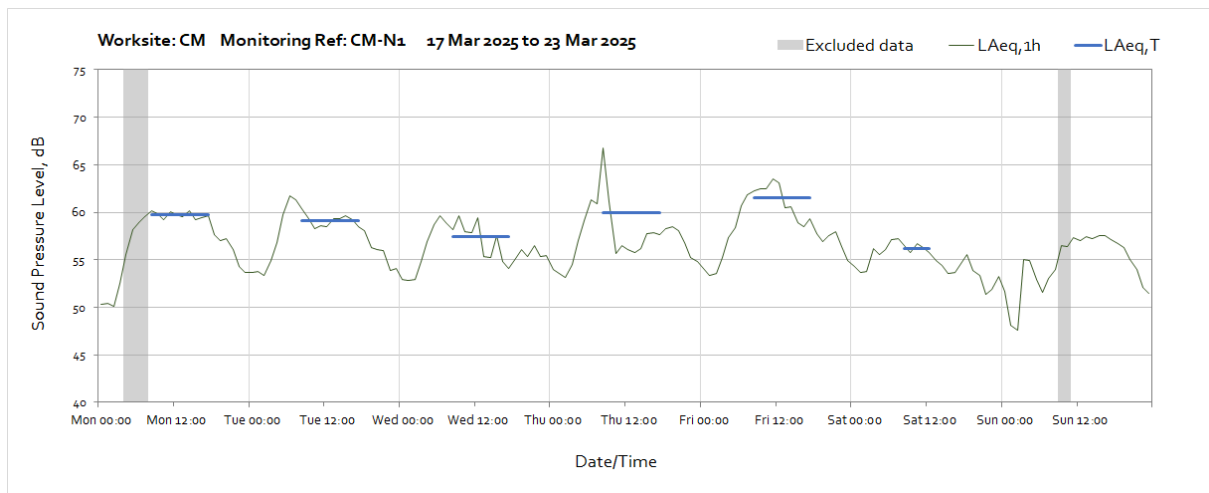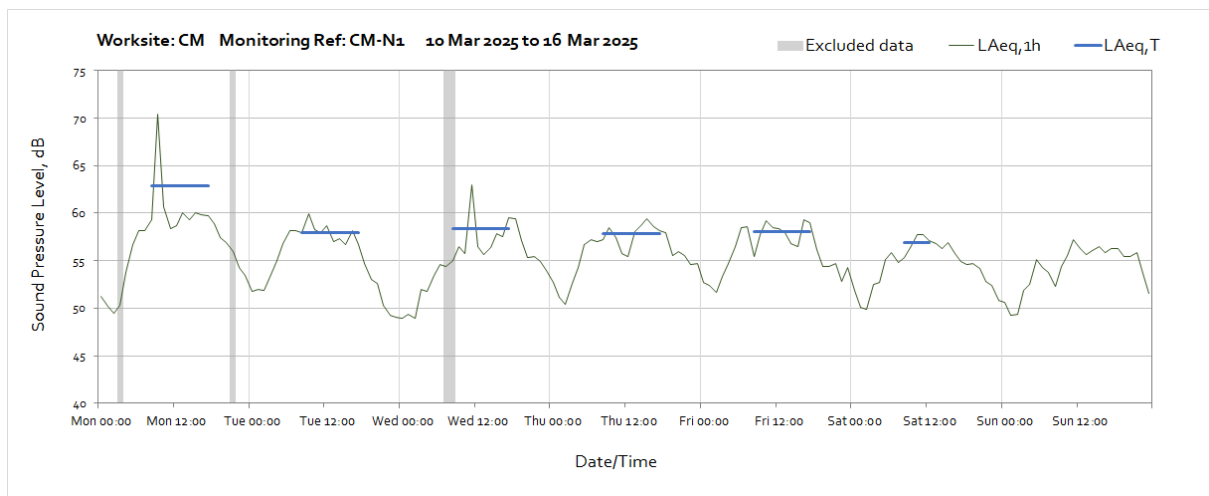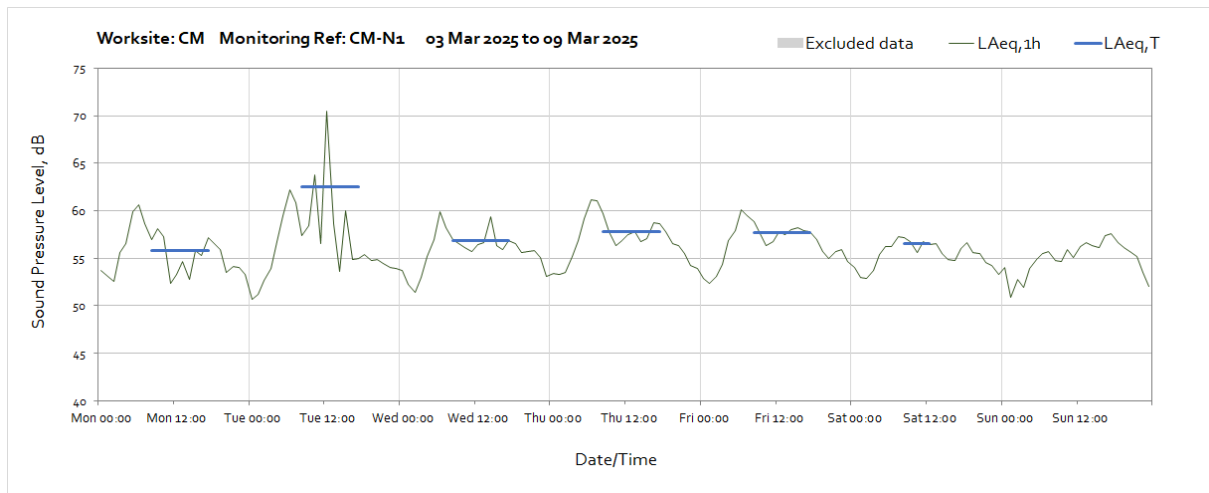




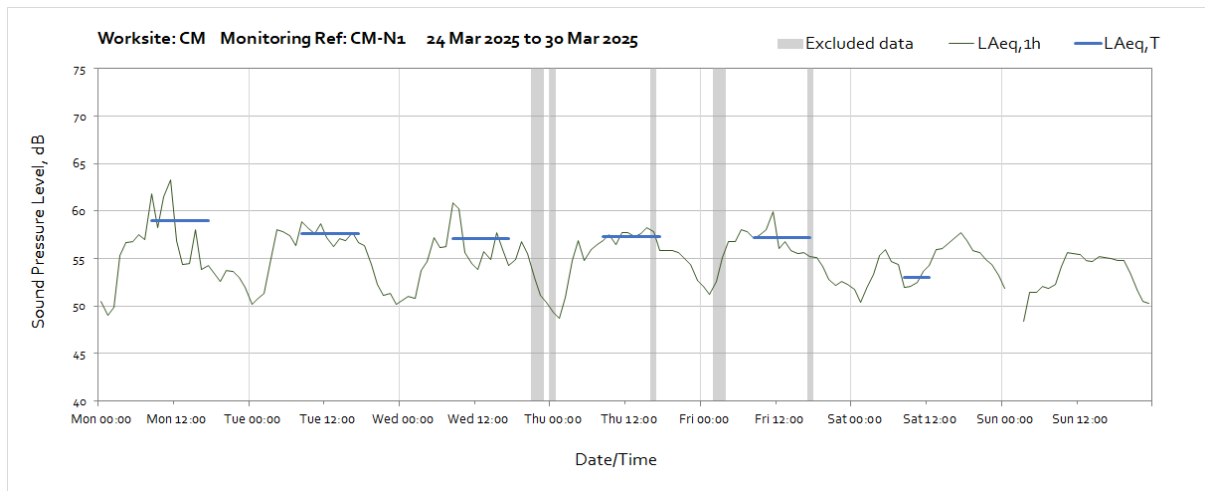



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

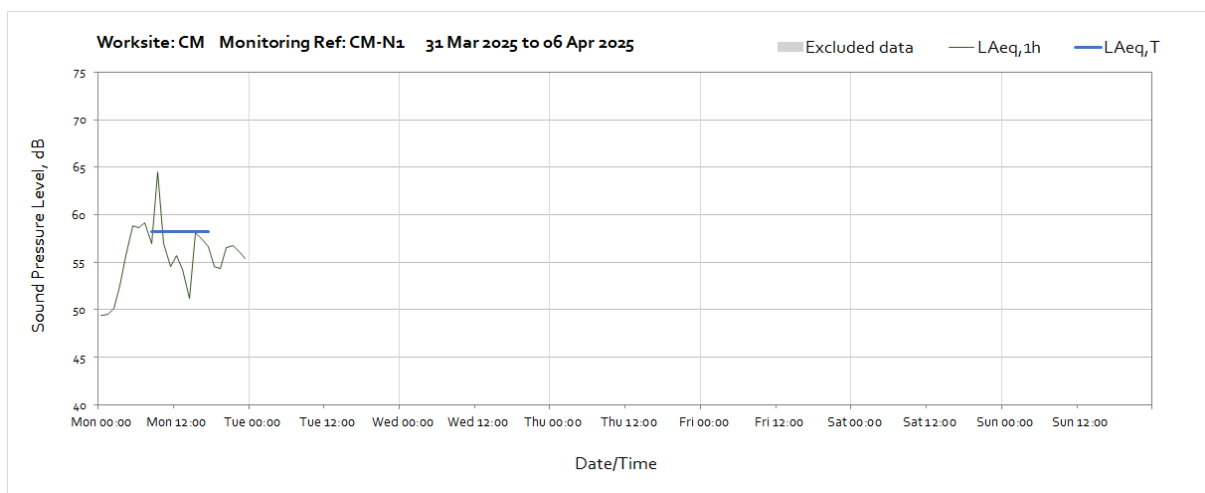


## Worksite: BRD - Monitoring Ref: BRD-N2

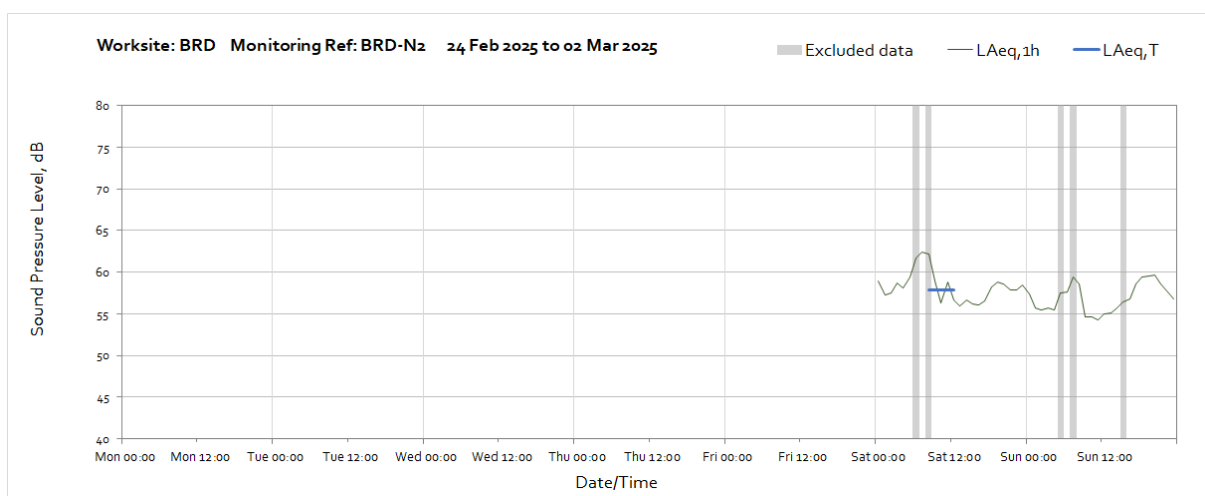

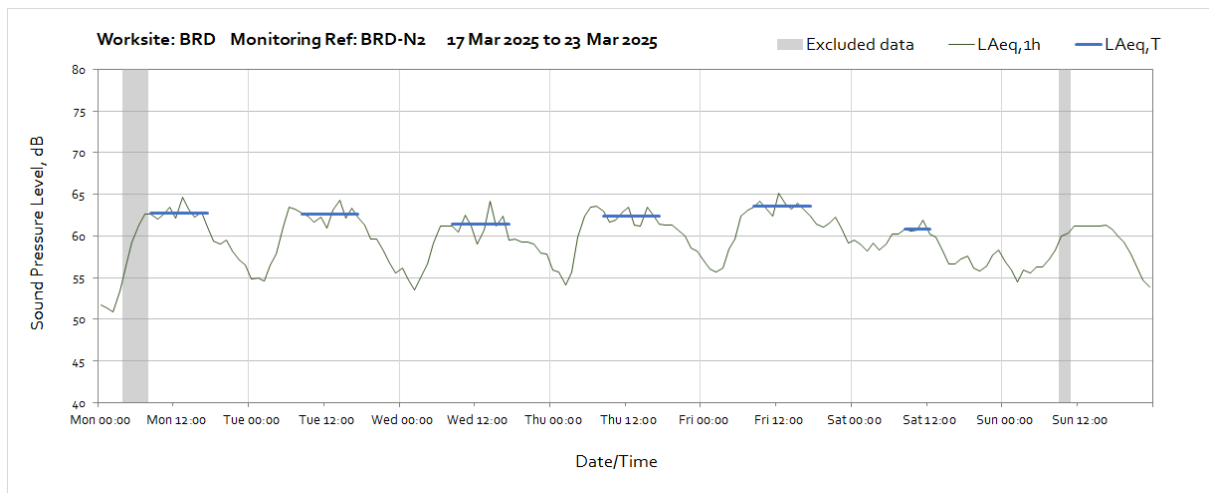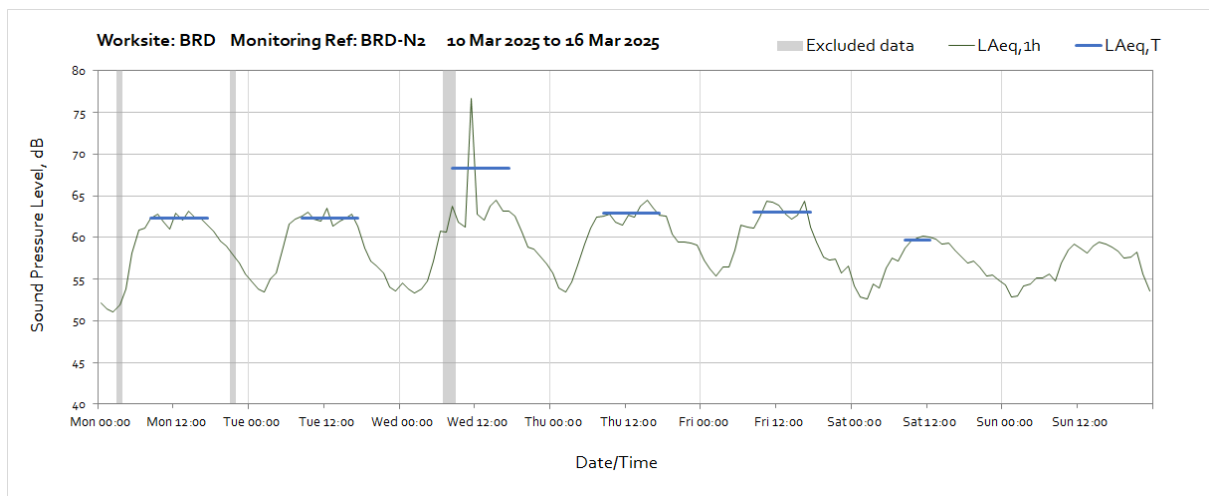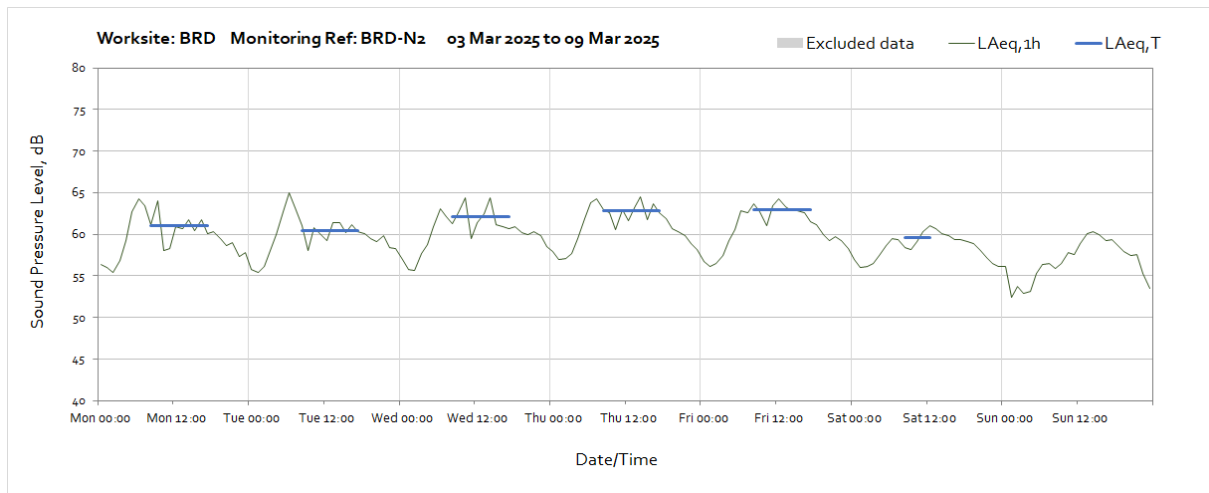




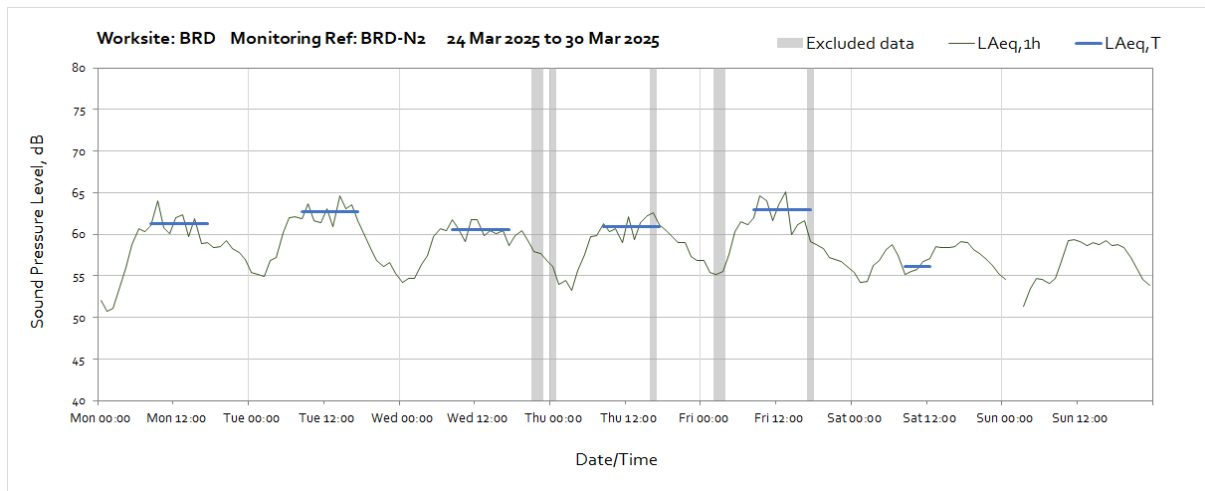


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

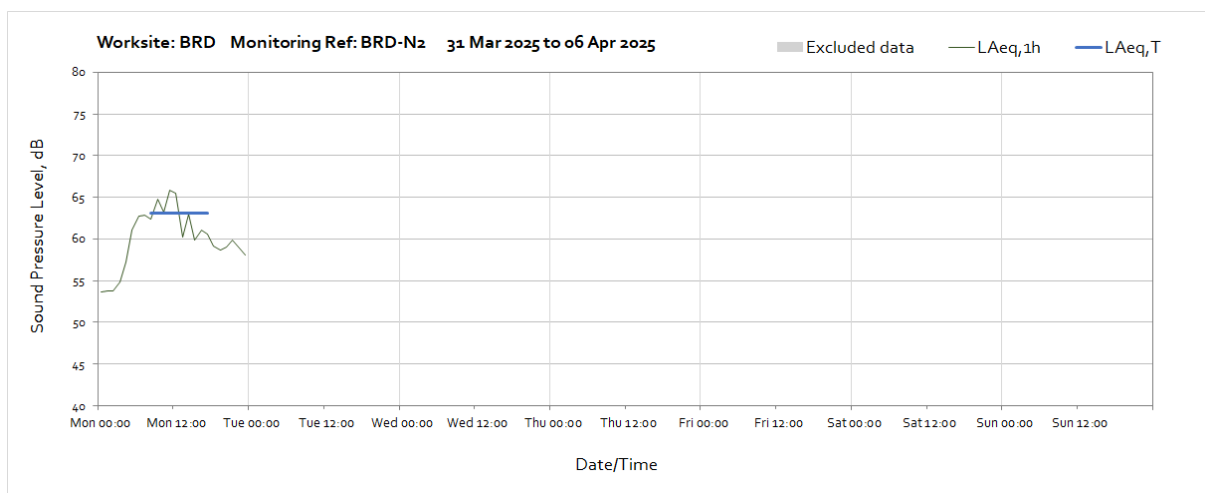


## Worksite: BRD - Monitoring Ref: BRD-N3

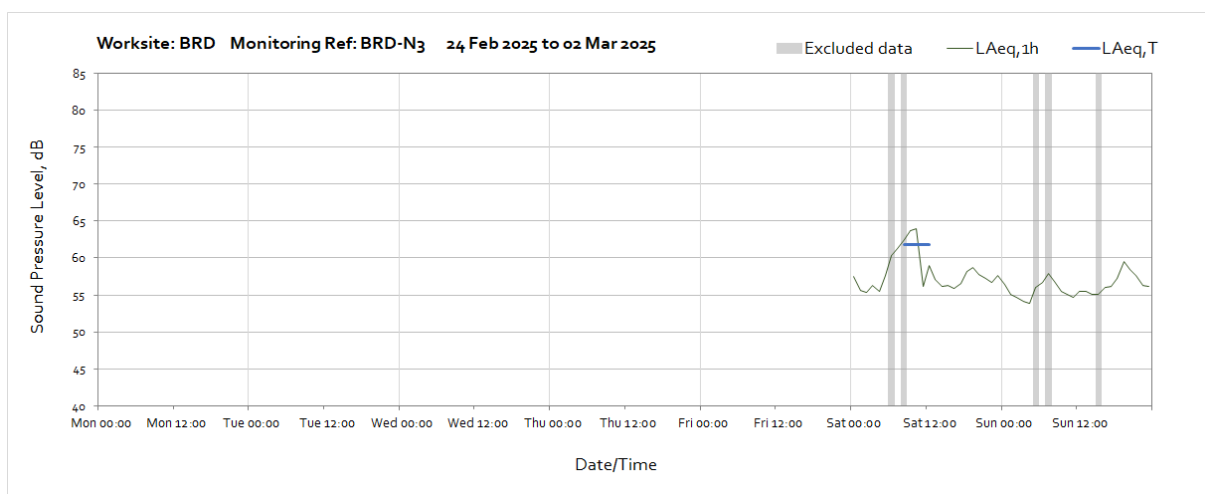


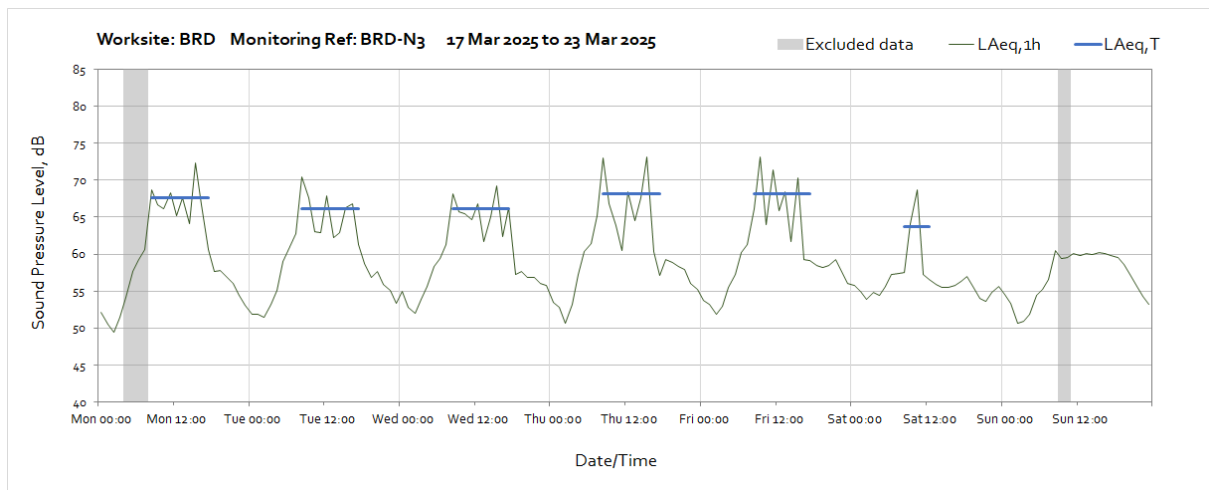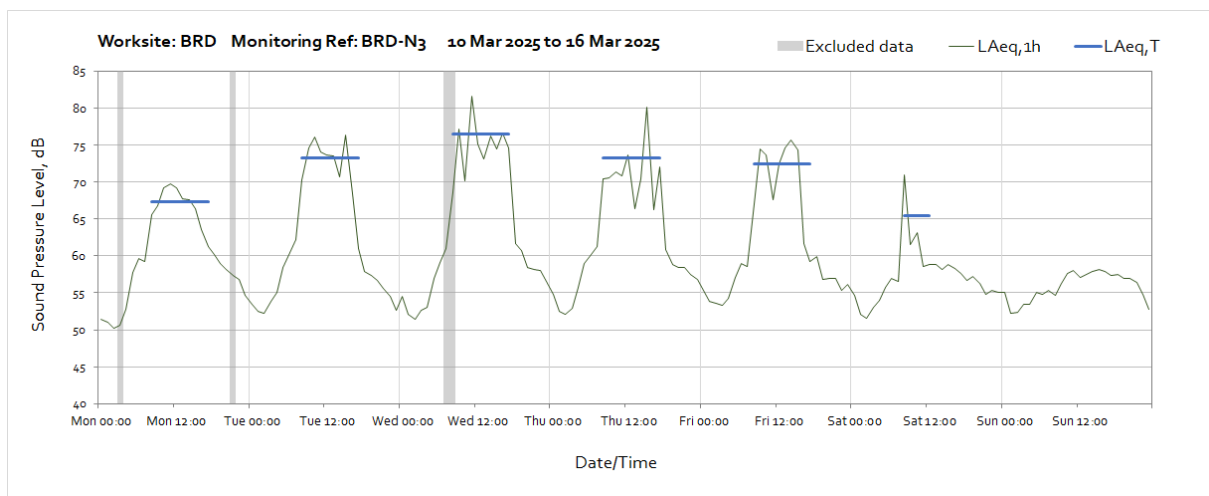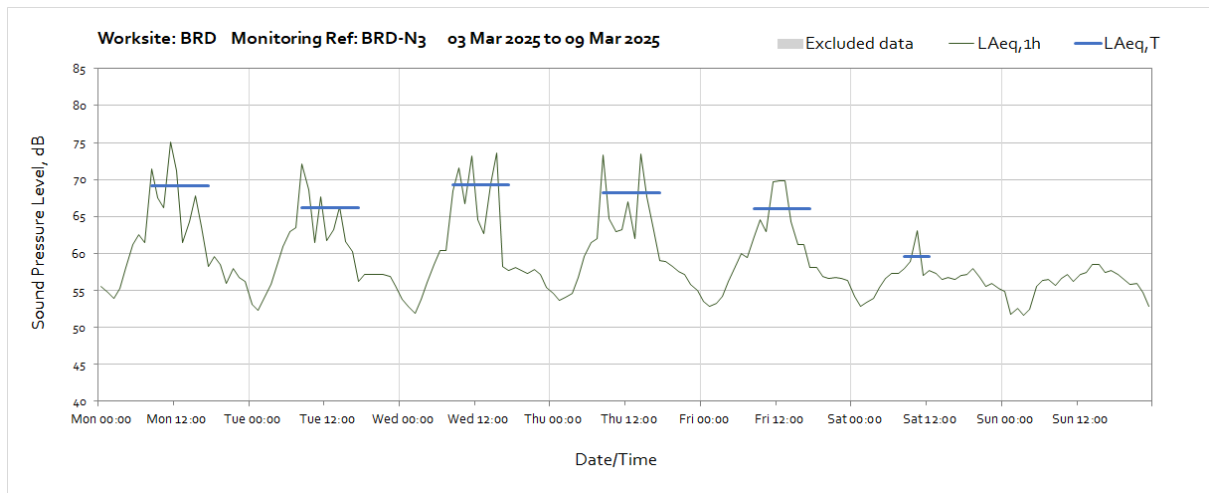



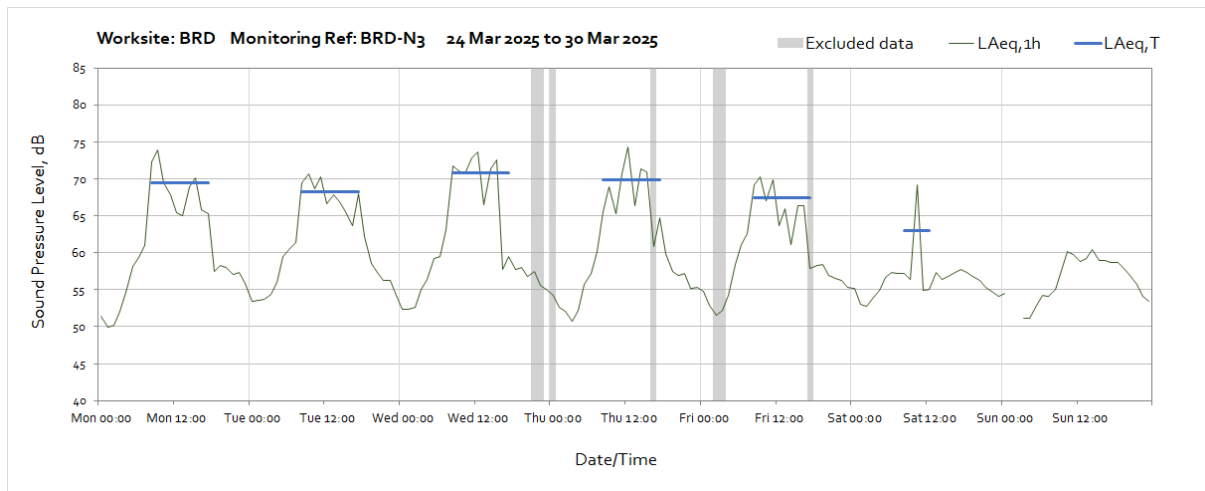



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

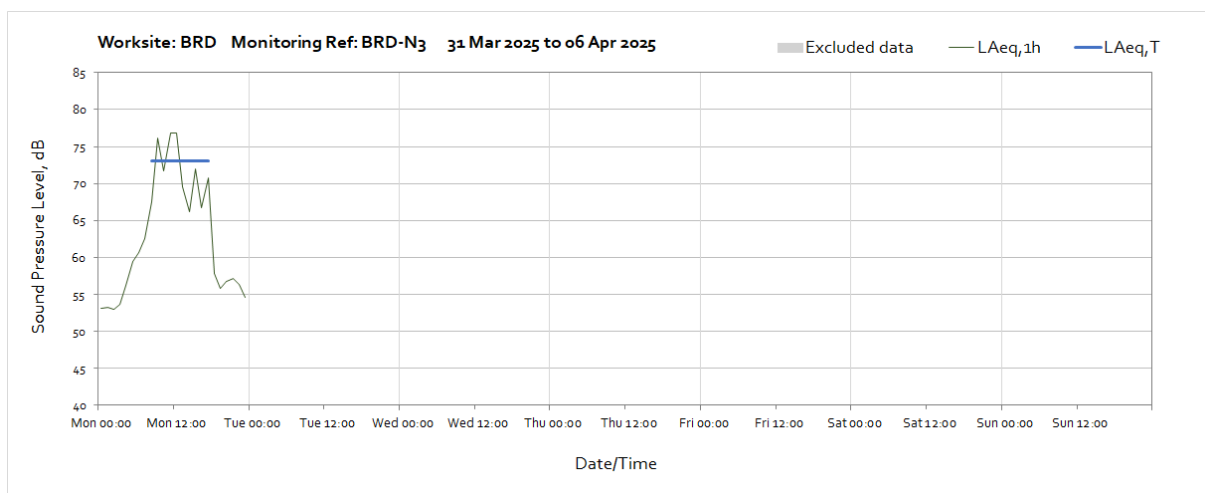


## Vibration

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.



### Worksite: BFCV – Monitoring Ref: BFCV-V4


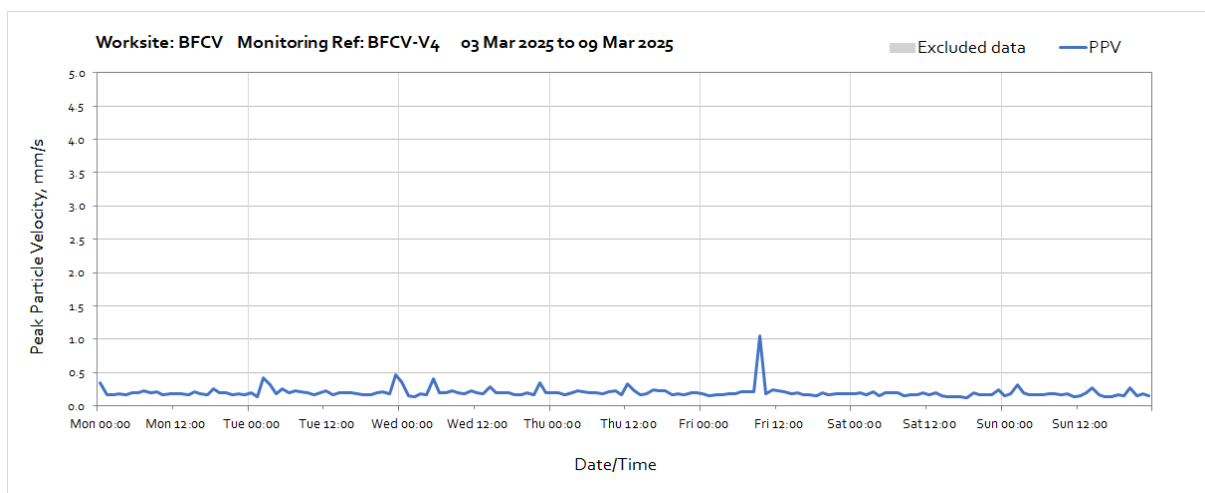
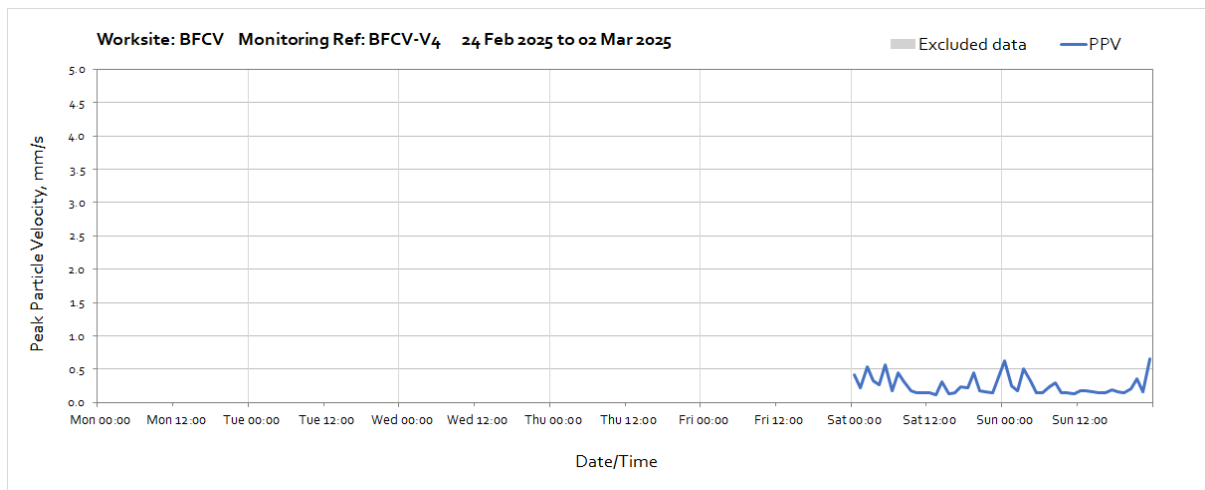


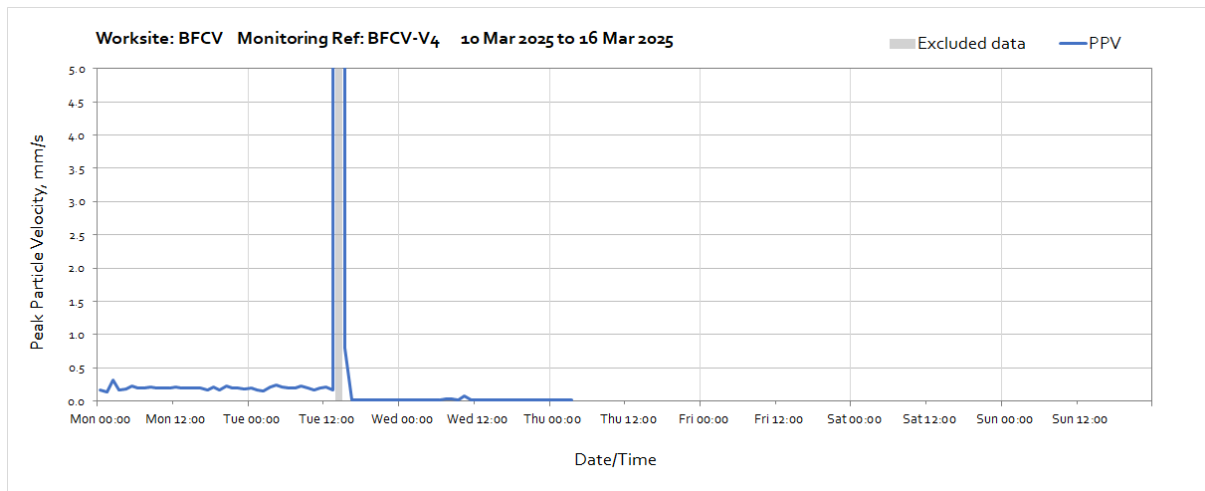

Note: Missing data 04:00 on Thursday 13<sup>th</sup> March until 10:00 on Tuesday 18<sup>th</sup> March was due to tampering of the monitoring station. Missing data from 10:00 on Tuesday 18<sup>th</sup> March was due to decommissioning of the monitoring station.


### Worksite: MB – Monitoring Ref: MB-V1

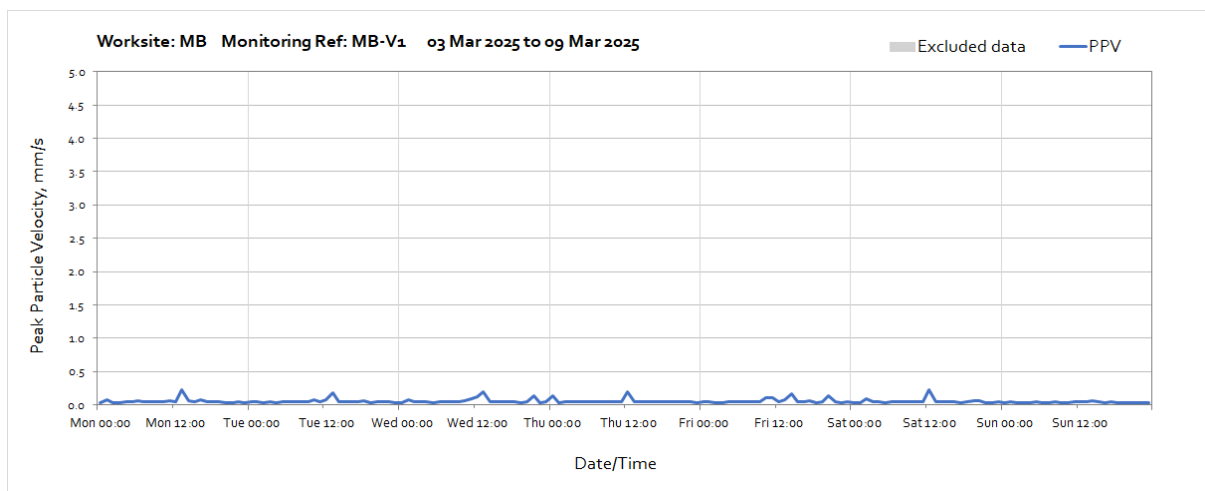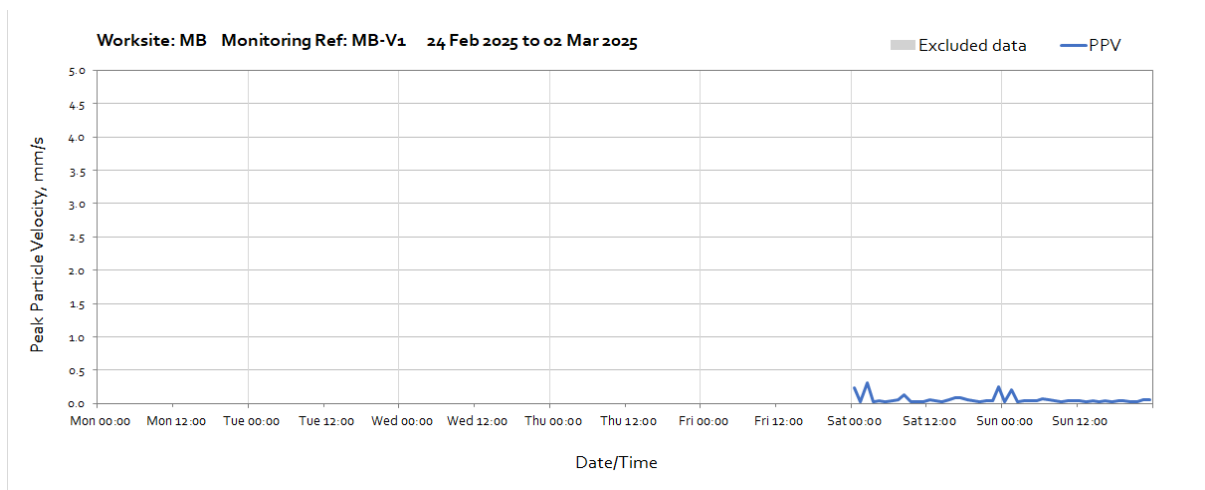

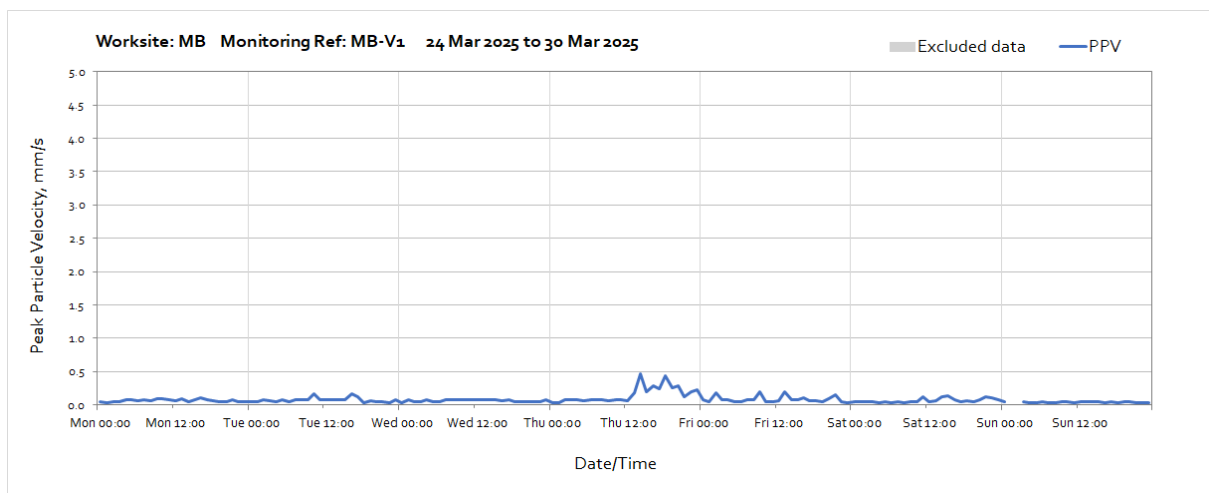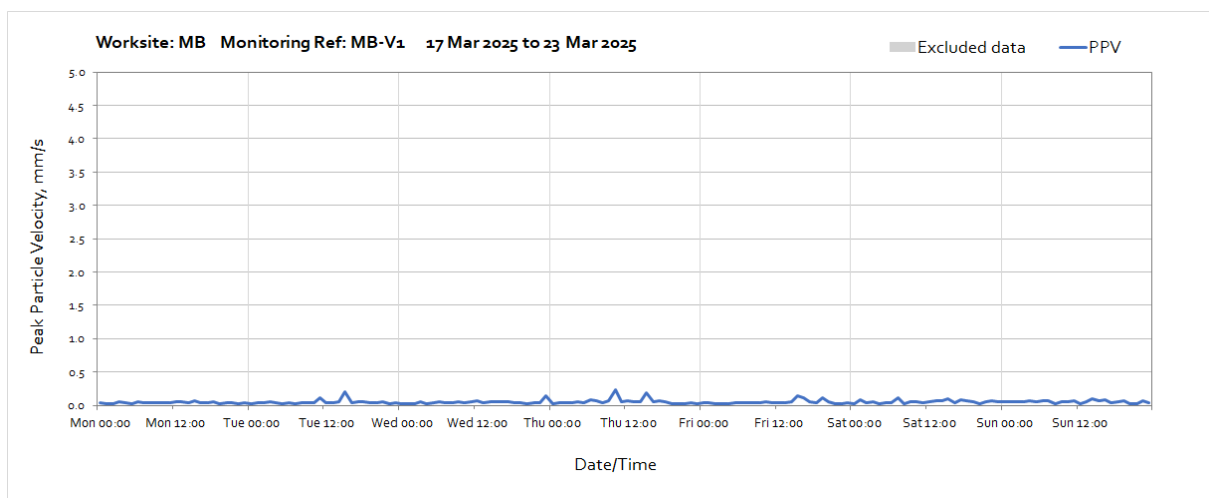
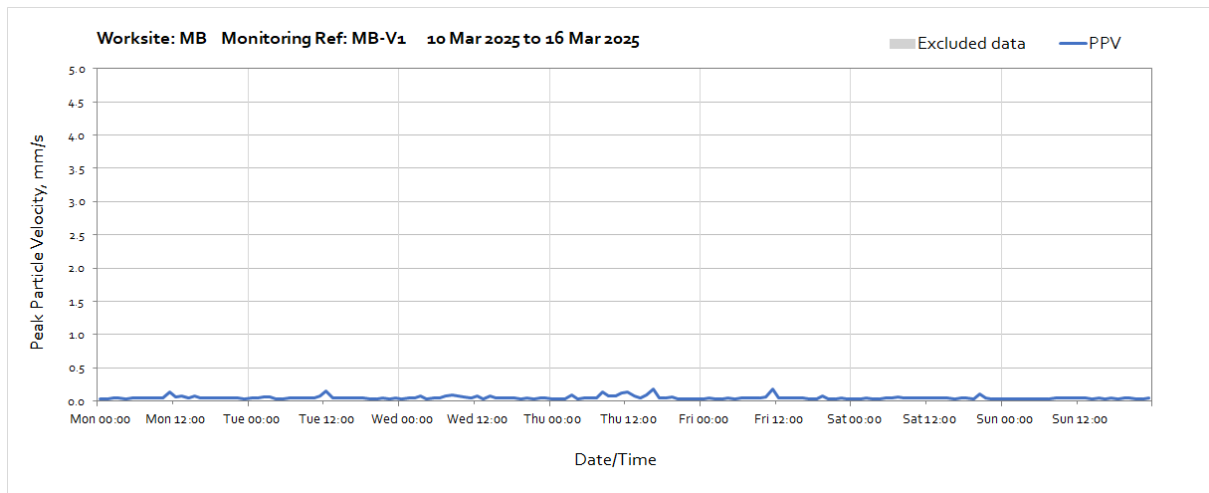


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.




OFFICIAL

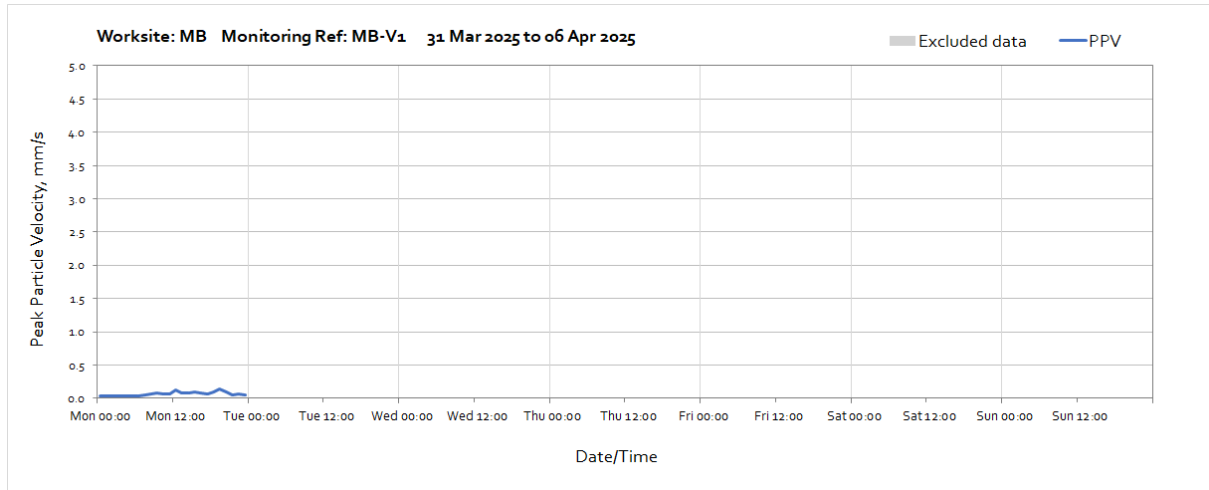

## Worksite: FAEU – Monitoring Ref: FAEU-V1

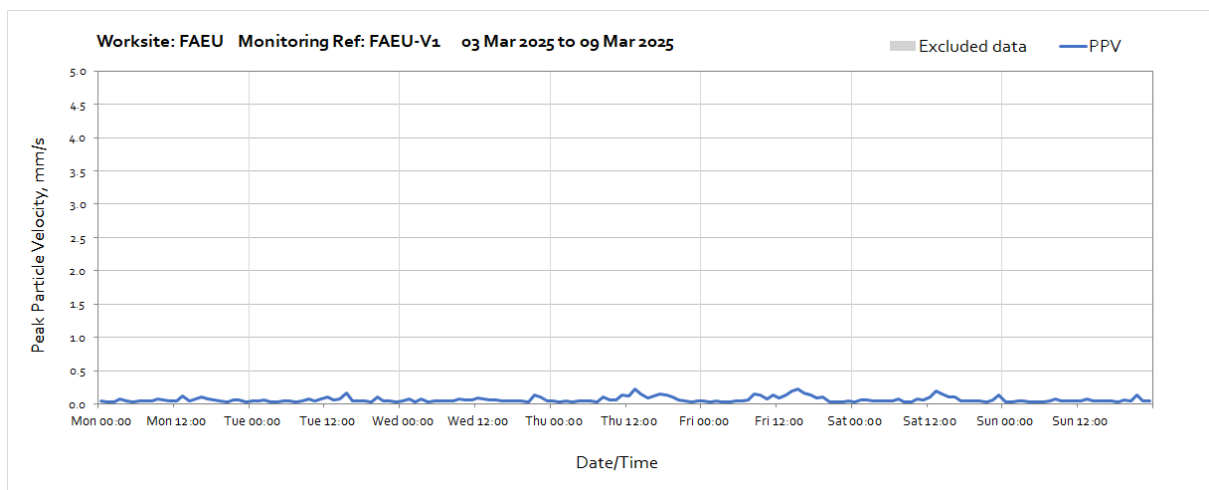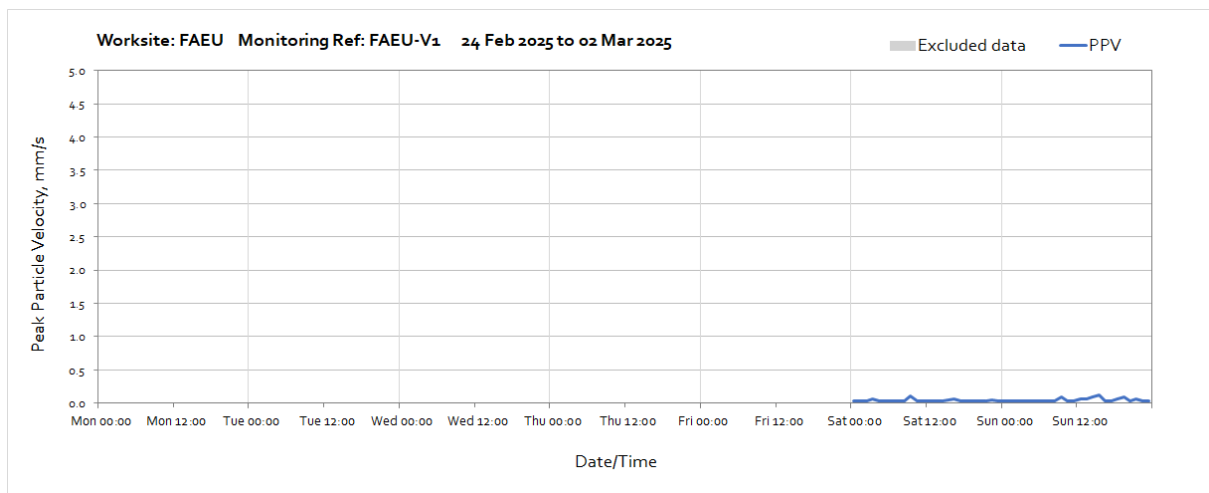


OFFICIAL

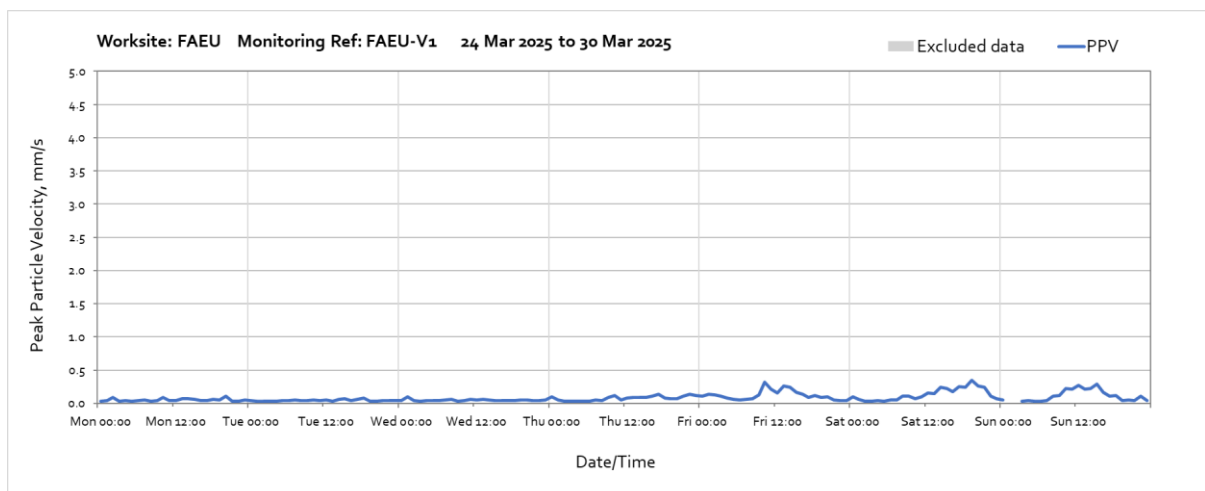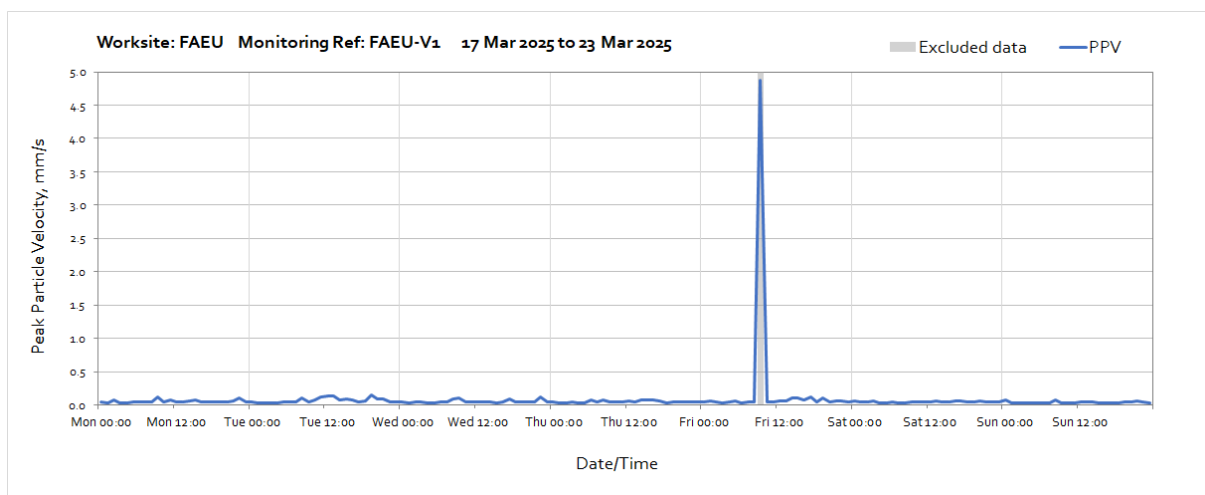
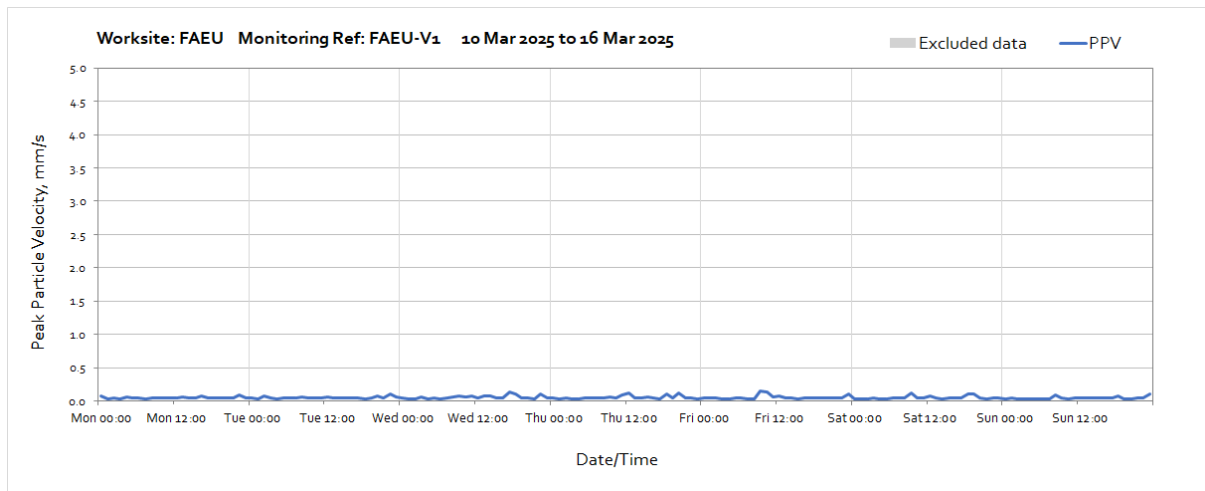




Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

OFFICIAL

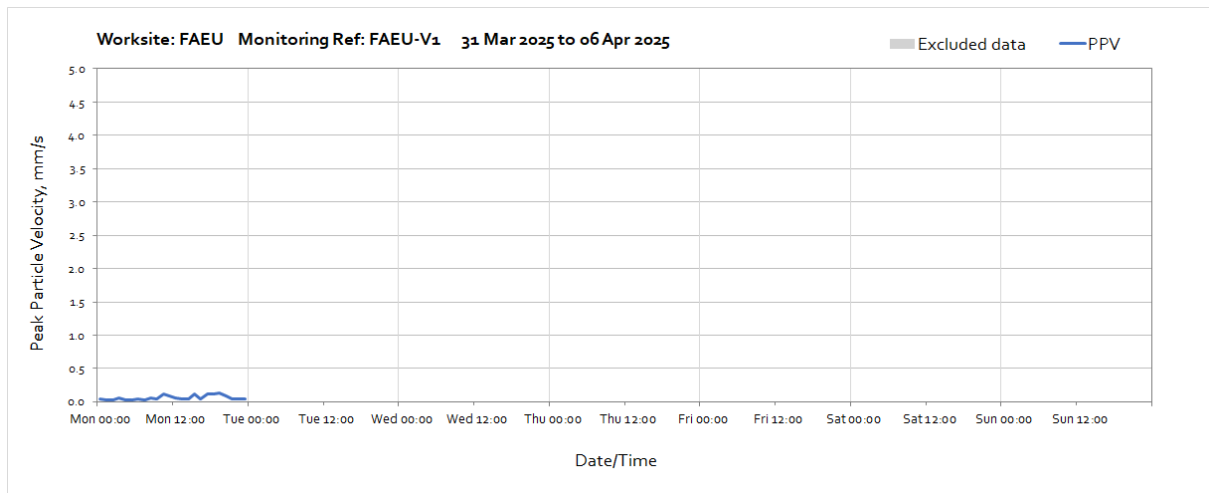

## Worksite: ALO – Monitoring Ref: ALO-V1

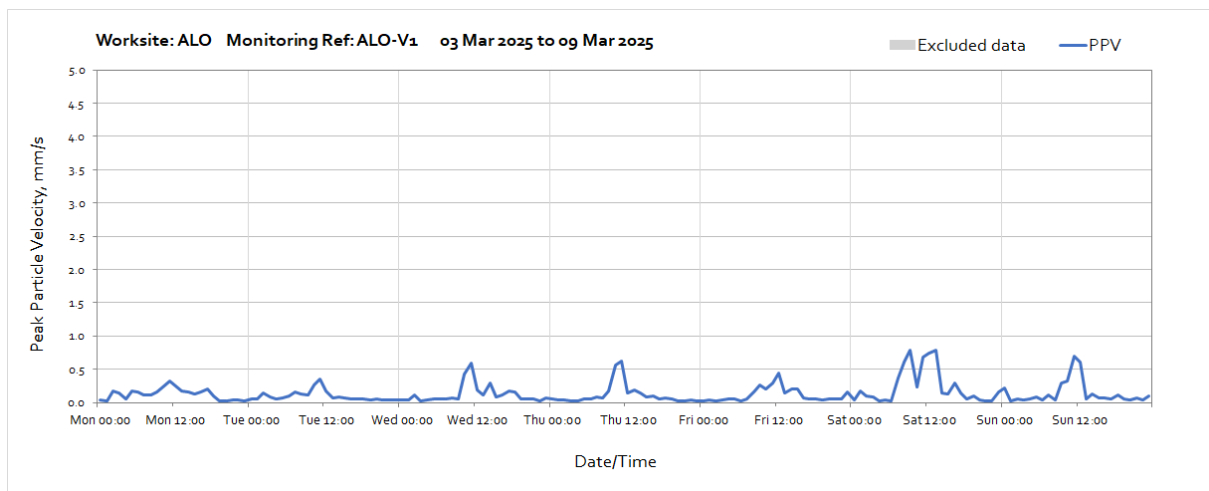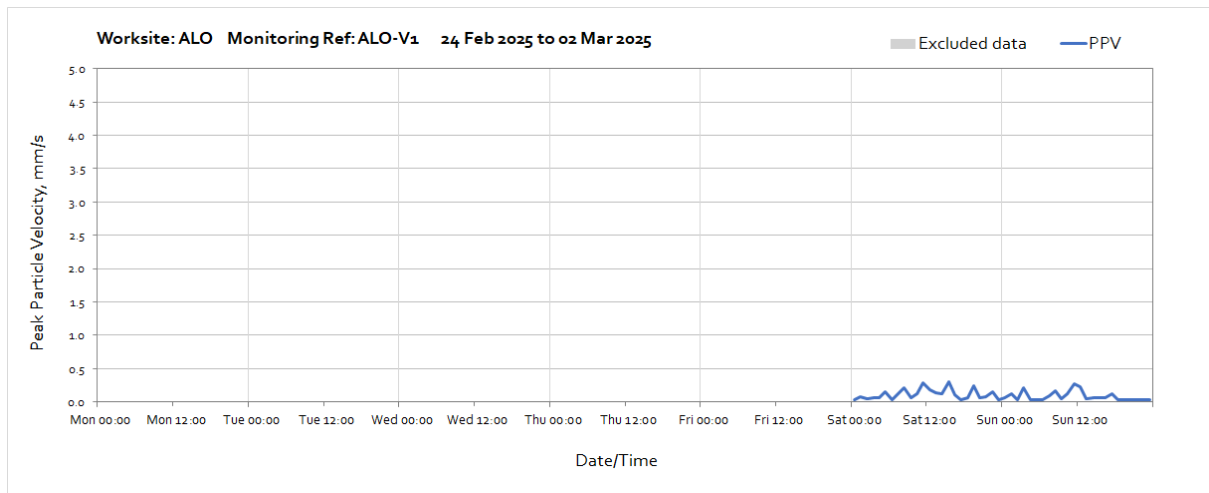


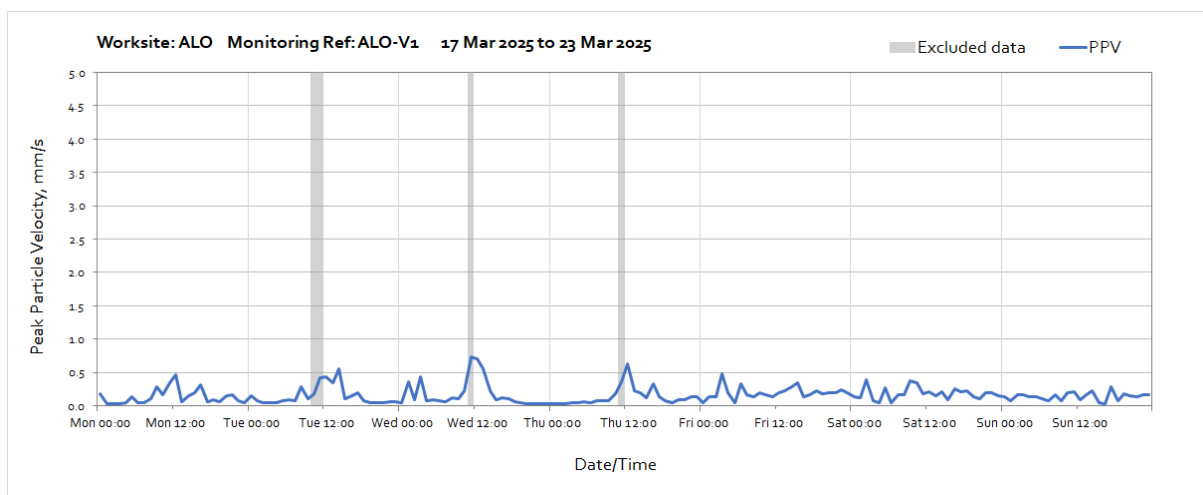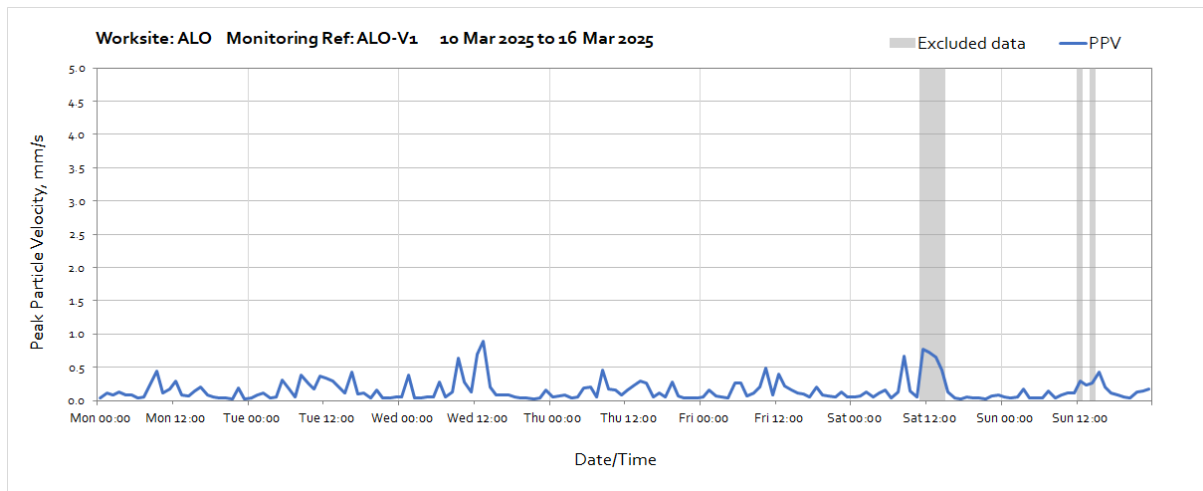



Note: Missing data between 13:00 and 14:00 on Wednesday 26<sup>th</sup> March was due to intermittent signal loss to the monitoring station. Missing data between 01:00 and 03:00 on Sunday 30<sup>th</sup> March is due to a monitor time adjustment at the start of British Summer Time.




OFFICIAL



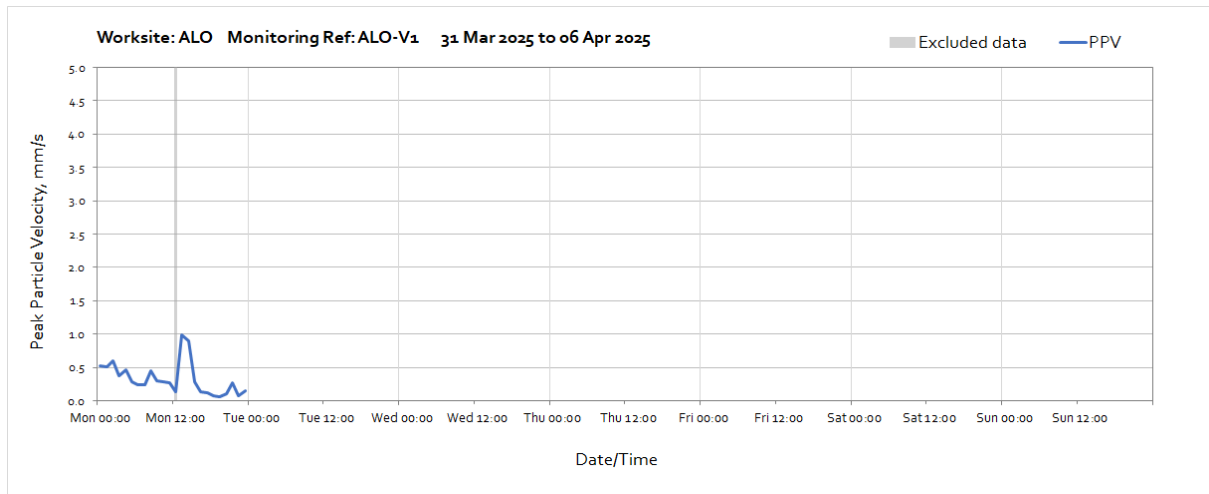


## Worksite: ALO – Monitoring Ref: ALO-V5

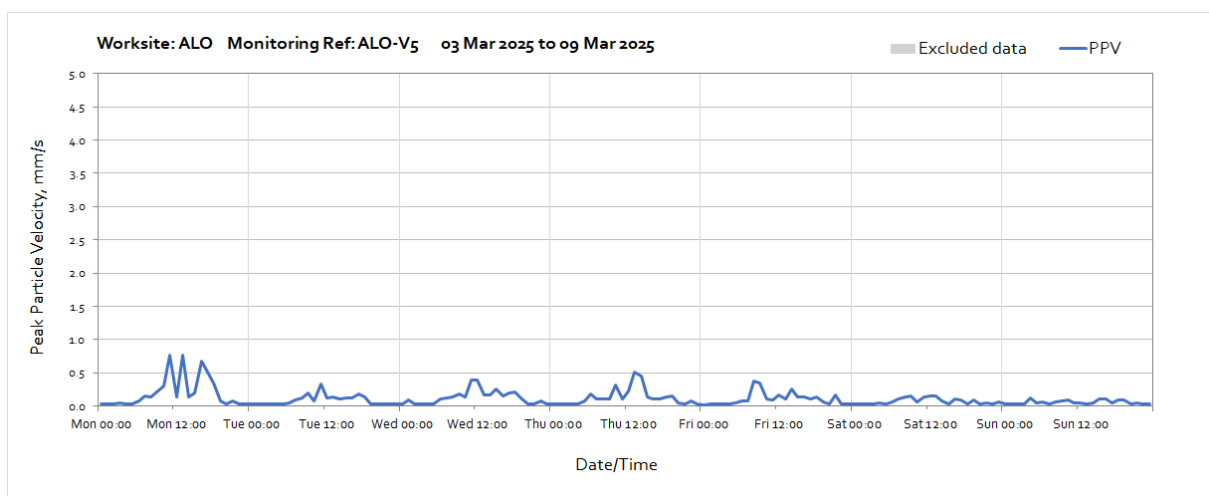
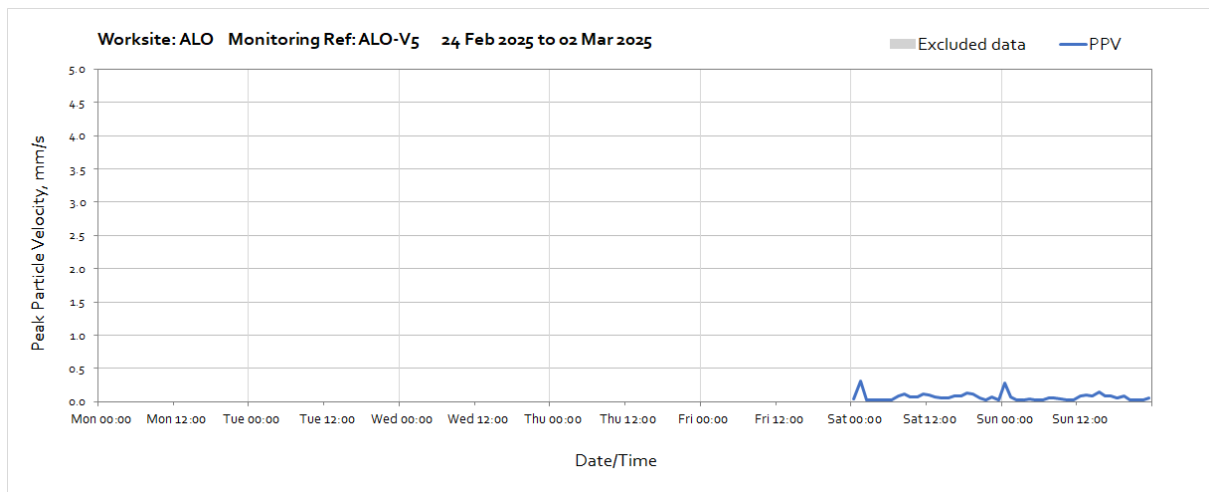


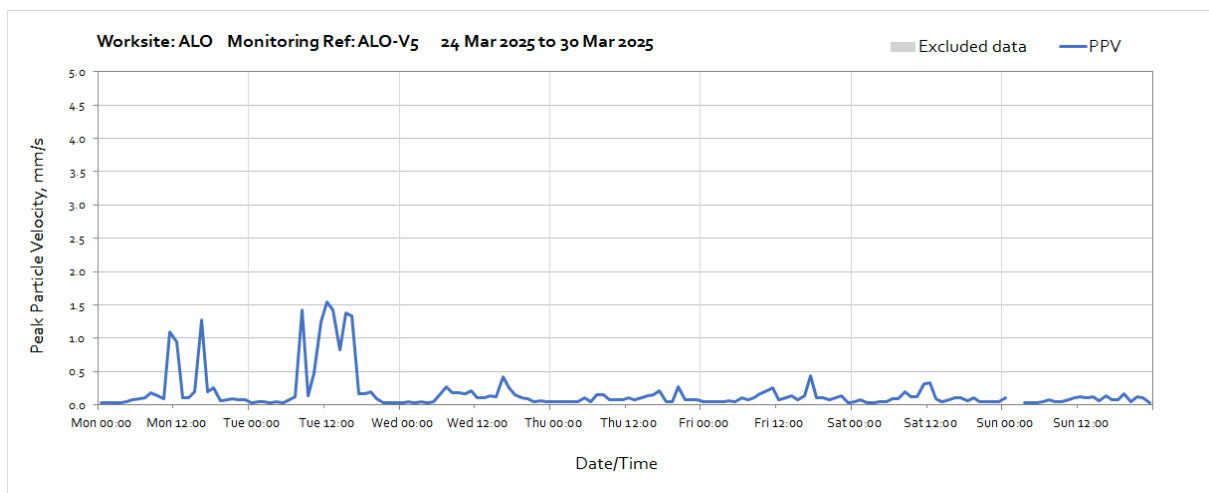
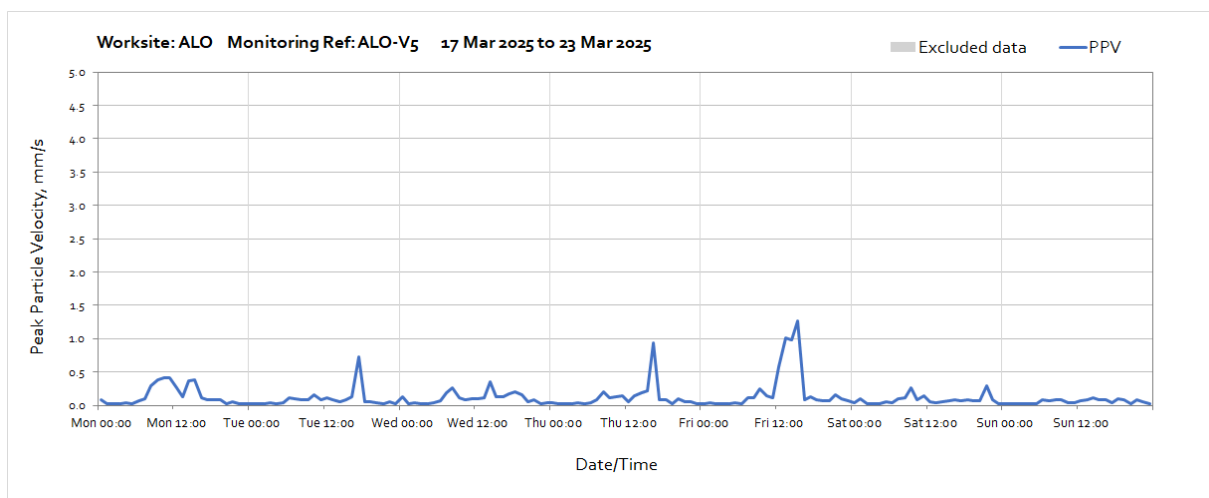
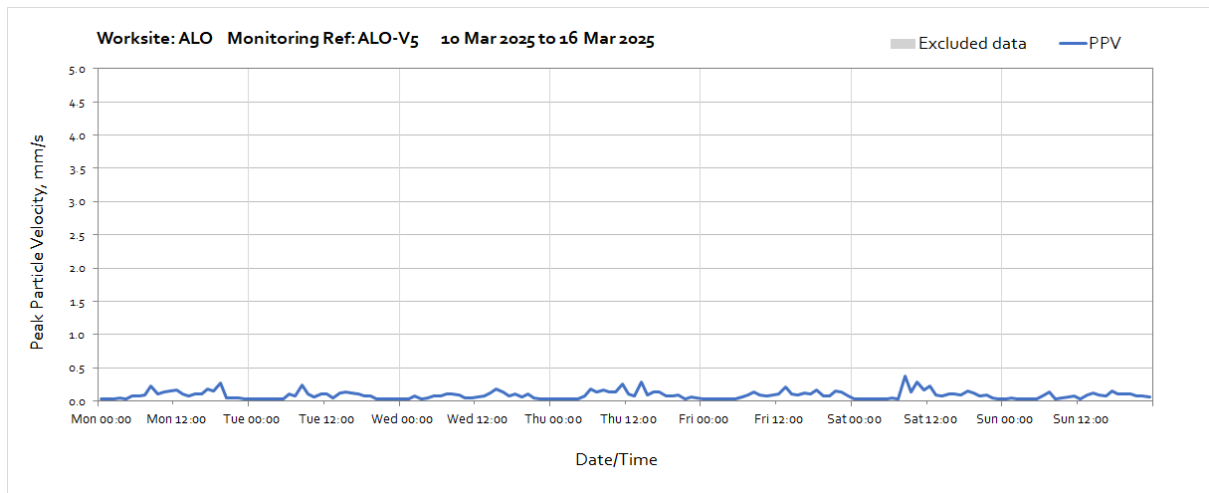


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

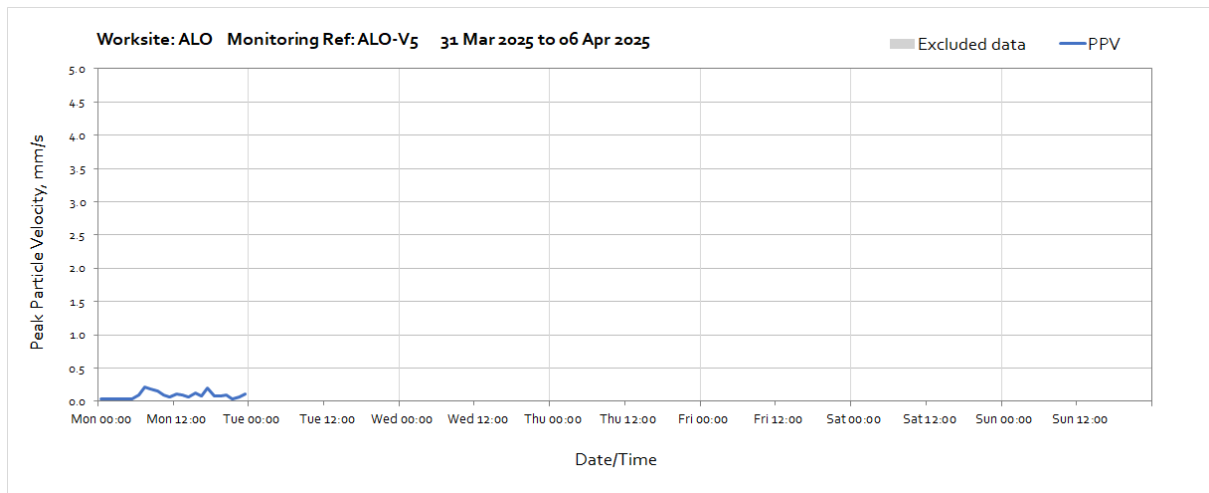


## Worksite: ALO – Monitoring Ref: AFE-V1

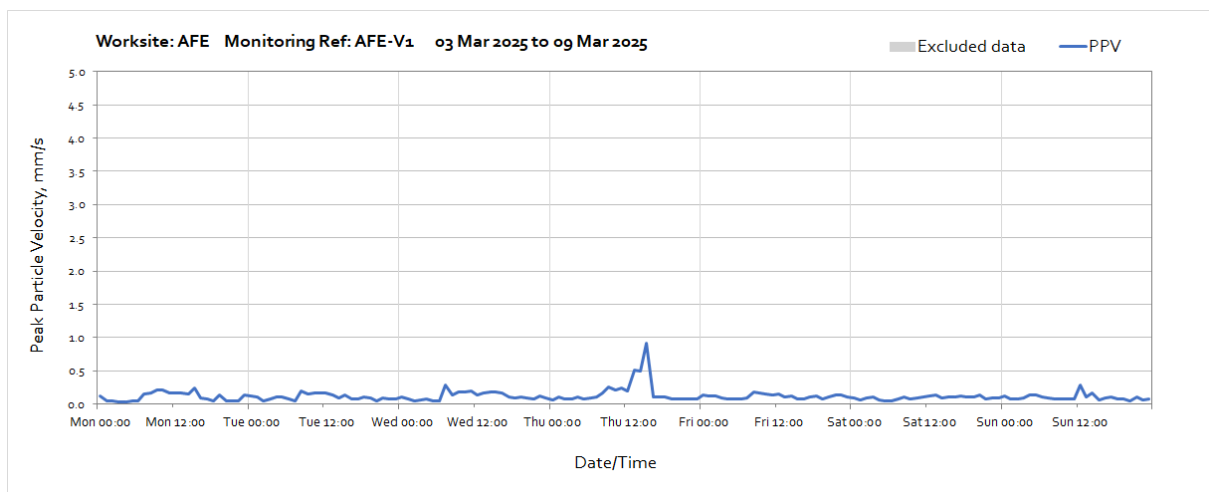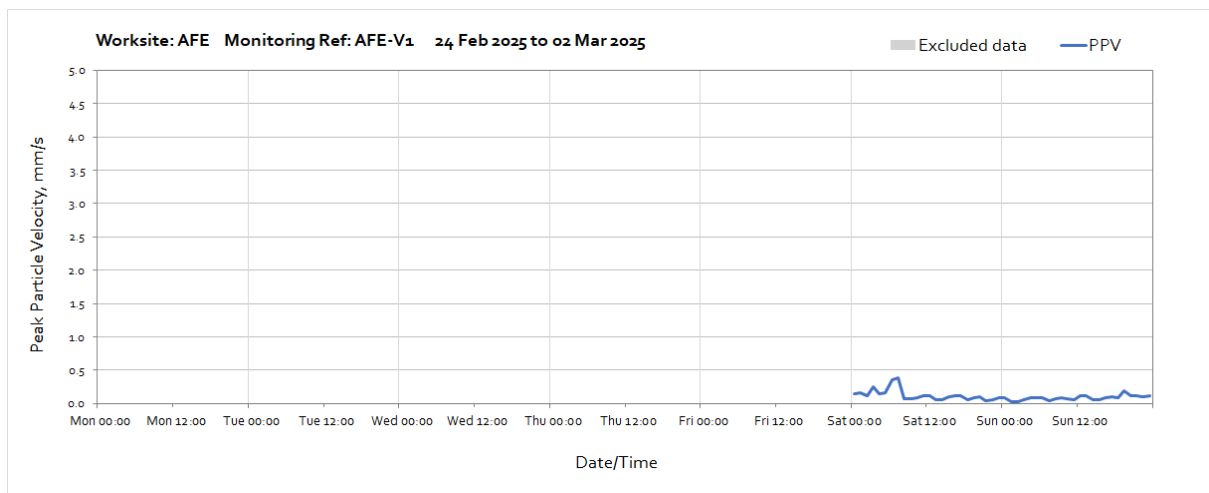

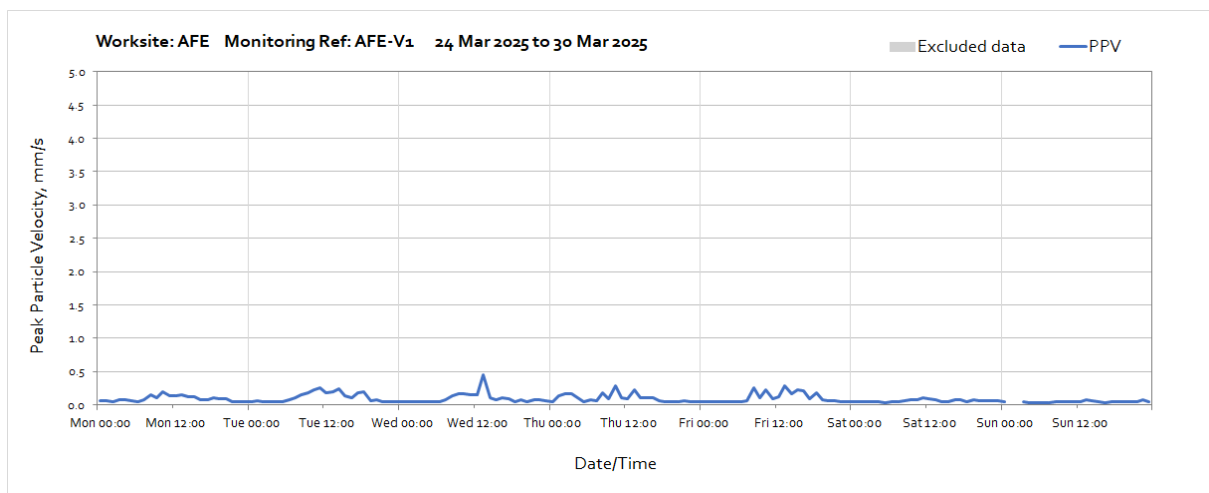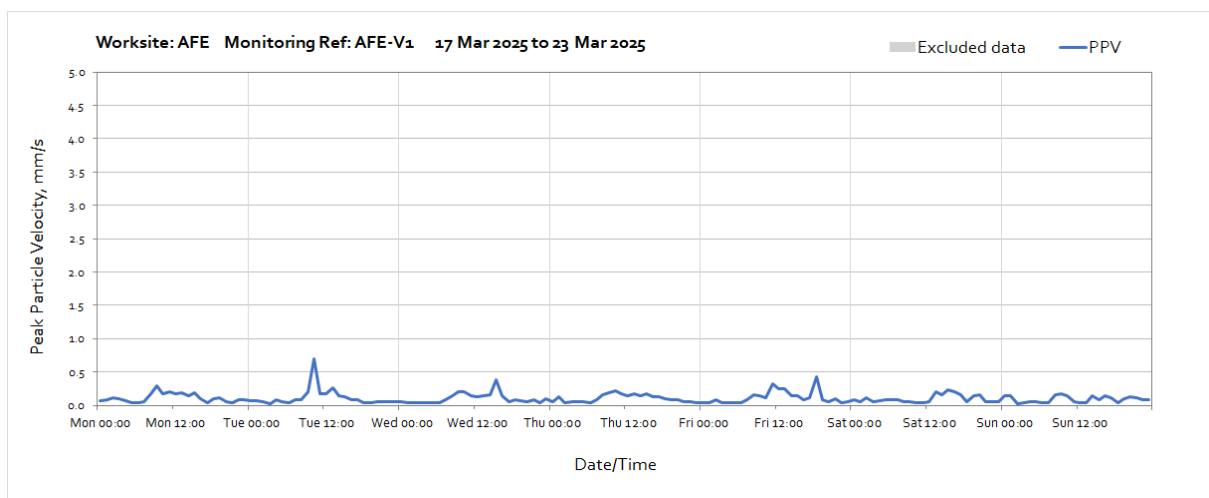
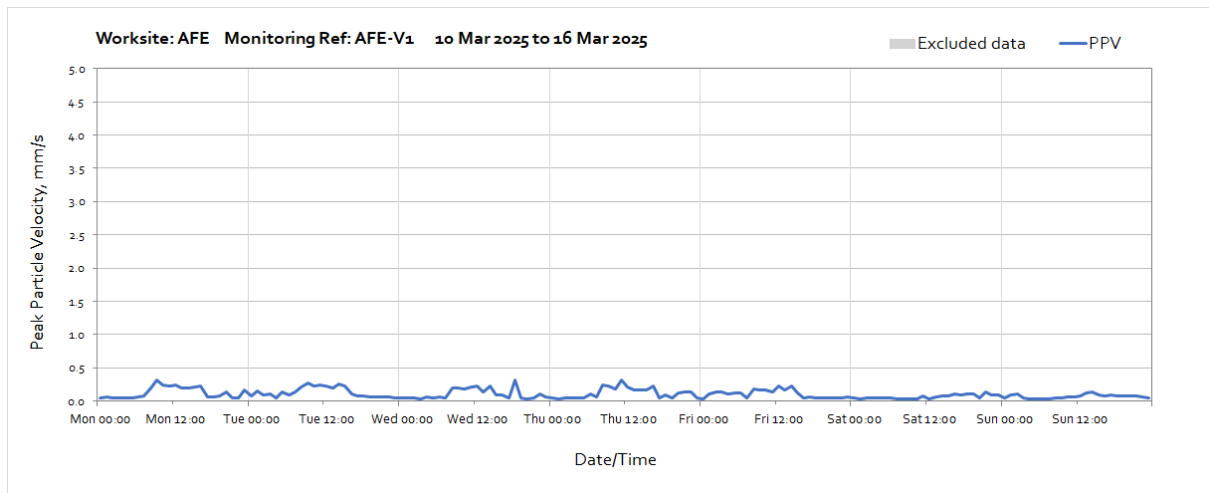



Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

OFFICIAL

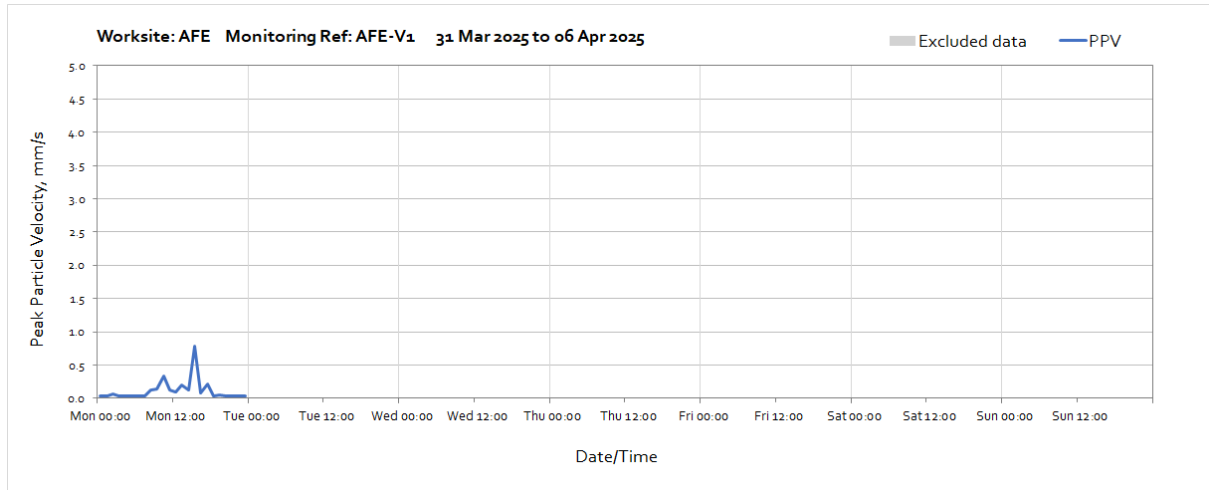


## Worksite: GE – Monitoring Ref: GE-V1

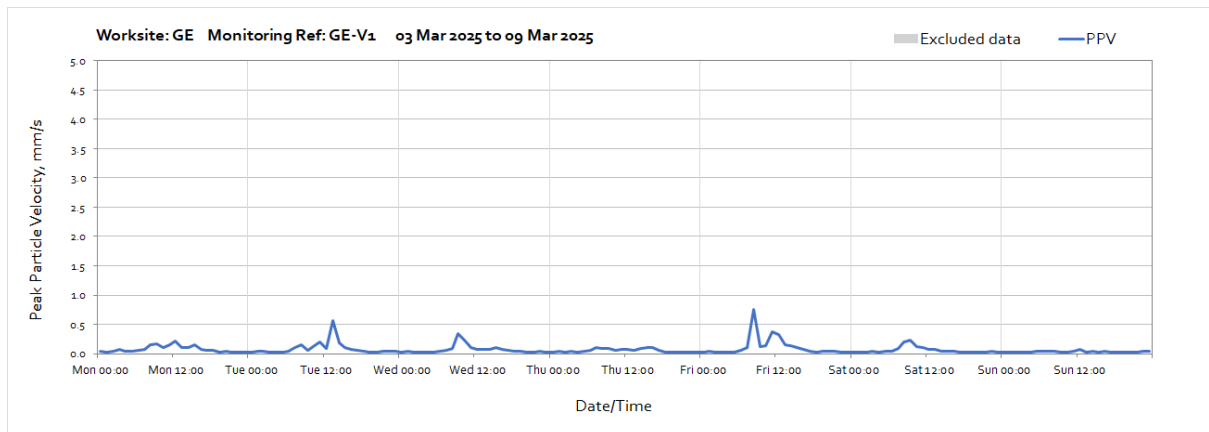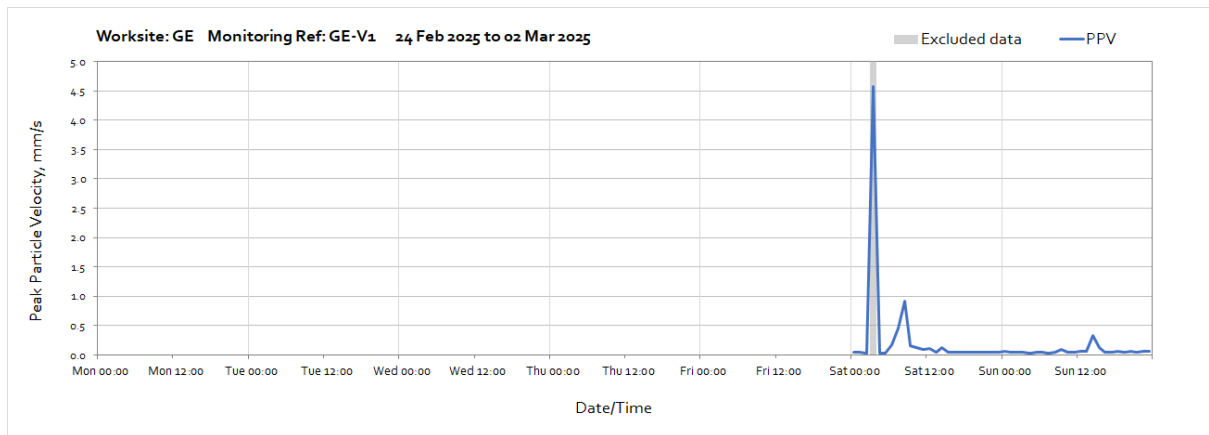


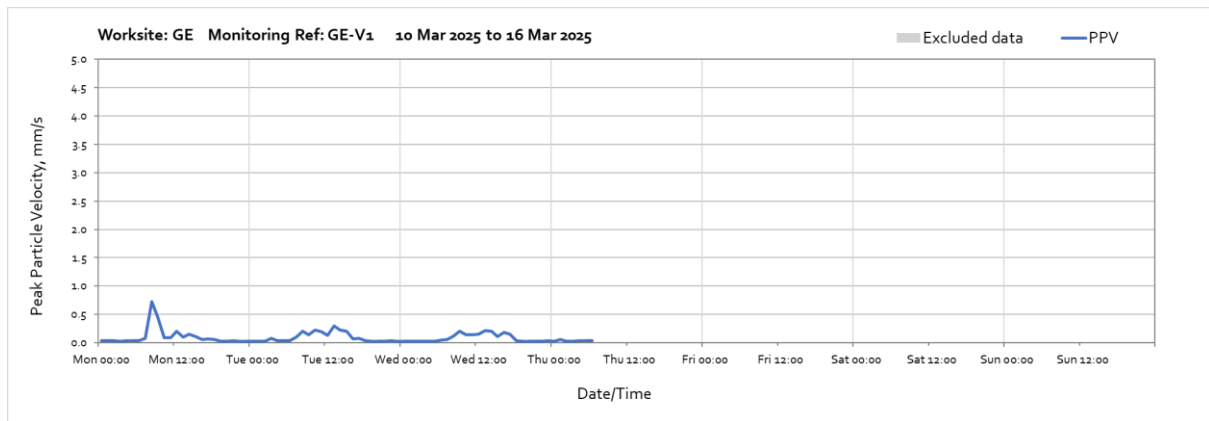

Note: Missing data from 08:00 on Thursday 8<sup>th</sup> March until 15:00 on Tuesday 18<sup>th</sup> March was due to loss of mains power to the monitoring station.

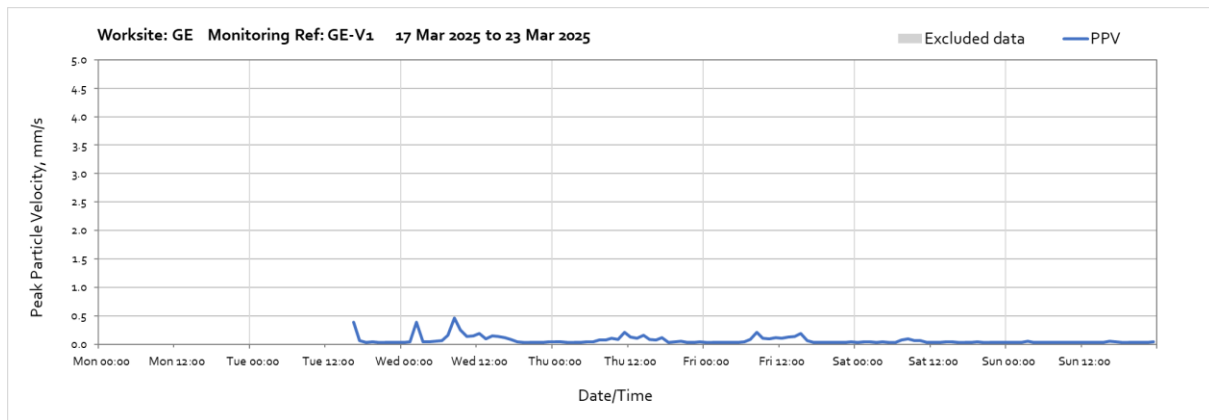




Note: Missing data from 08:00 on Thursday 8<sup>th</sup> March until 15:00 on Tuesday 18<sup>th</sup> March was due to loss of mains power to the monitoring station.

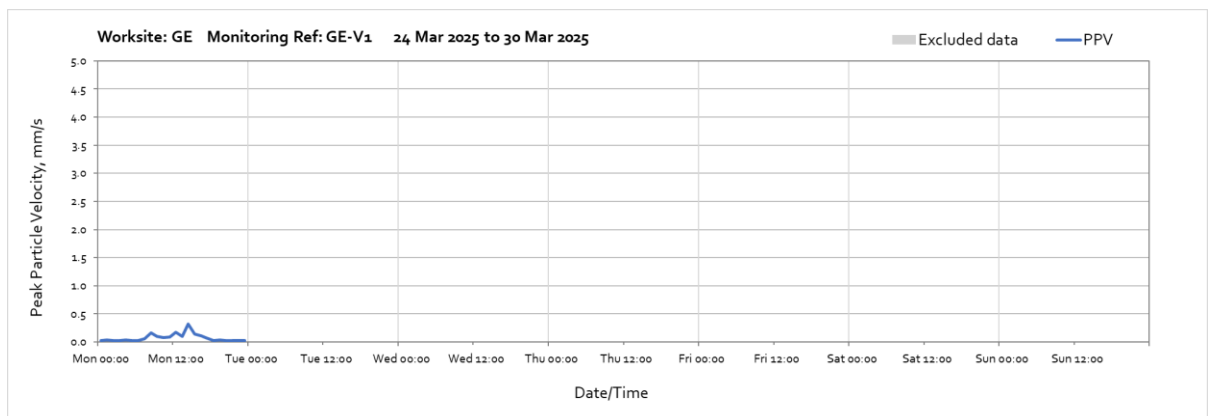



Note: Missing data from 01:00 on Tuesday 25<sup>th</sup> March until the end of the month was due to loss of power to the monitoring station.

OFFICIAL


## Worksite: GLD – Monitoring Ref: GLD-V1

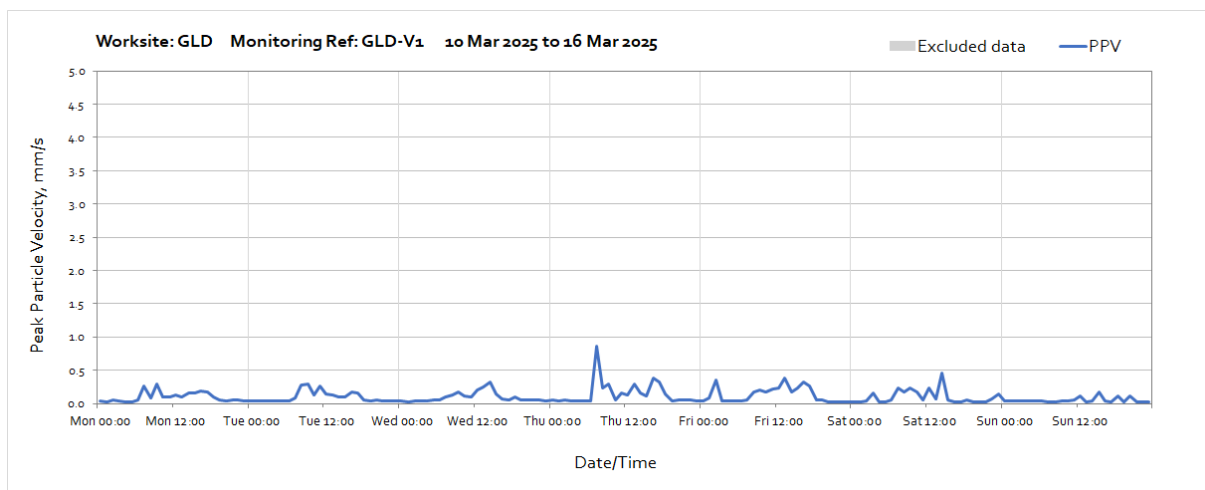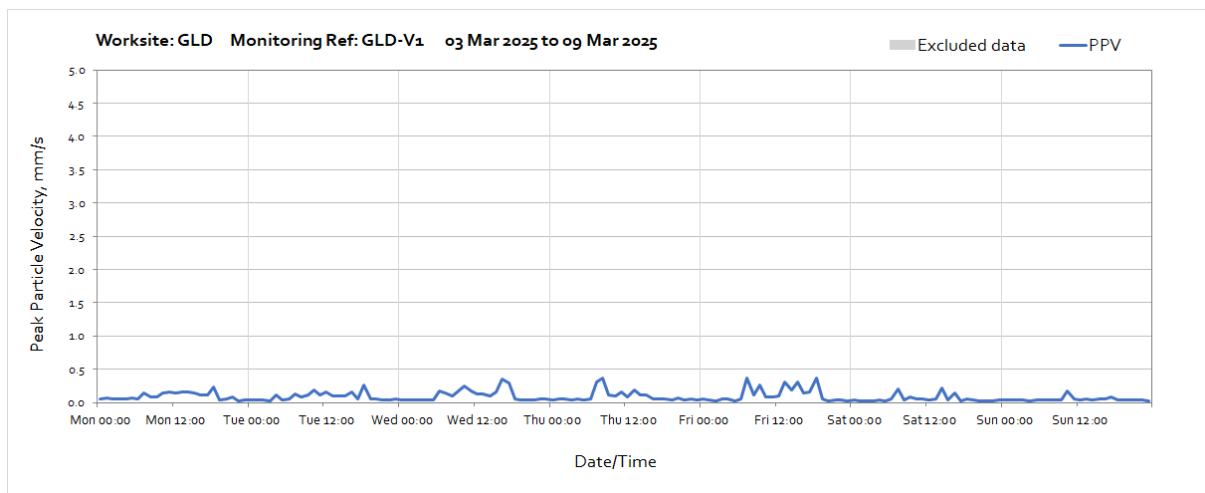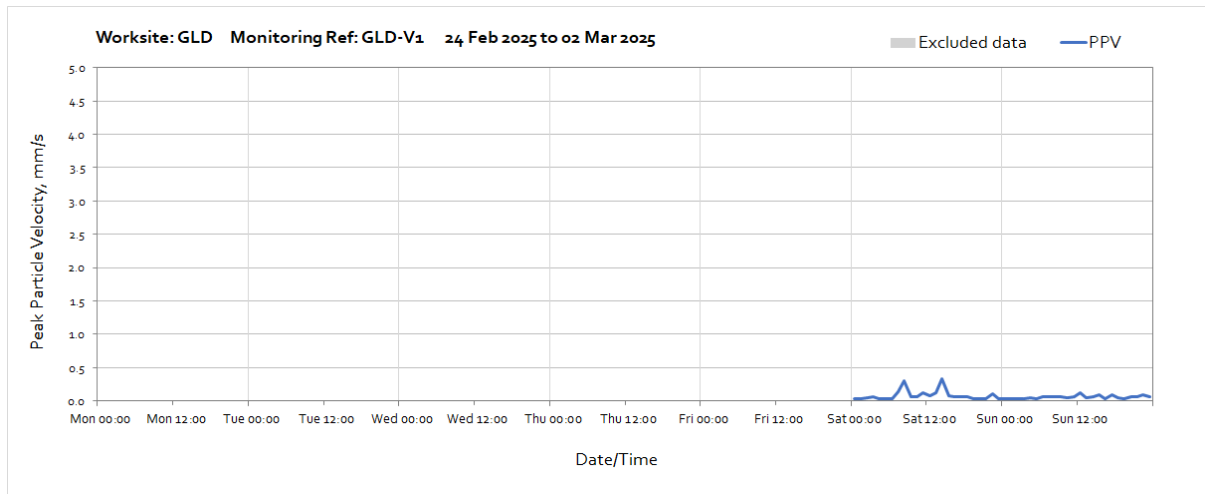

OFFICIAL


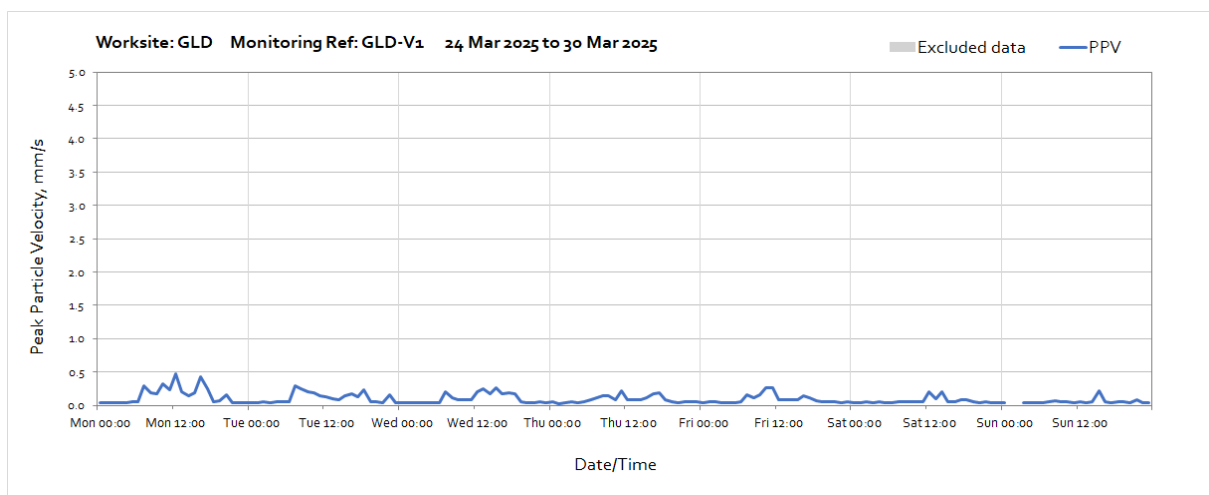
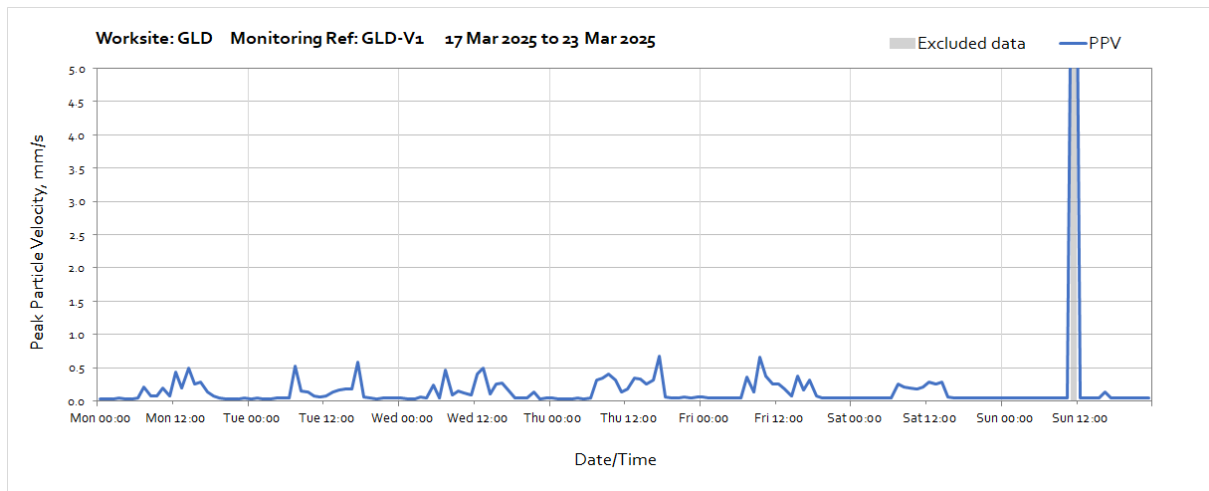


Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.


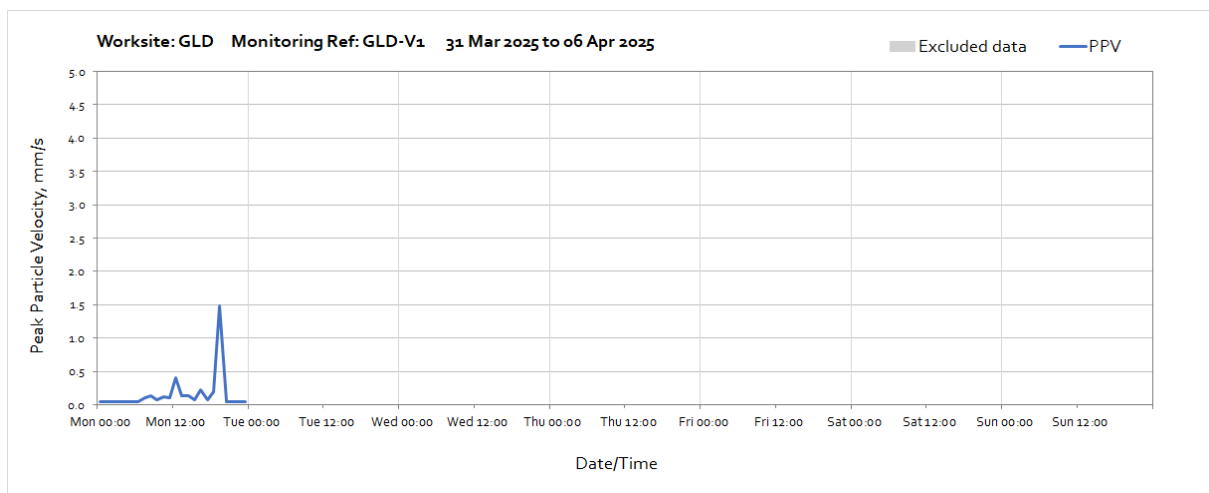




## Worksite: BRD – Monitoring Ref: BRD-V1

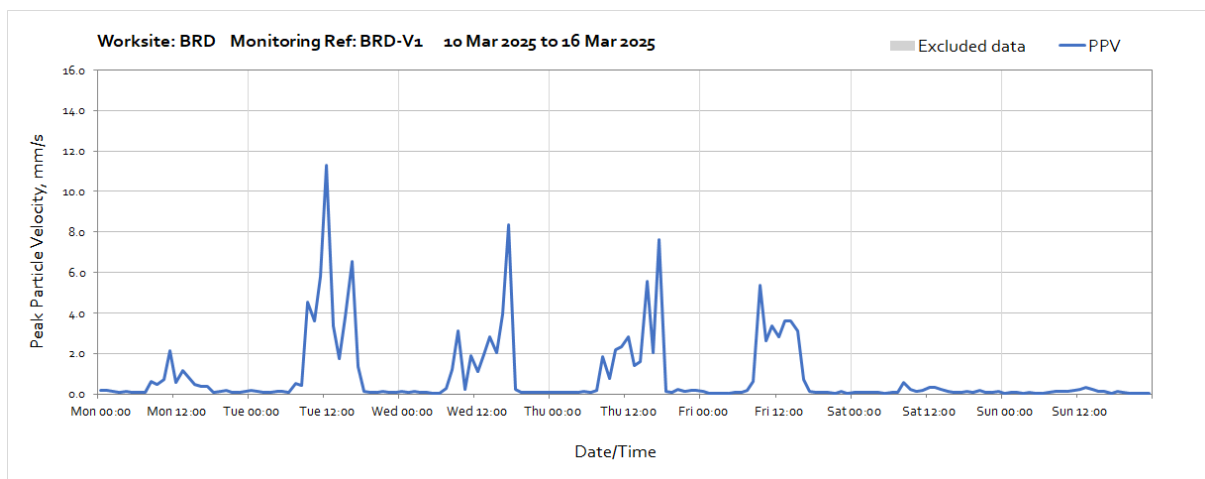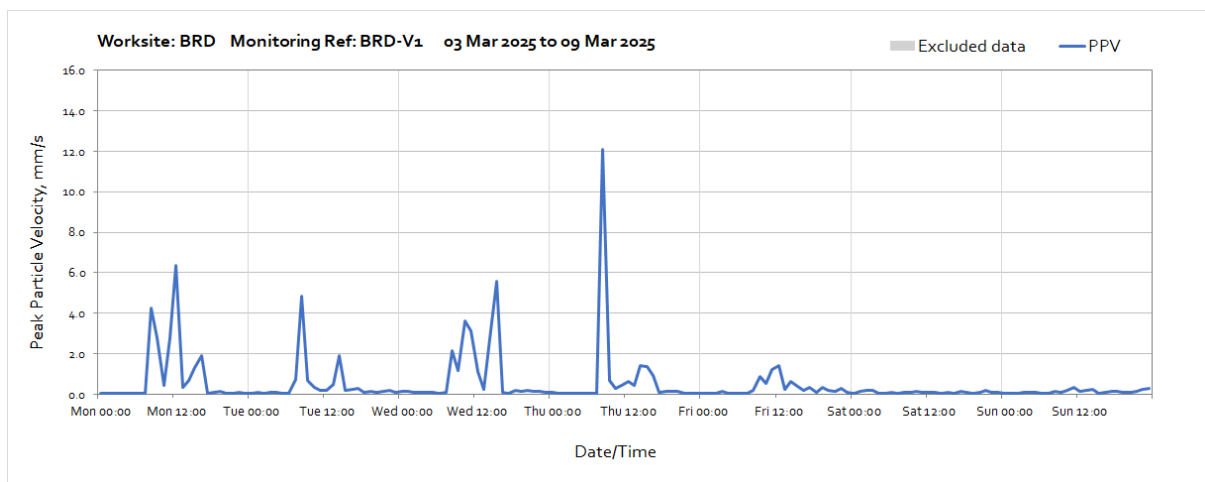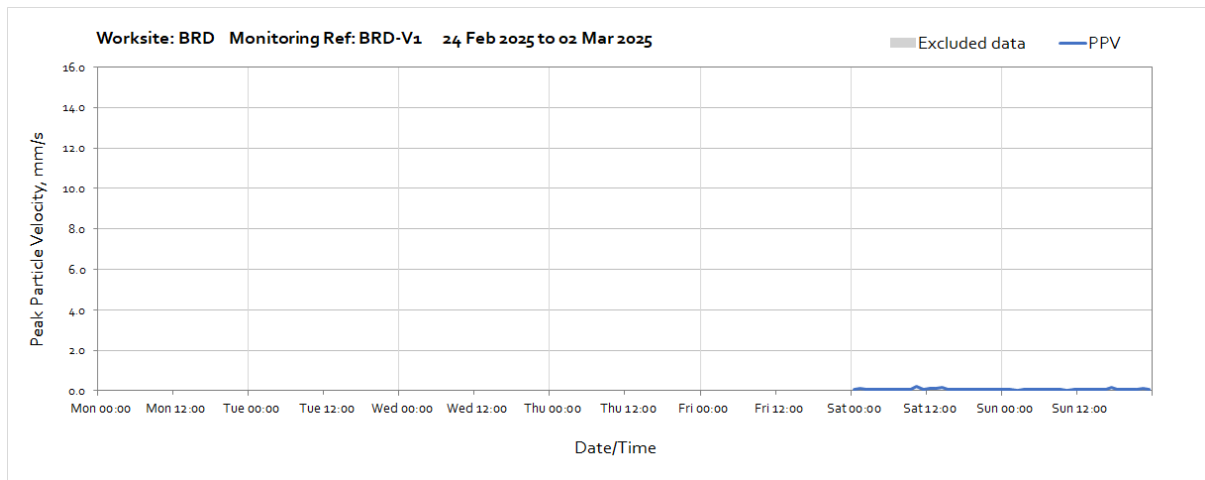

OFFICIAL

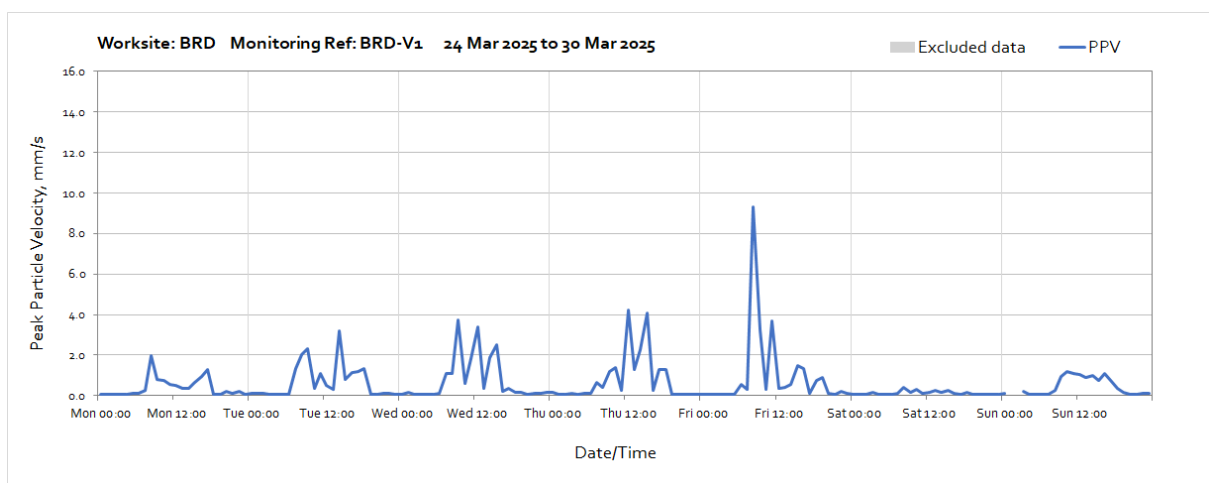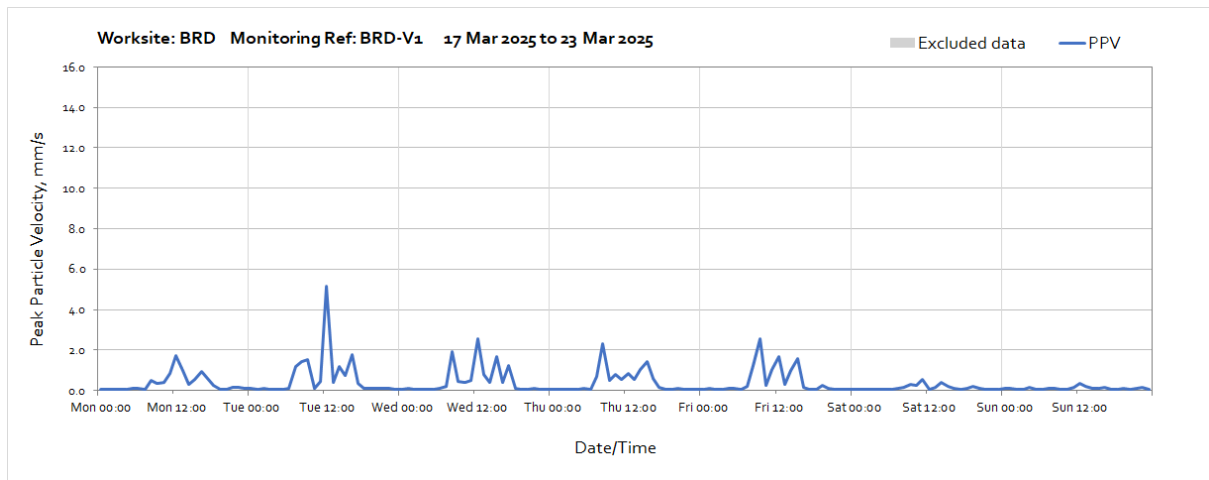

Note: Missing data between 01:00 and 03:00 on Sunday 30th March is due to a monitor time adjustment at the start of British Summer Time.

