

Construction Noise and Vibration Monthly Report – December 2025

North Warwickshire Borough Council

Non-Technical Summary	1
Abbreviations and Descriptions	3
1 Introduction	4
1.2 Measurement Locations	6
2 Summary of Results	9
2.1 Summary of Measured Noise and Vibration Levels	9
2.2 Exceedances of the LOAEL and SOAEL	13
2.3 Complaints	16
Appendix A Site Locations	17
Appendix B Monitoring Locations	23
Appendix C Data	29
Noise	29
Vibration	51

List of tables

Table 1: Table of Abbreviations	3
Table 2: Monitoring Locations	8
Table 3: Summary of Measured dB L_{Aeq} Data over the Monitoring Period	10
Table 4: Summary of Measured PPV Data over the Monitoring Period	13
Table 5: Summary of Exceedances of LOAEL and SOAEL	14
Table 6: Summary of Exceedances of Trigger Levels	16
Table 7: Summary of Complaints	16

Non-Technical Summary

This Noise and Vibration Monitoring Report fulfils HS2 Limited's commitment detailed in the Environmental Minimum Requirements (EMRs), Annex 1, Code of Construction Practice, to present the results of noise and vibration monitoring carried out within North Warwickshire Borough Council (NWBC) area during the month of December 2025.

Within this period noise and vibration monitoring were undertaken at the following worksites:

- Church Lane Embankment worksite (ref.: CLE), where kerbing and drainage works, utilities installation and concrete pours were underway.
- Kingsbury Main Compound worksite (ref.: KMC), where material deliveries and operation of precast yard, offices and welfare facilities were underway.
- Marston Box worksite (ref.: MB), where drilling and jet washing were underway.
- Faraday Avenue Embankment and Underbridge worksite (ref.: FAEU), where material deliveries were underway.
- Chattle Hill Box Structure worksite (ref.: CHBS), where rigid inclusion works were underway.
- Attleboro Lane Overbridge worksite (ref.: ALO), where pile installation, sheet piling, and retaining wall construction were underway.
- Marsh Lane Embankment (ref.: MLE) worksites, where dig and replace, stockpiling, embankment construction, compound operation, haul road operation and maintenance, culvert installation and material movements were underway
- Gilson Embankment worksite (ref.: GE), where no works were underway.
- Gilson Drive worksite (ref.: GLD), where embankment construction, landscaping and drainage were underway.
- Birmingham Road worksite (ref.: BRD), where no works were underway.
- Water Orton South Compound (ref.: WOSC), where bored piling, and formwork, reinforcement and concrete works, pile cropping and superstructure works were underway.

The HS2 threshold levels for significant noise impacts, which are defined in Information Paper E23 (<https://www.gov.uk/government/publications/hs2-information-papers-environment>), were not exceeded due to HS2 works during December 2025.

There were no exceedances of trigger levels as defined in section 61 consents during the reporting period .

No complaints regarding noise and vibration were received by HS2 during the reporting period.

Abbreviations and Descriptions

The abbreviations, descriptions and project terminology used within this report can be found in Table 1.

Table 1: Table of Abbreviations

Acronym/Term	Definition
$L_{Aeq,T}$	See equivalent continuous sound pressure level
Ambient sound	A description of the all-encompassing sound at a given location and time which will include sound from many sources near and far. Ambient sound can be quantified in terms of the equivalent continuous sound pressure level, $L_{pAeq,T}$
Decibel(s), or dB	Between the quietest audible sound and the loudest tolerable sound there is a million to one ratio in sound pressure (measured in Pascal (Pa)). Because of this wide range, a level scale called the decibel (dB) scale, based on a logarithmic ratio, is used in sound measurement. Audibility of sound covers a range of approximately 0-140dB.
Decibel(s) A-weighted, or dB(A)	The human ear system does not respond uniformly to sound across the detectable frequency range and consequently instrumentation used to measure sound is weighted to represent the performance of the ear. This is known as the 'A weighting' and is written as 'dB(A)'.
Equivalent continuous sound pressure level, or $L_{Aeq,T}$	An index used internationally for the assessment of environmental sound impacts. It is defined as the notional unchanging level that would, over a given period of time (T), deliver the same sound energy as the actual time-varying sound over the same period. Hence fluctuating sound levels can be described in terms of an equivalent single figure value, typically expressed as a decibel level.
Exclusion of data	Measurement of noise levels can be affected by weather conditions such as prolonged periods of rain, winds speeds higher than 5m/s and snow/ice ground cover. Noise levels measured during these periods are considered not representative of normal noise conditions at the site and, for the purposes of this report, are excluded from the assessment of exceedances and calculation of typical noise levels and are also greyed out in charts. Identifiable incongruous noise and vibration events not attributable to HS2 construction noise are also excluded.
Façade	A facade noise level is the noise level 1m in front of a large reflecting surface. The effect of reflection, is to produce a slightly higher (typically +3 dB) sound level than it would be if the reflecting surface was not there.
Free-field	A free-field noise level is the noise level measured at a location where no reflective surfaces, other than the ground, lies within 3.5 metres of the microphone position.
LOAEL	Lowest Observed Adverse Effect Level - the level above which adverse effects on health and quality of life can be detected.
Peak particle velocity, or PPV	Instantaneous maximum velocity reached by a vibrating element as it oscillates about its rest position. The PPV is a simple indicator of perceptibility and risk of damage to structures due to vibration. It is usually measured in mm/s.
SOAEL	Significant Observed Adverse Effect Level - the level above which significant adverse effects on health and quality of life occur.
Sound pressure level	The parameter by which sound levels are measured in air. It is measured in decibels. The threshold of hearing has been set at 0dB, while the threshold of pain is approximately 120dB. Normal speech is approximately 60dB at a distance of 1 metre and a change of 3dB in a time varying sound signal is commonly regarded as being just detectable. A change of 10dB is subjectively twice, or half, as loud.
Vibration dose value, or VDV	An index used to evaluate human exposure to vibration in buildings. While the PPV provides information regarding the magnitude of single vibration events, the VDV provides a measure of the total vibration experienced over a specified period of time (typically 16h daytime and 8h night-time). It takes into account the magnitude, the number and the duration of vibration events and can be used to quantify exposure to continuous, impulsive, occasional and intermittent vibration. The vibration dose value is measured in $m/s^{1.75}$.

1 Introduction

1.1.1 HS2 is required to undertake noise (and vibration) monitoring as necessary to comply with the requirements of the High Speed Rail (London-West Midlands) Environmental Minimum Requirements, including specifically Annex 1: Code of Construction Practice, in addition to any monitoring requirements arising from conditions imposed through consents under Section 61 of the Control of Pollution Act, 1974 or through Undertakings & Assurances given to third parties. Such monitoring may be undertaken for the following purposes:

- monitoring the impact of construction works;
- to investigate complaints, incidents and exceedance of trigger levels; or
- monitoring the effectiveness of noise and vibration control measures.

1.1.2 Monitoring data and interpretive reports are to be provided to each relevant local authority on a monthly basis and shall include a summary of the construction activities occurring, the data recorded over the monitoring period, any complaints received, any periods in exceedance of agreed trigger levels, the results of any investigations and any actions taken or mitigation measures implemented. This report provides noise data, and interpretation thereof, for monitoring carried out by HS2 within the North Warwickshire Borough Council (NWBC) area for the period 1st to 31st of December 2025.

1.1.3 Construction sites in the local authority area where monitoring was undertaken during this period include:

- Church Lane Embankment worksite, ref.: CLE (see Plan 1 in Appendix A), where work activities included:
 - Kerbing works including drainage installation.
 - Utilities installation.
 - Concrete pours.
- Kingsbury Main Compound worksite, ref.: KMC (see Plan 2 in Appendix A), where work activities included:
 - Material deliveries.
 - Operation of precast yard.
 - Operation of offices and welfare facilities.
- Marston Box/Marston Lane worksite, ref.: MB (see Plan 2 in Appendix A), where work activities included:

- High directional drilling.
- Jet washing.
- Faraday Avenue Embankment and Underbridge worksite, ref.: FAEU (see Plan 3 in Appendix A), where works activities included:
 - Material deliveries.
- Chattle Hill Box Structure worksite, ref.: CHBS (see Plan 4 in Appendix A), where work activities included:
 - Rigid inclusion, including piling, drilling and pile load testing.
- Attleboro Lane Overbridge worksite, ref.: ALO (See Plan 4 in Appendix A), where work activities included:
 - Pile installation.
 - Sheet piling.
 - Retaining wall construction, including base slab, capping beams, walls and roof slab installation.
- Marsh Lane Embankment worksite, ref: MLE (See Plan 4 in Appendix A), where work activities included:
 - Dig and replace.
 - Stockpiling.
 - Embankment construction.
 - Compound operation.
 - Haul road operation and maintenance.
 - Culvert installation.
 - Material movements.
- Gilson Embankment worksite, ref.: GE (see Plan 4 in Appendix A), where no works were underway.
- Gilson Drive worksite, ref.: GLD (see Plan 4 in Appendix A), works activities included:
 - Embankment construction.
 - Landscaping..
 - Drainage works.

- Birmingham Road worksite, ref.: BRD (see Plan 4 in Appendix A), where no works activities were underway.
- Water Orton Sound Compound, ref.: WOSC (see Plan 4 in Appendix A), work activities included:
 - Bored piling.
 - Formwork, reinforcement and concrete works.
 - Pile cropping.
 - Superstructure works, including plant maintenance.

1.1.4 The applicable standards, guidance, and monitoring methodology is outlined in the construction noise and vibration monitoring methodology report which can be found at the following location <https://www.gov.uk/government/collections/monitoring-the-environmental-effects-of-hs2>. Noise and vibration monitoring reports for previous months can also be found at this location.

1.2 Measurement Locations

1.2.1 Fourteen (14) noise monitoring installations and seven (7) vibration monitoring installations were active in December in the NWBC area.

- 1.2.2 Table 2 summarises the location of noise and vibration monitoring installations within the NWBC area in December 2025.
- 1.2.3 Maps showing the position of noise and vibration monitoring installations are presented in Appendix B.

Table 2: Monitoring Locations

Worksite Reference	Measurement Reference	Address
CLE	CLE-N1	Highfields Cottage, Middleton, North Warwickshire
KMC	KMC-N1	Wheatley House, Kingsbury Road, Curdworth CP, Marston, Warwick
MB	MB-N1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
	MB-V1	Elford House, Kingsbury Road, Curdworth, Sutton Coldfield
FAEU	FAEU-N1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire
	FAEU-V1	South of Orchard Cottage, Newlands Lane, Curdworth, Warwickshire
CHBS	CHBS-N1	6 Gorseway, Coleshill, Warwickshire, Birmingham
WOSC	WOSC-N3	(south of) 53 Watton Lane, Water Orton
MLE	MLE-N1	Rostrevor, Vicarage Lane, Water Orton CP, North Warwickshire
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton, Birmingham
	ALO-N2	(south of) 57 Attleboro Lane, Water Orton, Birmingham
	ALO-V1	West of 47 Attleboro Lane, Water Orton, Birmingham
	ALO-V5	(south of) 57 Attleboro Lane, Water Orton, Birmingham
	AFE-N1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham
GE	GE-N2	Lovegrove Cottage, Gilson Road, Warwickshire
GLD	GLD-N1	10 Gilson Dr, Coleshill, Birmingham
	GLD-V1	10 Gilson Dr, Coleshill, Birmingham
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-N3	1 New Cottages, Birmingham Road, Coleshill, Birmingham
	BRD-V1	1 New Cottages, Birmingham Road, Coleshill, Birmingham

2 Summary of Results

2.1 Summary of Measured Noise and Vibration Levels

- 2.1.1 Table 3 presents a summary of the measured noise levels at each monitoring location over the reporting period. The $L_{Aeq,T}$ is presented for each of the relevant time periods averaged over the calendar month, along with the highest single period $L_{Aeq,T}$ that was found to occur within the month.

Table 3: Summary of Measured dB LAeq Data over the Monitoring Period

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average LAeq,T (Highest Day LAeq,T)					Saturday Average LAeq,T (Highest Day LAeq,T)					Sunday / Public Holiday Average LAeq,T (Highest Day LAeq,T)	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
CLE	CLE-N1	Highfields Cottage, Middleton	Free-field	48.1 (51.2)	47.6 (52.0)	46.1 (53.4)	44.4 (50.7)	42.7 (50.2)	45.1 (46.2)	47.0 (47.8)	47.3 (48.5)	46.3 (50.7)	40.8 (46.6)	46.9 (55.8)	41.9 (48.1)
KMC	KMC-N1	Kingsbury Road, Curdworth	Free-field	56.2 (62.9)	58.0 (62.3)	56.9 (64.3)	56.6 (61.5)	55.5 (62.8)	54.4 (56.7)	57.2 (60.6)	55.5 (59.4)	55.8 (61.5)	52.1 (60.1)	53.7 (62.6)	52.7 (59.9)
MB	MB-N1	Elford House, Kingsbury Road, Curdworth	Free-field	57.0 (60.8)	58.0 (60.5)	57.4 (61.2)	56.0 (60.0)	53.9 (61.0)	55.3 (59.0)	57.0 (58.2)	57.5 (60.0)	56.5 (60.2)	50.7 (55.5)	55.7 (59.9)	51.9 (58.0)
FAEU	FAEU-N1	(South of) Orchard Cottage, Newlands Lane, Curdworth	Free-field	54.9 (59.1)	55.3 (58.3)	54.9 (60.0)	54.0 (59.8)	52.5 (59.3)	52.8 (55.1)	53.2 (56.1)	54.1 (57.7)	53.1 (57.6)	49.3 (53.2)	52.0 (56.8)	50.7 (57.0)
CHBS	CHBS-N1	6 Gorseway Way, Coleshill	Free-field	61.9 (65.1)	62.6 (65.0)	60.7 (63.4)	59.3 (63.0)	57.7 (66.5)	58.4 (59.8)	62.0 (62.7)	62.3 (63.8)	60.7 (64.7)	54.7 (60.6)	60.2 (64.4)	56.6 (63.8)

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average LAeq,T (Highest Day LAeq,T)					Saturday Average LAeq,T (Highest Day LAeq,T)					Sunday / Public Holiday Average LAeq,T (Highest Day LAeq,T)	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
WOSC	WOSC-N3	(south of) 53 Watton Lane, Water Orton	Free field	63.1 (66.5)	64.1 (65.9)	62.5 (67.4)	60.8 (65.8)	58.8 (65.4)	60.6 (61.5)	63.3 (64.6)	63.3 (65.5)	62.3 (65.6)	56.6 (59.7)	62.4 (65.4)	59.1 (64.9)
MLE	MLE-N1	Rostrevor, Vicarage Lane, Water Orton	Free field	55.8 (60.7)	55.9 (60.1)	55.8 (61.2)	54.8 (59.9)	53.4 (64.1)	55.3 (59.4)	56.3 (58.5)	56.5 (58.6)	56.2 (58.8)	51.5 (56.3)	54.8 (59.1)	52.1 (59.7)
ALO	ALO-N1	(west of) 47 Attleboro Lane, Water Orton	Free field	61.1 (64.5)	61.7 (64.2)	61.2 (63.6)	60.5 (63.5)	58.6 (64.1)	60.2 (62.0)	61.3 (62.7)	61.8 (63.6)	60.7 (63.2)	56.2 (60.5)	59.1 (63.6)	59.5 (64.1)
	ALO-N2	(South of) 57 Attleboro Lane, Water Orton	Free field	59.8 (64.0)	60.6 (64.1)	59.9 (63.8)	59.1 (63.4)	56.8 (63.6)	58.9 (61.6)	60.4 (62.6)	60.9 (63.6)	60.0 (63.3)	55.3 (60.3)	58.2 (63.9)	55.5 (63.8)
	AFE-N1	Attleboro Farm, Attleboro Lane	Free field	61.9 (68.1)	62.5 (67.8)	62.2 (67.5)	61.5 (66.7)	59.5 (68.2)	60.9 (65.3)	62.5 (66.0)	63.2 (67.9)	62.1 (67.7)	57.5 (64.1)	60.8 (68.2)	58.0 (67.9)
GE	GE-N2	Lovegrove Cottage, Gilson Road	Free-field	59.5 (64.5)	60.4 (64.7)	59.5 (64.0)	58.2 (62.9)	55.9 (63.9)	57.4 (60.5)	60.0 (62.8)	60.7 (63.7)	59.1 (63.7)	52.2 (58.2)	57.6 (64.5)	53.2 (63.7)

Worksite Reference	Measurement Reference	Site Address	Free-Field or Façade Measurement	Weekday Average LAeq,T (Highest Day LAeq,T)					Saturday Average LAeq,T (Highest Day LAeq,T)					Sunday / Public Holiday Average LAeq,T (Highest Day LAeq,T)	
				0700 - 0800	0800 - 1800	1800 - 1900	1900 - 2200	2200 - 0700	0700 - 0800	0800 - 1300	1300 - 1400	1400 - 2200	2200 - 0700	0700 - 2200	2200 - 0700
GLD	GLD-N1	10 Gilson Dr, Coleshill	Free-field	59.4 (60.6)	61.9 (68.7)	58.1 (60.4)	57.1 (58.7)	55.8 (60.6)	56.9 (56.9)	58.7 (58.7)	57.4 (57.4)	56.8 (57.7)	53.5 (55.1)	57.5 (58.8)	55.2 (60.1)
BRD	BRD-N2	1 New Cottages, Birmingham Road, Coleshill	Free-field	62.2 (65.6)	63.0 (66.2)	61.2 (64.7)	59.9 (63.2)	58.3 (64.9)	60.2 (61.1)	62.2 (62.8)	62.1 (62.9)	61.1 (63.4)	56.0 (58.1)	61.0 (64.2)	58.2 (65.0)
	BRD-N3		Free-field	66.9 (69.8)	68.1 (70.1)	66.1 (68.8)	64.7 (66.8)	61.6 (68.0)	63.8 (65.3)	68.4 (69.2)	67.2 (67.6)	65.8 (67.6)	60.3 (65.6)	65.4 (68.8)	61.2 (68.2)

2.1.2 Table 4 presents a summary of the measured vibration levels at each monitoring location over the reporting period. The highest PPV measured during the monitoring along any axis is presented in the table.

Table 4: Summary of Measured PPV Data over the Monitoring Period

Worksite Reference	Measurement Reference	Monitor Address	Highest PPV measured in any axis, mm/s
MB	MB-V1	Kingsbury Road, Curdworth, Sutton Coldfield, West Midland	0.22 (X-axis)
FAEU	FAEU-V1	(south of) Orchard Cottage, Newlands Lane, Curdworth, Warwickshire	0.32 (Y-axis)
ALO	ALO-V1	(west of) 47 Attleboro Lane, Water Orton	1.13 (Y-axis)
	ALO-V5	(south of) 57 Attleboro Lane, Water Orton	0.52 (X-axis)
	AFE-V1	Attleboro Farm, Attleboro Lane, Water Orton	0.25 (X-axis)
GLD	GLD-V1	10 Gilson Dr, Coleshill	1.62 (Z-axis)
BRD	BRD-V1	1 New Cottages, Birmingham Road, Coleshill	1.59 (Z-axis)

2.1.3 Appendix C presents graphs of the noise and vibration monitoring data over the month for each of the measurement locations. Noise data presented consists of the hourly L_{Aeq} values and, where relevant, the $L_{Aeq,T}$ values (where the time period T has been taken to be the averaging period as specified in Table 1 of HS2 Information Paper E23). Vibration data presented consist of hourly PPV values. The full data set for the monitoring equipment can be found at the following location:

<https://data.gov.uk/dataset/24542ae7-dd44-444f-b259-871c4cc43b5e/environmental-monitoring-data>.

2.2 Exceedances of the LOAEL and SOAEL

2.2.1 The lowest observed adverse effect level (LOAEL) is defined in the Planning Practice Guidance – Noise (PPG) as the level above which "noise starts to cause small changes in behaviour and/or attitude, e.g. turning up volume of television; speaking more loudly; where there is no alternative ventilation, having to close windows for some of the time because of the noise. Potential for some reported sleep disturbance. Affects the acoustic character of the area such that there is a perceived change in the quality of life".

2.2.2 The significant observed adverse effect level (SOAEL) is defined in the 'Planning Practice Guidance – Noise' as the level above which "noise causes a material change in behaviour and/or attitude, e.g. avoiding certain activities during periods of intrusion; where there is no alternative ventilation, having to keep windows closed

most of the time because of the noise. Potential for sleep disturbance resulting in difficulty in getting to sleep, premature awakening and difficulty in getting back to sleep. Quality of life diminished due to change in acoustic character of the area."

2.2.3 HS2 Phase One Information Paper E23: Control of Construction Noise and Vibration sets out the LOAELs and SOAELs for construction noise.

2.2.4 Where reported construction noise levels exceed the LOAEL and SOAEL, relevant periods will be identified. Summary statistics to evaluate ongoing qualification for noise insulation and temporary rehousing are also presented where relevant.

2.2.5 Table 5 presents a summary of recorded exceedances of the LOAEL and SOAEL at each measurement location over the reporting period, including the number of exceedances during each time period.

Table 5: Summary of Exceedances of LOAEL and SOAEL

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
CLE	CLE-N1*	Highfields Cottage, Middleton	All days	All periods	No exceedances	No exceedances
KMC	KMC-N1*	Kingsbury Road, Sutton Coldfield	All days	All periods	No exceedances	No exceedances
MB	MB-N1*	Elford House, Kingsbury Road, Curdworth	All days	All periods	No exceedances	No exceedances
FAEU	FAEU-N1*	South of Orchard Cottage, Newlands Lane, Curdworth	All days	All periods	No exceedances	No exceedances
CHBS	CHBS-N1*	6 Gorsey Way, Coleshill	All days	All periods	No exceedances	No exceedances
WOSC	WOSC-N3*	(south of) 53 Watton Lane, Water Orton, B46 1PB	All days	All periods	No exceedances	No exceedances
MLE	MLE-N1	Rostrevor, Vicarage Lane, Water Orton CP	All days	All periods	No exceedances	No exceedances

Worksite Reference	Measurement Reference	Site Address	Day (Weekday, Saturday, Sunday, Night)	Time period	Number of exceedances of LOAEL	Number of exceedances of SOAEL
ALO	ALO-N1	West of 47 Attleboro Lane, Water Orton	Weekday	0800-1800	3	No exceedances
	ALO-N2*	(south of) 57 Attleboro Lane, Water Orton, Birmingham, B46 1SD	All days	All periods	No exceedances	No exceedances
	AFE-N1*	Attleboro Farm, Attleboro Lane, Water Orton, Birmingham, B46 1SD	Weekday	0800-1800	5	No exceedances
GE	GE-N2*	Lovegrove Cottage, Gilson Road	All days	All periods	No exceedances	No exceedances
GLD	GLD-N1	10 Gilson Dr, Coleshill	Weekday	0800-1800	1	No exceedances
BRD	BRD-N2*	1 New Cottages, Birmingham Road, Coleshill	Weekday	0800-1800	4	No exceedances
	BRD-N3*	1 New Cottages, Birmingham Road, Coleshill	Weekday	0800-1800	3	No exceedances

*A distance correction has been applied when calculating exceedances of the LOAEL and SOAEL.

2.2.6 There were exceedances of the LOAEL due to HS2 construction works at five (5) monitoring locations during weekday daytime periods.

2.2.7 No exceedances of the SOAEL were recorded due to HS2 construction works during December 2025.

Exceedances of Trigger Level

2.2.8 Table 6 provides a summary of exceedances of the Section 61 trigger noise levels determined to be due to HS2 related construction noise measured during the reporting period, along with the findings of any investigation.

Table 6: Summary of Exceedances of Trigger Levels

Complaint Reference Number (if applicable)	Worksite Reference	Date and Time Period	Identified Source	Results of Investigation (including noise monitoring results)	Actions Taken
-	-	-	-	-	-

2.3 Complaints

2.3.1 Table 7 provides a summary of complaint information related to noise and vibration received during the reporting period, along with the findings of any investigation.


Table 7: Summary of Complaints

Complaint Reference Number	Worksite Reference	Description of Complaint	Results of Investigation	Actions Taken
-	-	-	-	-

Appendix A Site Locations

HS2


Worksite Identification Plan - Overview

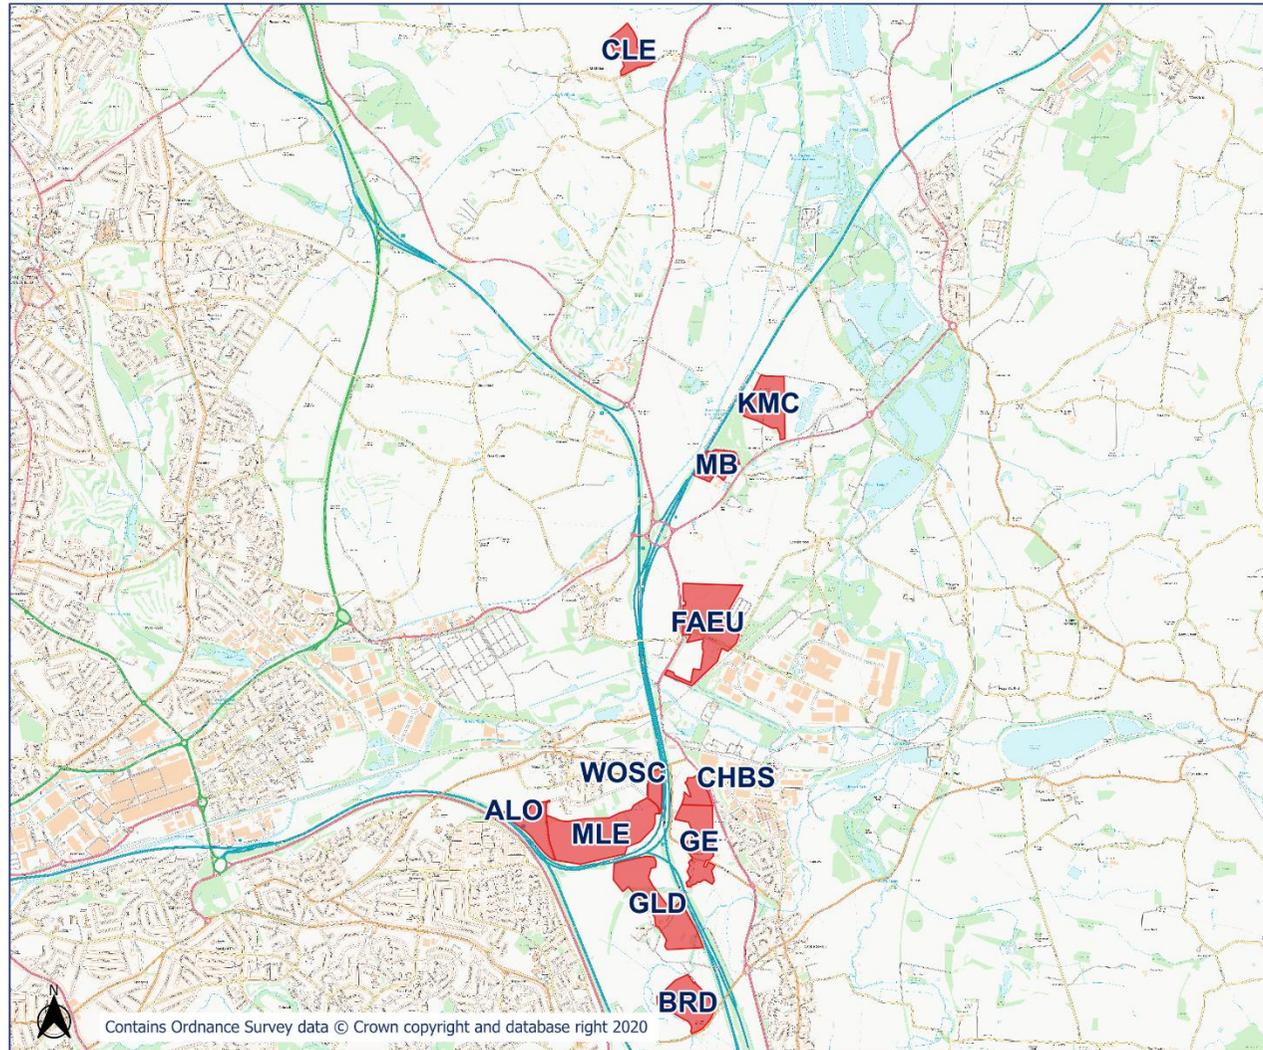

HS2


Worksite Identification Plan - 1



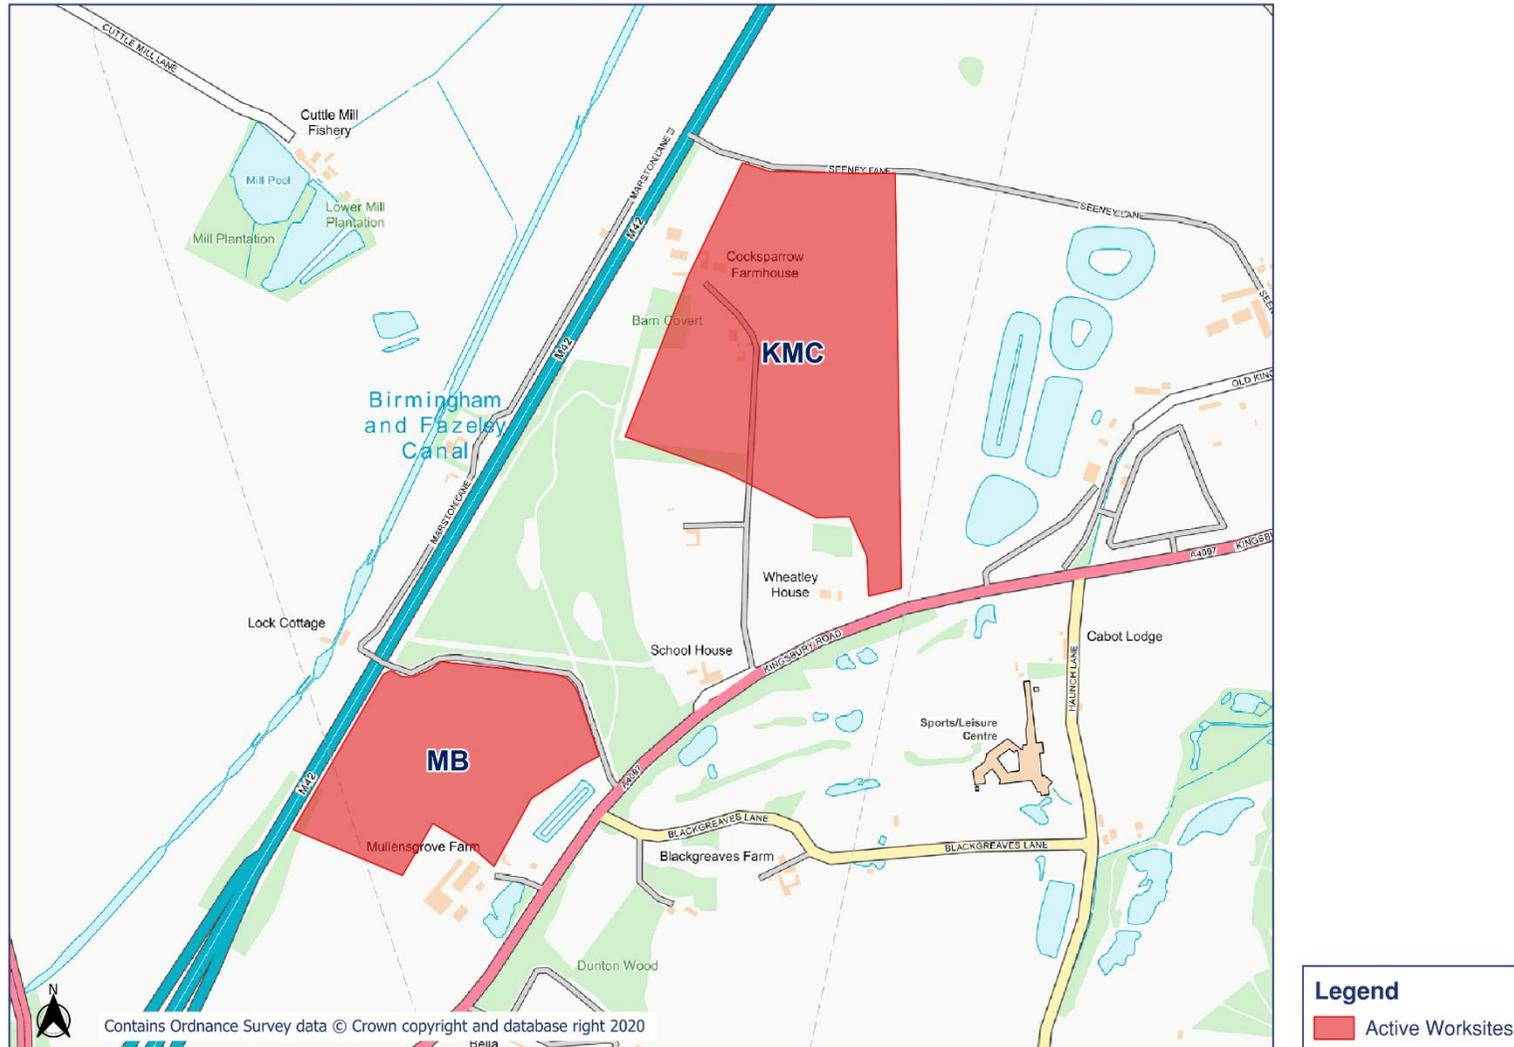

HS2

Worksite Identification Plan - 4

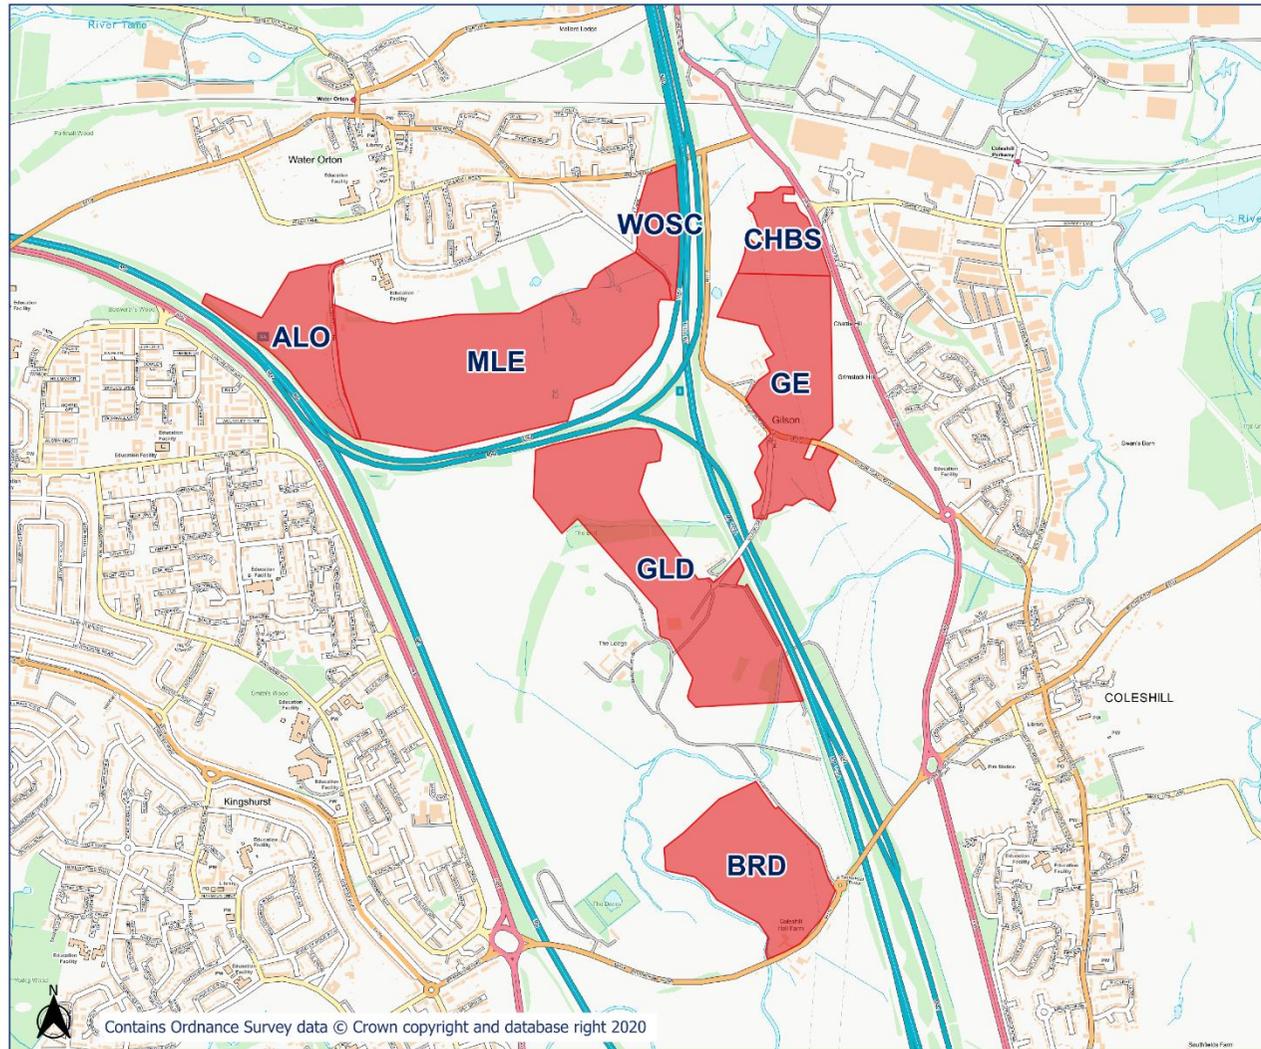


Appendix B Monitoring Locations




HS2

Noise and Vibration Monitoring Plan - 2

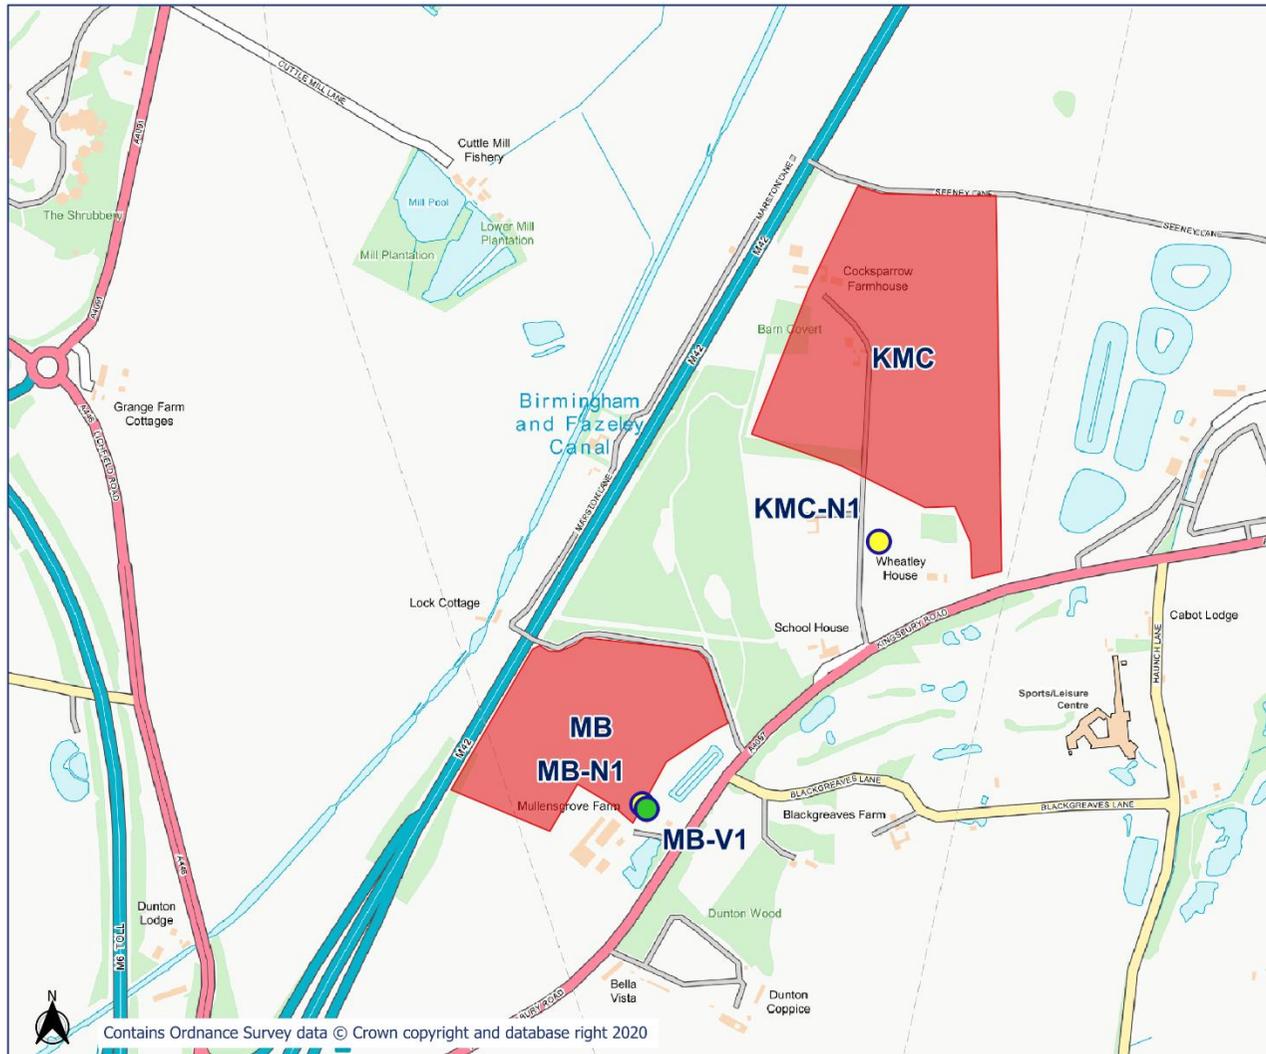


Legend

- Noise Monitor
- Vibration Monitor
- Active Worksites

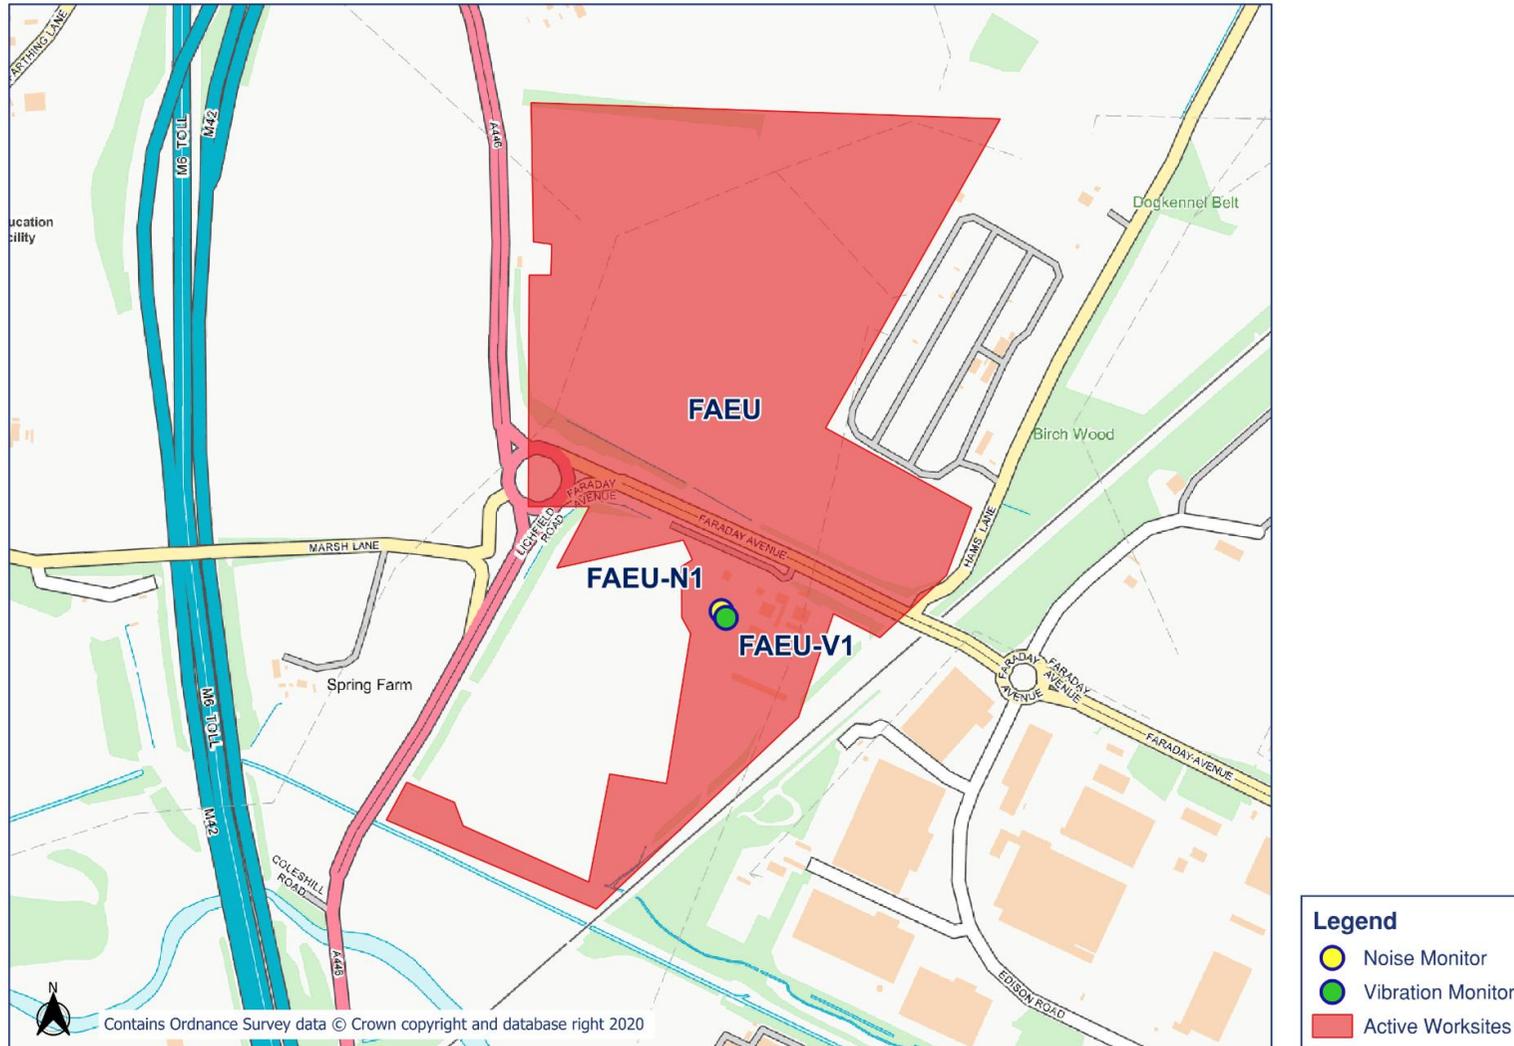


HS2

Noise and Vibration Monitoring Plan - 5

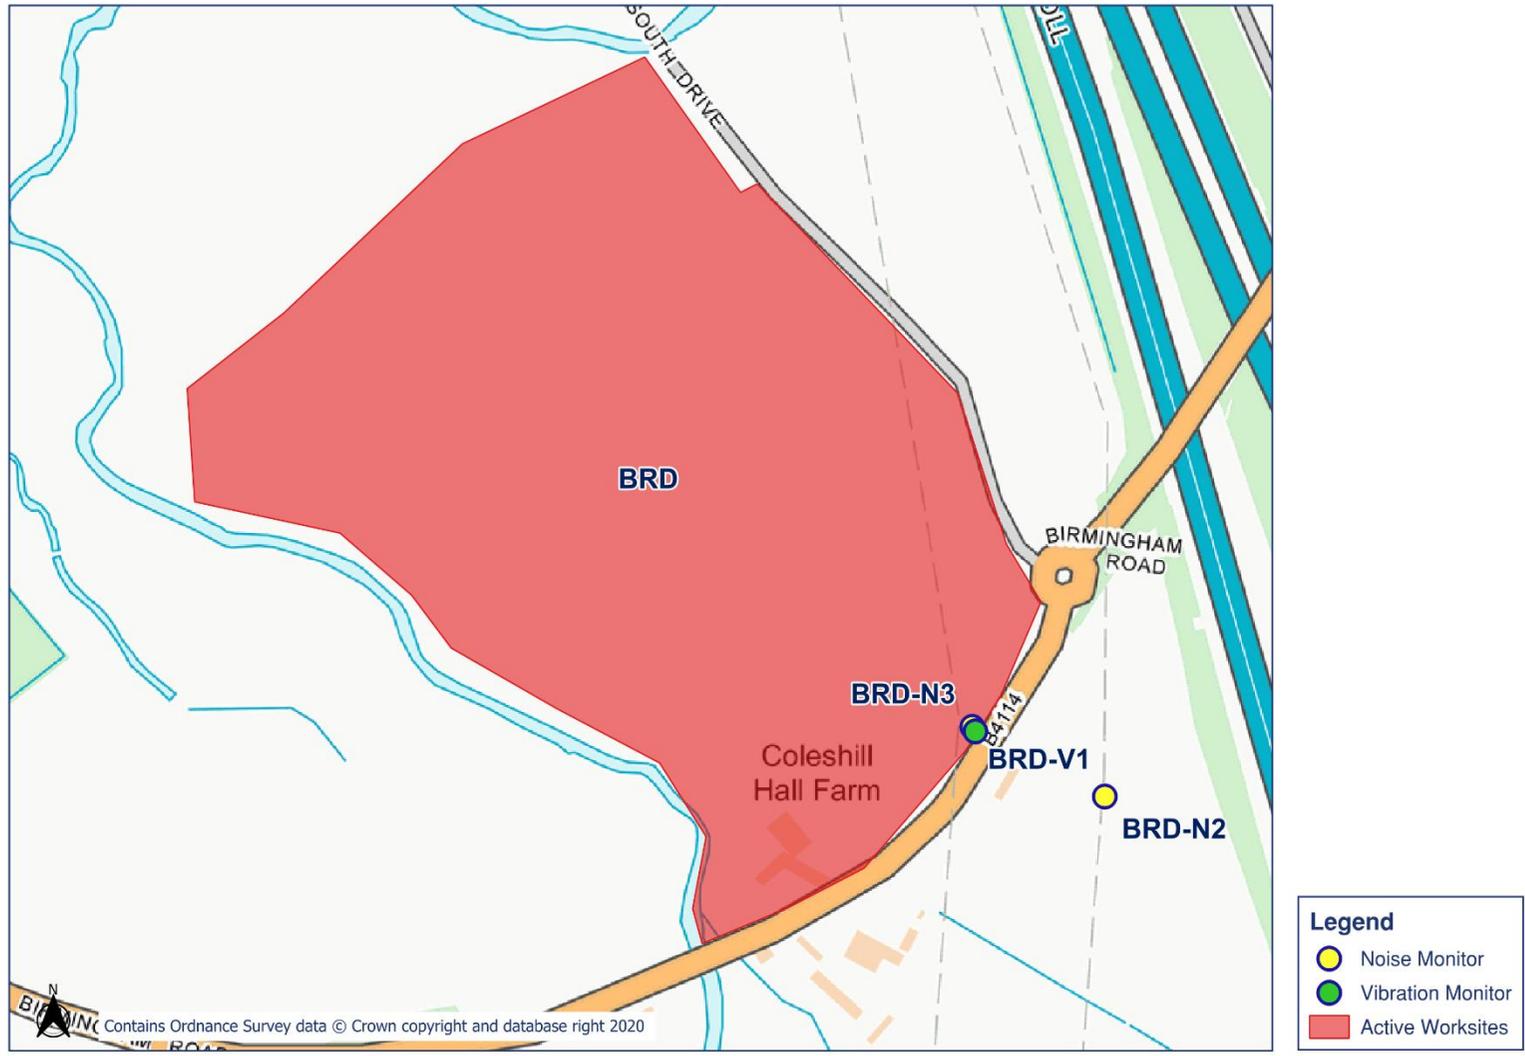

OFFICIAL

HS2 Noise and Vibration Monitoring Plan - 4

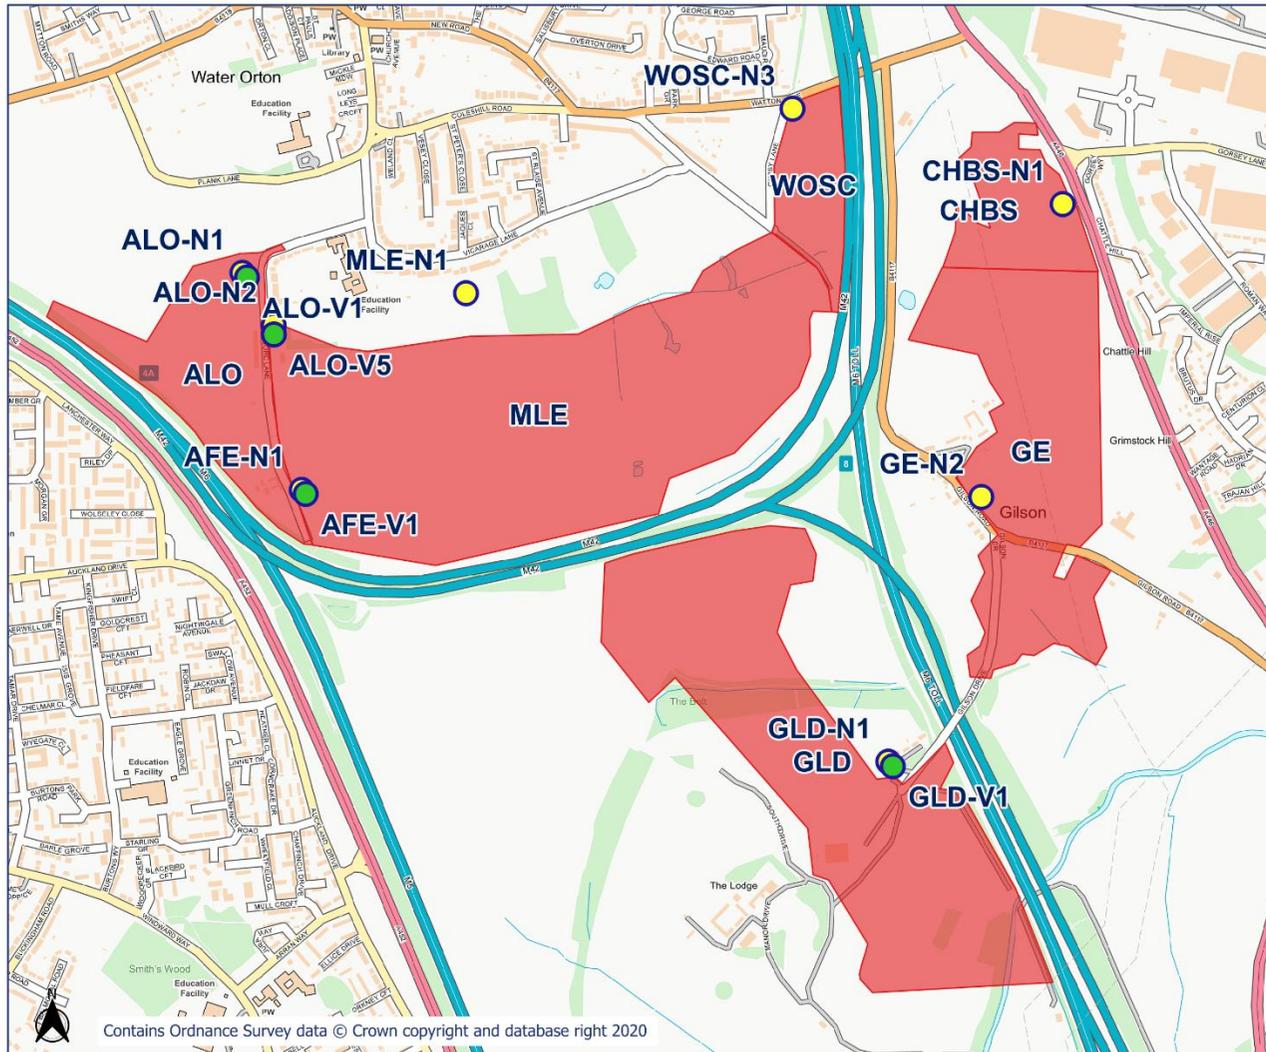

Legend



- Noise Monitor
- Vibration Monitor
- Active Worksites




Appendix C Data

Noise



The following graphs show the hourly measured ambient noise level $L_{Aeq,1h}$ and, where relevant, the averaged noise level $L_{Aeq,T}$ values, where the time period T is as specified in Table 1 of HS2 Information Paper E23. Periods with adversely weather affected noise levels are greyed out and have been excluded from the calculation of the $L_{Aeq,T}$ values in Table 3 of the main report.:

Worksite: CLE – Monitoring Ref: CLE-N1

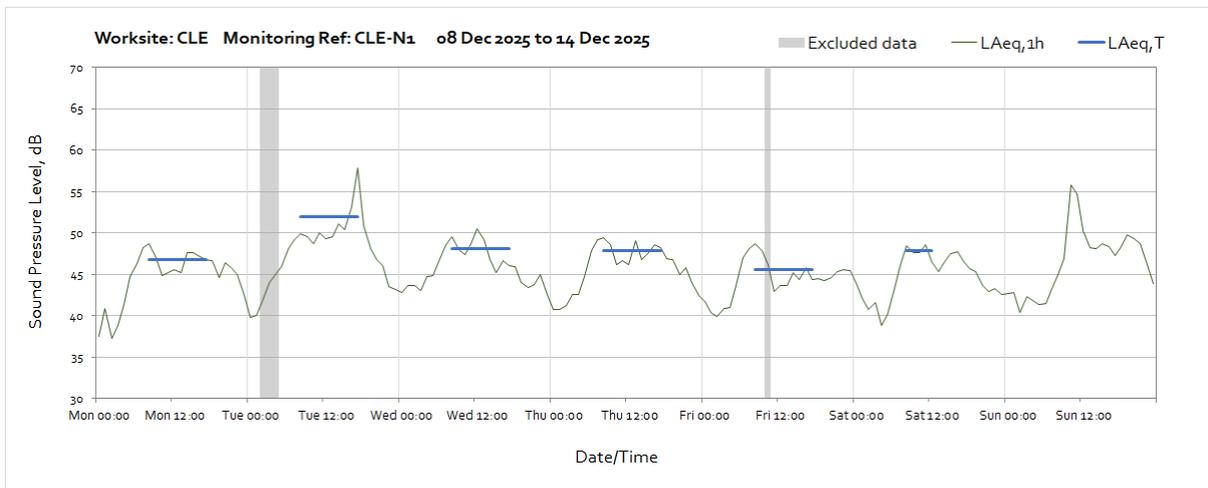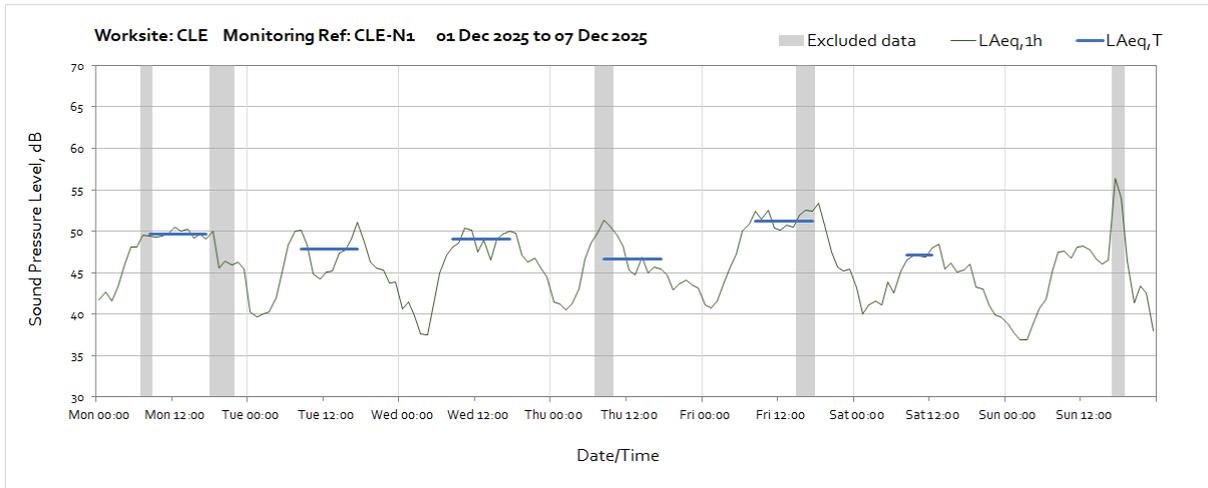


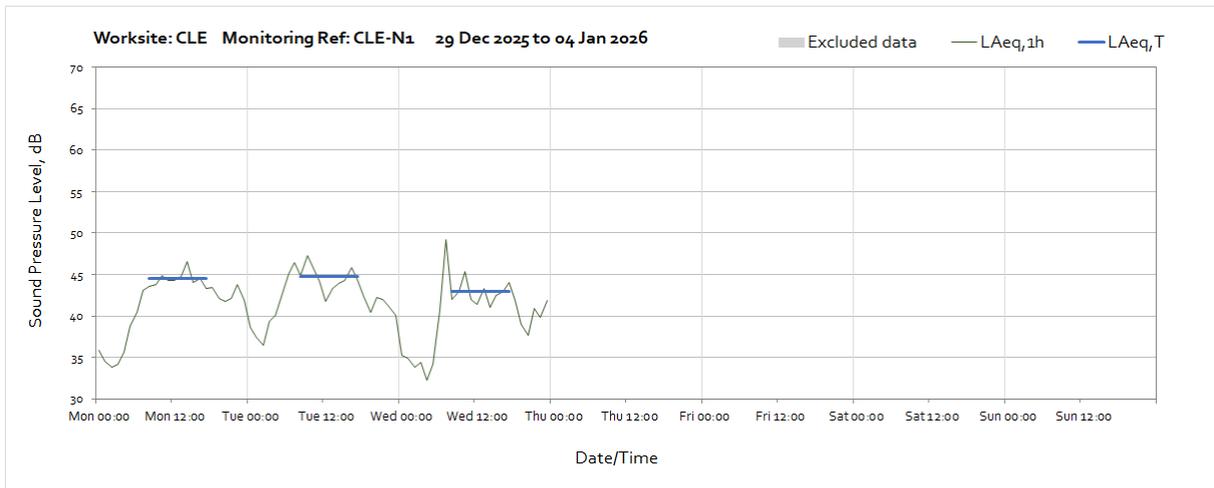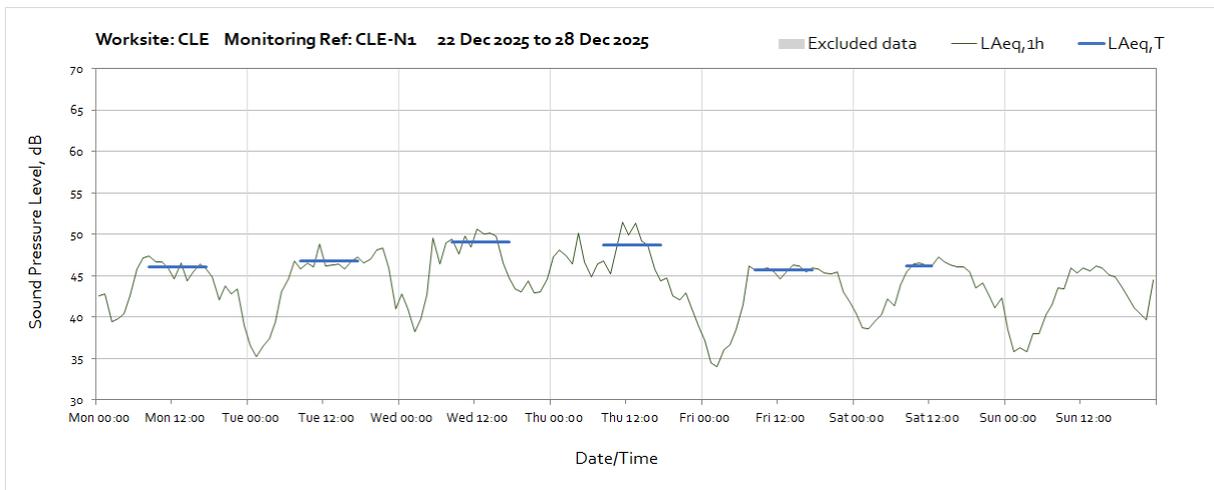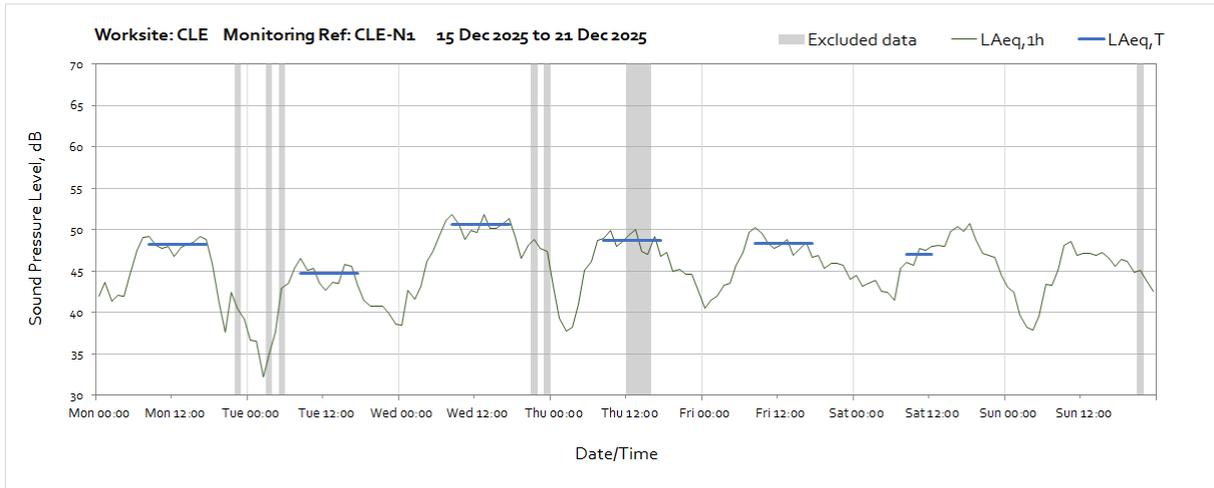

Worksite: KMC – Monitoring Ref: KMC-N1

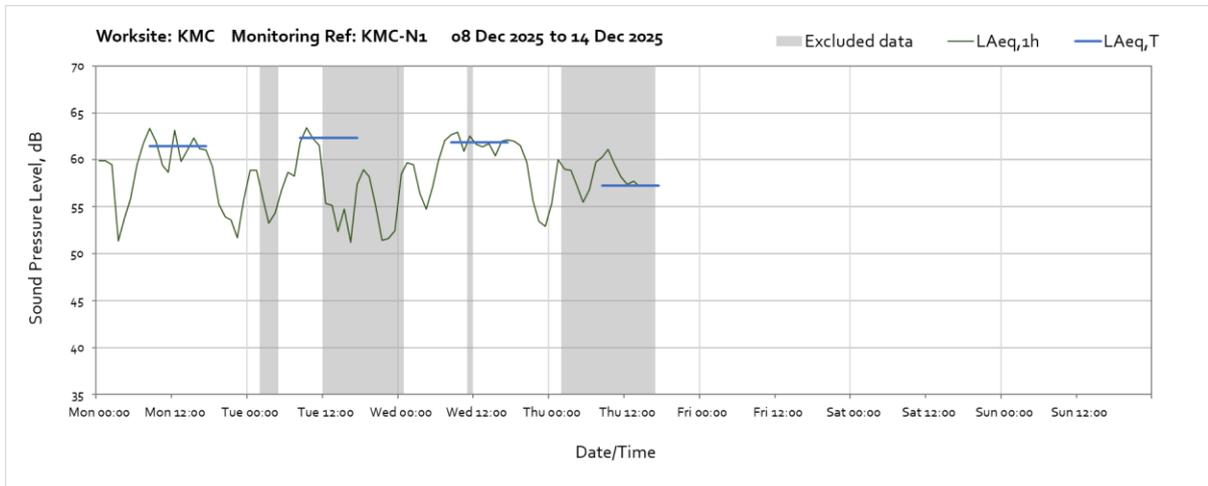
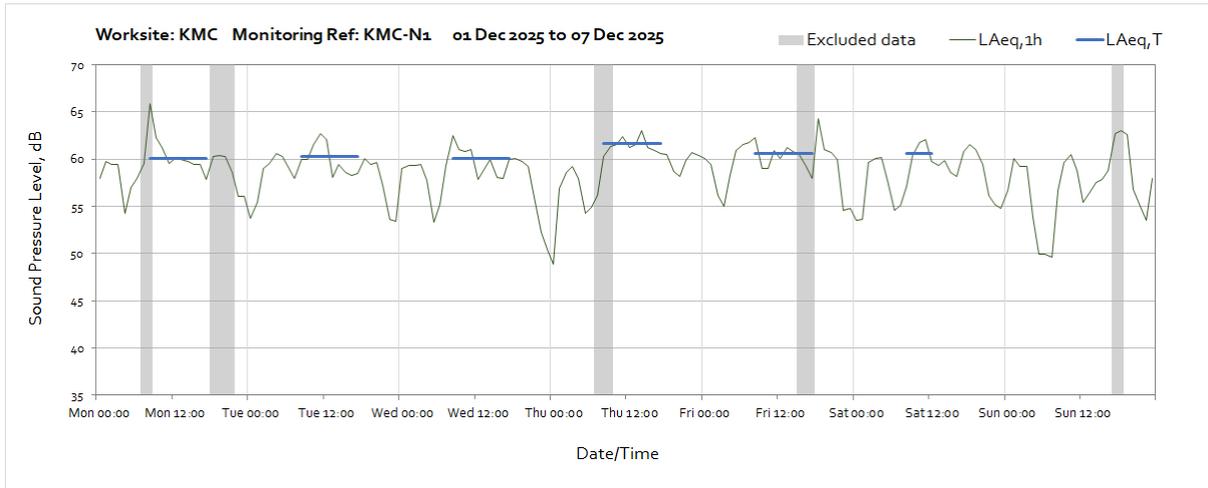


Note: Missing data between 18:00 on Thursday 11th and 13:00 on Tuesday 16th December was due to a system error at the monitoring station.

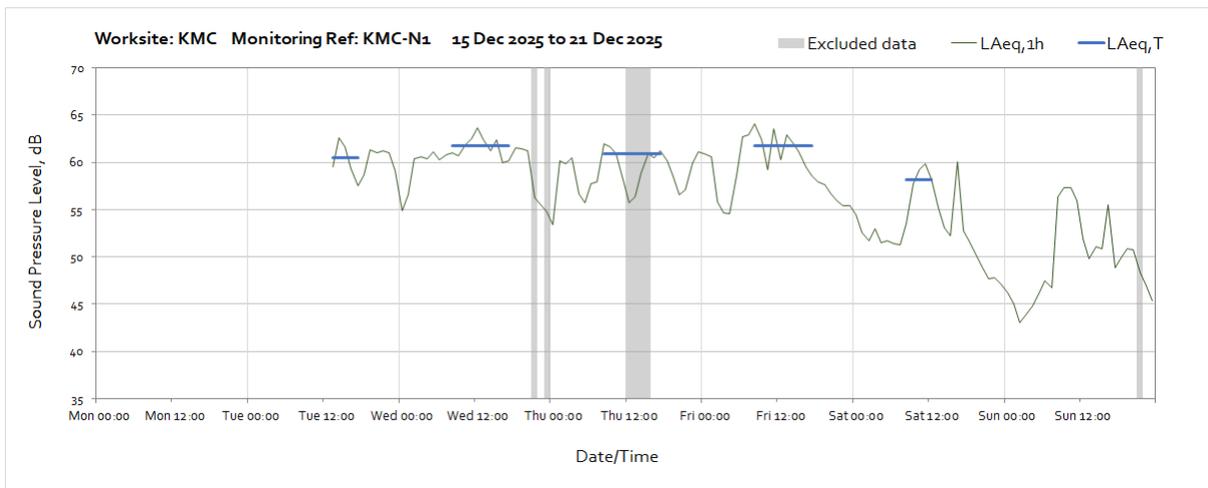





Note: Missing data between 18:00 on Thursday 11th and 13:00 on Tuesday 16th December was due to a system error at the monitoring station.


OFFICIAL

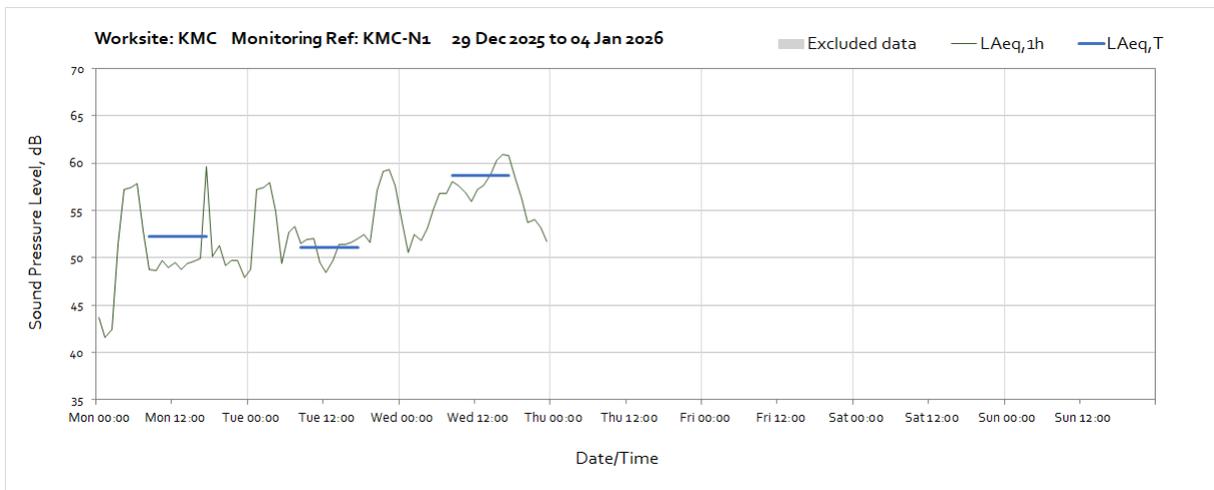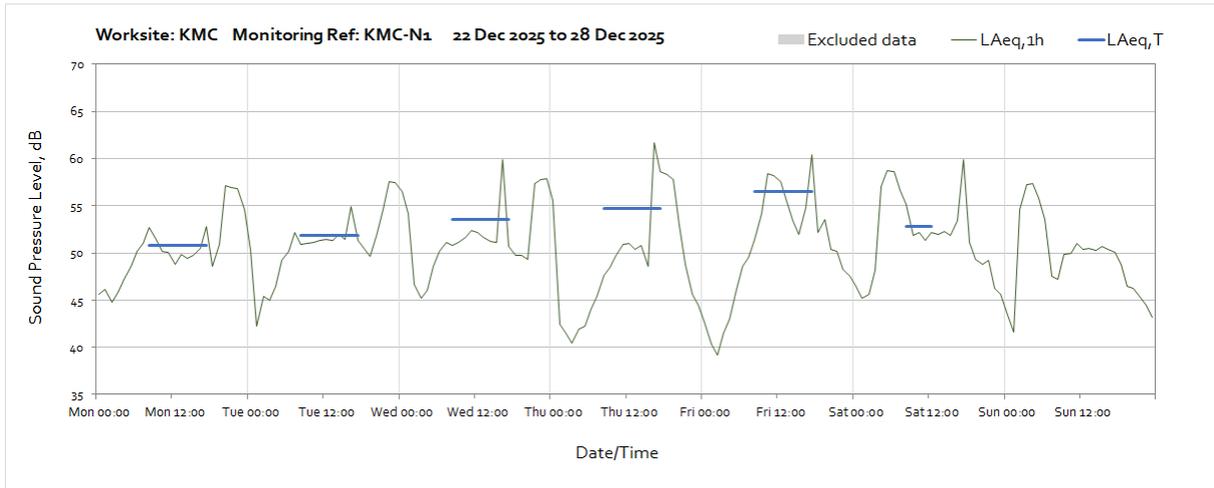



Worksite: MB - Monitoring Ref: MB-N1



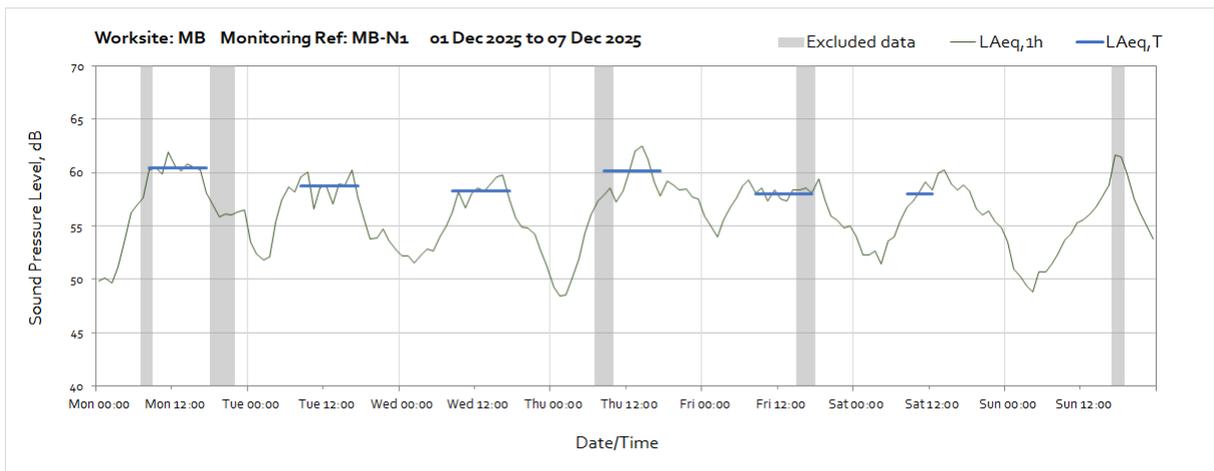


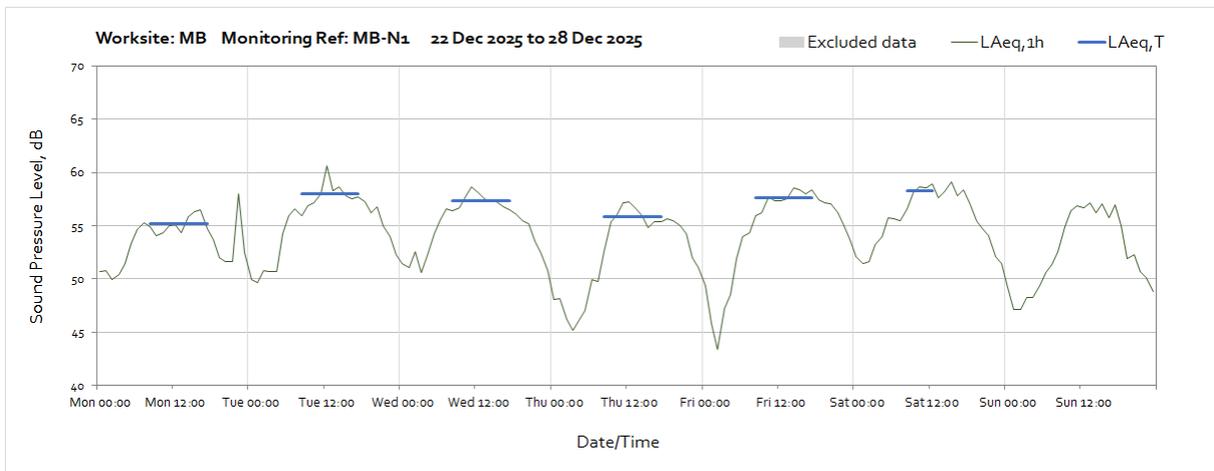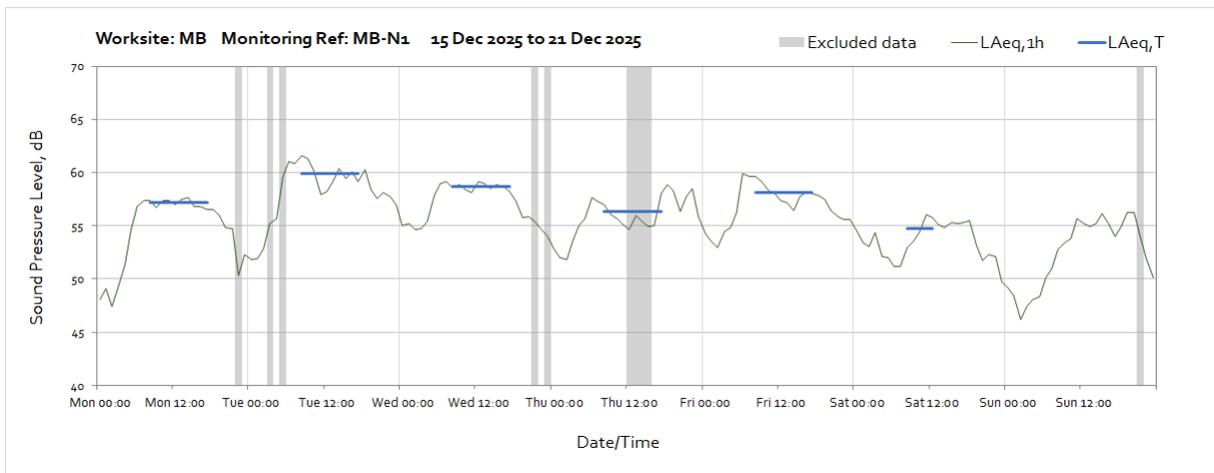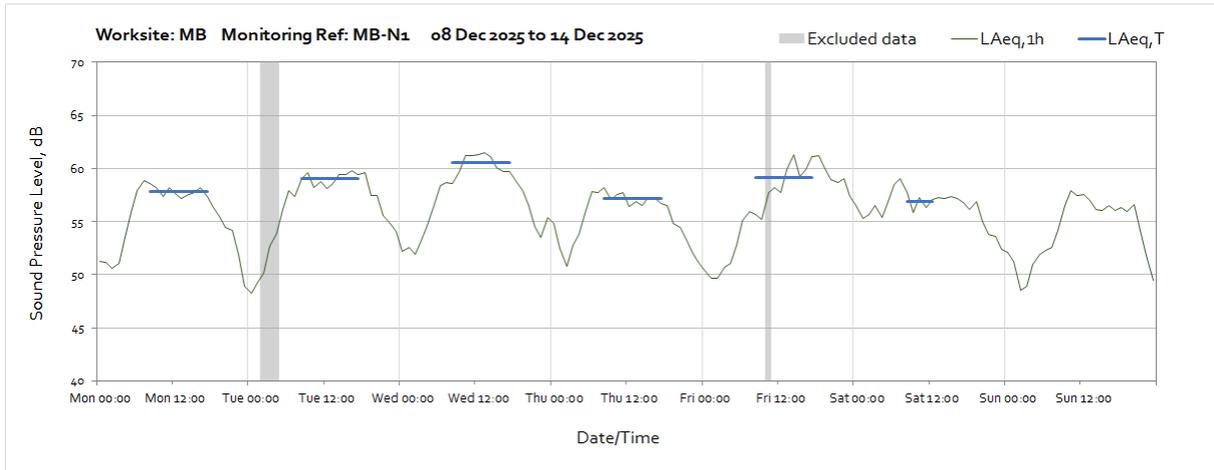



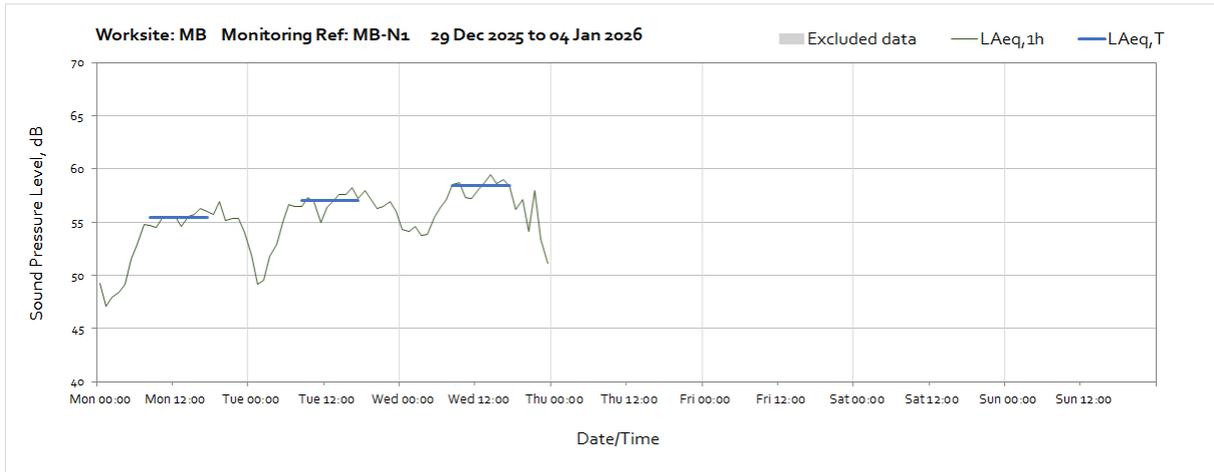




Worksite: FAEU – Monitoring Ref: FAEU-N1

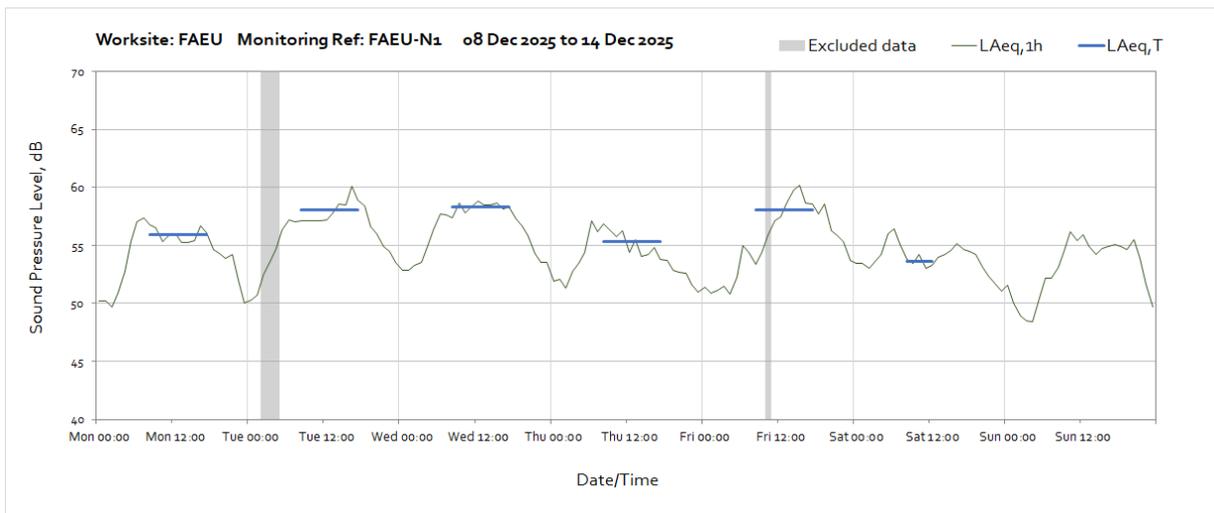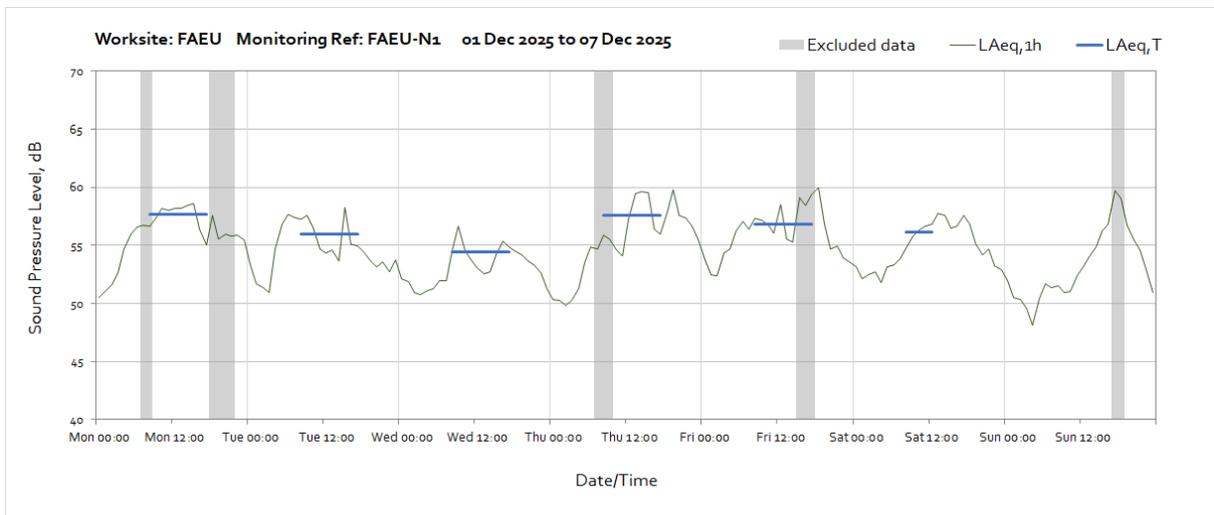

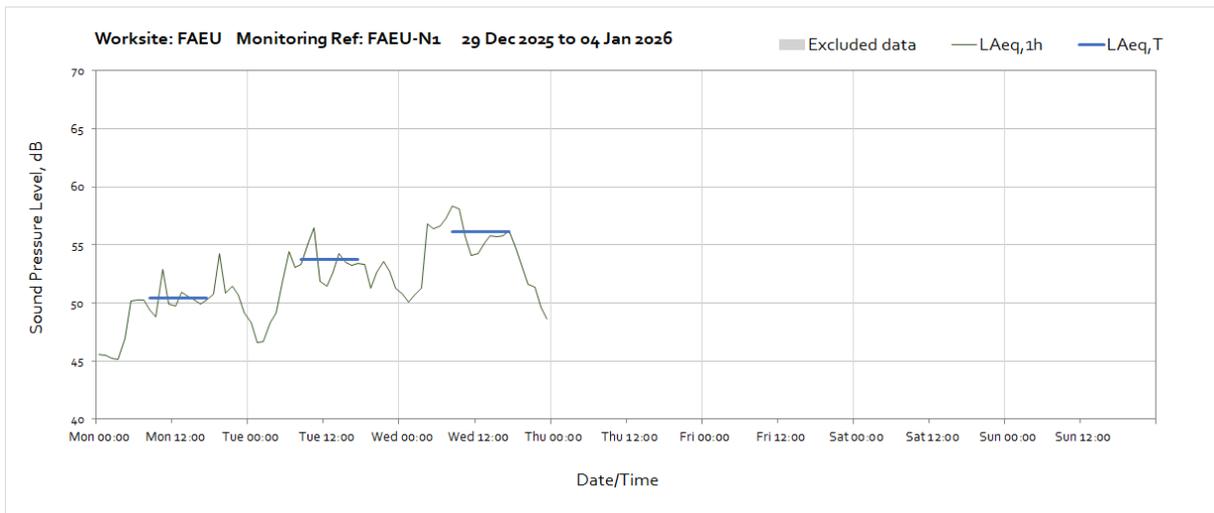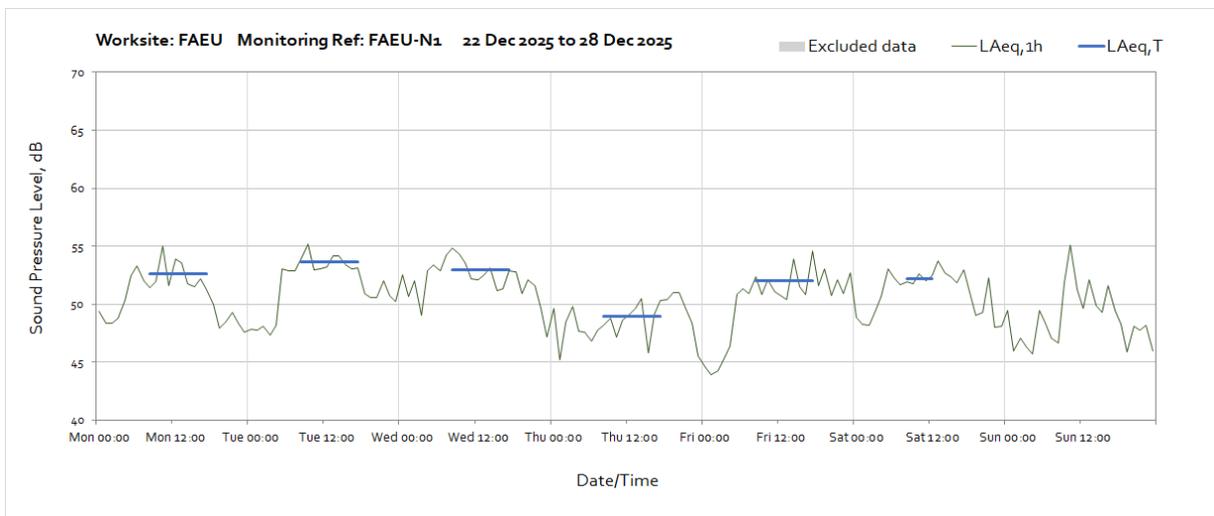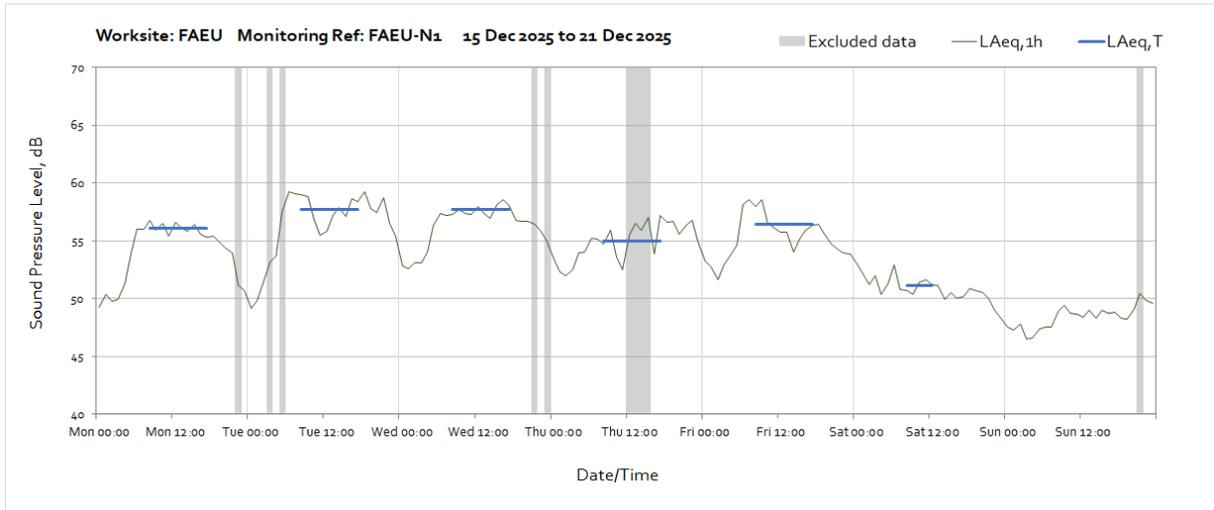




Worksite: CHBS – Monitoring Ref: CHBS-N1

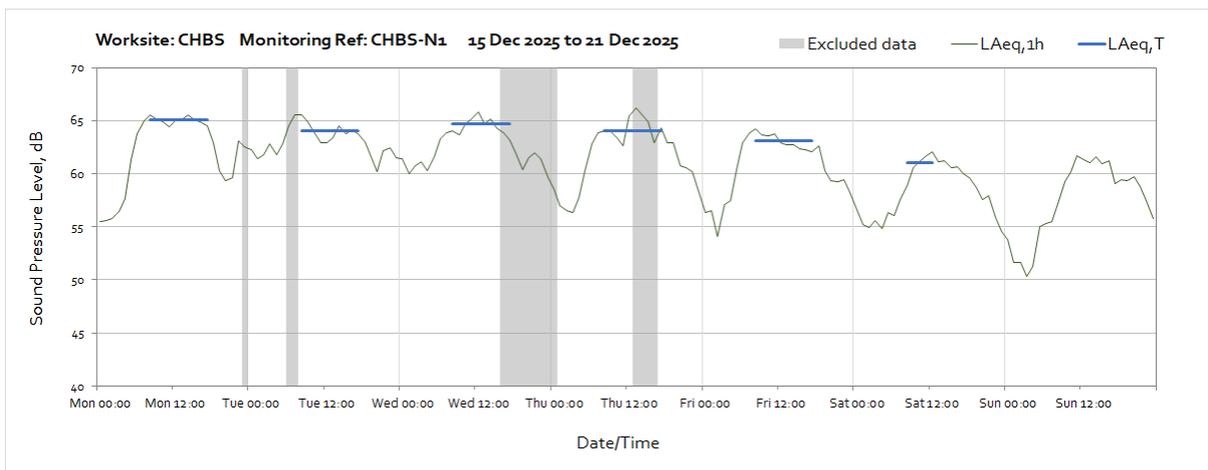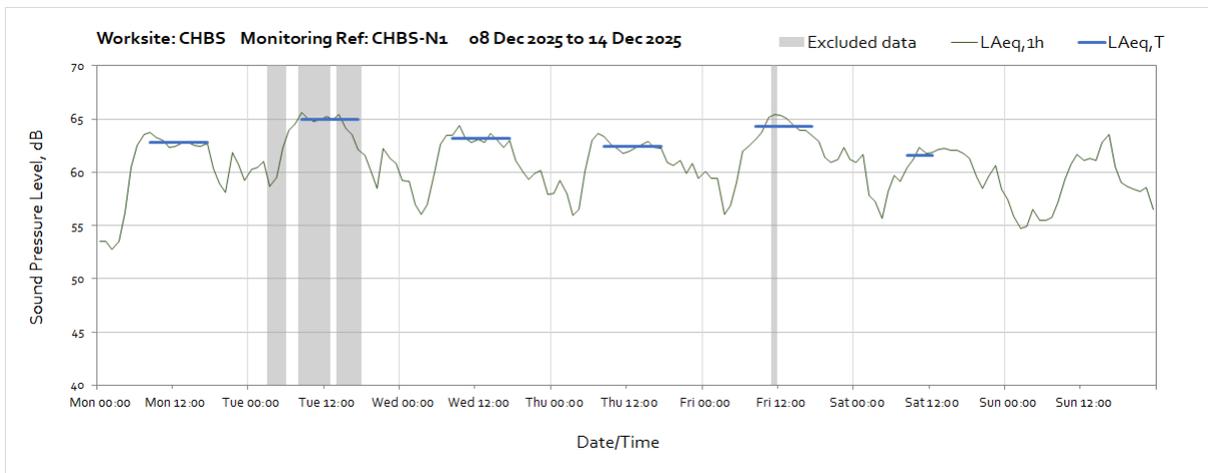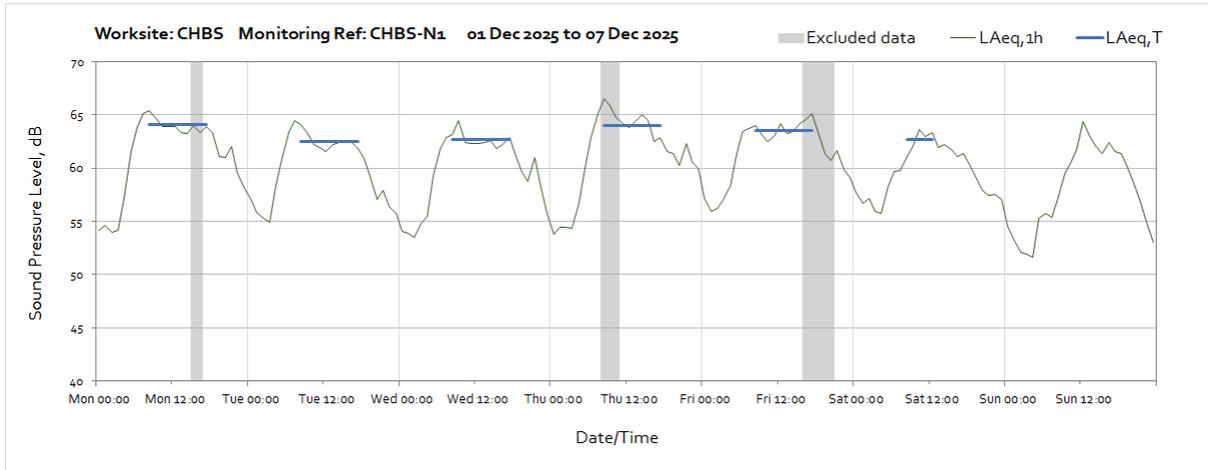

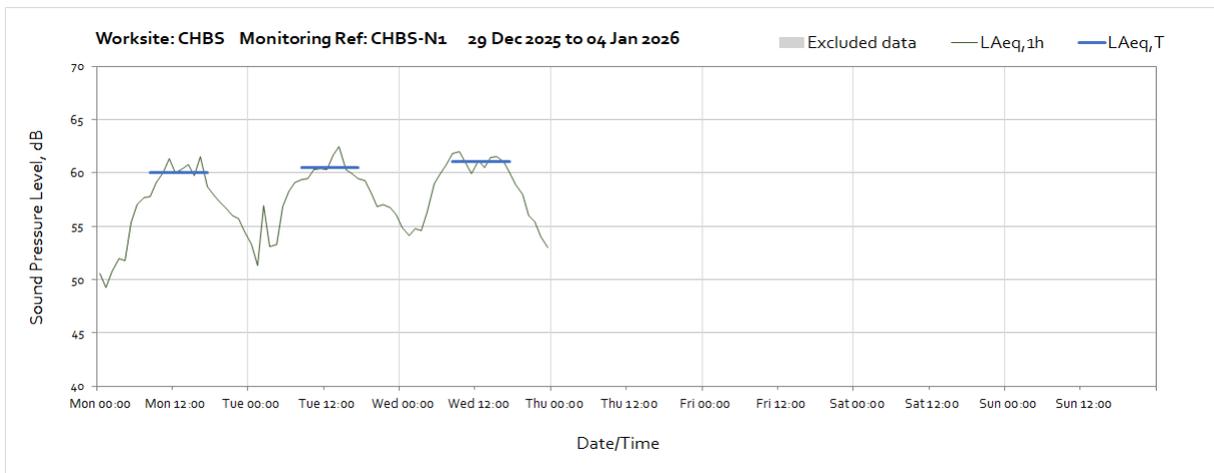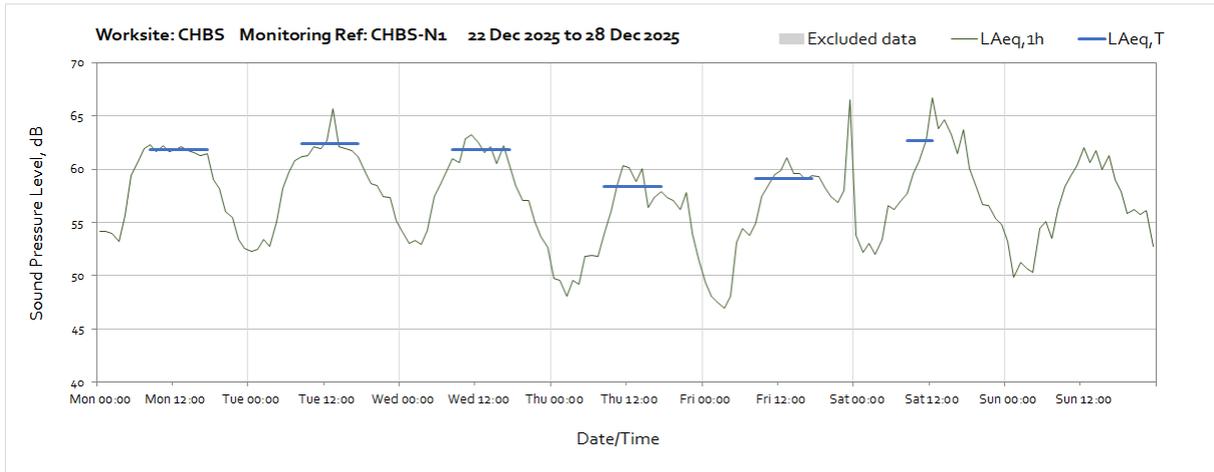



Worksite: WOSC – Monitoring Ref: WOSC-N3


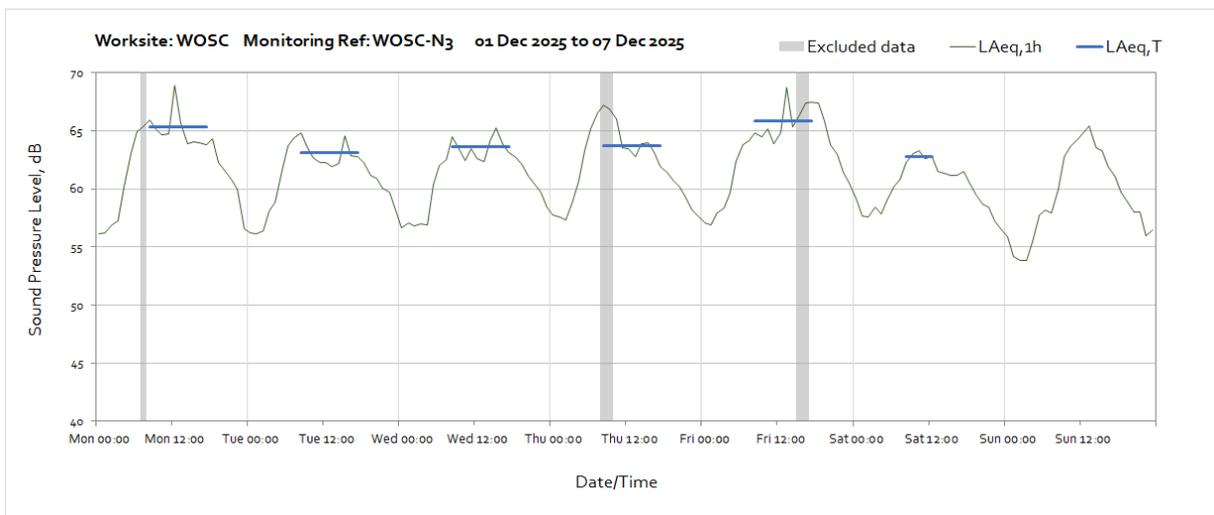


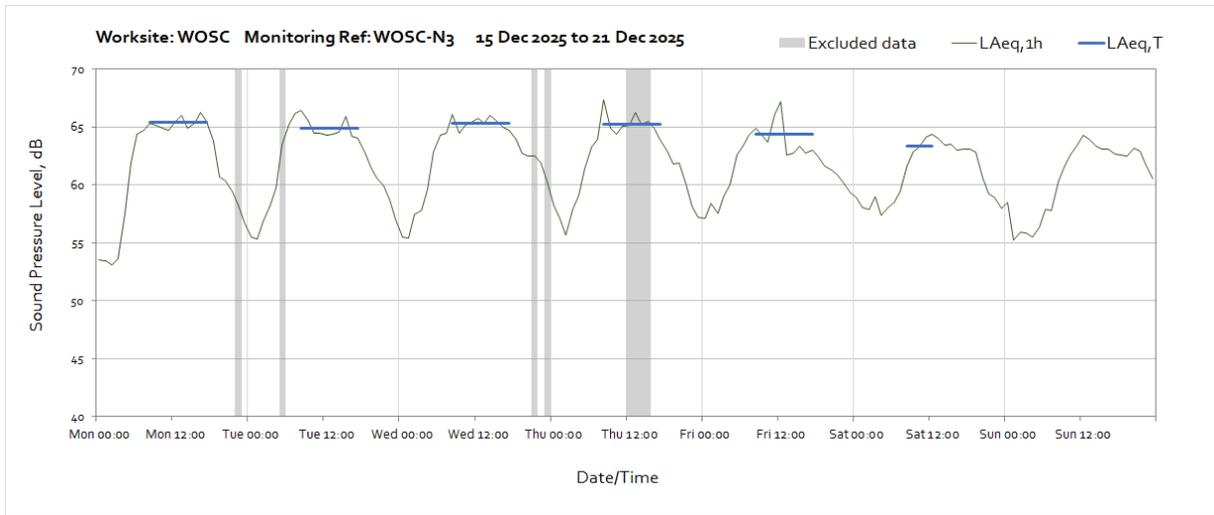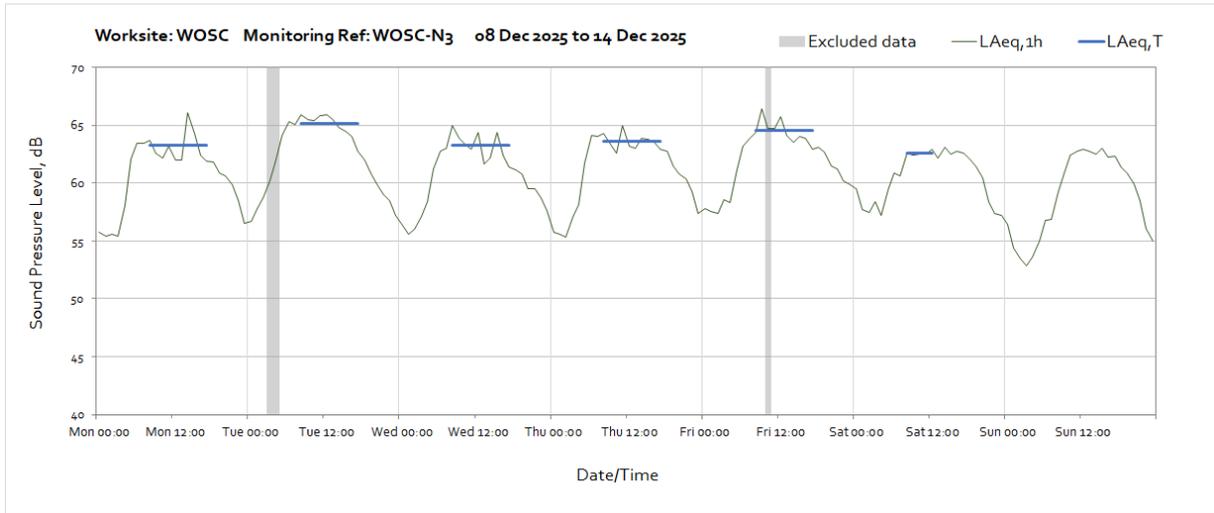






Worksite: MLE – Monitoring Ref: MLE-N1

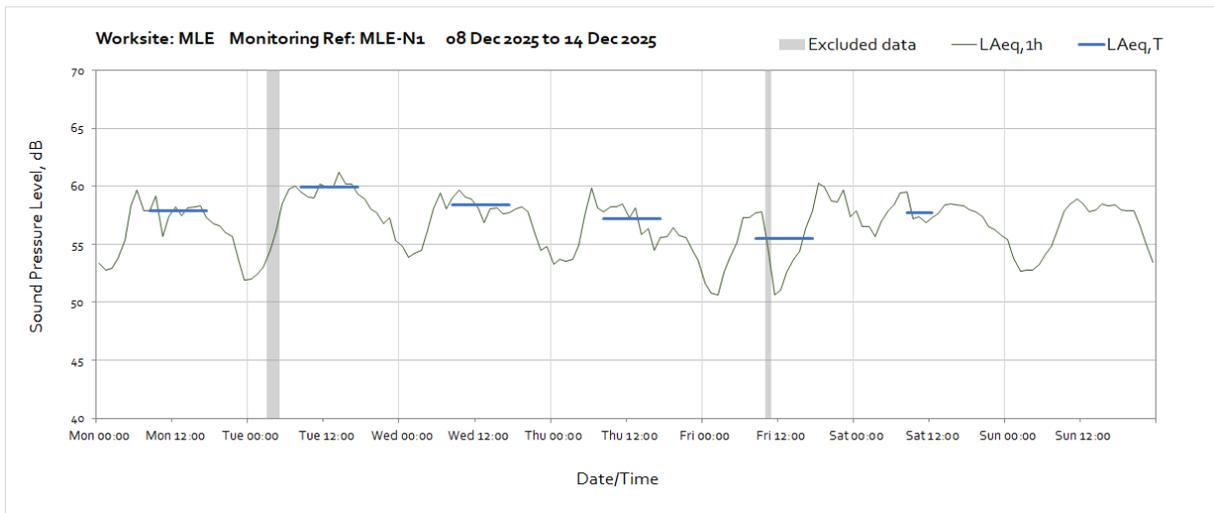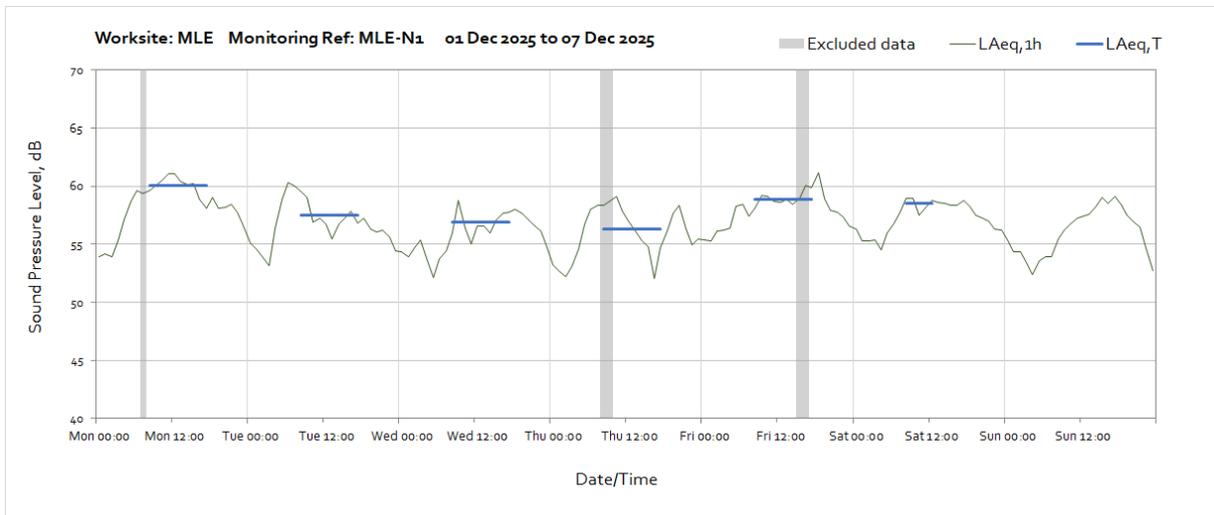

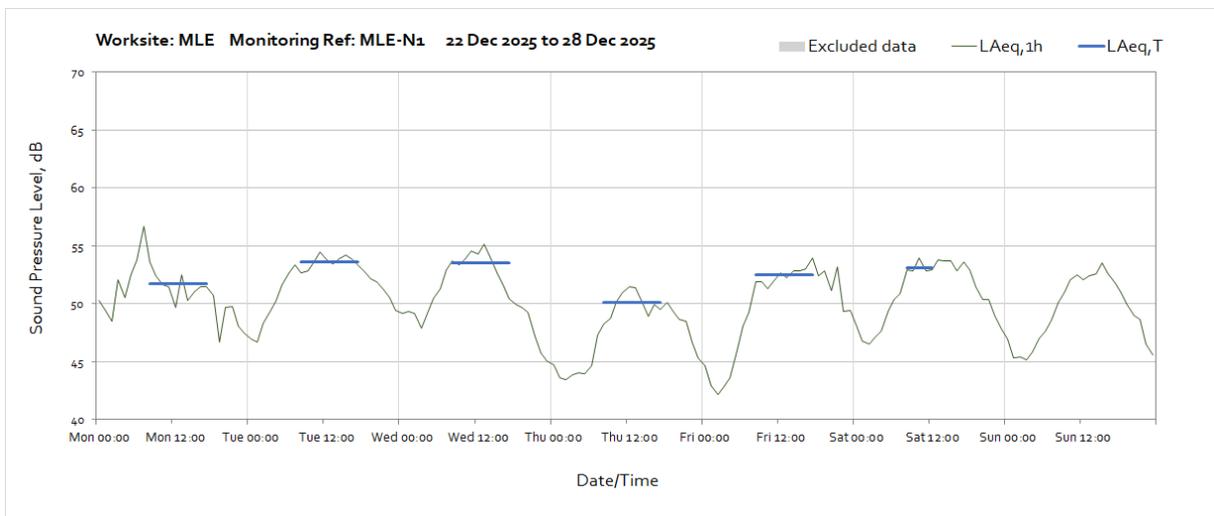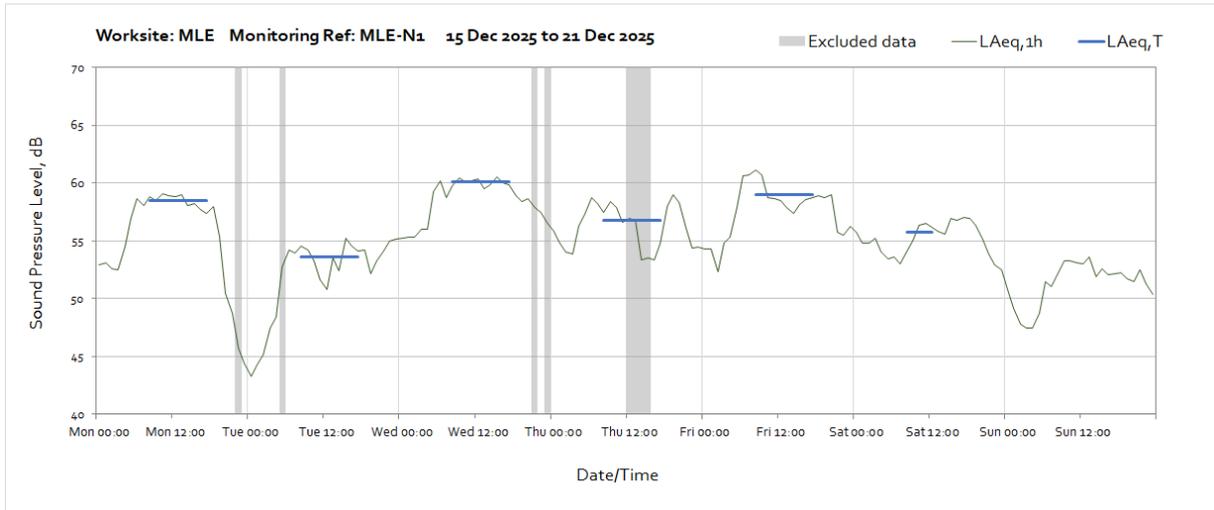




Worksite: ALO – Monitoring Ref: ALO-N1

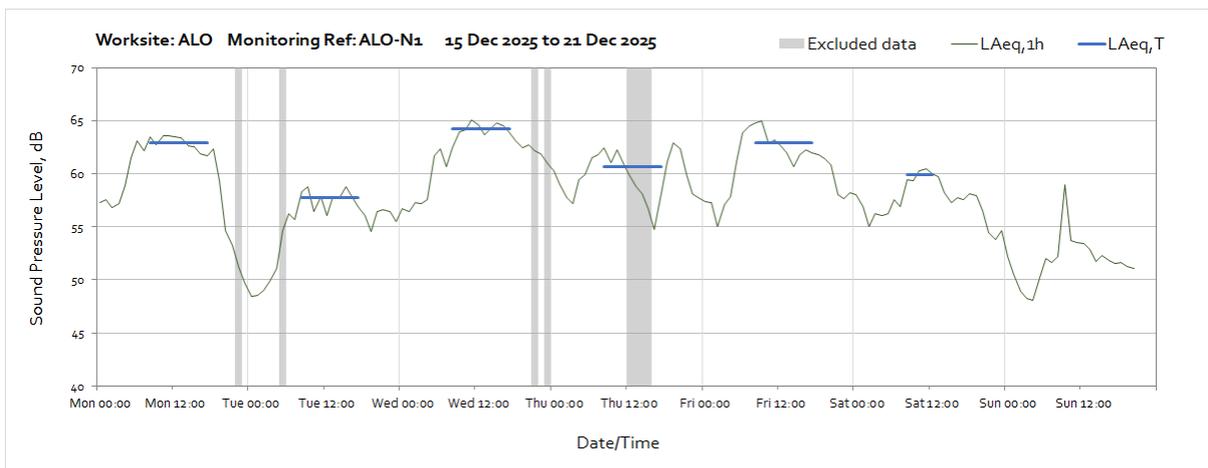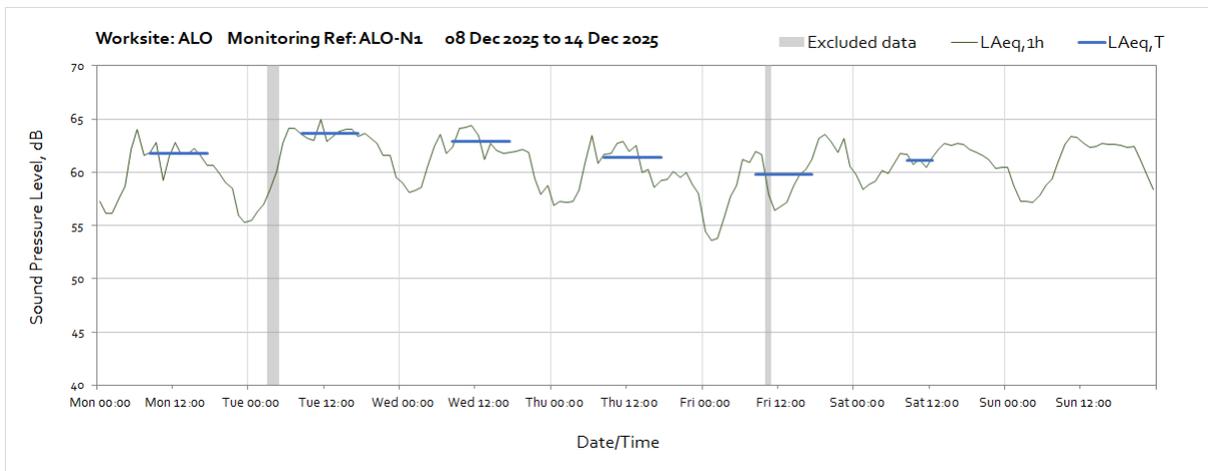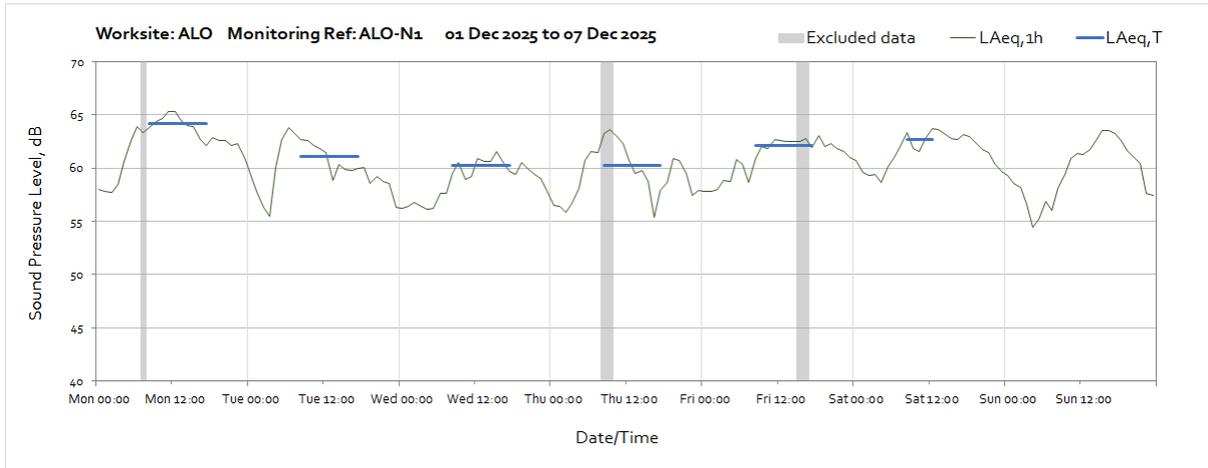


Note: Missing data from 21:00 on Sunday 21st December until the month end was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

OFFICIAL



Worksite: ALO - Monitoring Ref: ALO-N2

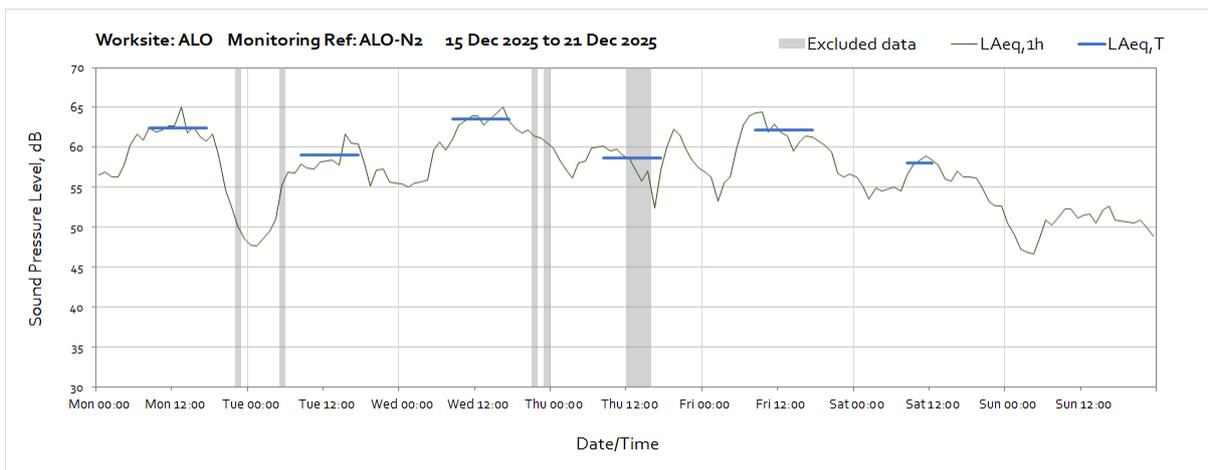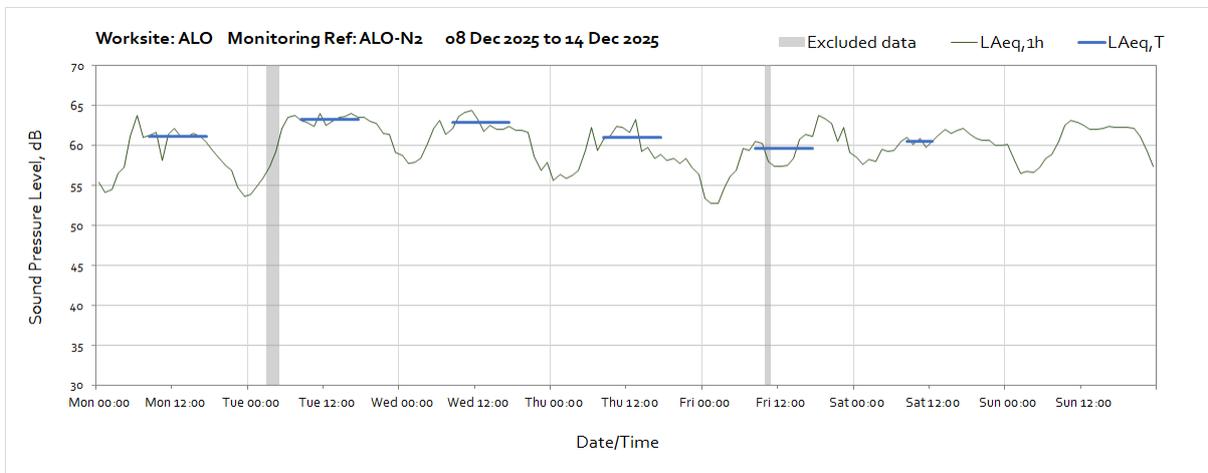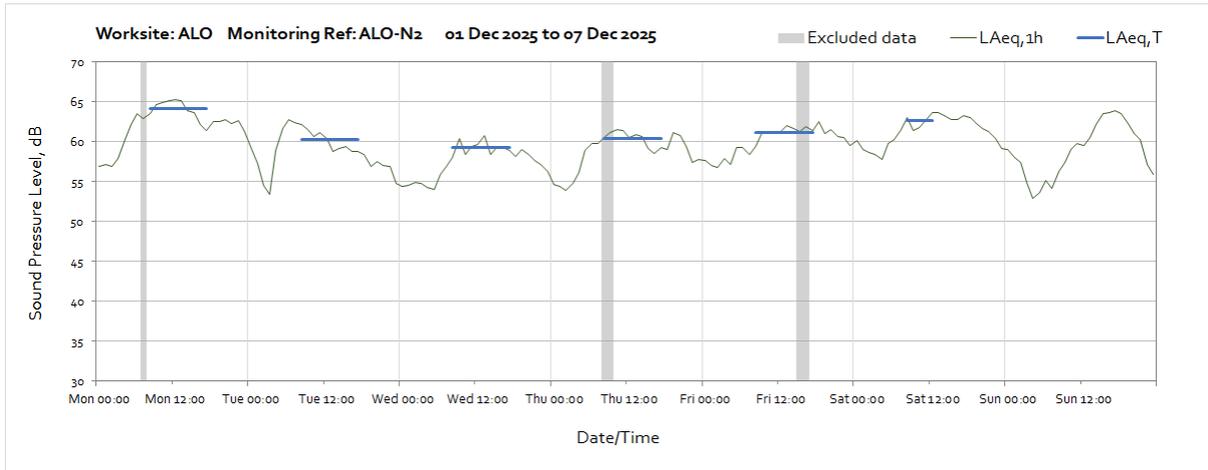



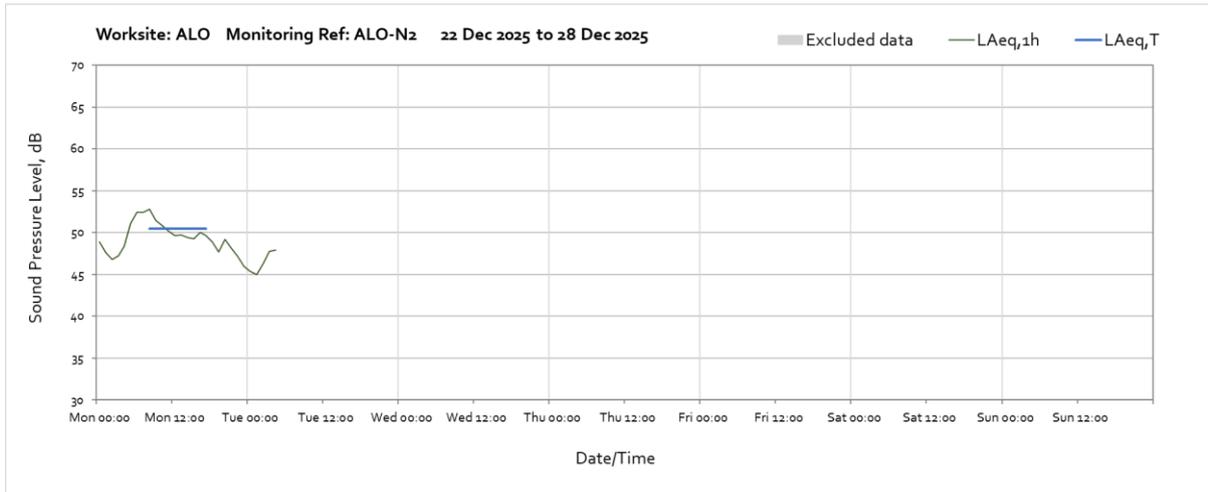


Note: Missing data from 05:00 on Tuesday 23rd December until the end of the month was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.




Worksite: ALO – Monitoring Ref: AFE-N1

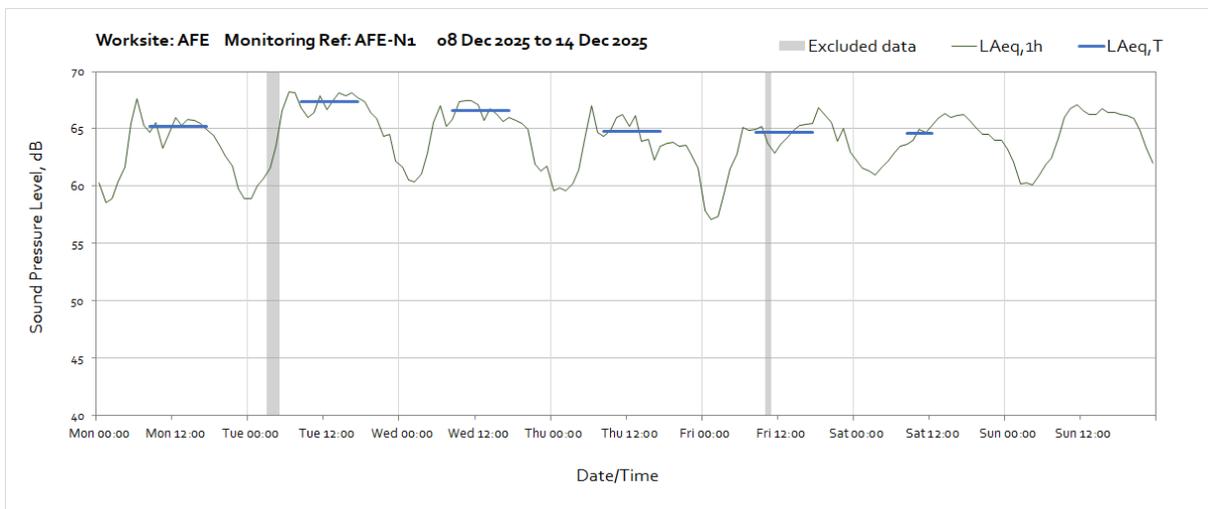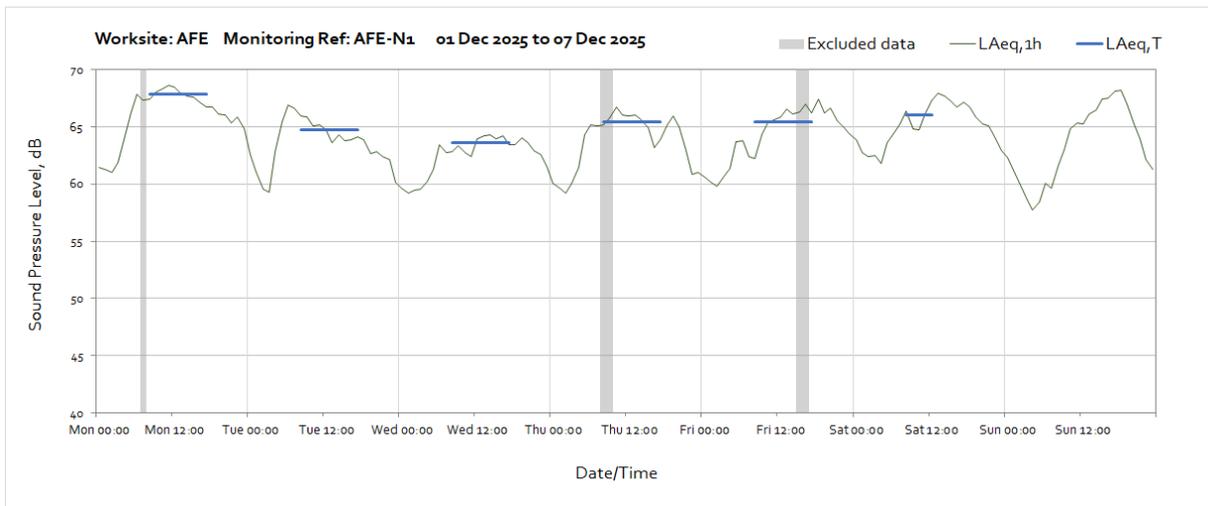



OFFICIAL

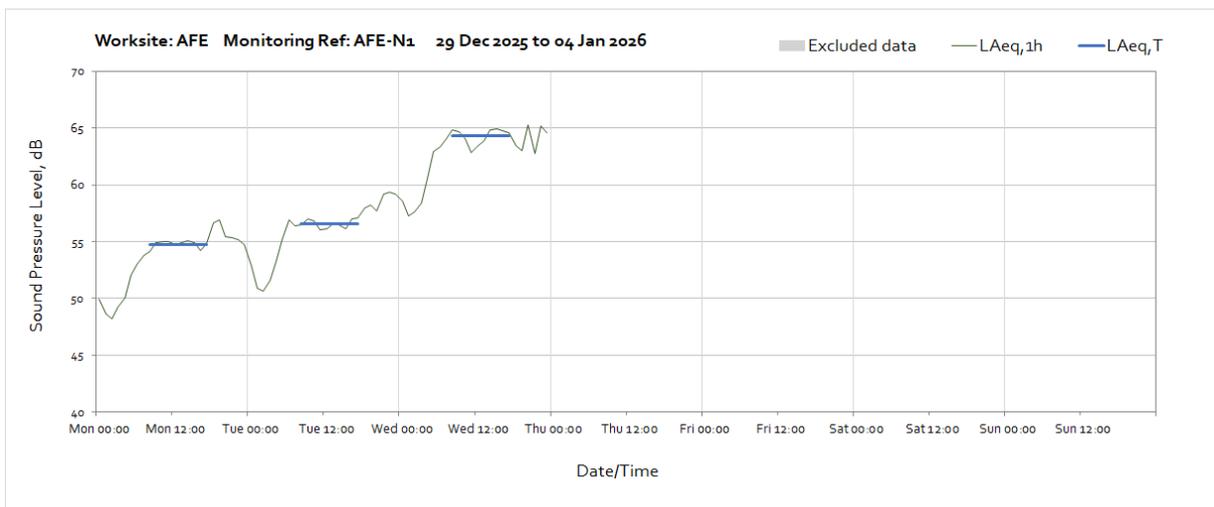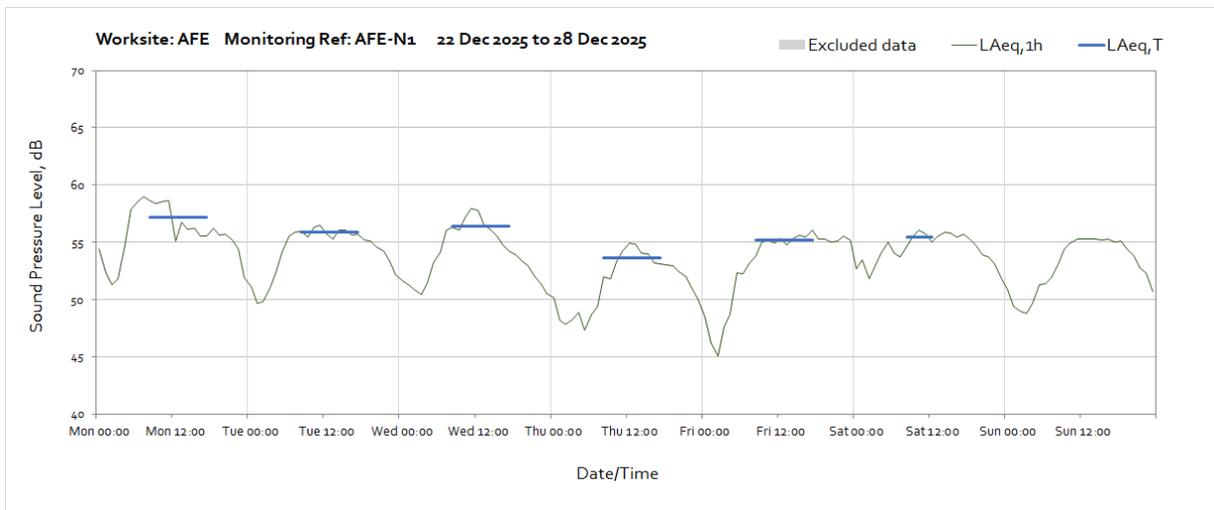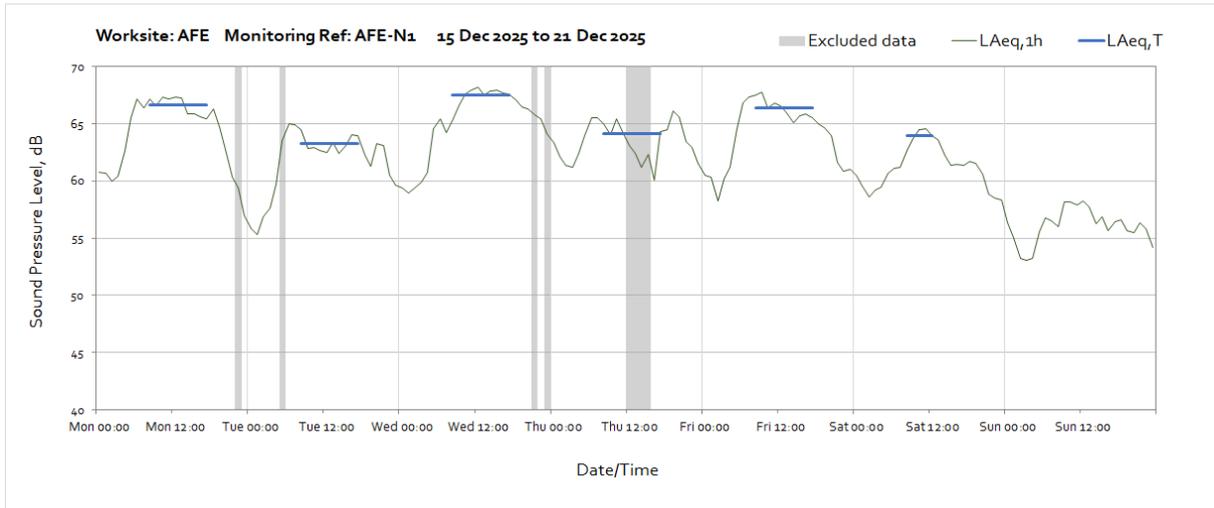


Worksite: GE – Monitoring Ref: GE-N2

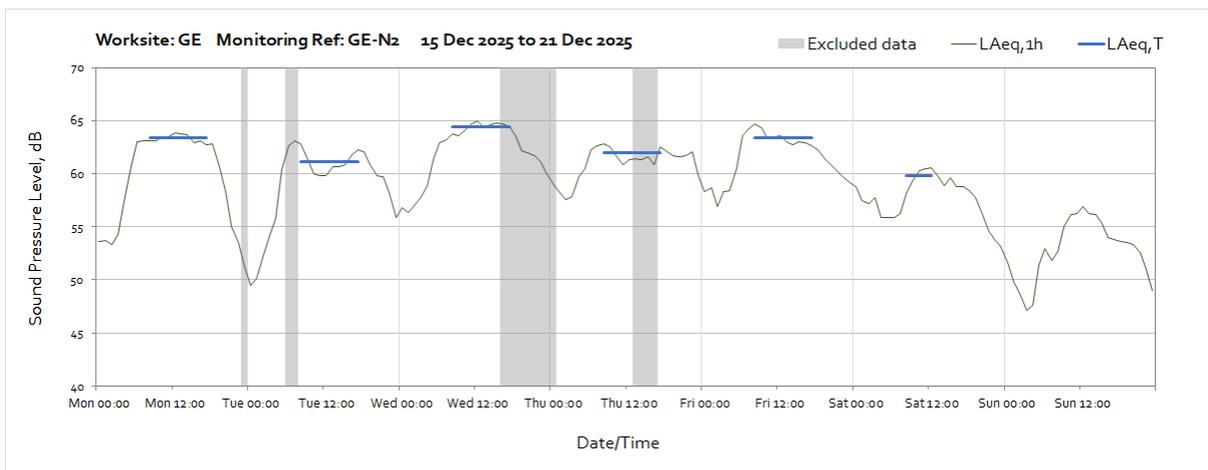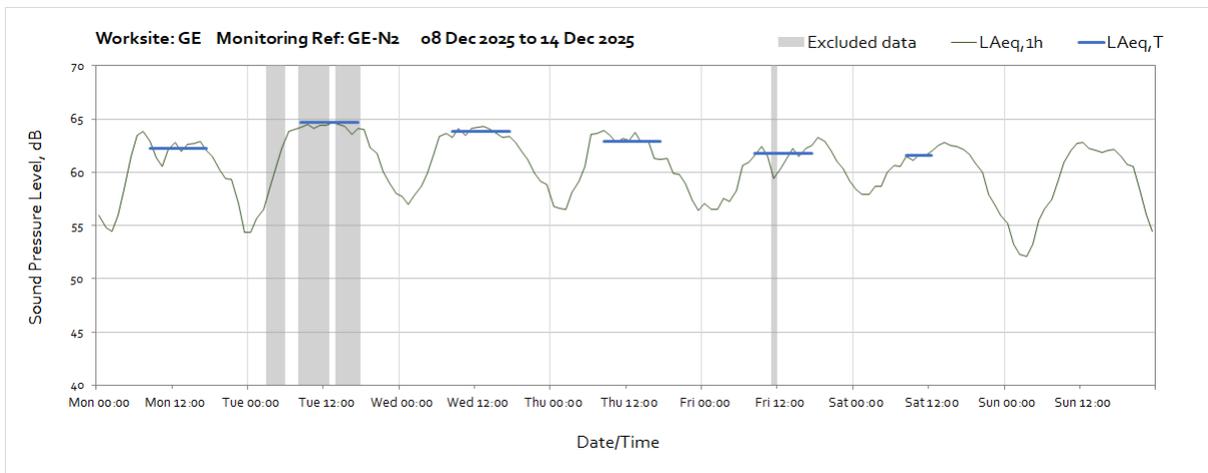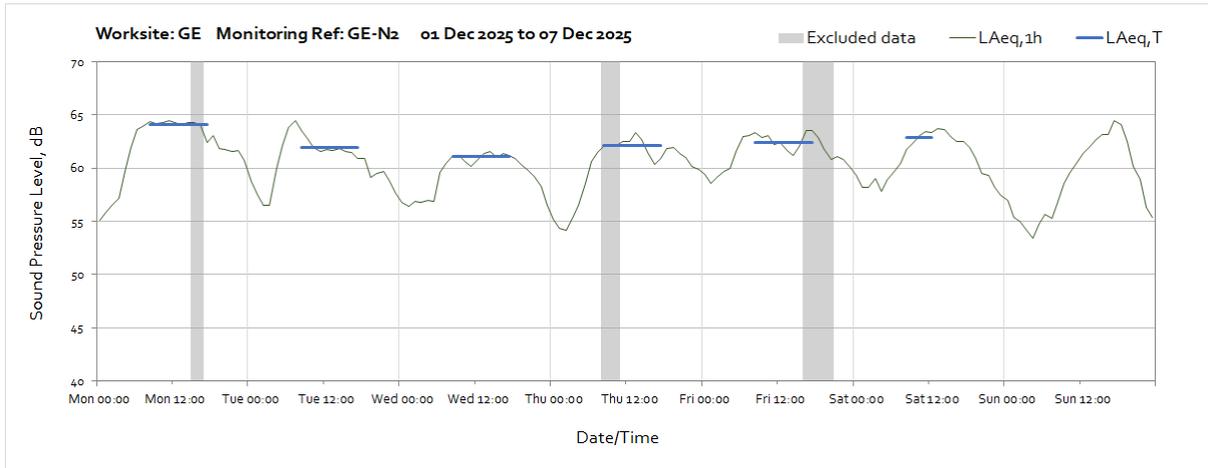


OFFICIAL

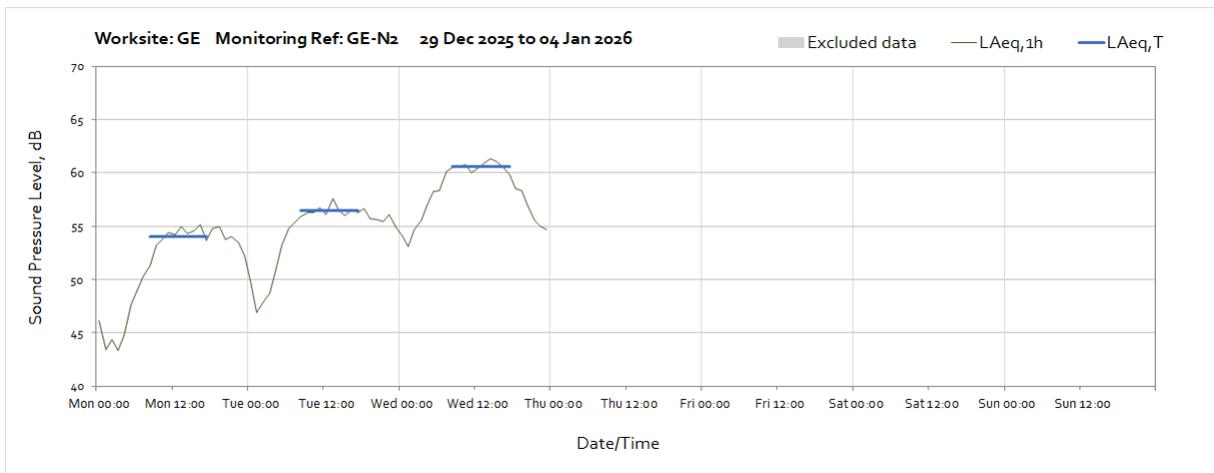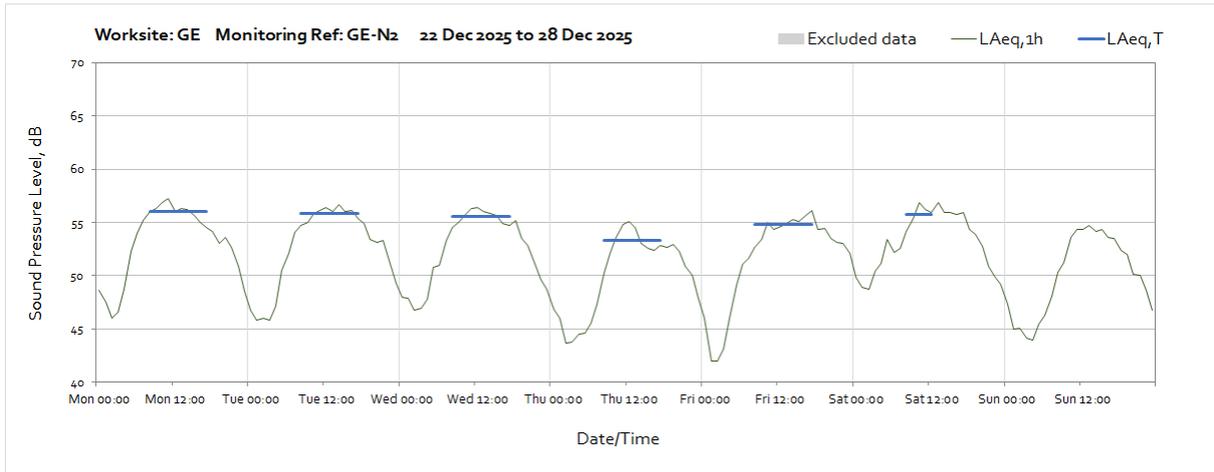



Worksite: GLD - Monitoring Ref: GLD-N1



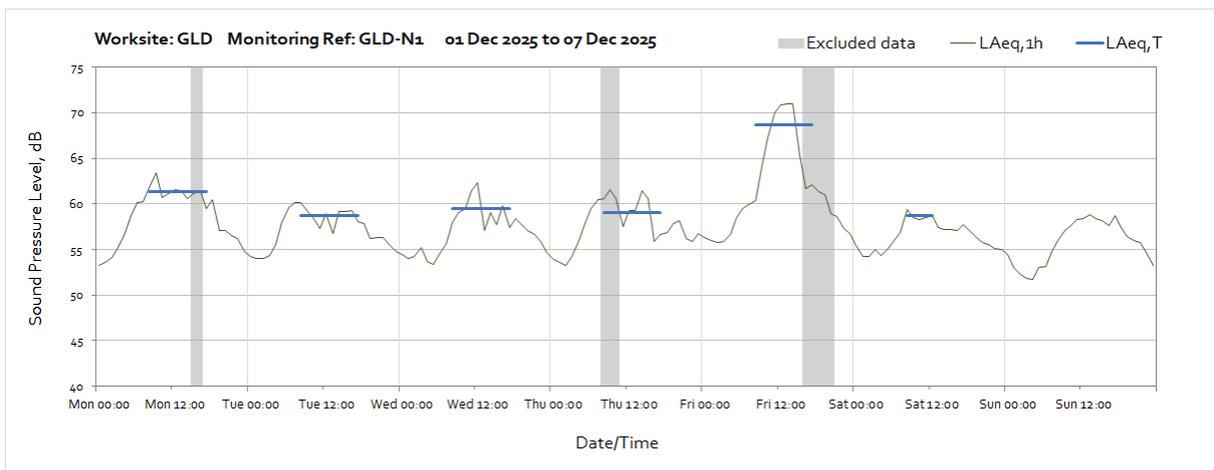


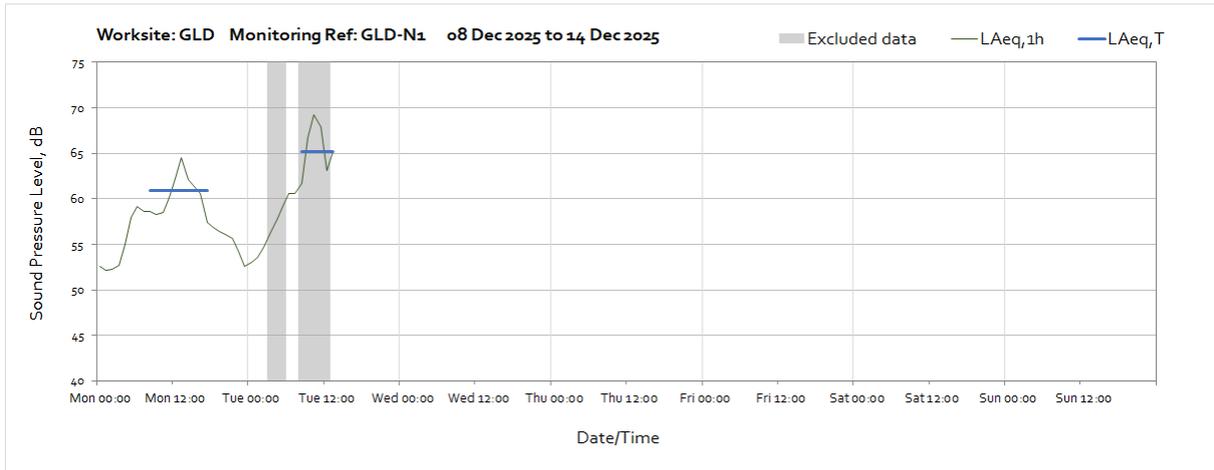




Note: Missing data from 14:00 on Tuesday 9th December until the end of the month was due to a mains power issue at the monitoring station.


Worksite: BRD - Monitoring Ref: BRD-N2

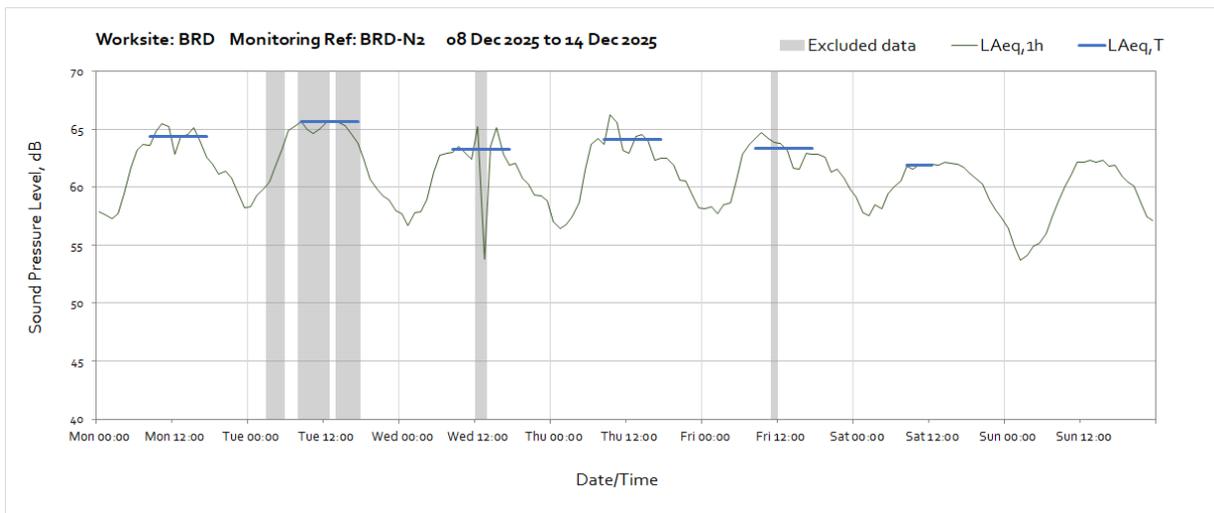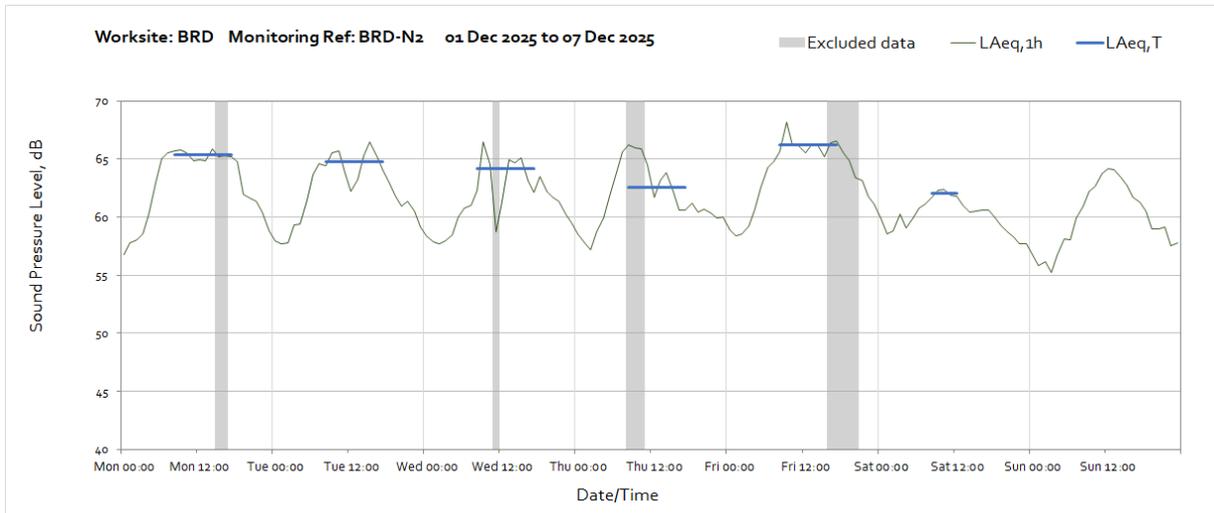

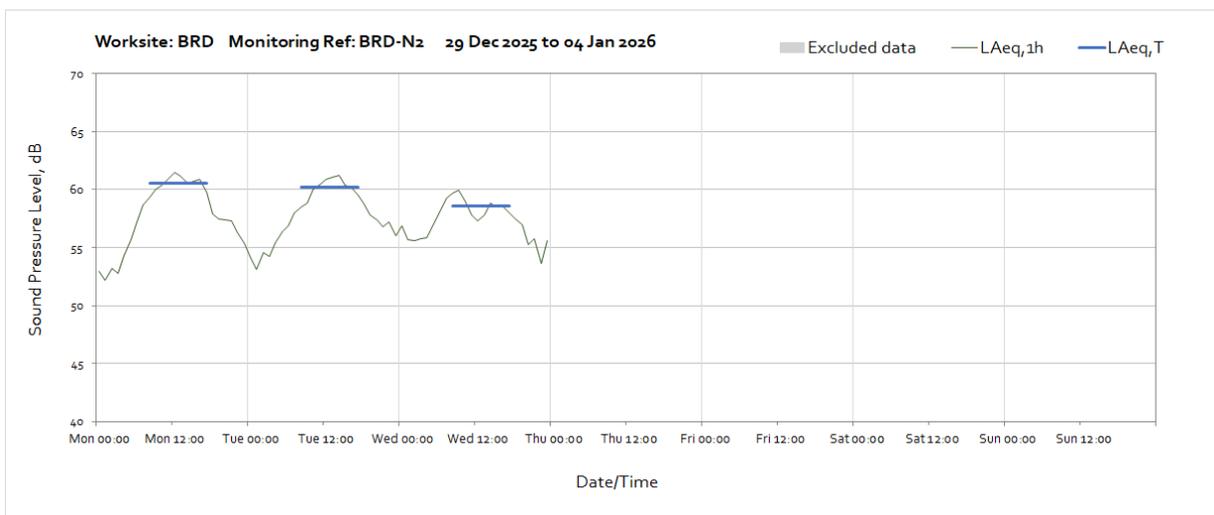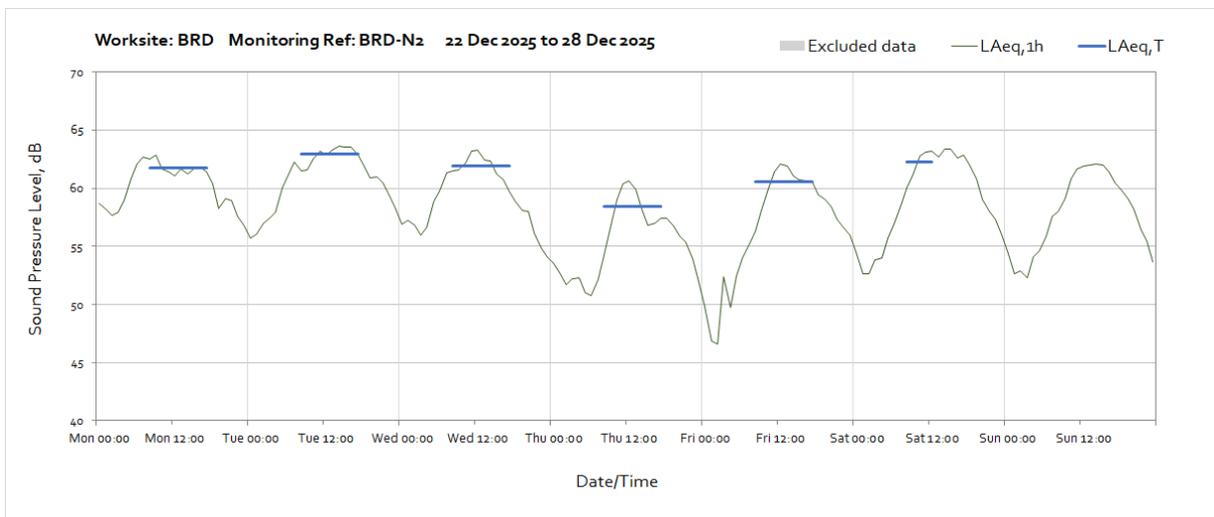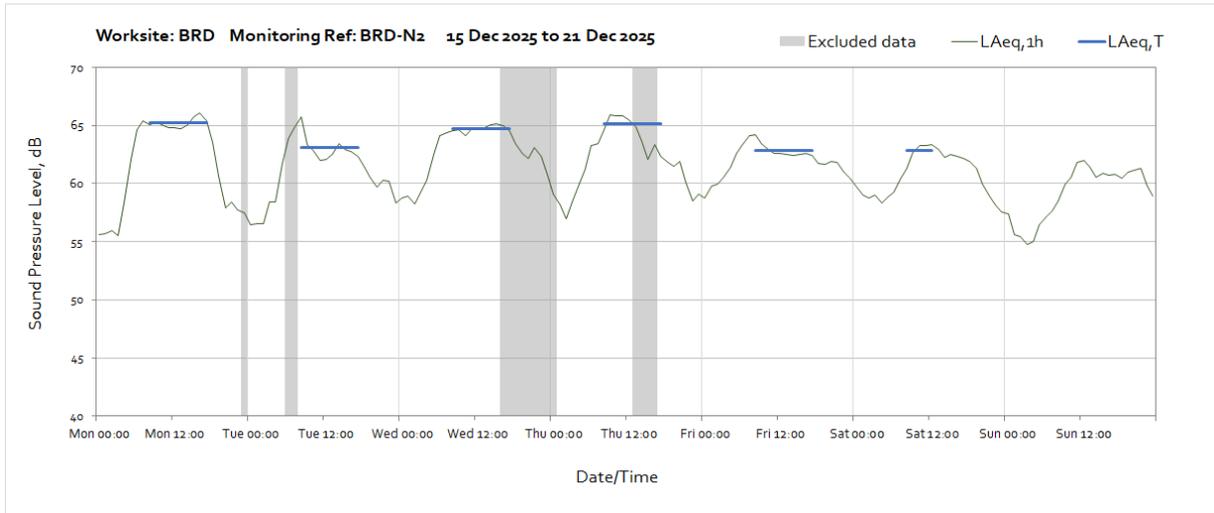

Worksite: BRD - Monitoring Ref: BRD-N3

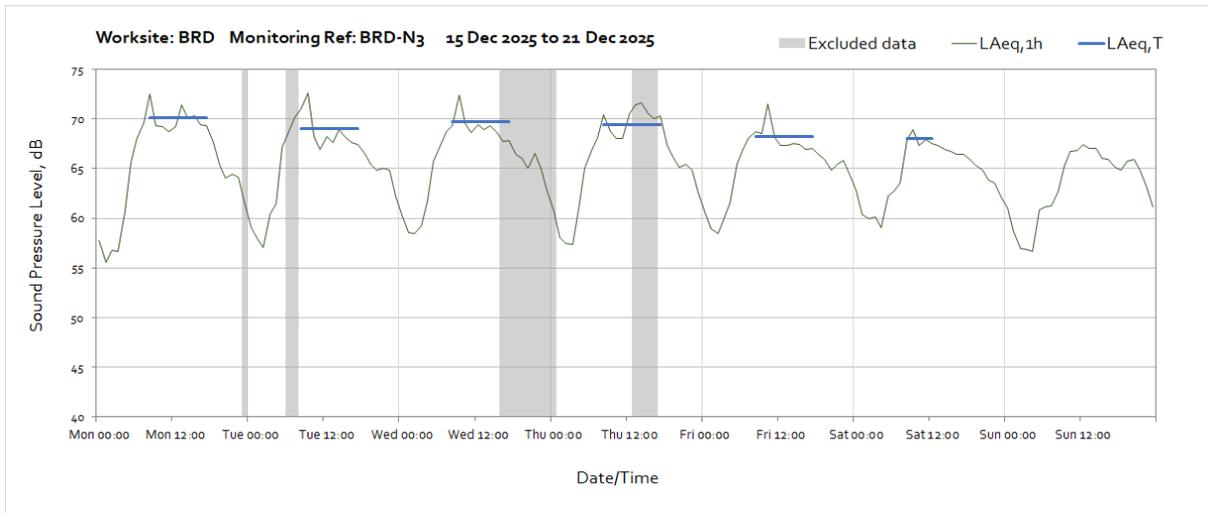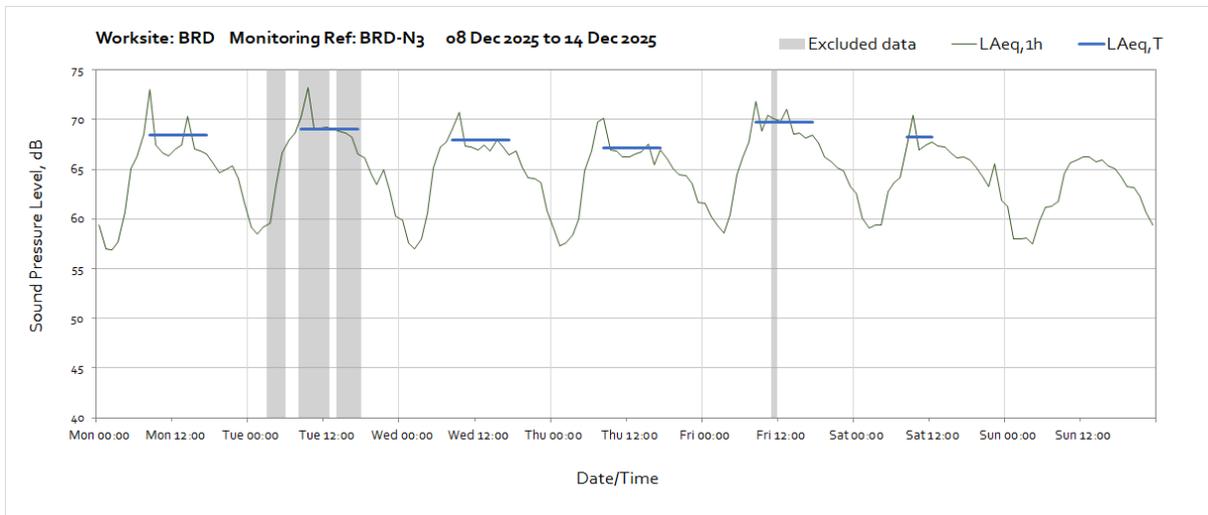
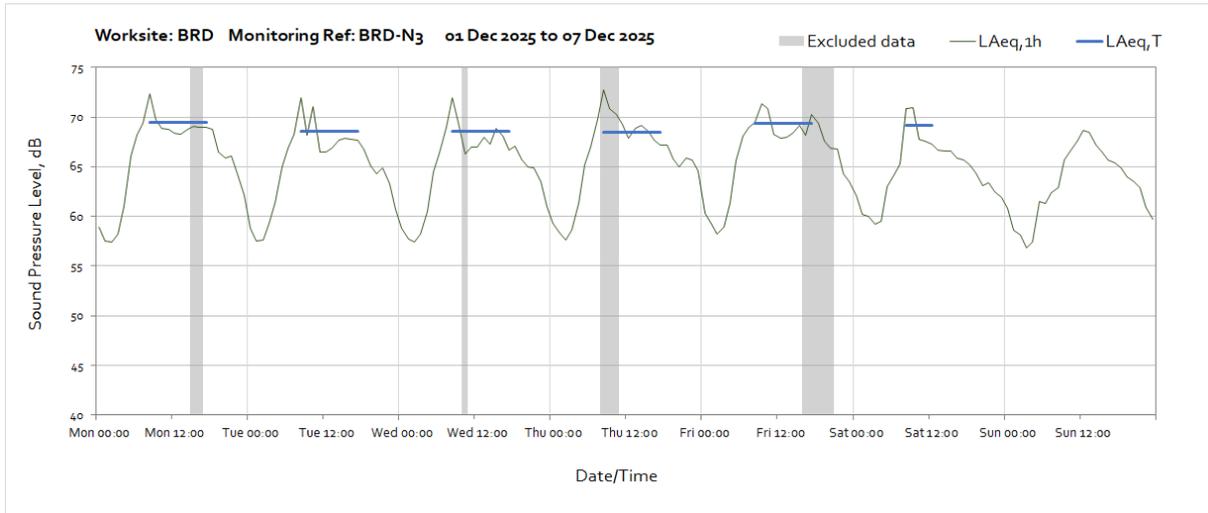




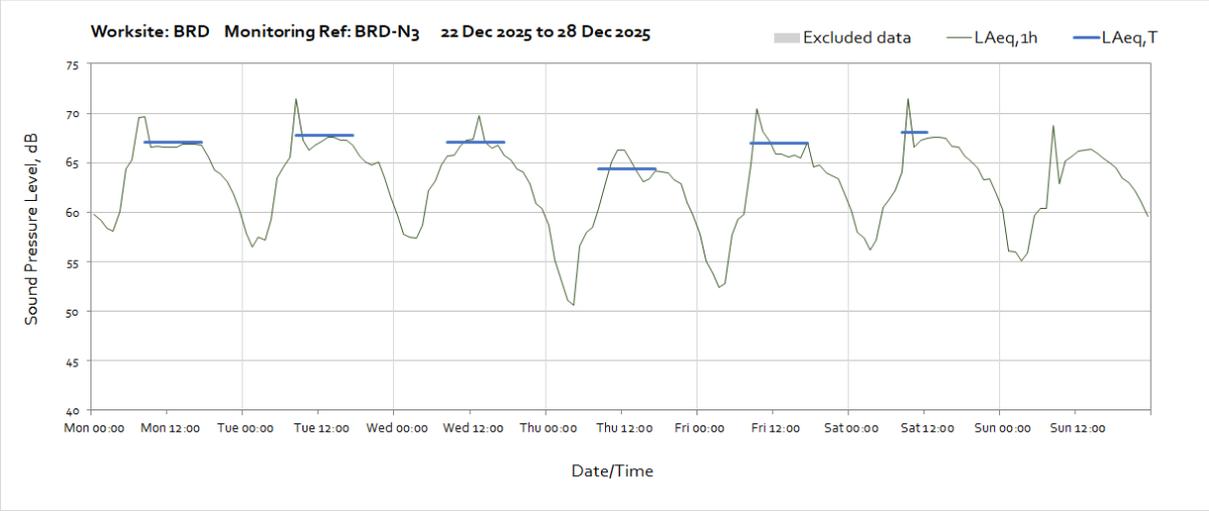


Vibration

The following graphs show the hourly measured peak particle velocity PPV recorded during the monitoring period. The graphs show the highest PPV of the three orthogonal axes x, y and z. Where high values of PPV were caused by local interference with the vibration monitor, which are not representative of HS2 construction works, these values have been greyed out in the following charts and have been excluded to calculate values in Table 4 of the main report.



Worksite: MB – Monitoring Ref: MB-V1

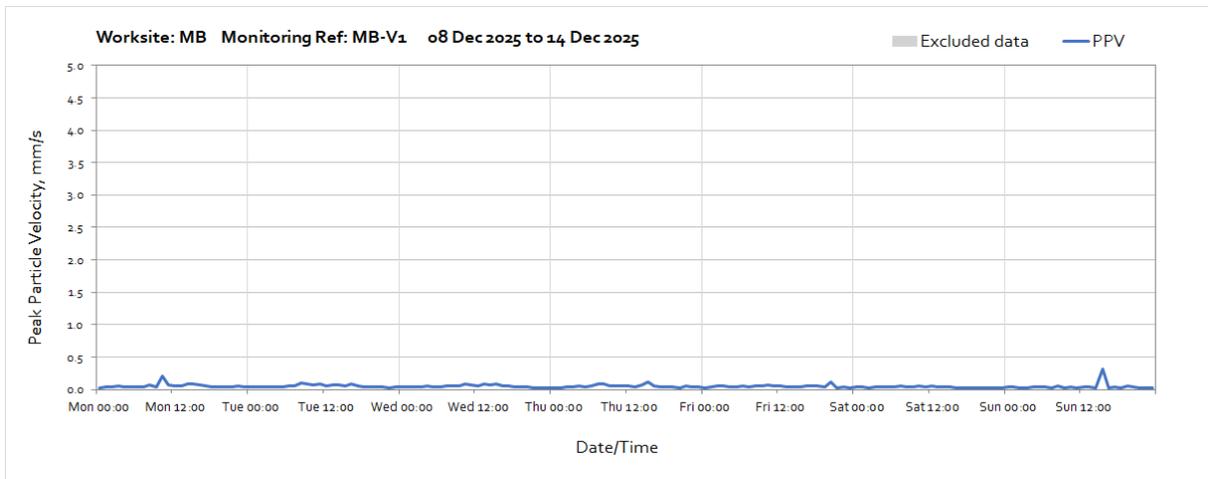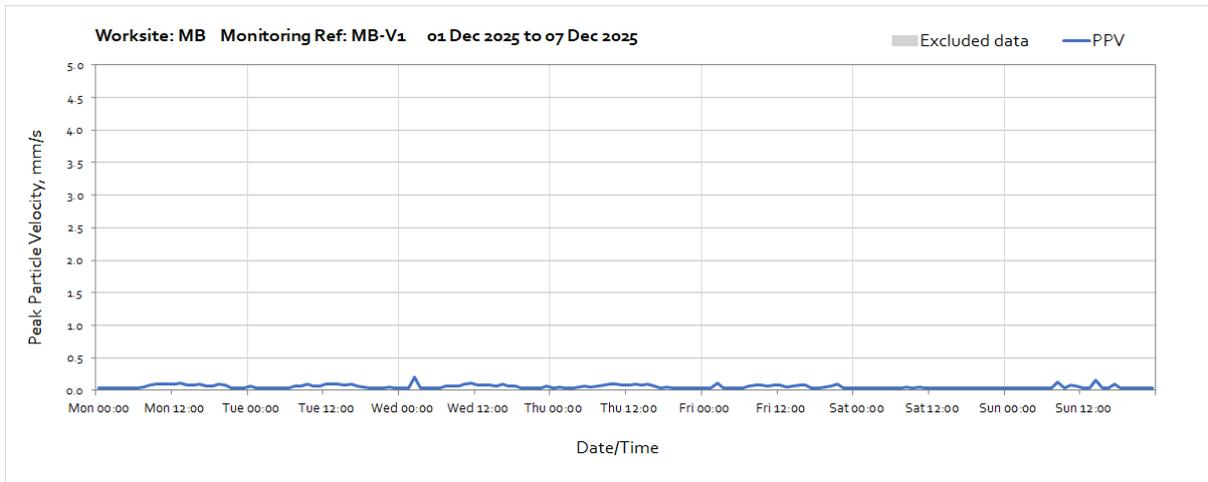

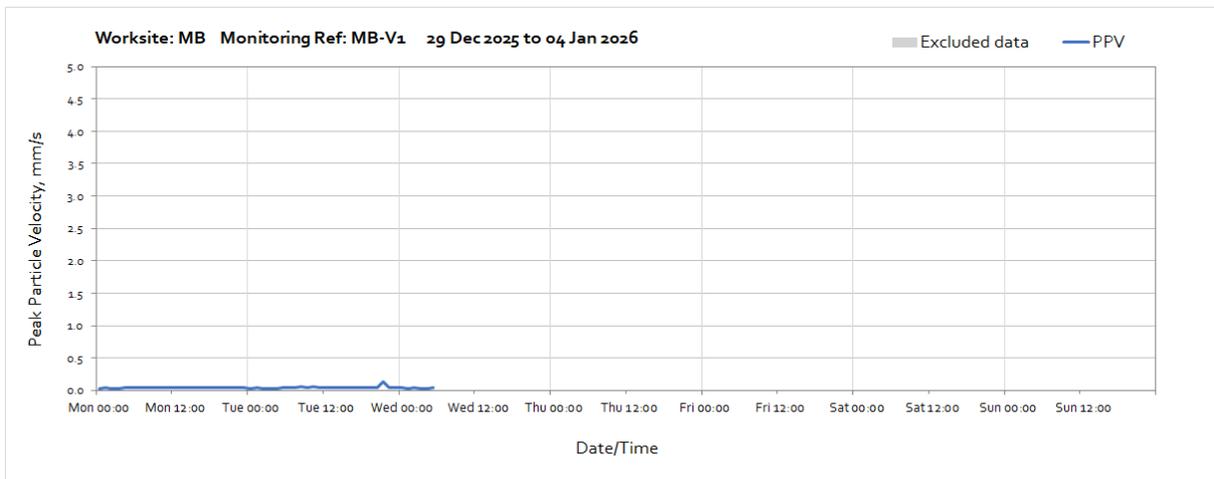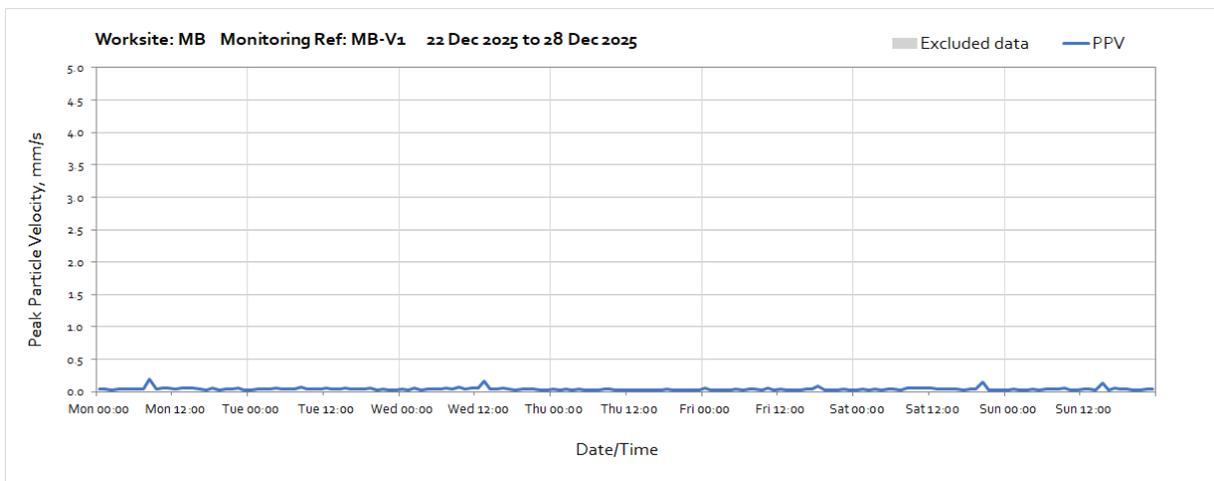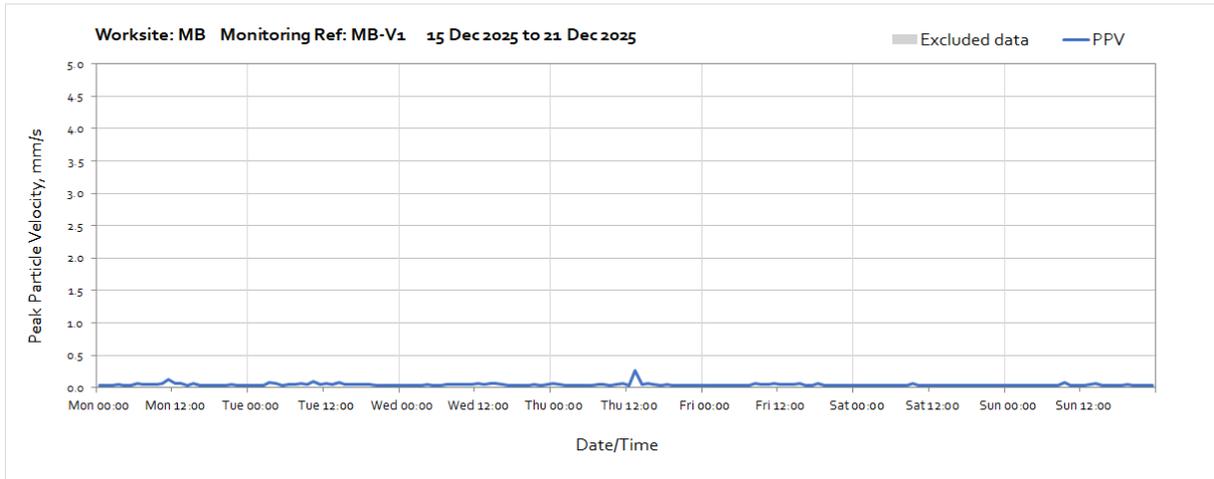


Note: Missing data from 06:00 on Wednesday 31st December until the end of the month was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

Worksite: FAEU – Monitoring Ref: FAEU-V1

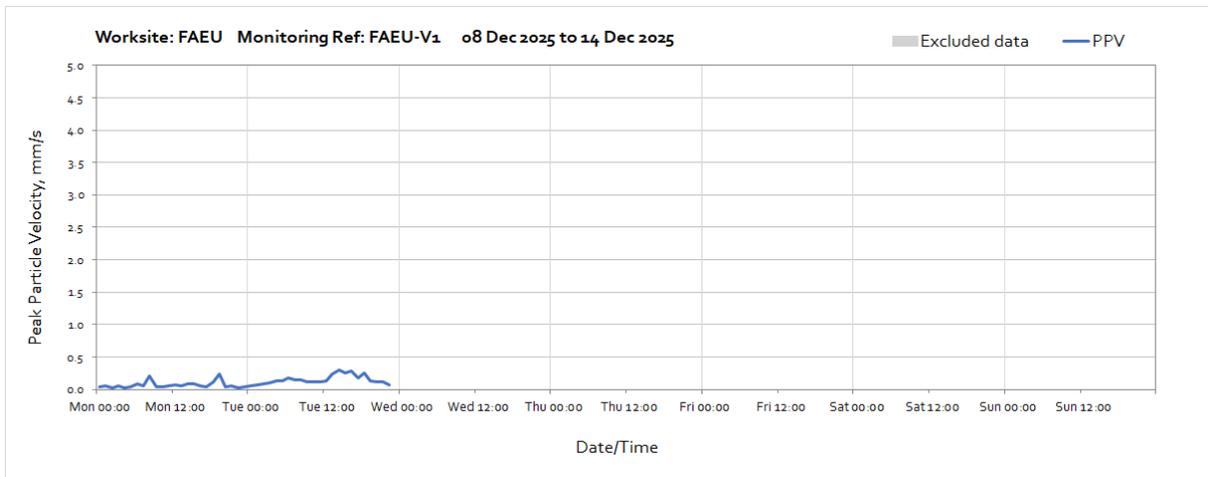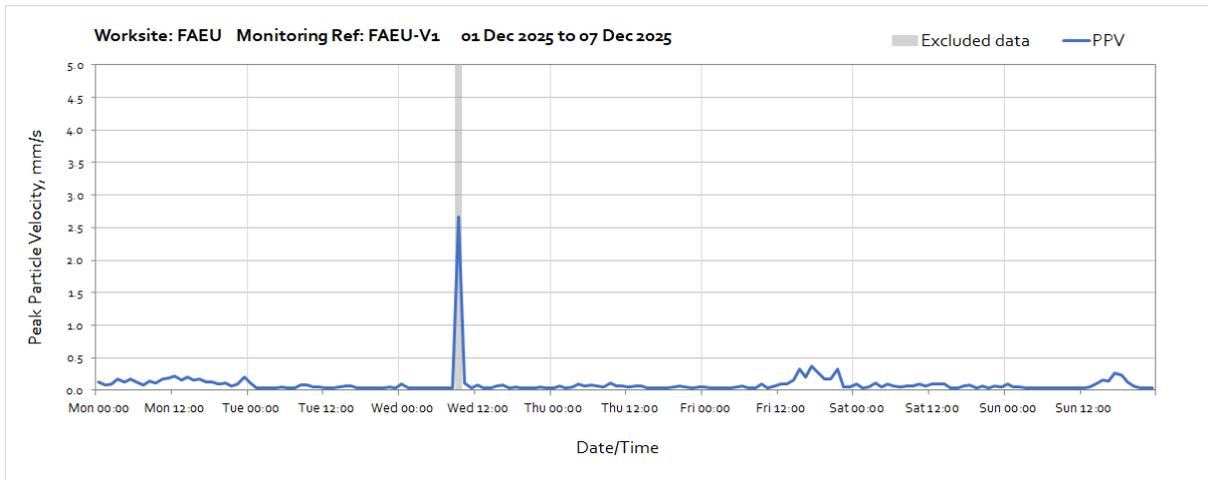



Note: Missing data between 23:00 on Tuesday 9th and 09:00 on Friday 19th December was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

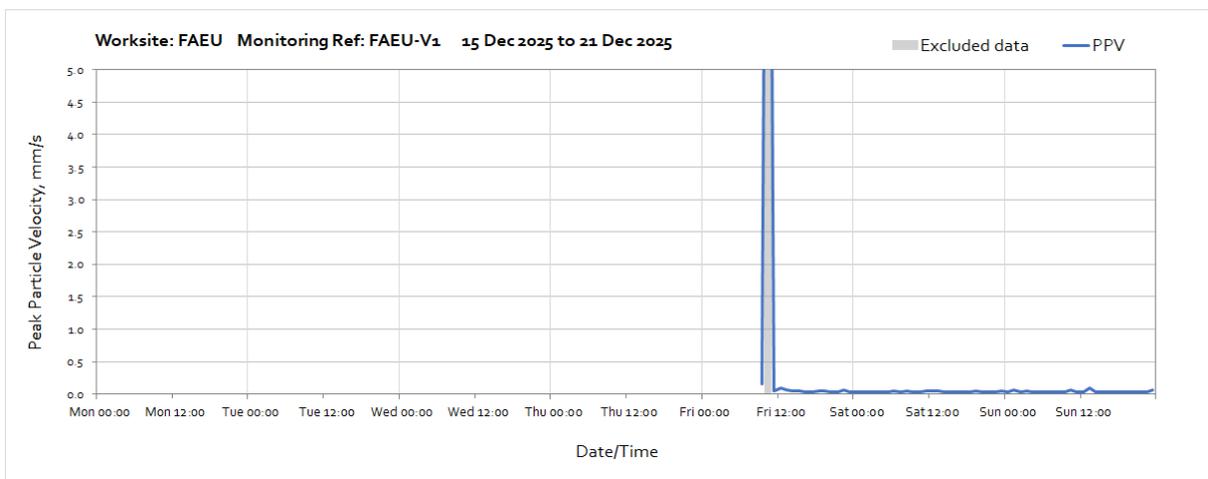


Note: Missing data between 23:00 on Tuesday 9th and 09:00 on Friday 19th December was due to a loss of

OFFICIAL

power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

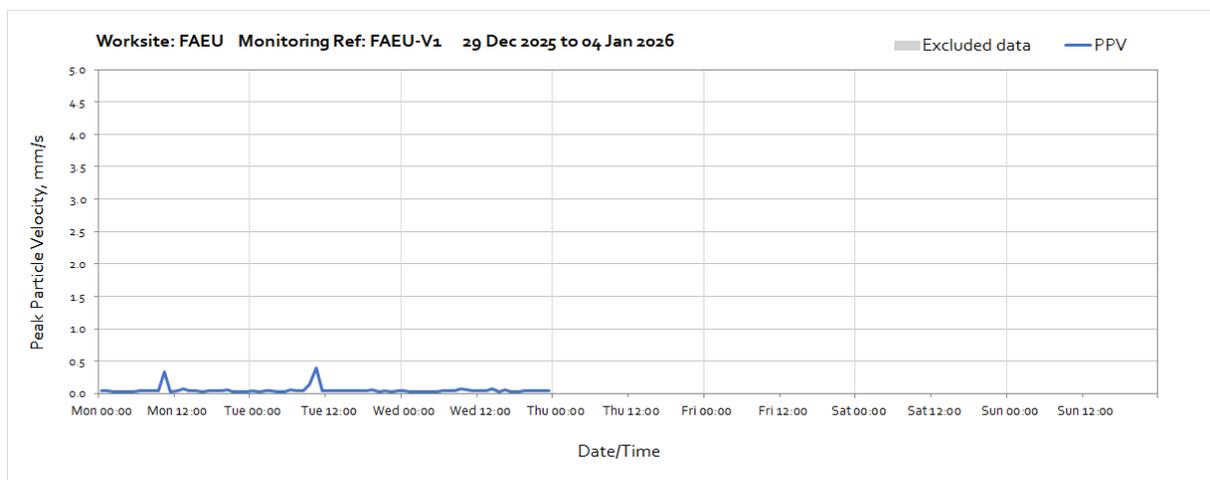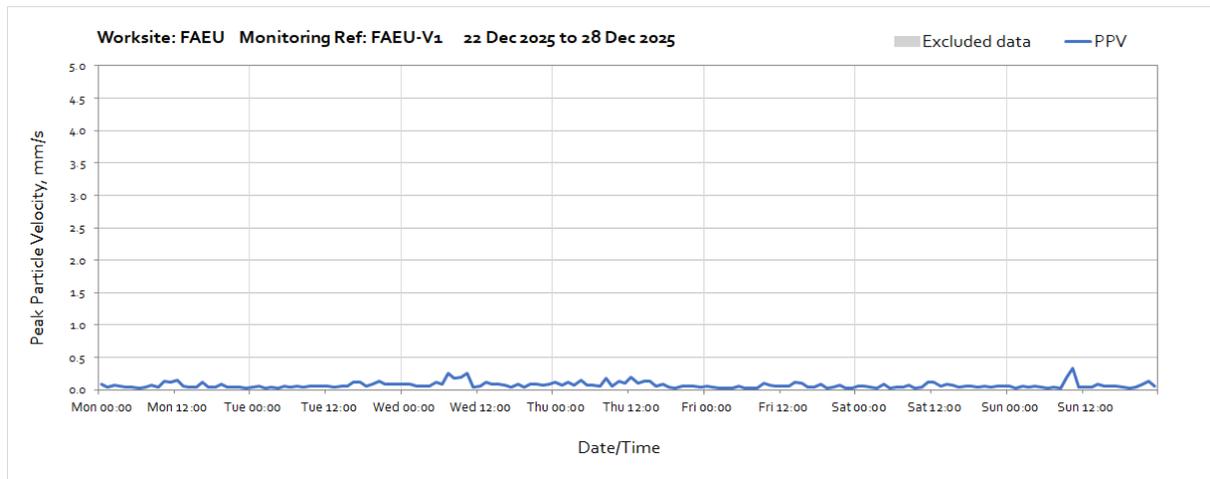



Worksite: ALO - Monitoring Ref: ALO-V1

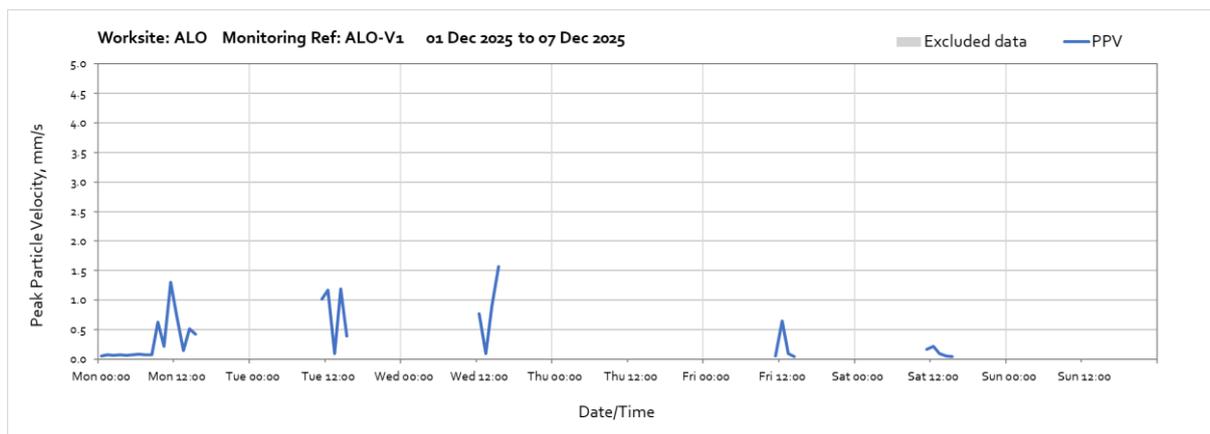


Note: Missing data throughout the month was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

OFFICIAL

Worksite: ALO – Monitoring Ref: ALO-V5

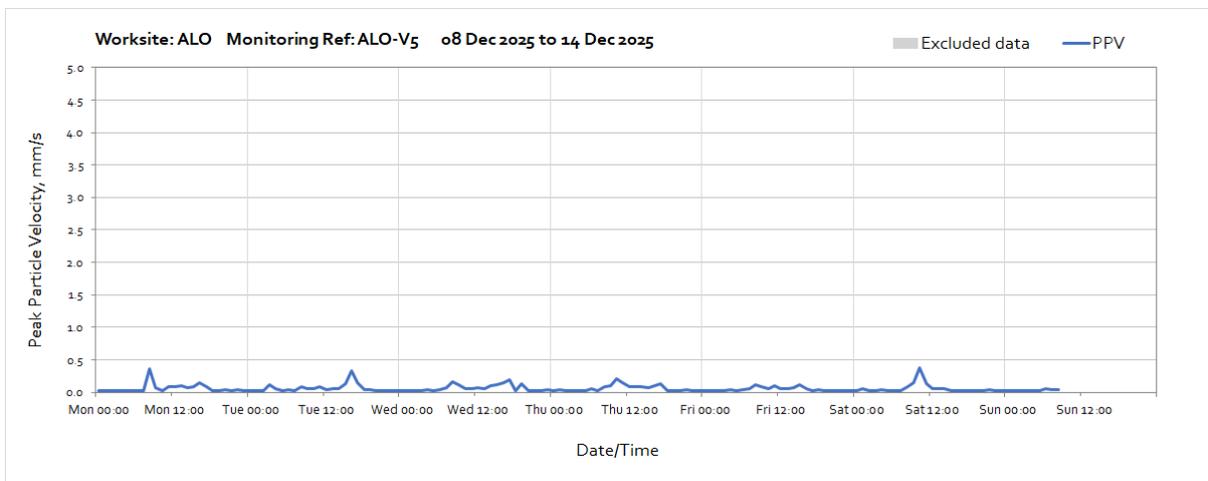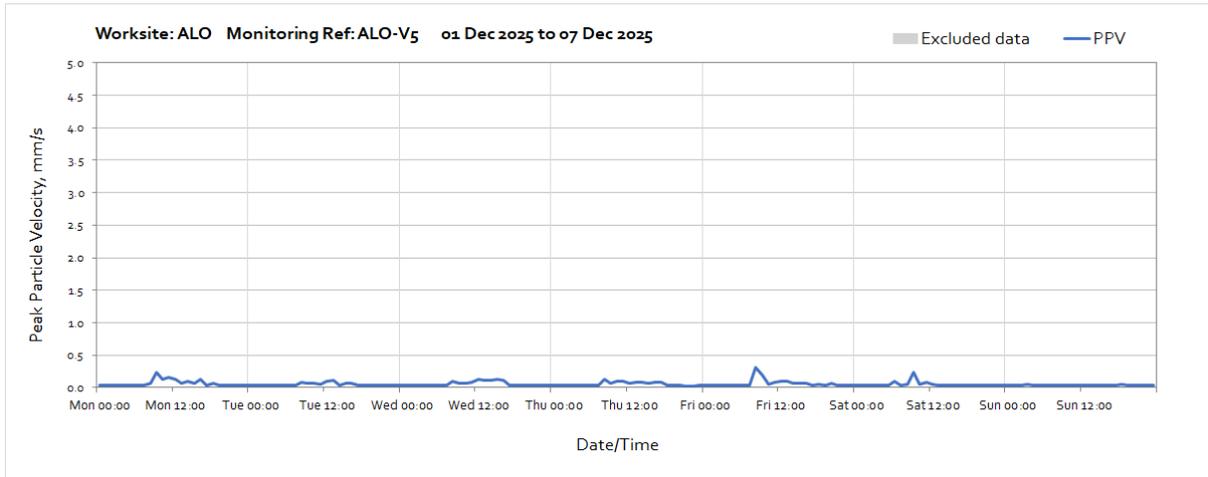




Note: Missing data throughout the month was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

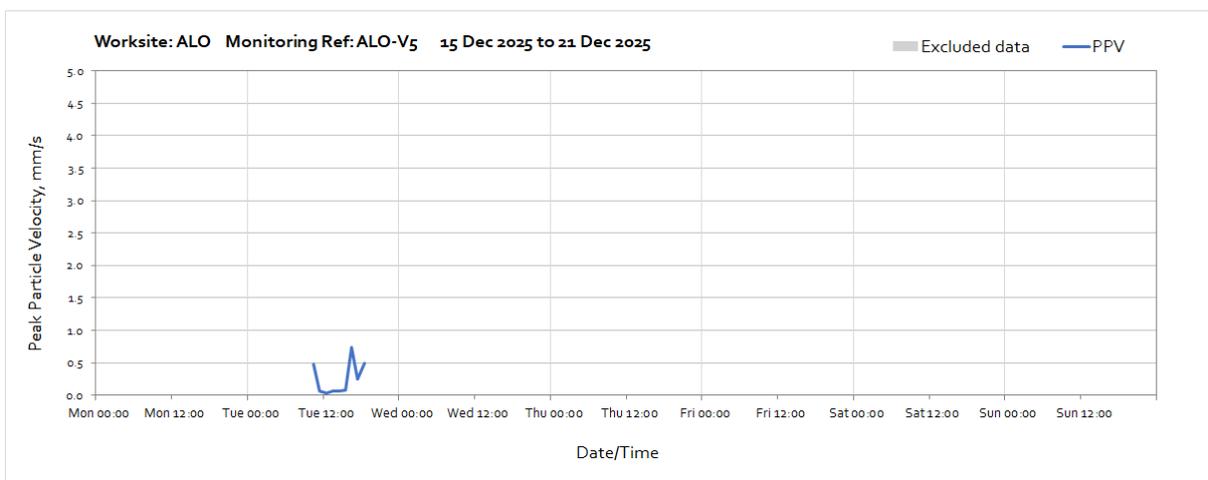



Note: Missing data throughout the month was due to a loss of power to the monitoring station caused by poor weather conditions preventing sufficient light reaching the solar panel.

OFFICIAL


Worksite: ALO – Monitoring Ref: AFE-V1

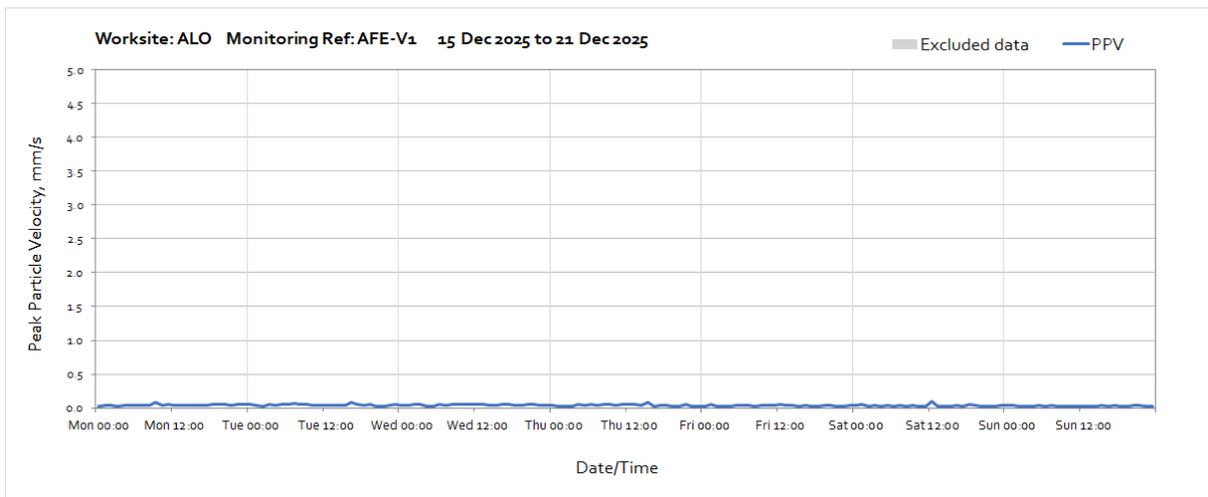
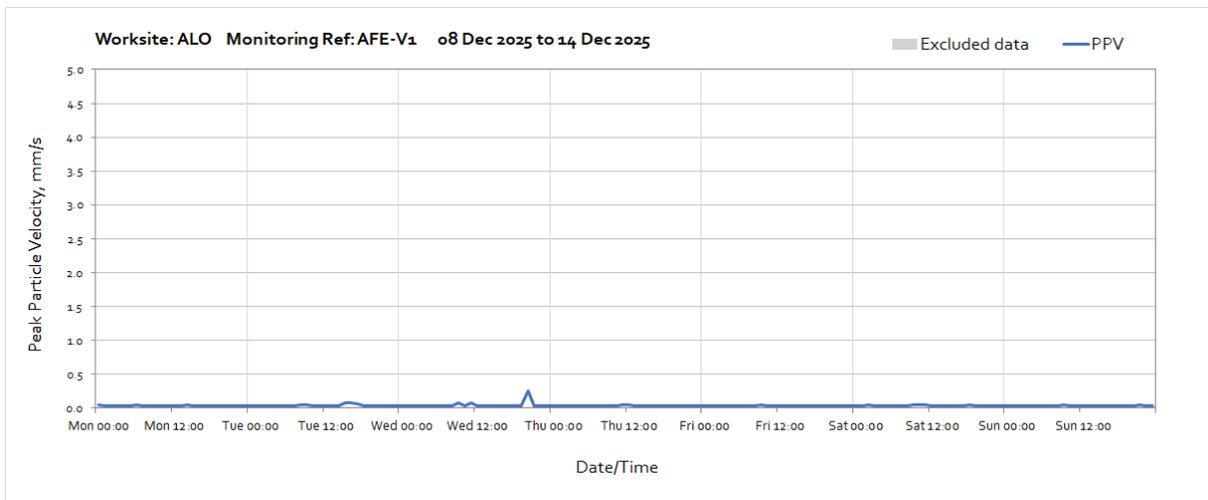
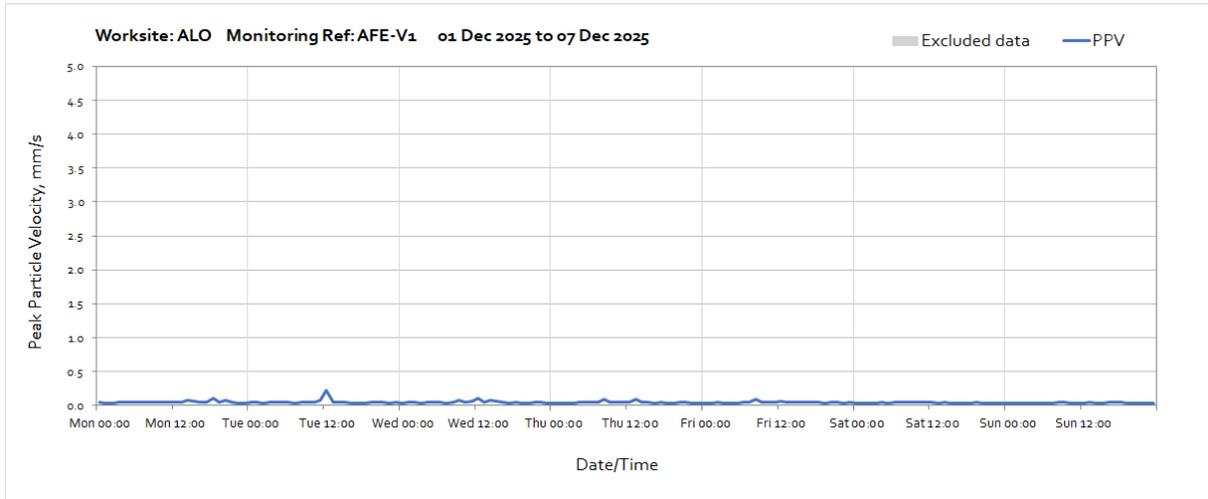



OFFICIAL

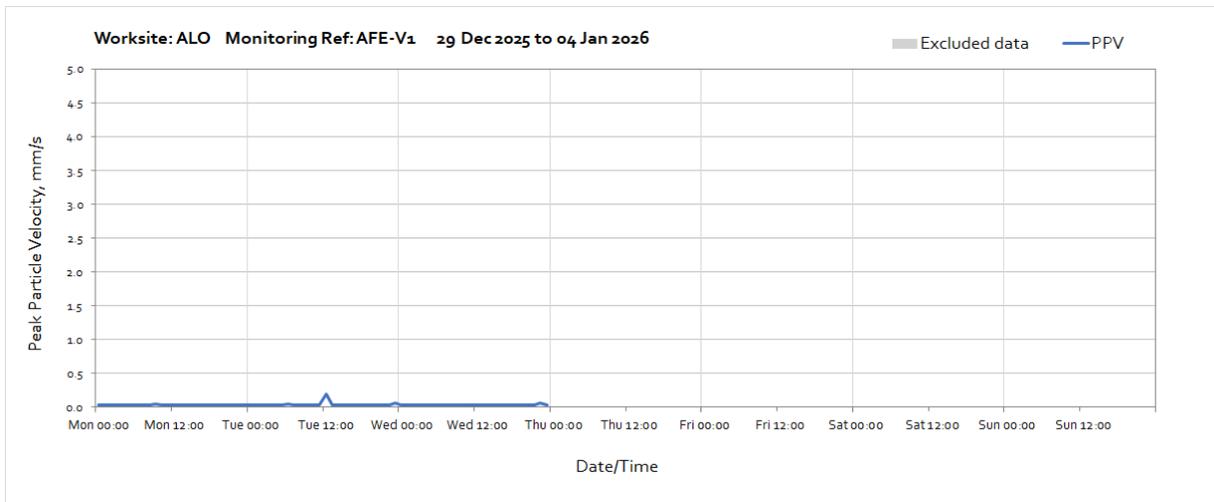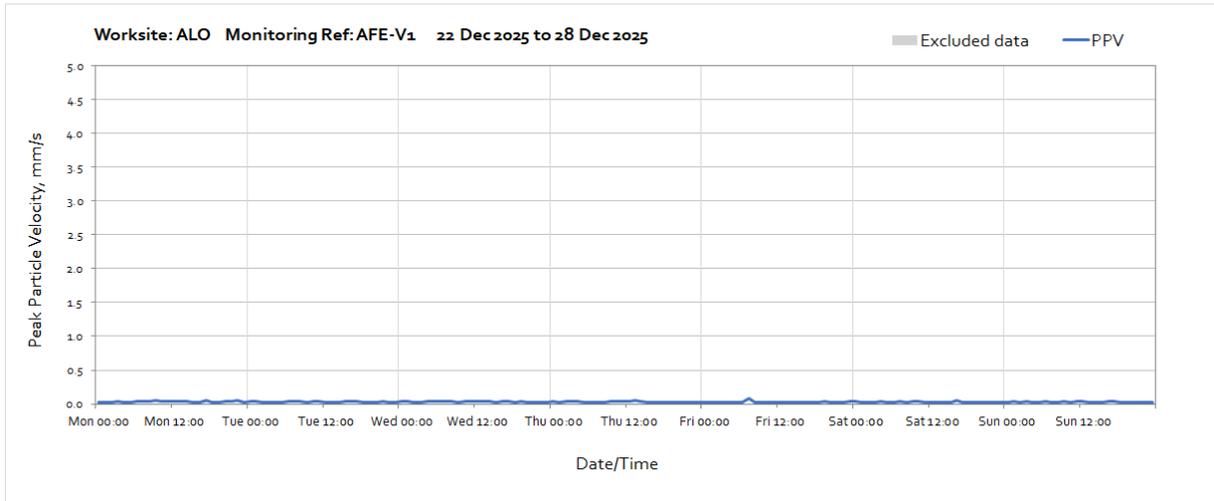

Worksite: GLD – Monitoring Ref: GLD-V1

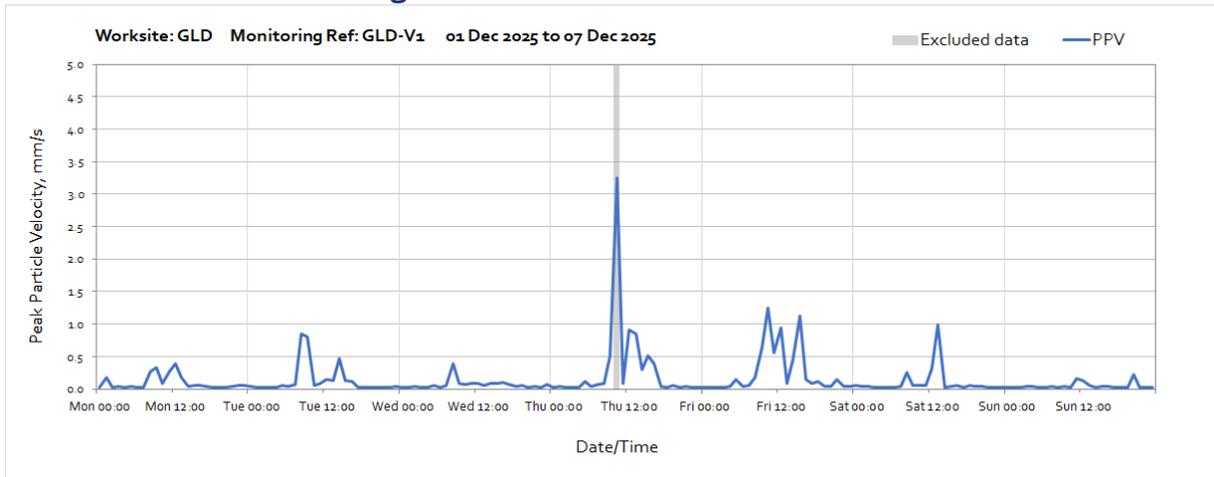

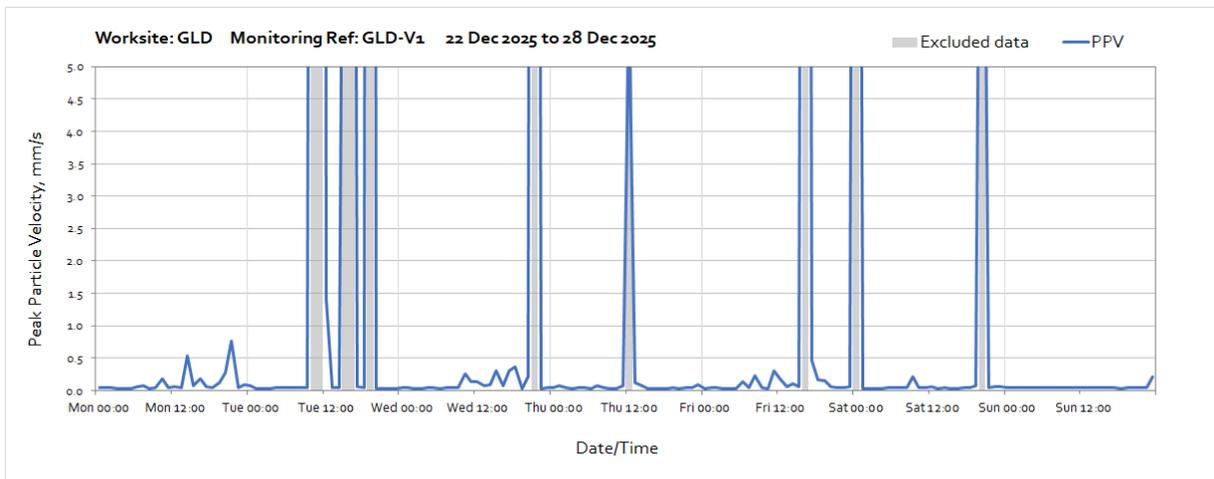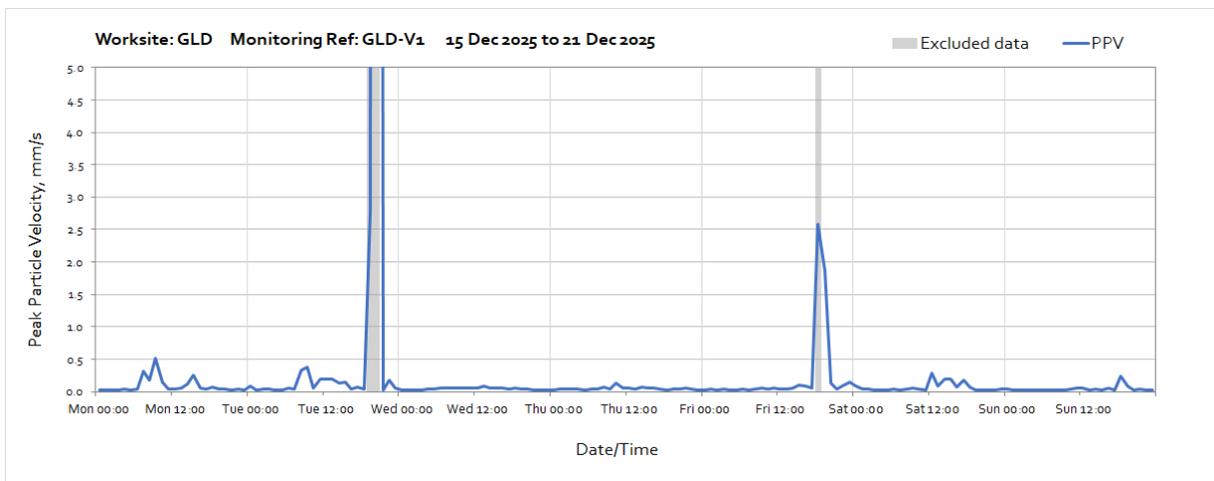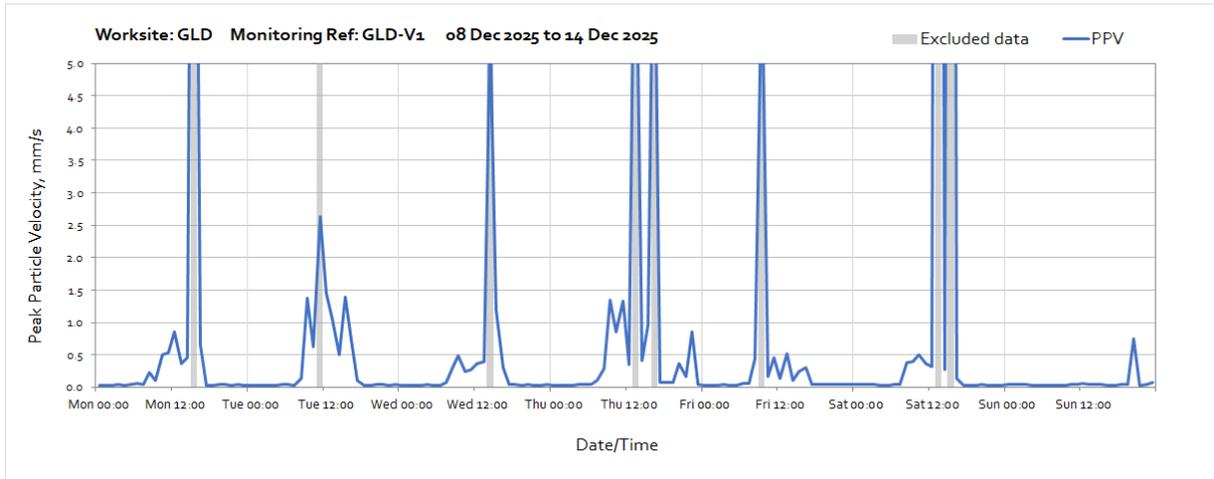

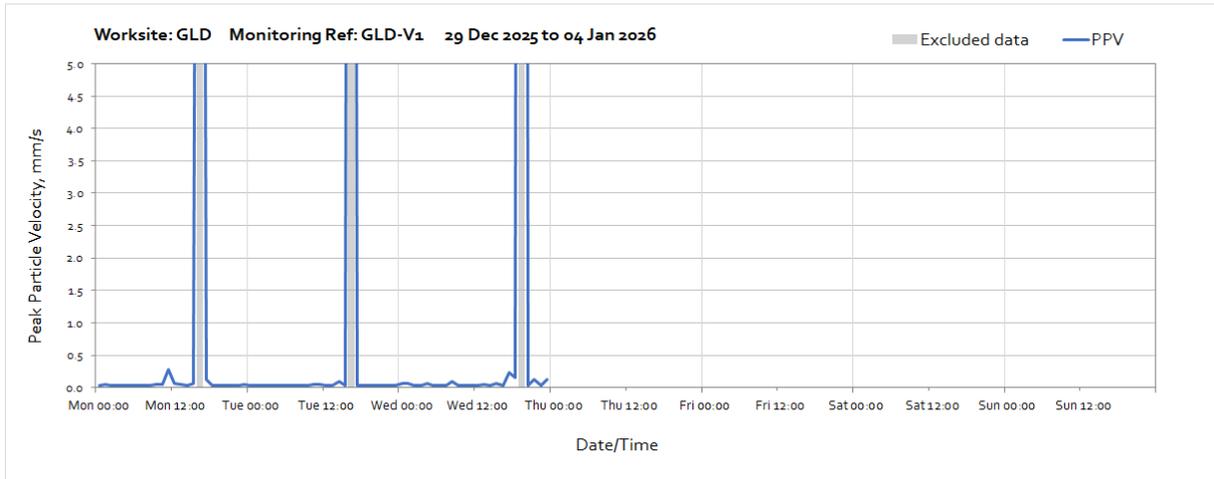

Worksite: BRD – Monitoring Ref: BRD-V1

