



Abbreviated Vibration Monitoring Reports

Monitoring Period: 01 June 2026 to 28 June 2026

Project: Grenfell Tower

Document Ref: EEMC-VMR-201/110 – Grenfell Tower Rev 00

Period: 01 June 2026 to 28 June 2026

(EEMC) Limited Contact Information:
European Environmental Monitoring & Consultancy (EEMC) Ltd.
Suite 11, 5a Lombard Road, Wimbledon, London SW19 3TZ
t: [0203 6271312](tel:02036271312)
e: info@eemc.london
w: www.eemc.london


Details of Vibration Monitor at Receptor Point VMP1 – VMP3

ID Reference	Location
VMP1	Opposite Southeast corner of tower between two (2) concrete blocks
VMP2	Base of North hoarding co located with NMP2
VMP3	Mobile unit- Located base of NW hoarding with DMP5 and NMP3

Contents

1. Exceedance Summary.....	3
Figure 1- Map of Vibration, Dust & Vibration Monitoring Locations	5
Image 2 – VMP1 Monitoring Location.....	6
Image 3 –VMP2 Monitoring Location	7
Image 4 – VMP3 Monitoring Location.....	8
2. Introduction.....	9
3. Instrumentation	9
4. Methodology	9
5. Measurement Results	10
6. Vibration Monitoring Graphs	11

Review and Authorisation

	Name	Role	Signature	
Author:	Ibrahim Busari MSc	Acoustic Consultant		30/06/2026
Technical Reviewer:	Emma Howard AMIOA, AISEP	Senior Acoustic Consultant		02/07/2026

(EEMC) Limited have prepared this document for the sole use of the client, using all reasonable skill and care, for the intended purpose(s) and within the resources made available and agreed with the client. No responsibility is accepted for matters outside the terms and scope of the agreement under which this document has been prepared. Similarly, no responsibility in any form is accepted for third party use of this report or parts thereof, the contents of which are confidential to the client. No other warranty, expressed or implied, is made as to the professional advice included in this report.

1. Exceedance Summary

VMP1:

There were **no exceedances** of the 3.0mm/s Red Action level and **two (2) exceedances** of the 1.0mm/s Amber Trigger level during working hours in this reporting period.

VMP2:

There were **no exceedances** of the 5.0mm/s Red Action level and **five (5) exceedances** the 3.0mm/s Amber Trigger level during working hours in this reporting period.

VMP3:

There were **no exceedances** of the 5.0mm/s Red Action level, or the 3.0mm/s Amber Trigger level during working hours in this reporting period.

Any exceedances that do occur will be shown in **Tables 0.1 and 0.2**, if there are no exceedances these tables will remain blank.

For more information regarding the trigger limits, refer to Section 4 – Methodology.

Table 0.1. – Amber Trigger Exceedance Count

Monitoring Location	Time and Date of Exceedance	Measured Level of Exceedance (mm/s)	Amber Trigger Level (mm/s)	Cause of Exceedance
VMP1	16/06/2026 12:15	1.03	1.0mm/s	Exceedance caused by a 14T digger loading skip with metal propping.
	26/06/2026 13:45	1.05		Exceedance caused during a 40-yard heavy rubble skip exchange.
VMP2	05/06/2026 13:35	3.02	3.0mm/s	14T digger loading iron skip with propping from deconstruction floor.
	08/06/2026 09:55	3.02		Exchange of metal skips.
	10/06/2026 15:20	4.05		14T digger moving steel propping from a small 7-yard skip.
	11/06/2026 13:25	4.36		
	16/06/2026 13:10	4.39		14T digger loading iron skip with propping from deconstruction floor.
VMP3	-	-		No exceedances

Table 0.2. Red Action Exceedance Count

Monitoring Location	Date and Time of Exceedance	Measured Level of Exceedance (mm/s)	Red Action Level (mm/s)	Cause of Exceedance	Mitigation
VMP1	-	-	3.0mm/s	No exceedances	
VMP2	-	-	5.0mm/s		
VMP3	-	-			

Figure 1- Map of Vibration, Dust & Vibration Monitoring Locations

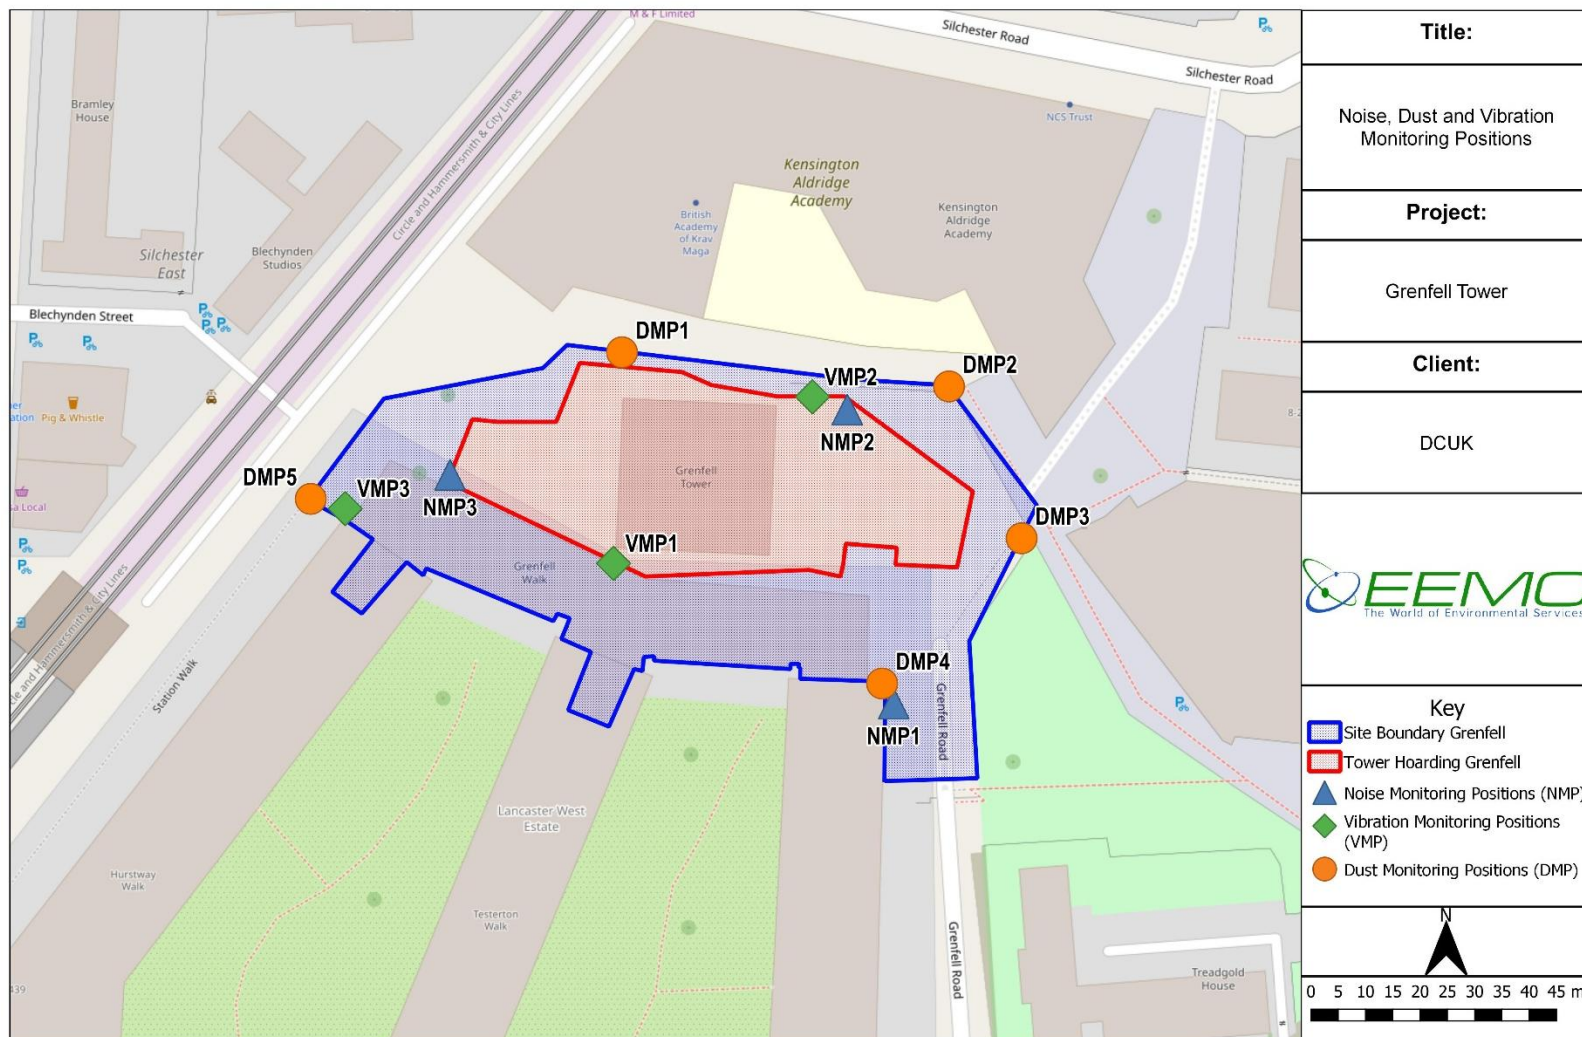


Image 2 – VMP1 Monitoring Location



Image 3 –VMP2 Monitoring Location



Image 4 – VMP3 Monitoring Location



2. Introduction

European Environmental Monitoring and Consultancy (EEMC) Limited have been appointed by Deconstruct to undertake vibration monitoring work during the Deconstruction works at the Grenfell Tower project.

The site boundary and hoarding line of this project is shown in Figure 1. The project is located at Grenfell Tower, Grenfell Road, W11 1TQ. The entire site is located within Royal Borough of Kensington & Chelsea (RBKC) and is bordered by residential blocks to the south, and a school and football pitches to the north and a leisure centre to the east. The London Underground viaduct is 70m to the west and Latimer Road Tube station is 200m from the project.

This report presents the measured and recorded unattended vibration monitoring data for the period 01 June 2026 to 28 June 2026.

Deconstruct will ensure ongoing liaison with MHCLG and RBKC when required to obtain any required consents and permits for the project.

3. Instrumentation

Three (3) Omnidots Swarm vibration (DIN45669-2 compliant) monitoring systems, affixed to ground vibration base plates, are installed positioned on a solid floor structure, close to the site boundary.

The Swarm monitor has built in logging and telemetry, data is managed, configured, and viewed on the Honeycomb cloud portal. Email alerts are generated when trigger levels are exceeded.

4. Methodology

The Swarm monitors record Peak Particle Velocity (PPV) in orthogonal (x, y and z) directions in mm/s continuously over 1-minute periods. A map showing the locations of the monitors is in Figure 1. A photograph showing the monitoring location is shown in Image 1.

The Trigger and Action levels for the project are set out in the **Noise and Vibration Management Plan** (ref: [Noise and vibration management plan - Grenfell Tower](#)) and are reproduced for reference in Table 3.1. The NVMP sets out different limits depending on if the closest sensitive receptor is residential or commercial.

The closest sensitive receptors for the three (3) monitoring positions are outlined below and directly link to the limits used:

- The closest sensitive receptor to VMP1 is the **residential** Receptor: E - Testerton Walk.
- The closest sensitive receptor to VMP2 is the **commercial** Receptor: A - Kensington Aldridge Academy.
- The closest sensitive receptor to VMP3 is the **commercial** adjacent Hammersmith and City and Circle Tube Lines.

Table 3.1 – Trigger & Action Levels

	Green Trigger Level	Amber Trigger Level	Red Action Level
VMP1 <i>Residential</i>		1 mm/s	3 mm/s
VMP2 and VMP3 <i>Commercial</i>	1 mm/s	3 mm/s	5 mm/s

**Green Trigger Alerts are a pre-warning for site only. These are not actionable and therefore the green alerts are not reported on in this report. Amber are a warning for site and red alerts are exceedances which require investigation and mitigation measures.*

5. Measurement Results

The results of the Vibration measurements in this period are presented graphically in Section 6 of this report.

6. Vibration Monitoring Graphs

